

ADA TITLE II SELF-EVALUATION TRANSITION PLAN

prepared for

Metropolitan Park District of Tacoma
4702 South 19th Street
Tacoma, Washington 98405



**BUREAU
VERITAS**



PREPARED BY:

Bureau Veritas
6021 University Boulevard, Suite 200
Ellicott City, Maryland 21043
800.733.0660
www.bureauveritas.com

BV CONTACT:

Tracy Trisko
Program Manager
800.733.0660 x7298048
Tracy.Trisko@bureauveritas.com

BUREAU VERITAS PROJECT #:

157753.22R000-00B.206

DATE OF REPORT:

April 17, 2024

Metro Parks District of Tacoma - Transition Plan
Transition Plan – Final
Tacoma, Washington

Bureau Veritas

6021 University Boulevard, Suite 200 | Ellicott City, Maryland 21043 | www.bureauveritas.com | p 800.733.0660

TABLE OF CONTENTS

- 1 Executive Summary 1**
 - 1.1 Introduction..... 1
 - 1.2 Overall Strategy..... 1
 - 1.3 Process And Scope..... 2
 - 1.4 The 2023 Transition Plan 2
- 2 Purpose and Scope 4**
 - 2.1 Overview of the Metro Parks Tacoma Agency 4
 - 2.2 Purpose Of The Transition Plan..... 2
 - 2.3 Basis For Probable Costs..... 2
 - 2.4 Scope of Work..... 3
 - 2.5 Physical Barrier Assessments..... 3
- 3. Accessibility Requirements..... 5**
- 4. Historic Amenities 6**
- 5. ADA Program Initiatives 8**
 - 5.1 ADA Program Progress..... 8
 - 5.2 ADA Public Outreach 8
- 6. Compliance Strategy..... 9**
- 7 Phasing..... 10**
 - 7.1 Park Priorities 10
 - 7.2 Barrier Priorities..... 18
- 8 Certification..... 21**
- 9 Appendices 22**



1 EXECUTIVE SUMMARY

1.1 INTRODUCTION

Metropolitan Park District of Tacoma is an independent government agency and municipal corporation established in 1907. Metro Parks Tacoma manages 84 developed and relatively undeveloped parks on 2,905 acres, providing outdoor recreation opportunities to community members of and visitors to the City of Tacoma. The park system includes natural and cultural resources unique to Tacoma. The portfolio of properties includes neighborhood parks, signature parks, community parks, community centers, historic places and facilities, regional parks, and zoos. The park system provides residents with local recreation and preserves the heritage of Tacoma through its interpretive facilities, events, and programs.

The park system's corporate office is located at 4702 South 19th Street, Tacoma, Washington, 98405. Metro Parks Tacoma currently has approximately 596 full-time employees and 602 seasonal and part-time employees.

Bureau Veritas has completed a comprehensive American with Disabilities Act Evaluation (ADA Evaluation) of 82 Metro Parks Tacoma properties. Stanley Playfield and Gas Station Park were not included in the contract or in this Transition Plan. The assessments were completed using the requirements of 28 CFR Part 35, the 2010 ADA Standards for Accessible Design, the 2009 ANSI A-117 as adopted by Washington State, and the Architectural Barriers Act (ABA) Accessibility Guidelines for Outdoor Developed Areas. The results of the assessments are incorporated into this ADA Title II Transition Plan, which lays out a way to allocate resources in a planned manner to achieve the removal of critical barriers to reach full accessibility.

The ADA Title II Transition plan includes the following components required by the Americans with Disabilities Act:

- Physical barriers that limit the accessibility of programs, activities, or services.
- The work to remove the barriers and make the facilities accessible.
- A schedule to remove prioritized barriers to accessibility.
- The name of the official(s) responsible for the Transition Plan's implementation.

The Americans with Disabilities Act (ADA) of 1990 provides comprehensive, wide-ranging rights and protections to individuals with disabilities in the areas of employment, public accommodations, state and local government services, and telecommunications. This Transition Plan focuses on the Title II Public Accommodations requirements for Metro Parks Tacoma.

In 2010, the Department of Justice revised and expanded the prior ADA regulations. The revised regulations included new standards for various recreational uses such as play equipment, amusement rides, fishing piers, etc. Because of the obligation to provide "program access," defined as access to programs, activities, and services provided by the agency, Metro Parks Tacoma is generally required to meet the 2010 standards, even though many facilities and amenities were constructed prior to the implementation of the 2010 standards.

Metro Parks Tacoma maintains a record of people consulted, comments received, any further audits or assessments performed based on the comments received, and modifications made. These records are maintained by the ADA Coordinator, Marty Stump, and can be made for public inspection. Marty Stump can be reached at accomodation@tacomaparks.com or 253.305.1078.

1.2 OVERALL STRATEGY

The proposed strategy for ADA compliance is a multi-stage approach for physical access as well as program access. The goal of this strategy is to ensure that the programs, services, and opportunities offered by Metro Parks Tacoma are accessible to the people of the city and its surrounding locales, regardless of abilities.

Physical access is proposed to focus on both recurring amenities and unique amenities. Recurring amenities are those which occur and are repeated in numerous parks, such as trails, picnic shelters, beaches, and other recreation amenities. A unique amenity is defined as one offering a singular experience or activity in the park system. Examples include historic buildings and sites. Metro Parks recognizes that a few unique amenities within its system may be duplicated, however, due to unique types of offerings, geographies, or overall uses, those amenities can still be defined as unique for the purposes of policy. Examples of unique amenities include the Tacoma Nature Center, the two zoos, and historic structures such as the Brown's Point Light House.

The 80 properties included in this Transition Plan are currently organized into 5 category types: (1) community and signature parks - 21 parks; (2) community centers and buildings - 6 centers; (3) neighborhood parks – 35 parks; (4) regional parks – 16 parks; and (5) ZEED - 2 zoos. At the start of the Transition Plan process, the parks were divided into these groups based on type to facilitate prioritization of the barrier removal work to be completed.

1.3 PROCESS AND SCOPE

An accessibility survey was completed for each of the parks and specific facilities within existing parks, such as Community Centers. The field observers inventoried and evaluated each of the park buildings, restrooms, playgrounds, and other amenities open to the public. The objective of the assessment phase of the Self-Evaluation was to identify any and all accessibility barriers for future removal. Findings were developed into individual reports for each park or facility. All barrier findings are defined by type of deficiency and priority and include an estimated cost for barrier removal.

Some of the existing accessibility barriers require a minimal amount of effort or expense to remove and are found throughout the system. These types of barrier removals are called Easily Removable Barriers (ERBs). ERB is defined as accessibility barrier removal that can be incorporated into recurring work being completed by maintenance staff and is relatively low in cost. The tasks generally require one-half day or less in labor and do not require design or project management oversight other than by shop supervisors or crew leaders.

The total number of individual barriers observed within the Metro Parks Tacoma system is 4,519, not including Anthony's Restaurant, which is a leased property and barrier removal is the responsibility of the leasee. The total estimated barrier removal cost is \$10,957,337.

The barriers have been prioritized into five phases to coordinate with future budgets and bond funding. There were 1,107 Easily Removable Barriers (ERBs) identified and their estimated cost is \$430,514. The ERBs have been grouped into a separate phase. The ERBs that can be removed over time through operating budgets by maintenance staff, rather than Capital Improvement contracts, are assigned a separate phase. The ERBs do not have a specific scheduling requirement or strategy; rather, they are a part of larger work programs. Appendix B: Accessibility Summaries by Park Type and Appendix D: Barriers by Transition Plan Phase provide details of these totals, including ERB barriers. Costs are shown without factoring for inflation.

1.4 THE 2023 TRANSITION PLAN

The 2023 Transition Plan represents a snapshot of Metro Parks' ongoing ADA efforts to evaluate, prioritize, and schedule ADA barrier removal, ensure that Program Access is provided consistently and system-wide, and to document all completed projects. The 2023 Transition Plan reflects the completion of all individual facility Self-Evaluations, provides updates to ongoing ADA activities within Metro Parks Tacoma, and finalizes the strategy to prioritize barrier removals. The Transition Plan is the blueprint for attaining optimal accessibility within the budgetary capabilities of the agency.

The Transition Plan is, and must be, a flexible, living document, as priorities and funding may change significantly over time. Additionally, other departmental initiatives may come into effect that will affect the requirements for services to park users. Thus, flexibility and responsiveness to inevitable changes must be reflected in shaping this Transition Plan.

After the enactment of the ADA in 1991, the Metro Parks Tacoma system created a series of Transition Plans, most recently the plan adopted in 2015. The 2015 Transition Plan was created internally by the agency's Department of Business & Innovation and Asset Management & Inventory Operational Work Team. The 2015 Transition Plan was implemented between the Plan's completion and the current Transition Plan. Many barriers identified in the plan were removed between 2015 and now. The 2023 Transition Plan is based on revised Department of Justice standards, current guidelines of the US Access Board and State of Washington building codes, as well as present conditions of the park system. The 2023 Transition Plan serves as an updated plan encompassing contemporary circumstances.

The 2023 Transition Plan establishes priorities for all evaluated facilities and amenities and the barriers found within those amenities. In short, the Metro Parks Tacoma system has been evaluated for compliance; only facilities/structures not open to the public, or anticipated not to be open to the public, have been excluded from the self-evaluation process.

The establishment of the priorities and ranking levels is determined by the regulations under the Americans with Disabilities Act, and by the necessity to schedule barrier removals within an established framework. The framework is built upon the following factors:

- Level of ADA barrier removal, with the highest level given to unique programs and facilities, and to a selection of parks designated as a priority by Metro Parks Tacoma.
- Opportunity to combine ADA barrier removal with scheduled capital improvements, such as playground replacements, parking lot renovations, restroom repairs, and/or park renovations.
- Development of an ongoing work program to eliminate easily removed barriers.
- Funding sources and funding timelines.
- Realistic time frame for accomplishment.
- Geographic and demographic distributions.

The Transition Plan prioritizes the barrier removal so that the zoos, most regional parks, and unique amenities are completed by the end of Phase Two, and the remaining regional parks by the end of Phase Three. Phase Four includes community and signature parks. The remainder of the community and signature parks are included in Phase Five, as well as neighborhood parks. All properties will be completed by the end of Phase Five. The table below shows the phasing of the Transition Plan. Further detail on the parks and barriers within each phase is contained in Section 9 and Appendix D: Barriers by Transition Plan Phase.

BARRIER REMOVAL BY PHASES		
Phases and Easy Barrier Removal	Estimated Pre-Planning Cost	Barriers
Phase One – Community Centers, ZEED (Zoos), and Safety	\$2,350,859	849
Phase Two – Regional Parks and Unique Parks	\$1,986,434	532
Phase Three – Regional Parks and Unique Parks	\$1,911,831	526
Phase Four – Community Parks and Signature Parks	\$2,046,476	671
Phase Five – Community Parks, Signature Parks, and Neighborhood Parks	\$2,231,223	834
Easily Removable Barriers (ERBs)	\$430,514	1107
Total Phases One through Five	\$10,526,823	3412
Total	\$10,957,337	4519

The number of barriers includes barriers entered for "amenity not assessed".



2 PURPOSE AND SCOPE

2.1 OVERVIEW OF THE METRO PARKS TACOMA AGENCY

A five-member Board of Park Commissioners oversees Metro Parks Tacoma and its facilities. The Park Board is elected by citizens of the City of Tacoma and areas of Browns Point and Dash Point. The members serve six year staggered terms. The Park Board provides policy direction for the agency.

The mission of the park district is *“creating healthy opportunities to play, learn and grow.”* The vision of Metro Parks is *“Metro Parks Tacoma envisions a vibrant, active and engaged community.”*

The eight core values guide future decisions, business and operations, and the manner in which Metro Parks Tacoma treats staff, customers, and the community. Of the eight core values, equity and inclusiveness are directly related to accessibility and non-discrimination:

- **Innovation-** Metro Parks Tacoma will seek and support innovative and creative ways to deal with issues and trends in our community and the organization. All MPT staff members will embrace change and encourage flexibility so that the District can benefit from new and unique opportunities.
- **Excellence-** Metro Parks Tacoma will strive for excellence, providing exceptional parks, facilities, programs, and customer service.
- **Equity-** Metro Parks Tacoma will provide parks, facilities, and program services in a just, fair, and equitable manner, so that residents from all neighborhoods and of diverse backgrounds can access MPT’s parks and program services in a non-discriminatory manner.
- **Inclusiveness-** Metro Parks Tacoma strives to provide accessible, affordable, accommodating, and welcoming parks and program services to diverse residents and regional visitors regardless of age, ability, race, ethnicity, and income level. We commit to respect and honor the diversity of people, ideas and cultures within the organization and the community.
- **Sustainability-** Metro Parks Tacoma shares United Nations’ understanding of sustainability to mean *“meeting the needs of the present without compromising the ability of future generations to meet their own needs”*. MPT believes that all decisions will have long-term and regional impacts on the environment, society, culture, and economy. We commit to practicing sustainability by considering a full range of defined impacts in order to make balanced and responsible decisions.
- **Accountability-** Metro Parks Tacoma will be responsive, transparent, and accountable to the people we serve. We will carry out our mission in a manner that builds public trust. MPT will engage the public and make decisions in an open and candid manner responsive to the changing needs of the diverse community.
- **Safety-** Metro Parks Tacoma will provide safe and inviting parks, recreation facilities, and program services for social interaction, learning, and enjoyment.
- **Fun-** Metro Parks Tacoma recognizes the importance of play in the lives of all residents regardless of age. MPT will build our community on a foundation of fun!

The webpage for accessibility and inclusion clearly outlines the agency’s commitment to the 2015 Transition Plan and provides a link to the summary: <https://www.metroparkstacoma.org/about/accessibility-at-metro-parks/> . An Agency Compliance Manual establishes Metro Parks Tacoma’s accessibility and inclusion standards and communicates the expectation for inclusion and accessibility throughout the District’s programs and facilities. The manual is a key element of a strategy to make inclusion and accessibility standard components of program and facility decisions.

Training for staff members on the requirements and opportunities of the Americans with Disabilities Act is an ongoing process, with special emphasis on:

- Capital program design and implementation
- Program accommodations
- Alternative communication formats
- Board meeting accessibility and room design
- Special event accessibility
- Signage standards
- Public lobby design and accommodation
- Picnic facility accessibility information

Metro Parks Tacoma indicates its acknowledgement of the native American heritage of Tacoma lands on each page of its website: *“Metro Parks Tacoma acknowledges that we operate on the traditional homelands of the Puyallup and Nisqually Tribes, and on lands with deep significance to other Coast Salish tribes. Coast Salish people have lived on and stewarded these lands since time immemorial and continue to do so today. We recognize that this land acknowledgement is one small step toward true allyship and we commit to uplifting the voices, experiences, and histories of the Indigenous people of this land and beyond.”*

The Metro Parks Tacoma portfolio of parks spans a large range of park types as well as a large range of amenity types in all parts of the city limits. Within the park sites, a full range of recreation amenities are supported and maintained for the enjoyment of the public. At more than 70 park facilities, accessibility projects funded by capital bond improvements and maintenance work orders have improved park access.

Amenities were identified and analyzed for this Transition Plan. Amenities were grouped into the following types:

- | | | |
|---------------------------|---------------------------|------------------|
| Beach | Field – Football / Soccer | Pool |
| Boat Pier | Garden | Playground |
| Café/Restaurant | Golf Course | Restroom |
| Center – Community | Historic Building | Sprayground |
| Center – Nature | Parking Lot | Trails – Paved |
| Court – Basketball | Picnic Shelter | Trails – Unpaved |
| Court – Tennis | Picnic Area | Zoo |
| Field – Baseball/Softball | Pier | |

For a full listing of park amenities within individual parks, see Appendix E: Park Amenities.

The extent of Metro Parks Tacoma is displayed on the following page.





Park properties are categorized into five types: zoos, regional parks, community centers and buildings, community and signature parks, and neighborhood parks. The parks which are assigned to each category are:

ZOOS - 2

NW Trek Wildlife Park
Point Defiance Zoo and Aquarium

REGIONAL PARKS -15

Chinese Reconciliation Park
Cummings Park
Dickman Mill Park
Dune Peninsula at Point Defiance Park
Fort Nisqually Living History Museum
Hamilton Park
Jack Hyde Park
Judge Jack Tanner Park
Les Davis Pier
Meadow Park Golf Course
Old Town Dock
Point Defiance Marina
Point Defiance Park
Ruston Way Areas 2-4
Thea's Park

COMMUNITY CTRS AND BUILDINGS - 6

Center at Norpoint
Eastside Community Center
Metro Parks Headquarters
People's Community Center
Portland Avenue Community Center
STAR Center

COMMUNITY AND SIGNATURE PARKS -21

Dash Point Park and Pier
Franklin Park
Heidelberg Davis Park
Jefferson Park
Kandle Park and Pool
Lincoln Eldridge Park
McKinley Park
Norpoint Park
Northeast Tacoma Playground
Peck Field
Portland Avenue Park
SERA Sports Complex
South Park
Stewart Heights Park and Pool
Swan Creek Park
Tacoma Nature Center and Snake Lake Natural Area
Titlow Park
Vassault Park
Verlo Playfield
Wapato Park and Pavilion
Wright Park and WW Seymour Botanical Conservatory

NEIGHBORHOOD PARKS -36

Alderwood Park
Alling Park
Baltimore Park
Browns Point Lighthouse Park
Browns Point Playfield

Charlotte's Blueberry Park
China Lake Park
Cloverdale Park
DeLong Park
Fern Hill Park
Ferry Park
Garfield Park
Irving Park
Jane Clark Park
Jerry Meeker Memorial
Julia's Gulch
Lincoln Heights Park
Lots for Tots
Manitou Park
Neighbors Park
North Slope Historic Park
Oak Tree Park
Oakland Madrona Park
Old Town Park
Optimist Park
People's Park
Proctor Community Garden
Puget Gulch
Puget Park
Rogers Playfield
Roosevelt Park
Ryan's Park
Sawyer Tot Lot
Sheridan Park
Ursich Park
Wapato Hills Park

See Appendix B for details of barrier removals by park type.



2.2 PURPOSE OF THE TRANSITION PLAN

The purpose of this 2023 Transition Plan is to plan accessibility compliance for Metro Parks Tacoma with the requirements of Title II of the Americans with Disabilities Act (ADA) and applicable state regulations contained in the accessibility and related chapters of the Washington State Building Code. The Transition Plan is part of the self-evaluation process required of Title II entities (state and local public agencies) by the ADA.

Metro Parks Tacoma initiated the original Self-Evaluation process and developed a draft ADA Transition Plan on March 22, 1994. The original Transition Plan evaluated barriers to accessibility based on the 1991 Standards of Accessible Design (ADAAG) enforceable at the time.

With the passage of the 2005 Park Bond and development of the Strategic Parks and Program Services Plan in 2006, Metro Parks Tacoma felt it was important to perform a new Self-Evaluation to update facility compliance information and guide capital projects and work plans that would implement the agency's strategic actions. An agency task force began work on a Transition Plan update in 2007 and moved forward with the adoption of a Diversity, Inclusion, and Accessibility Policy Manual, as well as the formation of an ADA Self-Evaluation Transition Team to perform necessary ADA barrier removal in 2009. The current manual is the result of these efforts to revitalize and enhance the agency's commitment to inclusion and accessibility.

The Metro Parks Tacoma 2009 ADA Transition Plan was updated by the agency in 2015-16 and barrier removals were identified in accordance with the 2010 Standards of Accessible Design, the newest ADAAG guidelines which are now enforceable by the Department of Justice (DOJ). Internal staff training for accessibility was conducted, and the assessments of individual parks were made by park staff to evaluate barriers to accessibility. The outcome was a Transition Plan developed and executed internally by the agency. Many barriers identified in the 2015-16 Transition Plan were removed in a series of capital improvement projects and operational work orders.

The 2015-16 Transition Plan established a prioritization system based on type of property and number of existing barriers at those properties. The major categories were included in many subsequent capital improvement projects. Priority was given to regional parks serving the largest numbers of visitors, number of accessibility complaints, and previously funded construction projects.

The priority rankings used in the 2015-16 Transition Plan were:

- Regional Parks – High priority
- Signature and Community Parks, Programmed Facilities – Medium priority with indoor facilities ranked higher
- Neighborhood Parks, Open Space, and Gardens – Low priority

Many of the barriers identified in the 2015-16 Transition Plan have been addressed. Significant progress has been made to make the park system accessible since the 2015-16 Transition Plan; however, some barriers still remain.

Transition plans are living documents which must be reevaluated and changed over time to evaluate and include changes in programs and facilities, as well as new or different funding opportunities. To that end, in 2022, Bureau Veritas was selected to conduct a new ADA evaluation. BV has completed a Comprehensive American Disabilities Act Self-Evaluation (ADA Evaluation) of the park system and prepared this Transition Plan.

The requirements of 28 CFR Part 35, the 2010 ADA Design Standards for Accessible Design, and 2009 ANSI A-117.1 as adopted by Washington State in the Washington State Building Code, were used in this Self-Evaluation. The Architectural Barriers Act (ABA) Accessibility Guidelines for Outdoor Developed Areas, developed by the US Access Board in 2009 and finalized in November 2013, are enforceable only for federal properties, but were used in the Self-Evaluation process on a voluntary basis. Metro Parks Tacoma has voluntarily incorporated ABA barriers in the 2023 Self-Evaluation in an effort to fully address access to its facilities and park amenities. Section 3 describes the American Disability Act.

2.3 BASIS FOR PROBABLE COSTS

The estimates are based on invoice or bid documents provided by the owner/facility, and construction costs developed by construction resources such as *R.S. Means* and *Marshall & Swift*, BV's experience with past costs for similar properties, city cost indexes, and assumptions regarding future economic conditions. Typically, barrier removal allowances are based upon the removal of the specific element being evaluated (for example, parking stalls, curb ramps, ramps). Grading plans based on field surveys using land surveyor instrumentation could result in significantly different material quantities and higher project costs. BV has no control over the final scope of work, pricing methods, and costs associated with a contractor constructing the project. The opinion of probable costs within this report cannot guarantee that the costs will accurately reflect the actual bids for construction.

The cost estimates for barrier removal are summarized in the plan and individual barrier details are provided in Appendices B and G.

2.4 SCOPE OF WORK

A Self-Evaluation is a governmental organization's evaluation of its current services, policies and practices, and all physical facilities. The Self-Evaluation includes three components:

- Assessments of individual physical properties
- Transition Plan based on physical and programmatic evaluations
- Action necessary to make required additions or modifications to non-compliant elements

This Transition Plan represents the planned modifications to physical facilities provided by Metro Parks Tacoma. The Transition Plan is a summation and analysis of the barriers to the use of facilities.

2.5 PHYSICAL BARRIER ASSESSMENTS

A Bureau Veritas Subject Matter Expert (SME) visited designated properties within the Metro Parks Tacoma portfolio to evaluate the facilities in accordance with the ADA and State of Washington Building Code and assessed the existing property's compliance with the Title II provisions of the Americans with Disabilities Act (ADA) and applicable state requirements.

All features of the property subject to accessibility standards and codes were observed, including, but not limited to, exterior elements such as parking lots, sidewalks, access ramps, and all common areas accessible to the public, as well as employee areas.

During the site walk-through, the field observer followed a Survey Form that meets or exceeds the current ADAAG format, and utilized an iPad, digital level, measuring tape, pressure gauge, light gauge, timer, and digital camera. The field observer identified and prioritized any existing improvements not in accordance with the applicable ADA requirements, in the order of preference as set out by the DOJ in general categories and refined by BV.

The BV team assessed exterior and interior to identify existing conditions that are not in accordance with the applicable regulations. Examples of elements required to be accessible are:

- Parking: adequacy as to automobile number, van accessible number, signage, and markings
- Parking and passenger loading zones
- Accessible routes: sidewalks and paths, interior routes
- Space allowance and ranges
- Protruding objects
- Ground and floor surfaces
- Curb and other ramps: size, distance, slope, rails, and surface finishes
- Exterior and interior common stairs
- Platform lifts (wheelchair lifts)
- Entrances and exits to common areas and employee areas
- Handrails and grab bars
- Alarms (visual and audible) and warnings
- Signage: Braille and visual
- Switches and outlets

Individual assessment reports for each property surveyed included:

- Summary of Findings for all amenity features (parking stalls, curb ramps, paths of travel, and related elements)
- Individually recorded barriers
- Digital photos of observed barriers and representative photos of elements observed to be in compliance
- Geocode GPS references for the location of observed exterior barriers
- Applicable ADA, State of Washington, and ABA regulatory references
- Recommendations for viable corrective measures necessary to comply with regulations
- Planning-level cost estimates for each barrier

Assessment results were tabulated into an ADA database using AssetCALC™, an online interactive database created by BV to manage assessments based on ADA and state or local accessibility codes. The AssetCALC™ asset management database used by BV establishes an online database in www.Assetcalc.net, which is used to compile records of all accessibility barriers, store photos and documents related to the individual facilities, and create reports. AssetCALC™ provides the ability to list, prioritize, query, and track accessibility barrier removals. Cost data in the database is calculated using rounding. Any minor discrepancies in the costs shown in this report are the result of rounding.

3. ACCESSIBILITY REQUIREMENTS

The Self-Evaluation assessments conducted for Metro Parks Tacoma were conducted based on compliance with the Americans with Disabilities Act (ADA), the State of Washington Barrier Free code portion of the state building code, and the Architectural Barriers Act (ABA) Outdoor Developed Area standards. The State of Washington does not allow local jurisdictions to supersede the Washington Barrier Free code.

The Americans with Disabilities Act (ADA) of 1990 provides comprehensive, wide ranging rights and protections to individuals with disabilities in the areas of employment, public accommodations, state and local government services, and telecommunications. The goal of the ADA is to ensure equality of opportunity, full participation, and independent living to all individuals including those with disabilities; it expressly prohibits all state and local governments and most private businesses from discriminating on the basis of disability. The ADA provides a clear and comprehensive national mandate for the elimination of discrimination against individuals with disabilities. The ADA includes the definition of a disability; and in 2008, the ADA Amendments Act expanded and better defined the definition of a disability.

The ADA defines a disability with respect to an individual in one of three ways: a physical or mental impairment that substantially limits one or more major life activities; a record or history of such impairment; or regarded as having such an impairment. Major life activities include, but are not limited to, caring for oneself, performing manual tasks, seeing, hearing, eating, sleeping, walking, standing, lifting, bending, speaking, breathing, learning, reading, concentrating, thinking, communicating, and working.

The ADA is divided into 5 Titles: Employment, Public Services, Public Accommodations and Commercial Facilities, Telecommunications, and Miscellaneous Provisions. This report focuses on the Title II requirements for Metro Parks Tacoma. The Department of Justice (DOJ) is responsible for the enforcement of the provisions of the ADA under Title V. Additionally, DOJ is responsible for the enforcement of the provisions of the ADA other than employment policy related issues. The DOJ's regulations implementing Title II of the ADA dictate that local governments and public agencies such as Metro Parks Tacoma must evaluate their services, programs, policies, and practices, and identify barriers that may limit accessibility for individuals with disabilities and develop transition plans describing how they will address identified barriers.

Generally, Title II of the Americans with Disabilities Act (ADA) prohibits discrimination by public entities to access and use of because of disability. In addition, public agencies must provide program access to all programs of the agency. Program, as used in the phrase "program access", is defined by the Department of Justice as "programs, facilities, and activities" of the public agency. Regardless of their age, programs, facilities, and activities must be maintained and operated to comply with the Americans with Disabilities Act Accessibility Guidelines (ADAAG), and applicable state and local accessibility regulations.

The American Barriers Act (ABA) Outdoor Developed Area standards are currently enforceable for Federal properties only. The Federal standards were revised to include standards for specific types of outdoor recreation and those standards became enforceable for federal properties on November 25, 2013. For the purposes of the ABA review, the Outdoor Developed Area standards have been applied where the ABA extends to picnic facilities, viewing areas, trails, and beach access routes. While the ABA standards do not currently apply to state and local entities, it is the intent of the US Access Board to include the ABA Standards in the next revision of the ADA Accessibility Guidelines (ADAAG).

In 2010, the Department of Justice issued revised and expanded ADA regulations. The new regulations revised and updated earlier standards and included new standards for various recreational uses such as play equipment, amusement rides, fishing piers, etc. These are collectively called the 2010 ADA Standards for Accessible Design (the "2010 Standards"). These new standards guide all new park construction and renovation projects. All facilities and parks have been evaluated using the 2010 Standards as well as the State of WA current accessibility code, ANSI A117.1 version 2009.

A full discussion of the requirements of the Americans with Disabilities Act (ADA) for state and local governments is provided in Appendix A.

4. HISTORIC AMENITIES

Metro Parks Tacoma stewards historic amenities and historic structures, which are of city, county, state, regional, and national historic significance. The eight parks containing historic amenities listed on historic registers represent approximately 10 percent of the total portfolio of Metro Parks Tacoma properties.

Many of the properties are listed on the National Register of Historic Places. A qualified historic element, amenity, building, or property is defined as follows: A building or facility that is listed in or eligible for listing in the National Register of Historic Places or designated as historic under an appropriate state or local law, such as a state register, regional register, or local register of historic places, buildings, amenities, and elements.

Preserving and programming these cultural resources for future generations has been an important aspect of the agency's mission since its founding in 1907. Some sites are open to the public; some sites are leased to partners. Some serve as offices, while others are vacant or lack a recreational use due to physical condition or site limitations.

The agency has initiated online, searchable documentation of historic elements within its jurisdiction at <https://www.metroparkstacoma.org/about/history-of-metro-parks/historic-art-artifacts/>. While not all elements on the website pages are listed on historic registers, the elements are significant to the greater view of relevant history in the area.

A list of parks that contain historically relevant elements, both on and not on historic registers, can be found at <https://www.metroparkstacoma.org/about/history-of-metro-parks/>.

Most historic properties that are open to the public have been evaluated for ADA compliance. These include offices and rentable centers. Vacant and closed historic structures, for which no programming or use is anticipated, such as sheds and pumphouses, were not evaluated as part of the Self-Evaluation.

Innovative programming, which complies with ADA requirements, is a cornerstone of what the agency will be doing at the historic sites. Inclusive programming will be an important strategy to provide ADA access to existing and future historic structures and properties. Most historic amenities are open to the public, except Point Defiance Lodge, which is currently used as office space.

For a historic property that requires alteration to be compliant with the Washington State Building Code and the ADA, any alteration must be approved by the State of Washington Historic Preservation Officer, which in the State of Washington is the Department of Archaeology and Historic Preservation. Alterations to a qualified historic building or facility must comply with the State Historical Building Code and the ADA. State Historic Preservation Officers consult with Federal and State agencies, local governments, and private entities on providing access and protecting significant elements of qualified historic buildings and facilities. When the State Historic Preservation Officer or National Advisory Council on Historic Preservation determines that compliance with the requirements for accessible routes, entrances, or toilet facilities would threaten or destroy the historic significance of the building or facility, the exceptions for alterations to qualified historic buildings or facilities for that element can apply.

Public state and local governments have an additional obligation to achieve program accessibility under the Department of Justice ADA regulations (28 CFR 35.150). These regulations require public agencies that operate historic preservation programs to give priority to methods that provide physical access to individuals with disabilities. If alterations to a qualified historic building or facility to achieve program accessibility would threaten or destroy the historic significance of the building or facility, fundamentally alter the program, or result in undue financial or administrative burdens, the Department of Justice ADA regulations allow alternative methods to be used to achieve program accessibility.

The Department of Justice ADA regulations also allow public entities to use alternative methods when altering qualified historic buildings or facilities, in the rare situations where the State Historic Preservation Officer determines that it is not feasible to provide physical access without threatening or destroying the historic significance of the building or facility.

Some examples of providing alternative access are:

- For historic preservation programs, such as a historic building, alternative methods to access may include using audio-visual materials in an accessible space to depict portions of the building that cannot otherwise be made accessible. This can be accomplished by providing visual presentations, models, and exhibits about inaccessible locations in spaces which are accessible.
- In the case of other types of qualified historic properties, alternative methods may require relocating programs and services to accessible locations.

The complete list of historic elements which appear on historic registers is shown in Appendix F: Historic Amenities.

5. ADA PROGRAM INITIATIVES

5.1 ADA Program Progress

Metro Parks Tacoma has initiated physical and programmatic improvements, communication, and website upgrades among other efforts to improve accessibility to amenities within the agency's systems.

- An ADA Self-Assessment and Transition Plan was adopted in 2015.
- Department-wide ADA policy has been evolving, with the goal of incorporating the overall ADA strategy into daily operations.
- The official agency website includes a page dedicated to actions taken by the agency to improve accessibility. <https://www.metroparkstacoma.org/about/accessibility-at-metro-parks/>
- The official agency website includes a page providing the official policy for Diversity, Inclusion and Accessibility. <https://www.metroparkstacoma.org/about/policies/200-019/>
- ADA accessible amenities and elements are listed on the official website Accessibility page for selected park playgrounds.
- Maps with ADA symbols for accessible amenities are available on the official website page for selected individual parks.
- Accessible amenities are described or shown on each individual park brochure, when appropriate.
- Metro Parks Tacoma initiated the current Self-Evaluation process, of which this Transition Plan is part. A policies and programs evaluation is contained in a separate report.
- Accessibility evaluations were completed throughout the system in the fall of 2022 and in 2023.
- An ADA database utilizing BV's AssetCALC™ database system is managing the accessibility barrier information.

5.2 ADA Public Outreach

Metro Parks Tacoma recognizes the importance of public engagement. In order to provide all interested persons the opportunity to comment on this Self-Evaluation and Transition Plan strategies, Metro Parks Tacoma has in the past:

- Posted the Transition Plan on the Metro Parks Tacoma website in September 2023.
- Hosted public reviews of the Transition Plan with special invitations made to persons with disabilities and advocates.
- Provided Transition Plan reports to local educational institute experts for review.
- Asked for a peer review by area ADA Compliance Officers and the City of Tacoma Commission on Disabilities.
- Made the Draft Transition Plan available for review online and at major community facilities.
- Held an online public meeting to discuss the draft Transition Plan in December 2023, and hosted a live ADA Fair in January 2024.
- Conducted public surveys in October 2022 and October 2023. The public input results were analyzed and incorporated into park planning efforts where feasible.

Specific programming requests received for new ADA facilities in the public survey responses were not addressed in this Transition Plan, but will be addressed in future capital planning projects when feasible. The public survey results are summarized in Appendix I. Metro Parks Tacoma maintains a record of persons consulted, comments received, any further audit or assessment performed based on the comments received, and modifications made. These records are maintained by the ADA Coordinator, Marty Stump, and are available for public inspection.

Marty Stump's contact information is: email accomodation@tacomaparks.com or phone 253.305.1078. The ADA Coordinator contact information is available on the official agency website.

6. COMPLIANCE STRATEGY

The proposed strategy for ADA compliance is a multi-phase approach for facility access as well as programmatic access. The goal of this strategy is to ensure that the programs, services, and opportunities offered by Metro Parks Tacoma are accessible to the Tacoma community, regardless of abilities, yet provide a realistic plan for barrier removal that is within the fiscal capabilities of Metro Parks Tacoma. The proposed strategy for ADA compliance is a multi-stage approach for physical access and program access.

Provision of facility access is proposed to be based on a park/facility level, using as the initial criteria the level of public use. As its foundation, the proposed strategy is to ensure amenities that are in highest demand are accessible. This effort is, subject to various limitations, such as technically infeasible conditions and funding limitations. The strategy takes into account numerous factors such as population density, usage levels, and amenity uniqueness. This strategy will enable the best use of available funds to provide the optimal facility access to the park programs for all citizens.

Programmatic access will be an ongoing effort. Metro Parks Tacoma will initiate efforts to improve facility access and develop and expand its review of its many programs with a focus on policy initiatives, inclusion, and reasonable accommodation. Not all barriers must be removed as long as the disabled community is accommodated, and unique programs, facilities, and services are made available for disabled users. Selected recurring amenities will be made barrier-free so that multiple types of amenities are accessible across the park system and dispersed among regions and park experiences.

Park types provide a method of prioritization with emphasis on Regional Parks, which receive the highest number of visitors as well as the highest number of accessibility complaints.

Physical access is also focused on both recurring amenities and unique amenities. Recurring amenities are those occurring in multiple locations and are repeated in a number of parks, such as picnic shelters, trails, beaches, and other recreation amenities that are frequently found in parks, and within types of amenities, each location can be ranked in importance.

A unique amenity is defined as one offering a singular experience or activity in the park system such as historic buildings and sites. The Park Board and staff recognizes that a few unique amenities within its system may be duplicated, however, due to unique types of offerings, geographies, or overall uses, those amenities can still be defined as unique for the purpose of policy. Unique amenities are a high priority due to their singular nature. Unique amenities in the Metro Parks Tacoma System are:

- Browns Point Lighthouse and Keepers Cottage
- Charlotte's Blueberry Park
- Chinese Reconciliation Park
- Fort Nisqually Living History Museum
- Meadow Park Golf Course
- Northwest Trek Wildlife Park
- Point Defiance Park: Rose Garden
- Point Defiance Zoo and Aquarium
- Ruston Way – Fireboat #1
- SERA Sports Complex
- Tacoma Nature Center
- Wright Park: Lawn Bowling

Planning level estimated values for barrier removal, along with the extent of barrier removal efforts completed or currently funded, will change as the entire park system undergoes the process of barrier removal, and as the system is evaluated in the future, beyond the 2023 Transition Plan.

The level of funding is expected to continue at the same level going forward. Therefore, the majority of barrier removal is not anticipated to be funded as a separate initiative, but rather as part of larger capital projects. Barrier removal must be accomplished in phases, as funding becomes available.

7 PHASING

7.1 Park Priorities

The Transition Plan establishes a priority rating system for parks and facilities, and assigns parks into five phases, with the critical parks being the highest priority and in early budget phases. Easy barrier removal funded under the operations budget will be accomplished in a separate phase. See Executive Summary Section 1.2 for the phasing summary.

- **Phase One** – Phase One comprises the zoos, centers, unique amenities, and safety issues. The total pre-planning estimate for Phase One is \$2,350,859 and includes 849 barriers.

Phase One by Park	
Center at Norpoint	\$158,839
People's Community Center	\$211,014
Portland Avenue Community Center	\$69,148
Eastside Community Center	\$49,819
NW Trek Wildlife Park	\$1,119,654
Point Defiance Zoo and Aquarium	\$682,332
STAR Center	\$44,668
Tripping and Safety Hazards	\$15,385
Total	\$2,350,859

Phase One by Category		
Exterior Access Route	\$ 825 K	35%
Interior Access Route	\$ 690 K	29%
Accessible Parking	\$ 442 K	19%
Restroom	\$ 160 K	7%
Entrance to Building	\$ 46 K	2%
Kitchen	\$ 40 K	2%
Site Furnishings	\$ 40 K	2%
Common Areas	\$ 35 K	1%
Playground	\$ 30 K	1%
Swimming Pools	\$ 32 K	1%
Locker and Dressing Rooms	\$ 5 K	0%
Concession Stand	\$ 4 K	0%
Employee Work Areas	\$ 2 K	0%
Trail	\$ 2 K	0%

Anthony’s Restaurant is leased from Metro Parks Tacoma and contains barriers with an estimated cost of \$25,269 to remove. The owner of Anthony’s Restaurant is responsible for the removal of the barriers and will be informed about removal of barriers to access during Phase One.

A portion of the barriers in Phase One may be removed under the 6-year Capital Improvement Plan 2023-2028 in the following planned capital improvement projects:

- NW Trek Wildlife Park – multiple projects through 2028



- Point Defiance Zoo and Aquarium - multiple projects through 2028
- Center at Norpoint – Phase 2 2024 project
- 2023 projects are not included on this list due to timing.

- **Phase Two** – Phase Two comprises regional parks and unique amenities. The total pre-planning estimate for Phase Two is \$1,986,434 and includes 532 barriers.

Phase Two by Park	
Browns Point Lighthouse Park	\$143,990
Cummings Park	\$137,684
Dickman Mill Park	\$107,100
Dune Peninsula at Point Defiance Park	\$34,991
Fort Nisqually Living History Museum	\$62,465
Hamilton Park	\$10,591
Jack Hyde Park	\$93,883
Judge Jack Tanner Park	\$85,677
Les Davis Pier	\$294,333
Meadow Park Golf Course	\$239,759
Old Town Dock	\$131,602
Point Defiance Marina	\$47,947
Point Defiance Park	\$550,427
Thea's Park	\$45,985
Total	\$1,986,434

Phase Two by Category		
Exterior Access Route	\$ 1 M	52%
Accessible Parking	\$ 330 K	17%
Interior Access Route	\$ 123 K	6%
Restroom	\$ 72 K	4%
Sports Facilities	\$ 68 K	3%
Beach	\$ 56 K	3%
Boating and Fishing	\$ 55 K	3%
Kitchen	\$ 51 K	3%
Historic Structure	\$ 47 K	2%
Picnic Area	\$ 37 K	2%
Common Areas	\$ 26 K	1%
Entrance to Building	\$ 25 K	1%
Site Furnishings	\$ 24 K	1%
Trail	\$ 11 K	1%
Accessible Route	\$ 10 K	1%
Portable Restroom	\$ 4 K	0%
Picnic Shelter	\$ 4 K	0%



Phase Two by Category		
Scenic Viewing Area	\$ 2 K	0%
Concession Stand	\$ 2 K	0%
Picnic Area	\$1 K	0%

A portion of the barriers in Phase Two may be removed under the 6-year Capital Improvement Plan 2023-2028 in the following planned capital improvement projects:

- Pt. Defiance Park – 2024 Lodge project
 - Fort Nisqually Living History Museum – 2024 project
 - Meadow Park Golf Course – multiple projects through 2028
 - 2023 projects are not included on this list due to timing
- **Phase Three** – Phase Three comprises the community centers and the remaining regional parks. The total pre-planning estimate for Phase Three is \$1,911,831 and includes 526 barriers.

Phase Three by Park	
Chinese Reconciliation Park	\$448,149
Dash Point Park and Pier	\$80,093
Franklin Park	\$89,234
Heidelberg Davis Park	\$166,800
Jefferson Park	\$131,508
Kandle Park and Pool	\$64,538
Lincoln Eldridge Park	\$53,062
Metro Parks Headquarters	\$73,355
Ruston Way Areas 2-4	\$704,667
Wright Park and WW Seymour Botanical Conservatory	\$100,425
Total	\$1,911,831

Phase Three by Category		
Exterior Access Route	\$ 1 M	73%
Accessible Parking	\$ 291 K	15%
Restroom	\$ 57 K	3%
Site Furnishings	\$ 45 K	2%
Playground	\$ 28 K	1%
Picnic Area	\$ 19 K	1%
Basketball Court	\$ 18 K	1%
Interior Access Route	\$ 14 K	1%
Trail	\$ 13 K	1%
Baseball/Softball Field	\$ 10 K	1%
Beach	\$ 6 K	0%
Portable Restroom	\$ 3 K	0%
Historic Structure	\$ 3 K	0%

Phase Three by Category		
Common Areas	\$ 2 K	0%
Concession Stand	\$ 2 K	0%
Picnic Shelter	\$ 1 K	0%
Entrance to Building	\$ 1 K	0%
Signage	\$280	0%
Boating and Fishing	\$200	0%
Athletic Fields	\$52	0%

A portion of the barriers in Phase Three may be removed under the 6-year Capital Improvement Plan 2023-2028 in the following planned capital improvement projects:

- Dash Point Park and Pier – 2024 project
 - Franklin Park – 2024 and 2025 projects
 - Heidelberg Davis Park – 2024 project
 - Jefferson Park – 2024 project
 - Lincoln Eldridge Park – 2024 project
 - 2023 projects are not included on this list due to timing.
- **Phase Four** – Phase Four comprises the community centers and the remaining regional parks. The total pre-planning estimate for Phase Four is \$ 2,046,476 and includes 671 barriers.

Phase Four by Park	
Charlotte's Blueberry Park	\$101,331
McKinley Park	\$371,585
Norpoint Park	\$252,735
Northeast Tacoma Playground	\$17,025
Peck Field	\$97,456
Portland Avenue Park	\$138,958
SERA Sports Complex	\$149,249
South Park	\$322,273
Stewart Heights Park and Pool	\$454,194
Swan Creek Park	\$141,670
TOTAL	\$2,046,476

Phase Four by Category		
Exterior Access Route	\$ 1 M	51%
Accessible Parking	\$ 405 K	20%
Trail	\$ 402 K	20%
Restroom	\$ 60 K	3%
Site Furnishings	\$ 47 K	2%
Common Areas	\$ 23 K	1%
Playground	\$ 12 K	1%
Interior Access Route	\$ 11 K	1%



Phase Four by Category		
Football Field	\$ 14 K	1%
Basketball Court	\$ 5 K	0%
Picnic Shelter	\$ 5 K	0%
Entrance to Building	\$ 4 K	0%
Baseball/Softball Field	\$ 4 K	0%
Sports Facilities	\$ 4 K	0%
Picnic Area	\$ 4 K	0%
Locker and Dressing Rooms	\$ 3 K	0%
Signage	\$ 3 K	0%
Concession Stand	\$ 2 K	0%
Swimming Pools	\$ 2 K	0%
Common Area	\$ 1 K	0%
Employee Work Areas	\$330	0%

A portion of the barriers in Phase Four may be removed under the 6-year Capital Improvement Plan 2023-2028 in the following planned capital improvement projects:

- McKinley Park – 2025 project
- Norpoint Park – 2024 and 2025 projects
- Northeast Tacoma Playground - 2024 and 2025 projects
- South Park – 2024 project
- Stewart Heights Park and Pool - 2024 project
- 2023 projects are not included on this list due to timing

- **Phase Five** – Phase Five comprises the remaining community parks, signature parks, and neighborhood parks. The total pre-planning estimate for Phase Five is \$ and includes 834 barriers.

Phase 5 by Park	
Alderwood Park	\$35,141
Alling Park	\$30,238
Baltimore Park	\$8,367
Browns Point Playfield	\$72,212
China Lake Park	\$11,860
Cloverdale Park	\$29,858
DeLong Park	\$44,901
Fern Hill Park	\$6,930
Ferry Park	\$61,243
Garfield Park	\$54,470
Irving Park	\$5,034
Jane Clark Park	\$32,120
Jerry Meeker Memorial	\$19,215
Julia's Gulch	\$2,352
Lincoln Heights Park	\$31,462



Phase 5 by Park	
Lots for Tots	\$14,168
Manitou Park	\$31,712
Neighbors Park	\$46,418
North Slope Historic Park	\$4,565
Oak Tree Park	\$2,720
Oakland Madrona Park	\$31,801
Old Town Park	\$54,773
Optimist Park	\$21,075
People's Park	\$64,885
Proctor Community Garden	\$195,672
Puget Gulch	\$560
Puget Park	\$71,649
Rogers Playfield	\$56,966
Roosevelt Park	\$25,535
Ryan's Park	\$12,265
Sawyer Tot Lot	\$19,623
Sheridan Park	\$25,512
Tacoma Nature Center and Snake Lake Natural Area	\$107,719
Titlow Park	\$265,156
Ursich Park	\$560
Vassault Park	\$66,922
Verlo Playfield	\$123,961
Wapato Hills Park	\$80,259
Wapato Park and Pavilion	\$461,344
Total	\$2,231,223

Phase Five by Category		
Exterior Access Route	\$ 1 M	46%
Accessible Parking	\$ 409 K	18%
Playground	\$ 278 K	12%
Interior Access Route	\$ 158 K	7%
Restroom	\$ 113 K	5%
Site Furnishings	\$ 108 K	5%
Trail	\$ 45 K	2%
Soccer Field	\$ 28 K	1%
Entrance to Building	\$ 14 K	1%
Common Areas	\$ 13 K	1%
Basketball Court	\$ 19 K	1%
Picnic Shelter	\$ 9 K	0%
Picnic Area	\$ 8 K	0%



Phase Five by Category		
Kitchen	\$ 5 K	0%
Assembly Area	\$ 3 K	0%
Baseball/Softball Field	\$ 2 K	0%
Fitness Course	\$708	0%
Signage	\$840	0%
Beach	\$430	0%

A portion of the barriers in Phase Five may be removed under the 6-year Capital Improvement Plan 2023-2028 in the following planned capital improvement projects:

- Alderwood Park – 2024 project
- Alling Park – 2025 project
- China Lake Park – 2025 project
- Cloverdale Park – 2024 project
- DeLong Park – 2024 project
- Fern Hill Park - 2024 and 2025 projects
- Ferry Park - 2024 and 2025 projects
- Garfield Park – 2025 project
- Jane Clark Park - 2024 and 2025 projects
- Neighbors Park - 2024 and 2025 projects
- North Slope Historic Park - 2024 and 2025 projects
- Oakland Madrona Park – 2024 project
- Optimist Park – 2025 project
- People’s Park - 2024 and 2025 projects
- Puget Park - 2024 and 2025 projects
- Rogers Playfield - 2024 and 2025 projects
- Roosevelt Park - 2024 and 2025 projects
- Sawyer Tot Lot – 2024 project
- Sheridan Park – 2025 project
- Titlow Park – 2024, 2025 and 2026 projects
- Vassault Park – 2025 project
- Verlo Park – 2024 and 2025 projects
- Wapato Park – 2024 project
- 2023 projects are not included on this list due to timing
- **Easily Removable Barriers (ERBs)** – Easily Removable Barriers will be removed through the maintenance program and the removals will not necessarily be included in capital improvement projects. Therefore, the barriers were not included in the five phases of barrier removal. The total pre-planning estimate for ERBs is \$430,514 and includes 1107 barriers.

Easily Removable Barriers (ERBs) by Park	
Alderwood Park	\$2,673
Alling Park	\$2,101
Baltimore Park	\$1,280
Browns Point Lighthouse Park	\$3,480
Browns Point Playfield	\$1,360
Center at Norpoint	\$10,814
Charlotte's Blueberry Park	\$406
China Lake Park	\$280
Chinese Reconciliation Park	\$3,440



Easily Removable Barriers (ERBs) by Park	
Cloverdale Park	\$700
Cummings Park	\$1,120
Dash Point Park and Pier	\$15,166
DeLong Park	\$840
Dickman Mill Park	\$520
Dune Peninsula at Point Defiance Park	\$4,259
Eastside Community Center	\$34,438
Fern Hill Park	\$13,793
Ferry Park	\$527
Fort Nisqually Living History Museum	\$6,380
Franklin Park	\$4,085
Garfield Park	\$5,342
Heidelberg Davis Park	\$3,450
Jack Hyde Park	\$250
Jane Clark Park	\$5,359
Jefferson Park	\$4,475
Judge Jack Tanner Park	\$560
Kandle Park and Pool	\$3,851
Les Davis Pier	\$2,302
Lincoln Eldridge Park	\$6,710
Lincoln Heights Park	\$1,216
Lots for Tots	\$976
Manitou Park	\$598
Meadow Park Golf Course	\$7,978
Metro Parks Headquarters	\$4,585
Norpoint Park	\$1,788
North Slope Historic Park	\$246
Northeast Tacoma Playground	\$1,200
NW Trek Wildlife Park	\$43,032
Oakland Madrona Park	\$280
Old Town Dock	\$200
Old Town Park	\$1,250
Optimist Park	\$560
Peck Field	\$4,562
People's Community Center	\$24,480
Point Defiance Marina	\$6,980
Point Defiance Park	\$31,169
Point Defiance Zoo and Aquarium	\$30,523
Portland Avenue Community Center	\$11,440
Portland Avenue Park	\$1,412



Easily Removable Barriers (ERBs) by Park	
Proctor Community Garden	\$320
Rogers Playfield	\$160
Sawyer Tot Lot	\$100
SERA Sports Complex	\$2,680
South Park	\$1,280
STAR Center	\$21,921
Stewart Heights Park and Pool	\$32,351
Swan Creek Park	\$4,012
Tacoma Nature Center and Snake Lake Natural Area	\$7,440
Thea's Park	\$280
Titlow Park	\$20,845
Vassault Park	\$6,903
Verlo Playfield	\$876
Wapato Hills Park	\$1,322
Wapato Park and Pavilion	\$13,006
Wright Park and WW Seymour Botanical Conservatory	\$2,582
Total	\$430,514

Easily Removable Barriers (ERBs) by Category		
Interior Access Route	\$ 92 K	21%
Entrance to Building	\$ 87 K	20%
Accessible Parking	\$ 59 K	14%
Exterior Access Route	\$ 56 K	13%
Playground	\$ 57 K	13%
Restroom	\$ 52 K	12%
Common Areas	\$ 11 K	3%
Signage	\$ 7 K	2%
Portable Restroom	\$ 3 K	1%
Beach	\$ 2 K	1%
Trail	\$ 2 K	0%
Locker and Dressing Rooms	\$789	0%
Site Furnishings	\$350	0%
Kitchen	\$325	0%
Sports Facilities	\$160	0%

7.2 Barrier Priorities

Barriers can be generically prioritized based on the type of barrier. Barriers of various priority levels are contained within each park; therefore, each phase of this Transition Plan includes a range of individual barrier priorities.



The scope of the individual assessments was limited to exterior site features and amenities, specifically accessible parking and exterior accessible pedestrian paths of travel to and from all amenities and features provided at each site. Elements assessed included amenities such as parking, playgrounds, and restroom interiors. Bureau Veritas prioritized each of the captured barriers based on Department of Justice (DOJ) criteria focusing on the primary scope of work. Interior spaces such as common corridors, public restrooms, and other interior elements along the common path of travel, such as water fountains that are the responsibility of the property owner, were included.

Per requirements of the ADA Title II (Congressional Federal Record Section 35.151 New construction and alterations) and DOJ Guidelines, *people with disabilities should be able to arrive on the site, approach the building or facility and its amenities, and enter as freely as everyone else.*

The following priority levels have been used to assign priorities to barriers within each property and facility.

Priority 1: Path of Travel-Accessible Van Parking – Access to a public facility begins with accessible parking. Van accessible parking is deemed the most important barrier. Those with the most severe disabilities tend to require a van accessible space to accommodate their vehicle and mobility device. In addition, when only the minimum number of accessible spaces is required, there must be a van accessible space. This priority includes all barriers associated with the compliance of a van accessible space including signage, restriping, constructing, or reconfiguring the pavement to accommodate the required number of spaces.

Accessible Car Parking – Access to a public facility begins with accessible parking. Car accessible parking is deemed the second most important barrier. This priority includes all barriers associated with the compliance of a van accessible space including signage, restriping, constructing, or reconfiguring the pavement to accommodate the required number of accessible spaces.

Accessible Approach and Entrances – A public agency is required to take measures to provide access to a place of public accommodation and employee areas from public sidewalks, parking, or public transportation. The DOJ dictates the minimum width, cross and running slope, signage, and handrail requirements associated with pedestrian accessible routes of travel. These measures include, for example, installing an entrance ramp, correcting tripping hazards, or lessening the slope of a curb ramp. At least one route of travel to each amenity or feature should be safe and accessible for everyone, including people with disabilities.

Priority 2: Elements used for programs, services, and activities – Barriers may include play equipment, picnic tables, public counters, benches, and trash receptacles.


Priority 3: Restrooms, Signage – Barriers may include widening of toilet stalls, installation of grab bars, and lowering lavatories and mirrors.

Priority 4: Access to Auxiliary Features and Amenities – A public agency is required to take measures to provide access to auxiliary features and amenities along paths of travel, such as kiosks, water fountains, and kitchen appliances.

Priority 5: Employee-only Areas – Employee-only areas are required to have accessible entrances and exits and accessible paths of travel within interior work areas and workstations. Corridors in employee-only areas, employee-only restrooms, employee-only kitchens, and employee-only break rooms are considered public areas under the ADA and are required to fully comply with accessibility regulations governing those types of areas.

Employee areas have been set as the lowest priority as the total estimated cost for barrier removal in public areas is the more pressing need.

The Federal Department of Justice (DOJ) has developed guidelines so that people with disabilities should be able to arrive on the site, approach the building or park and its amenities, and enter as freely as everyone else. To meet the guidelines throughout the assessment of individual park locations, five levels of priority for barrier types were established, ranging from the exterior accessible route to a facility, the highest priority, to Employee-only areas, the lowest priority. The total cost divided over these five priorities is shown in the chart below. The greatest cost for barrier removal is Priority 1, over 77% of the total dollar amount for all barrier removals.

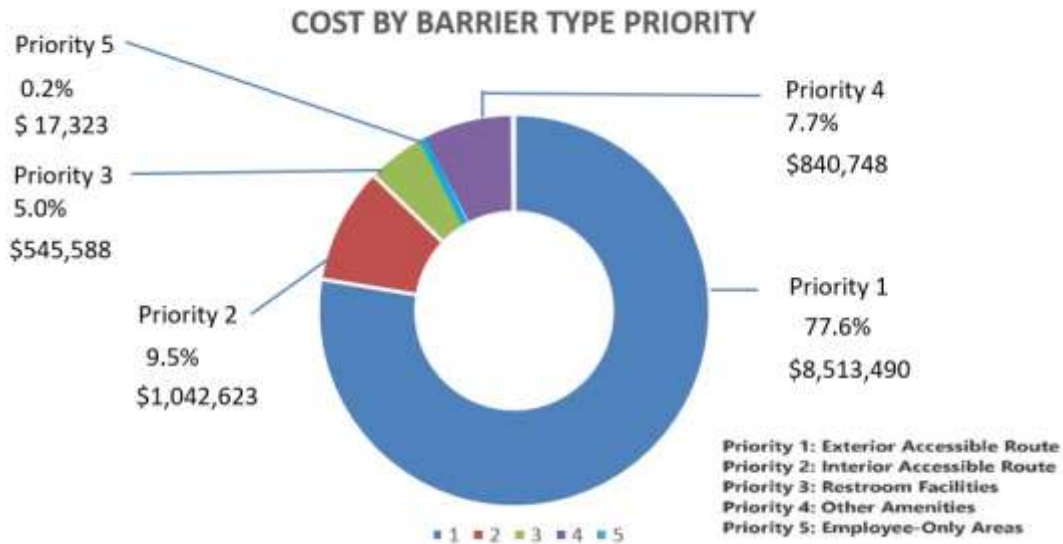

These priorities assigned to barrier types follow the DOJ guidelines and are built into the AssetCALC™ library. The priorities assigned to barrier types in the library provide a basic metric over which is laid prioritization based on the individual park needs for Metro Parks Tacoma properties.

8 CERTIFICATION

Bureau Veritas has completed this ADA Transition Plan of the Metro Parks Tacoma agency in Pierce County, Washington, in accordance with the requirements of 28 CFR Part 35, the 2010 ADA Design Standards for Accessible Design, and the State of Washington Building Code sections related to accessibility.

The conclusions and recommendations presented in this report are based on the evaluations of properties under the jurisdiction of Metro Parks Tacoma, associated documentation related to the organization, and input from the Metro Parks Tacoma staff.

The Transition Plan was developed at the Client's request using methods and procedures consistent with good commercial and customary practice for assessing compliance with the Title II provisions of the Americans with Disabilities Act (ADA) including the requirements of 28 CFR Part 35.

The opinions Bureau Veritas expresses in this report were formed utilizing the degree of skill and care ordinarily exercised by any ADA consultant. Bureau Veritas assumes no responsibility or liability for the accuracy of information contained in this report which has been obtained from the Client or the Client's representatives, from other interested parties, or from the public domain. The conclusions presented represent Bureau Veritas's professional judgment based on information obtained during the course of this assignment. The conclusions presented are based on the data provided, observations made, and conditions that existed specifically on the dates of the documentation and discussions with Metro Parks Tacoma personnel.

Bureau Veritas certifies that Bureau Veritas has no undisclosed interest in the agency, Bureau Veritas's relationship with the Client is at arms-length, and that Bureau Veritas's employment and compensation are not contingent upon the findings or estimated costs to remedy any deficiencies.

This report has been prepared on behalf of and exclusively for the use of Metro Parks Tacoma for the purposes stated herein. The purpose for which this report shall be used shall be limited to the use as stated in the contract between the client and Bureau Veritas.

This report, or any of the information contained therein, is not for the use or benefit of, nor may it be relied upon by any other person or entity, for any purpose without the advance written consent of Bureau Veritas. Any reuse or distribution without such consent shall be at the client's or recipient's sole risk, without liability to Bureau Veritas.

If you have any questions regarding this report, please contact Program Manager Tracy Trisko at Tracy.Trisko@bureauveritas.com or at (800) 766-0660, x7298048.

Prepared by: Tracy Trisko, RLA

Reviewed by:



Micheal Cunniff, Senior Project Manager
Micheal.Cunniff@bureauveritas.com

9 APPENDICES

APPENDIX A: ADA TITLE II REQUIREMENTS

APPENDIX B: ACCESSIBILITY SUMMARIES BY PARK TYPE

APPENDIX C: PORTFOLIO ACCESSIBILITY SUMMARY

APPENDIX D: BARRIERS BY TRANSITION PLAN PHASE

APPENDIX E: EASILY REMOVABLE BARRIERS

APPENDIX F: SAFETY AND TRIPPING HAZARDS

APPENDIX G: PARK AMENITIES

APPENDIX H: HISTORIC AMENITIES

APPENDIX I: PUBLIC SURVEY

APPENDIX A: ADA TITLE II REQUIREMENTS



The Americans with Disabilities Act

With the passage of the Americans with Disabilities Act in 1990, people with disabilities were, for the first time, assured of access to all programs and services provided by state and local government agencies. Previously, under Section 504 of the Rehabilitation Act of 1973, as amended, only those public entities that receive federal funding were explicitly prohibited from discriminating based on disability. Title II of the Americans with Disabilities Act applies Title I regulations to most public entities and became effective on January 26, 1992.

The Americans with Disabilities Act is divided into five areas, Titles I through V.

Title I- Employment: Title I of the Americans with Disabilities Act prohibits all employers, including government agencies, from discriminatory practices in the hiring, training, advancement, compensation, or discharge of any employee, or in any terms, conditions, and rights of employment.

Title II- Public Services: Title II of the American Disabilities Act, which governs state and local government entities, prohibits all public entities, even those completely independent from federal funding, from discriminating against people with disabilities. Generally, Title II of the Americans with Disabilities Act (ADA) prohibits discrimination by state and local government entities to access and use of "areas of public accommodations" and "public facilities" on the basis of disability.

Title III- Public Accommodations and Commercial Facilities: Title III requires places of public accommodation (privately funded and operated facilities) and commercial facilities that serve the public to be accessible to and usable by people with disabilities.

Title IV- Telecommunications: Title IV covers private telecommunication carriers offering services to the public to increase the availability of interstate and intrastate telecommunication relay services to individuals with hearing and speech impairments.

Title V- Miscellaneous Provisions: Title V contains miscellaneous provisions, including construction standards and practices, provisions for attorneys' fees, and technical assistance provisions.

Terms such as "Public Entity" and "Governmental Agency" are applicable to Title II entities, which are defined as state and local governments.

The Department of Justice (DOJ) is tasked with enforcement of the ADA.

Scope of Title II

Title II is divided into two subtitles. This discussion focuses only on Subtitle A, which is implemented by the Department of Justice's Title II regulation at 28 C.F.R. § Part 35. Subtitle B covers public transportation and is implemented by the Department of Transportation's regulation. Subtitle B provisions are not applicable to this report, since parks are not a mode of public transportation. The use of the term "Title II" anywhere in the Transition Plan report refers only to Subtitle A.

28 C.F.R. §35.102 Application

(a) Except as provided in paragraph (b) of this section, this part applies to all services, programs, and activities provided or made available by public entities.

(b) To the extent that public transportation services, programs, and activities of public entities are covered by Subtitle B of Title II (42 U.S.C.12141) of the ADA, they are not subject to the requirements of this part.

The obligation to comply with Title II extends to all public entities, including:

- Any state or local government
- Any department, agency, special purpose district, or other instrumentality of a state or local government

All local agencies, including municipalities, are required to comply with Title II because they are considered "instrumentalities" of the state government. All programs, activities, and services of local government, including municipalities, must be in compliance with Title II. Examples of activities covered include:

- Operation of all services and programs offered by the entity
- All aspects of the employment relationship
- Services carried out by contractors.

Title II covers any and all events the local government system offers, for example, any public meetings, entertainment or lecture series, all events offered by the school system including after-school activities and social events, festivals or other special events, and all services provided for the public or staff. Services provided by any private contractors on behalf of the municipal system must also comply fully with relevant provisions of Title II.

Under Title II, a public entity (i.e. governmental agency) shall operate each service, program, or activity so that the service, program, or activity, when viewed in its entirety, is readily accessible to and usable by individuals with disabilities. The local government may not deny the benefits of its programs, activities, and services to individuals with disabilities because its facilities are inaccessible.

Public meeting rooms must be accessible to people with disabilities. Buildings where public meetings, services, programs, or activities take place must provide access to telephones and restrooms, if provided, for people with disabilities as well as the general public. When a program, service, or activity is scheduled in an inaccessible location and a person with a disability notifies the agency of their desire or need to participate, that program, service, or activity must be moved to an accessible location.

The government must maintain equipment and features of facilities in working order if those features and equipment are required to provide ready access to individuals with disabilities. Isolated or temporary interruptions in access due to maintenance and repair of accessible features are not prohibited. For example, where the governmental agency must provide an accessible route, the route must remain accessible and not blocked by obstacles such as furniture, filing cabinets, or potted plants. An isolated instance of placement of an object on an accessible route, however, would not be a violation if the object is promptly removed. Similarly, accessible doors must be unlocked when the governmental agency's offices are open for business.

Mechanical failures in equipment such as elevators or automatic doors will occur from time to time. The obligation to ensure that facilities are readily accessible to and usable by individuals with disabilities would be violated if repairs are not made promptly, or if improper or inadequate maintenance causes repeated failures.

However, this does not --

(1) Necessarily require a public entity to make each of its existing facilities accessible to and usable by individuals with disabilities.

(2) Require a public entity to take any action that would threaten or destroy the historic significance of an historic property; or

(3) Require a public entity to take any action that it can demonstrate would result in a fundamental alteration in the nature of a service, program, or activity, or in undue financial and administrative burdens. In those circumstances where personnel of the public entity believe that the proposed action would fundamentally alter the service, program, or activity, or would result in undue financial and administrative burdens, a public entity has the burden of proving that compliance with 35.150(a) of this part would result in such alteration or burdens. The decision that compliance would result in such alteration or burdens must be made by the head of a public entity or his or her designee after considering all resources available for use in the funding and operation of the service, program, or activity, and must be accompanied by a written statement of the reasons for reaching that conclusion. If an action would result in such an alteration or such burdens, a public entity shall take any other action that would not result in such an alteration or such burdens, but would nevertheless ensure that individuals with disabilities receive the benefits or services provided by the public entity.

In summary, Title II requires state, county, and city governments to ensure that all of their programs, services, and activities, when viewed in their entirety, are accessible to people with disabilities. Program access is intended to remove physical barriers to state, county, and city services, programs, and activities, but it generally does not require that a government agency make each facility, or each part of a facility, accessible. For example, all restrooms in a facility may not be accessible. However, signage should be provided directing people with disabilities to the accessible features and spaces in a facility, including at least one accessible restroom.

Program accessibility may be achieved in a variety of ways. State, county, and city governments may choose to make structural changes to existing facilities to achieve access or can pursue alternatives to structural changes to achieve program accessibility. For example, governments can move public meetings to accessible buildings, or can relocate services for individuals with disabilities to accessible levels or sections of buildings. When choosing between possible methods of program accessibility, governments must give priority to the choices that offer services, programs, and activities in the most integrated setting appropriate. [28 C.F.R. § 35.149, 35.150, 35.151, 35.163]

Definition of Disability

The ADA stipulates a definition of disability. Disability is defined as an individual who:

- Has a physical or mental impairment that substantially limits one or more major life activities; or
- Has a record or history of such an impairment or is perceived or regarded as having such an impairment.
- Major life activities encompass activities such as caring for oneself, performing manual tasks, walking, seeing, hearing, speaking, breathing, learning, and working. [28 C.F.R. § 35.104]

Human Resources

The ADA requires equal opportunity for the disabled in all areas of employment practices, including the application process, interviewing, testing, hiring, job assignment, evaluation, discipline, medical examinations, compensation, promotion, on-the-job training, layoff/recall, termination, leave, and benefits such as health insurance. The non-discrimination requirement applies to the hiring process, as well as employees.

The ADA requires that all employees be provided equal access to benefits, such as health insurance, regardless of disability. However, the regulations also indicate that certain restrictions, such as pre-existing condition, waiting periods, or caps on particular types of services, such as out-patient physical therapy, are permissible unless proven to be a subterfuge for discrimination.

The ADA requirements for the hiring protocol and all areas of responsibility of the human resources department extend to seasonal workers, workers covered by collective bargaining agreements, and workers who may be hired through outside agencies. Volunteers, interns, or student teachers who may be placed at an agency program or recruiters are not necessarily defined as government employees.

An important factor in the Self-Evaluation process is the identification of unionized employees and the terms of union agreements. For example, the terms of a collective bargaining agreement may include job restructuring or reassignment requests, which may affect seniority provisions. If the granting of requests would create an undue hardship, the Equal Employment Opportunity Commission (EEOC) has the authority to determine on a case-by-case basis whether the claim of undue hardship is valid.

Employment regulations treat alcohol and drug use differently. Alcoholism is recognized as a disability under the ADA; however, employers do not have to tolerate poor work performance due to alcoholism. If a person with alcoholism is provided only one paid leave for treatment of the alcoholism, while persons with different diseases are provided multiple paid leave, then such a provision is a violation of the ADA.

The ADA does not protect an individual currently engaging in the illegal use of drugs. However, a person with a history of drug addiction who (1) has been successfully rehabilitated or is participating in a drug rehabilitation program and (2) is not engaging in the illegal use of drugs is protected if the person is a qualified individual with a disability. An individual who is erroneously regarded as being a drug addict is also protected. [28 C.F.R. § 35.104, 131]

Communications

People who have disabilities that affect hearing, seeing, speaking, reading, writing, or understanding may use different ways to communicate than people who do not. Governmental agencies are required to take steps to ensure that the agency's communications with people with disabilities are as effective as communications with others. [28 C.F.R. § 35.160(a)(1)]

This effective communication requirement applies to all members of the public with disabilities, including job applicants, program participants, and even people who simply contact state or local government agencies seeking information about programs, services, events, or activities. The requirement applies to all agencies and to all modes of communication including written, spoken, telecommunications, television, and video. Specifically, where the governmental agency communicates by telephone with applicants and any other person, text phones (TTY's) or equally effective telecommunications systems are required to be used for individuals who are deaf, hard of hearing, or have speech impairments. [28 C.F.R. § 35.161]

When the government uses an automated-attendant system, including, but not limited to, voice mail and messaging, or an interactive voice response system for receiving and directing incoming telephone calls, that system must provide for real-time communication with individuals using auxiliary aids and services, including TTY's and all forms of FCC-approved telecommunications relay system, including Internet-based relay systems. [28 C.F.R. § 35.161]

Under 28 C.F.R. § 35.161, the ADA requires that all Public Safety Answering Points (PSAPs) provide direct and equal access to their services for people with disabilities who use text phones (TTYs). All basic emergency services are included in this requirement. Both primary and secondary PSAPs have the same responsibilities under the ADA. To be in compliance, every call-taking position within the PSAP must have its own TTY or TTY-compatible equipment.

Additionally, telephone emergency services, including 911 services, shall provide direct access to individuals who use telecommunication devices for the deaf (TDD's) or computer modems. [28 C.F.R. § 35.162]

The governmental agency must provide equal access to the programs, services, and activities available on the agency's website(s). This can include making websites accessible to people with disabilities or providing an alternative format for people to access the information, programs, and services available through the web. In order to aid development of a government website that is accessible, the web administrator can consult the Web Content Accessibility Guidelines, developed by the Web Content Accessibility Working Group, which is part of the World Wide Web Consortium Web Accessibility Initiative, and available at <http://www.w3.org/TR/WCAG20>.

When an auxiliary aid or service is requested, the Department must provide an opportunity for the requester to specify aids or services of their choice, and that choice must be given primary consideration. There are many types of auxiliary aids and services that may be used to provide effective communication for people with disabilities, but not all ways work for all people, or even for people with the same type of disability. The law does not require the agency to provide every one of these aids and services, but it does require that each person who interacts with the agency receives effective communication. [28 C.F.R. § 35.160]

Requirements for an ADA Coordinator

A Title II entity with more than 50 employees must designate an ADA Coordinator who coordinates agency efforts to comply with and carry out the responsibilities of the ADA. The coordinator provides a single point of contact for members of the public about ADA and the agency. To ensure that individuals can easily identify the ADA Coordinator, the governmental agency must provide the ADA Coordinator's name, office address, and telephone number to all interested individuals [28 C.F.R. § 35.107].

The ADA Coordinator facilitates compliance with the ADA and provides expertise regarding the American Disability Act and ADA Standards. The ADA coordinator receives and investigates complaints related to discrimination on the basis of disability.

Under 28 C.F.R. § 35.107, a grievance procedure is required for public entities of 50 or more employees. Title II entities are required to adopt and publish grievance procedures providing for prompt and equitable resolution of complaints alleging any action that would be prohibited by 28 C.F.R. § 35.

New Construction and Alterations

A public Title II entity may not deny the benefits of its programs, activities, and services to persons with disabilities because its existing facilities are inaccessible. It is the general availability of a program to persons with disabilities that must be evaluated; not compliance with facility standards developed for new construction and alterations.

While state and local governments may wish to measure the accessibility of their existing buildings against the scoping and technical provisions in the 2010 Standards, program accessibility may be achieved without making every existing facility, or every part of an existing building, accessible. Alternatives to building retrofit can include the temporary relocation of an activity to an accessible facility, or the delivery of the service or benefit by other means. In many cases, however, permanent construction that provides physical access may be the most efficient and economical approach to program access, particularly when life cycle costs are considered.

Although physical changes are required only when there is no other feasible way to make a program accessible, public entities are required to give priority to methods that result in the most integrated setting appropriate. The program access obligation is limited: Title II entities do not have to take actions that they can demonstrate would result in a fundamental alteration in the nature of a program, or that would impose undue financial or administrative burdens.

In compliance with 28 C.F.R. §35.151 (c), if new construction and alterations to a facility were begun prior to September 15, 2010, then the facility or portion of the facility that is affected by the alteration shall comply with the 1991 standards. If new construction and alterations to a facility were begun on or after September 15, 2010, and before March 15, 2012, then either the 1991 standards or the 2010 ADA Standards for Accessible Design are applicable. For all new construction or alterations begun on or after March 15, 2012, the 2010 ADA Standards for Accessible Design are applicable. New construction and alterations must fully comply with all applicable 2010 ADA Standards for Accessible Design if begun on or after March 15, 2012.

The DOJ definition of the commencement of construction is the establishment of a physical object, such as a foundation wall, rather than the groundbreaking first shovel and initial grading of the site.

Existing facilities (including all buildings, exterior facilities, and the on-site access to them) constructed prior to January 26, 1992, and not altered in any way since that date, are held to the lesser standard of complying, with the extent allowed by structural feasibility and the financial resources available, or when a reasonable accommodation can be made.

If the cost of providing a path of travel to an altered facility is more than 20% of the cost of the alteration to the primary function area, then the cost is disproportionate to the overall area and not required. Costs that may be considered as part of the cost of providing an accessible path of travel may include: (1) the costs associated with providing an accessible entrance and an accessible route to the altered area, for example, the cost of widening doorways or installing ramps; (2) costs associated with making restrooms accessible, such as installing grab bars, enlarging toilet stalls, insulating pipes, or installing accessible faucet controls, if the restroom is not the primary function of the area (e.g. the restroom is not in a highway rest area); (3) costs associated with providing accessible telephones, such as relocating the telephone to an accessible height, installing amplification devices, or installing a text telephone (TTY); and (4) costs associated with relocating an inaccessible drinking fountain. [28 C.F.R. § 35.151(b)(4)(iii)]

When the cost of alterations necessary to make the path of travel to the altered area fully accessible is disproportionate to the cost of the overall alteration, the path shall be made accessible to the extent that it can without incurring disproportionate costs. In choosing which accessible elements to provide, priority should be given to those elements that will provide the greatest access, in the following order: (1) an accessible entrance; (2) an accessible route to the altered area; (3) at least one accessible restroom for each sex or a single unisex restroom; (4) accessible telephones; (5) accessible drinking fountains; and (6) when possible, additional accessible elements such as parking storage and alarms. [28 C.F.R. § 35.151(b)(4)(iv)]. A series of smaller alterations cannot be used to evade the requirement if the alterations are served by a single path of travel. [28 C.F.R. § 35.151(b)(4)(v)]

Safe Harbor

The 2010 ADA Standards for Accessible Design use the terms incremental change and supplemental change. Incremental changes are those elements that were requirements under the 1991 standards but were changed in some way under the 2010 standards. Supplemental changes are those regulations or regulatory areas that were not included in the 1991 standards, but are included in the 2010 standards.

“Safe harbor” is the term used in the 2010 ADA Standards to describe situations where the 2010 incremental changes to the ADA regulations are not required if alterations to the building or facility are not made. Specifically, “safe harbor” applies to a path of travel. “A ‘path of travel’ includes a continuous, unobstructed way of pedestrian passage by means of which the altered area may be approached, entered, and exited, and which connects the altered area with an exterior approach (including sidewalks, streets, and parking areas), an entrance to the facility and other parts of the facility. “[28 C.F.R. § 35.151(b)(4)(ii)] “An accessible path of travel may consist of walks and sidewalks, curb ramps and other interior or exterior pedestrian ramps; clear floor paths through lobbies, corridors, rooms, and other improved areas; parking access aisles; elevators and lifts; or a combination of these elements. For the purposes of the section the term ‘path of travel’ also includes the restrooms, telephones and drinking fountains serving the altered area.” [28 C.F.R. § 35.151(b)(4)(ii)(B)]

Safe harbor applies only if a building or facility built after July 26, 1992 was compliant with the 1991 standards prior to the enforceable date of the 2010 regulations of March 15, 2012. "Safe harbor" is granted to facilities or buildings if the facilities are fully in compliance with the 1991 standards prior to March 15, 2012. However, if alterations are made after March 15, 2012, the alteration of the building or facility must fully comply with the 2010 standards, and any other portions of the existing building or facility that are substantially affected by the alteration in terms of their use, must also comply with the 2010 standards. "Safe harbor" does not apply to areas of supplemental change. For instance, the 2010 standards include regulations for exercise equipment or exercise areas, play areas, recreational boating, mini-golf, swimming pools, bowling, and court sports, but those regulations are not governed by "safe harbor." Other supplemental changes not enumerated here are also not covered by "safe harbor". [28 C.F.R. § 35.151(b)(4)(ii)(c)]

For example, one of the regulated areas where "safe harbor" makes an impact is in a single occupant restroom. The 2010 ADA Standards for Accessible Design require a clear floor space next to the water closet, while the 1991 ADAAG allows the lavatory to overlap the clear space. The intent of the new provisions is to allow space for a side transfer to the water closet. The 2010 ADA Standards allow the door to swing into the bathroom as long as there is a clear floor space past the swing of the door, so that a person can enter the room, shut the door, and then maneuver. The 1991 ADAAG does not allow the door swing and the clear floor space to overlap for any of the fixtures. While the 2010 standards do not allow clear space overlap in multi-stall bathrooms, overlap is allowed in single occupant bathrooms.

Undue Burden

A public entity must operate each service, program, or activity so that when viewed in its entirety, the service, program, or activity is readily accessible to and usable by individuals with disabilities. This does not necessarily require the public entity to make each of its facilities accessible to and usable by individuals with disabilities. Additionally, a public entity is not required to take any action that would threaten or destroy the historical significance of an historic property.

If the state or local government agency can demonstrate that an action would result in a fundamental alteration in the nature of a service, program, or activity or in undue financial and administrative burdens, then the decision must be made in a written statement describing the reason for the conclusion, and the decision must be made by the head of the government agency, or his or her designee after considering all resources available for use in the funding and operation of the service, program, or activity. The public entity has the burden of proof that compliance with 28 C.F.R. § 35.151 would result in such alterations or burdens.

If an action would result in a fundamental alteration of the service, program, or activity, or in undue financial and administrative burdens, the Title II entity shall take any other action to ensure that individuals with disabilities receive the benefits or services provided by the state or local government agency.

Self-Evaluation Requirements

A Self-Evaluation is a governmental organizations' evaluation of its current services, policies and practices, and all physical facilities. The Self Evaluation comprises three components: 1. Data gather/assessments/internal reviews, etc., 2. The Transition Plan, and 3. Action to make necessary modifications. A government entity is required to conduct a Self-Evaluation within one year of the effective date of 28 C.F.R. § 35.105, the effective date being March 15, 2011. All governments were required to complete a Self-Evaluation of their facilities, programs, policies, and practices by January 26, 1993. The evaluation required by March 15, 2012 is required to cover any and all areas that were not covered under the previous Self-Evaluation, including any programs or facilities that were altered since the previous Self-Evaluation. If a previous self-evaluation was not conducted, then the Self-Evaluation required by March 15, 2012 must include all facilities, services, policies, and practices.

Commented [MJ1]: You use (1) in the other sections, so use the same pattern here for numbering the items.

The Self-Evaluation identifies and corrects those policies and practices that are inconsistent with Title II's requirements. Self-Evaluations should consider all of a local government's programs, activities, and services, as well as the policies and practices that a governmental agency has put in place to implement its various programs and services. Remedial measures necessary to bring the programs, policies, and services into compliance with Title II should be specified -- including, but not limited to: (1) relocation of programs to accessible facilities; (2) offering programs in an alternative accessible manner; (3) structural changes to provide program access; (4) policy modifications to ensure nondiscrimination; and (5) auxiliary aids needed to provide effective communication. [28 C.F.R. §§ 35.105, 35.150(d)] The Self-Evaluation process identifies those policies and practices that are inconsistent with the requirements of Title II of the ADA. As part of the Self-Evaluation, the governmental agency is required to:

- A. Identify all programs, activities, and services.
- B. Review all the policies and practices that govern the administration of the governmental agency's programs, activities, and services.
- C. Examine each program to determine whether any physical barriers to access exist, including whether individuals with mobility impairments are provided access to public meetings.
- D. Review its policies and practices to determine whether any have the effect of excluding or limiting the participation of individuals with disabilities in the governmental agency's programs, activities, or services. The Self-Evaluation should provide justification for any agency policy that creates a barrier for people with disabilities that will not be modified.
- E. Review its policies to assess whether communications with persons with disabilities are as effective as communication with others.
- F. Review its policies for responding to requests for accommodations to ensure such requests are responded to expeditiously.
- G. Review its employment practices to assess whether they comply with other applicable nondiscrimination requirements, including Section 504 of the Rehabilitation Act and the ADA regulations issued by the Department of Justice.
- H. Review its building and construction policies to assess whether construction of each new facility or part of a facility, or alteration of existing facilities, conforms to the standards designated under the Title II regulations.
- I. Provide the opportunity to interested persons, including individuals with disabilities or organizations representing individuals with disabilities, to participate in the Self-Evaluation process by submitting comments.

In addition, a public entity that employs 50 or more persons shall for at least three years following completion of the Self-Evaluation maintain on file and make available for public inspection: (1) a list of the interested persons consulted; (2) a description of areas examined and any problems identified, and (3) a description of any modification made.

Transition Plan Requirements

If a state or local government that employs 50 or more persons decides to make structural changes to achieve program access, it must develop a transition plan that identifies those changes and sets a schedule for implementing them. Transition plans must be available to the public.

28 C.F.R. §35.150 (d) Transition plan: (1) In the event that structural changes to facilities will be undertaken to achieve program accessibility, a public entity that employs 50 or more persons shall develop, within six months of the effective date of this part, a transition plan setting forth the steps necessary to complete such changes. A public entity shall provide an opportunity to interested persons, including individuals with disabilities or organizations representing individuals with disabilities, to participate in the development of the transition plan by submitting comments. A copy of the transition plan shall be made available for public inspection.

(2) If a public entity has responsibility or authority over streets, roads, or walkways, its transition plan shall include a schedule for providing curb ramps or other sloped areas where pedestrian walks cross curbs, giving priority to walkways serving entities covered by the Act, including State and local government offices and facilities, transportation, places of public accommodation, and employers, followed by walkways serving other areas.

(3) The plan shall, at a minimum -

(i) Identify physical obstacles in the public entity's facilities that limit the accessibility of its programs or activities to individuals with disabilities.

(ii) Describe in detail the methods that will be used to make the facilities accessible.

(iii) Specify the schedule for taking the steps necessary to achieve compliance with this section and, if the time period of the transition plan is longer than one year, identify steps that will be taken during each year of the transition period; and

(iv) Indicate the official responsible for implementation of the plan.

28 CFR §35.151(b)(4) path of travel requirements apply only to alterations undertaken solely for purposes other than to meet program accessibility requirements of 28 CFR §35.150 provides additional guidance regarding the duty to provide accessible features in the event of disproportionality of the cost to make corrections to barriers with the overall project costs. In the event of disproportionality, 28 CFR §35.151 (b)

(4) Path of Travel (iv) states that when the cost of alterations necessary to make the path of travel to the altered area fully accessible is disproportionate to the cost of the overall alteration, the path of travel shall be made accessible to the extent that it can be made accessible without incurring disproportionate costs. Additional guidance supplied in relation to choosing which accessible elements to provide, priority should be given to those elements that will provide the greatest access, in the following order—

Priority 1: An accessible entrance

Priority 2: An accessible route to the altered area

Priority 3: At least one accessible restroom for each sex or a single unisex restroom

Priority 4: Accessible telephones

Priority 5: Accessible drinking fountains

Priority 6: When possible, additional accessible elements such as parking, storage, and alarms

These priorities are provided for guidance only. The individual Title II entity can develop its own priorities to provide reasonable accommodation.

Commented [MJ2]: This looks strangely formatted – is it from an ADA document?

TITLE II ADA COORDINATOR ROLE IN STATE AND LOCAL GOVERNMENT

ADA Coordinator's Role

Title II of the ADA requires all state or local government entities with 50 or more employees to appoint a responsible person to coordinate the administrative requirements of ADA compliance, and to respond to complaints filed by the public. The name and contact information for the responsible person is required to be publicly advertised. The ADA coordinator can be either a single individual or an office of the ADA Coordinator with more than one staff member, however the Title II requirements dictate that one individual's name be publicized.

[28 C.F.R. § 35.107]: *A Title II entity with more than 50 employees must designate an ADA Coordinator who coordinates agency efforts to comply with and carry out the responsibilities of the ADA. The coordinator provides a single point of contact for members of the public about ADA and the agency. To ensure that individuals can easily identify the ADA Coordinator, the governmental agency must provide the ADA Coordinator's name, office address, and telephone number to all interested individuals.*

The ADA Coordinator facilitates compliance with the ADA and provides expertise regarding the American Disability Act and ADA Standards. The ADA coordinator receives and investigates complaints related to discrimination based on disability.

Under 28 C.F.R. § 35.107, a grievance procedure is required for public entities of 50 or more employees. Title II entities are required to adopt and publish grievance procedures providing for prompt and equitable resolution of complaints alleging any action that would be prohibited by 28 C.F.R. § 35.

The drafters of the ADA modeled this position after the 504 Coordinator that had been required under the Rehabilitation Act. Title II of the ADA stipulates five major administrative duties:

1. Publicize the name and contact information of the designated ADA Coordinator responsible to oversee compliance.
2. Administer and write self-evaluation of the programmatic barriers in services offered by the state or local government.
3. Establish a complaint or grievance procedure to respond to complaints of noncompliance from the public.
4. Develop a transition plan if structural changes are necessary for achieving program accessibility; and
5. Retain the self-evaluation for three years.

While additional duties of an ADA Coordinator are not defined by law, the usual duties would require the attention of an experienced professional who can effectively handle a variety of responsibilities. The ADA coordinator should have a general understanding of the ADA and the legal requirements of the ADA. Duties most often include coordination and development of ongoing efforts for full ADA compliance, including administering ADA consultative services to agency/department management.

Other tasks may include:

- Involvement in agency/department public outreach
- Developing processes for fulfillment of public requests for alternative formats, interpreting services and other communication access needs
- Coordinating and monitoring programmatic and physical barrier surveys and barrier removal
- Development of the required Transition Plan to remove accessibility barriers

- Assistance to the agency/department to facilitate policy formation and to review existing policies, such as reasonable accommodation for employees.
- Establishing training programs for employees, including conducting training.

The following guidance information can be found on the Department of Justice website www.ada.gov.

ADA Best Practices Tool Kit for State and Local Governments- Chapter 2 – ADA Coordinator, Notice and Grievance Procedure: Administrative Requirements under Title II of the ADA

In this section, you will learn about the administrative requirements of Title II of the ADA, including the mandates to designate an ADA coordinator, give notice about the ADA's requirements, and establish a grievance procedure. Questions answered include:

- If the local government has fewer than 50 employees, do different requirements apply?
- What are the responsibilities of an ADA Coordinator?
- What are the benefits of having an ADA Coordinator?
- What are the requirements for providing notice of the ADA's provisions?
- How and where must you provide ADA notices?
- What is a grievance procedure?
- What must an ADA grievance procedure include?

A. Designating an ADA Coordinator

If a public entity has 50 or more employees, it is required to designate at least one responsible employee to coordinate ADA compliance. ¹ A government entity may elect to have more than one ADA Coordinator. Although the law does not refer to this person as an "ADA Coordinator," this term is commonly used in state and local governments across the country and will be used in this chapter.

The ADA Coordinator is responsible for coordinating the efforts of the government entity to comply with Title II and investigating any complaints that the entity has violated Title II. The name, office address, and telephone number of the ADA Coordinator must be provided to interested persons.

Common Question: Which employees count?

If a local government or other public entity has fewer than 50 employees, it is not required to appoint an ADA Coordinator or establish grievance procedures.

The number of employees is based on a government-wide total, including employees of each department, division, or another sub-unit. Both part-time and full-time employees count. Contractors are not counted as employees for determining the number of employees.

For example: Jones City has 30 full-time employees and 20 part-time employees. The employees include ten police department employees and eight fire department employees.

Jones City must have an ADA Coordinator and an ADA grievance procedure. The total number of employees is 50 because both full-time and part-time employees are counted. In addition, the police and fire departments are part

of the city-wide employment pool, and the requirements for an ADA Coordinator and an ADA grievance procedure cover both of those departments.

¹ Department of Justice Nondiscrimination on the Basis of State and Local Government Services Regulations, 28 C.F.R. pt. 35, §35.107(a) (2005). See www.ada.gov/reg2.htm for the complete text of the Department of Justice's Title II regulation.

Benefits of an ADA Coordinator

There are many benefits to having a knowledgeable ADA coordinator, even for smaller public entities that are not required to have one.

For members of the public, having an ADA Coordinator makes it easy to identify someone to help them with questions and concerns about disability discrimination. For example, the ADA Coordinator is often the main contact when someone wishes to request an auxiliary aid or service for effective communication, such as a sign language interpreter or documents in Braille. A knowledgeable ADA Coordinator will be able to efficiently assist people with disabilities with their questions. She or he will also be responsible for investigating complaints.

Having an ADA Coordinator also benefits state and local government entities. It provides a specific contact person with knowledge and information about the ADA so that questions by staff can be answered efficiently and consistently. In addition, she or he coordinates compliance measures and can be instrumental in ensuring that compliance plans move forward. With the help of this Tool Kit, ADA Coordinators can take the lead in auditing the state or local government's programs, policies, activities, services, and facilities for ADA compliance.

An Effective ADA Coordinator

The regulations require state and local governments with 50 or more employees to designate an employee responsible for coordinating compliance with ADA requirements. Here are some of the qualifications that help an ADA Coordinator to be effective:

- familiarity with the state or local government's structure, activities, and employees
- knowledge of the ADA and other laws addressing the rights of people with disabilities, such as Section 504 of the Rehabilitation Act, 29 U.S.C. § 794
- experience with people with a broad range of disabilities
- knowledge of various alternative formats and alternative technologies that enable people with disabilities to communicate, participate, and perform tasks
- ability to work cooperatively with the local government and people with disabilities
- familiarity with any local disability advocacy groups or other disability groups
- skills and training in negotiation and mediation
- organizational and analytical skills

B. Notice of the ADA's Provisions

The second administrative requirement is providing public notice about the ADA.² There are three main considerations for providing notice:

1. Who is the target audience for the ADA notice?
2. What information shall the notice include?
3. Where and how should the notice be provided?

Regardless of Size, the ADA Notice Requirement Applies

The ADA notice requirement applies to ALL state and local governments covered by title II, even localities with fewer than 50 employees.

² 28 C.F.R § 35.106.

1. Who is the target audience for the ADA notice?

The target audience for public notice includes applicants, beneficiaries, and other people interested in the state or local government's programs, activities, or services. **The audience is expansive, and includes everyone who interacts – or would potentially interact – with the state or local government.**

Examples of the Target Audience for the ADA Notice

- a recipient of social services, food stamps, or financial assistance provided by the state or local government
- an applicant for a public library card
- a public transit user
- a person who uses the county recreation center
- a grandmother attending her grandchild's high school graduation in a city park
- a member of a citizen's advisory committee
- a recipient of a grant from the state or local government
- a citizen who wants to participate in a town council meeting
- a person adopting a dog from the local public animal shelter

2. What information shall the notice include?

The notice is required to include relevant information regarding Title II of the ADA, and how it applies to the programs, services, and activities of the public entity.

The notice should not be overwhelming. **An effective notice states the basics of what the ADA requires of the state or local government without being too lengthy, legalistic, or complicated. It should include the name and contact information of the ADA Coordinator.**

This chapter contains a model "Notice Under the Americans with Disabilities Act" created by the Department of Justice. It is a one-page document in a standard font, and includes brief statements about:

- employment,
- effective communication,
- making reasonable modifications to policies and programs,
- not placing surcharges on modifications or auxiliary aids and services, and
- filing complaints.

The model notice is included at the end of this chapter.

3. How and where should the notice be provided?

It is the obligation of the head of the public entity to determine the most effective way of providing notice to the public about their rights and the public entity's responsibilities under the ADA.

Publishing and publicizing the ADA notice is not a one-time requirement. State and local governments should provide the information on an ongoing basis, whenever necessary. If you use the radio, newspaper, television,

or mailings, re-publish and re-broadcast the notice period.

Some Ways to Provide Notice to Interested Persons

- Include the notice with **job applications**
- Publish the notice periodically in **local newspapers**
- Broadcast the notice in public service announcements on **local radio and television stations**
- Publish the notice on the government entity's **website** (ensure that the website is accessible)
- Post the notice **at all facilities**
- Include the notice in **program handbooks**
- Include the notice in **activity schedules**
- Announce the notice at **meetings** of programs, services, and activities
- Publish the notice as a **legal notice** in local newspapers
- Post the notice in bus shelters or other **public transit stops**

The information must be presented so that it is accessible to all. Therefore, it must be available in alternative formats.

Examples of Alternative Formats

- Audio tape or other recordings
- Radio announcements
- Large print notice
- Braille notice
- Use of a qualified sign language interpreter at meetings
- Open or closed-captioned public service announcements on television
- ASCII, HTML, or word processing format on a computer diskette or CD
- HTML format on an accessible website
- Advertisements in publications with large print versions

C. Establishing and Publishing Grievance Procedures

Local governments with 50 or more employees are required to adopt and publish procedures for resolving grievances arising under Title II of the ADA.³ Grievance procedures set out a system for resolving complaints of disability discrimination in a prompt and fair manner.

Neither Title II nor its implementing regulations describe what ADA grievance procedures must include. However, the Department of Justice has developed a model grievance procedure that is included at the end of this chapter.

The grievance procedure should include:

- a description of how and where a complaint under Title II may be filed with the government entity.
- if a written complaint is required, a statement notifying potential complainants that alternative means of filing will be available to people with disabilities who require such an alternative.
- A description of the time frames and processes to be followed by the complainant and the government entity.
- Information on how to appeal an adverse decision.
- A statement of how long complaint files will be retained.

Once a state or local government establishes a grievance procedure under the ADA, it should be distributed to all agency heads. Post copies in public spaces of public building and on the government's website. Update the procedure and the contact information, as necessary. In addition, the procedure must be available in alternative formats so that it is accessible to all people with disabilities.

³ 28 C.F.R. § 35.107(b).

Common Question: Complaint Filing

If a person with a disability has a complaint about a public entity, is she or he required to file a complaint with the public entity before filing a complaint with the federal government?

No, the law does not require people who want to file an ADA complaint against a public entity with the federal government to file a complaint with the public entity first. However, it is often more efficient to resolve local problems at a local level.

D. Summing up: ADA Coordinator, Notice, and Grievance Procedures

If a state or local government has fewer than 50 employees, it is required to:

- adopt and distribute a public notice about the relevant provisions of the ADA to all people who may be interested in its programs, activities, and services.

If a state or local government has 50 employees or more, it is required to:

- Adopt and distribute a public notice about the relevant provisions of the ADA to all persons who may be interested in its programs, activities, and services.
- Designate at least one employee responsible for coordinating compliance with the ADA and investigating ADA complaints.
- Develop and publish grievance procedures to provide fair and prompt resolution of complaints under Title II of the ADA at the local level.

These administrative requirements help ensure that the needs of people with disabilities are addressed in the programs, activities, and services operated by a public entity. Having these requirements in place will not prevent all problems, but it will help you to address many questions and problems efficiently.

Notice Under the Americans with Disabilities Act

In accordance with the requirements of title II of the Americans with Disabilities Act of 1990 ("ADA"), the **[name of public entity]** will not discriminate against qualified individuals with disabilities on the basis of disability in its services, programs, or activities.

Employment: **[name of public entity]** does not discriminate on the basis of disability in its hiring or employment practices and complies with all regulations promulgated by the U.S. Equal Employment Opportunity Commission under title I of the ADA.

Effective Communication: **[Name of public entity]** will generally, upon request, provide appropriate aids and services leading to effective communication for qualified persons with disabilities so they can participate equally in **[name of public entity's]** programs, services, and activities, including qualified sign language interpreters, documents in Braille, and other ways of making information and communications accessible to people who have speech, hearing, or vision impairments.

Modifications to Policies and Procedures: **[Name of public entity]** will make all reasonable modifications to policies and programs to ensure that people with disabilities have an equal opportunity to enjoy all of its programs,

services, and activities. For example, individuals with service animals are welcomed in **[name of public entity]** offices, even where pets are generally prohibited.

Anyone who requires an auxiliary aid or service for effective communication, or a modification of policies or procedures to participate in a program, service, or activity of **[name of public entity]**, should contact the office of **[name and contact information for ADA Coordinator]** as soon as possible but no later than 48 hours before the scheduled event.

The ADA does not require the **[name of public entity]** to take any action that would fundamentally alter the nature of its programs or services or impose an undue financial or administrative burden.

Complaints that a program, service, or activity of **[name of public entity]** is not accessible to persons with disabilities should be directed to **[name and contact information for ADA Coordinator]**.

[Name of public entity] will not place a surcharge on a particular individual with a disability or any group of individuals with disabilities to cover the cost of providing auxiliary aids/services or reasonable modifications of policy, such as retrieving items from locations that are open to the public but are not accessible to persons who use wheelchairs.

**[Name of public entity]
Grievance Procedure under
The Americans with Disabilities Act**

This Grievance Procedure is established to meet the requirements of the Americans with Disabilities Act of 1990 ("ADA"). It may be used by anyone who wishes to file a complaint alleging discrimination on the basis of disability in the provision of services, activities, programs, or benefits by the **[name of public entity]**. The **[e.g. State, City, County, Town]**'s Personnel Policy governs employment-related complaints of disability discrimination.

The complaint should be in writing and contain information about the alleged discrimination such as name, address, phone number of complainant and location, date, and description of the problem. Alternative means of filing complaints, such as personal interviews or a tape recording of the complaint, will be made available for persons with disabilities upon request.

The complaint should be submitted by the grievant and/or his/her designee as soon as possible but no later than 60 calendar days after the alleged violation to:

**[Insert ADA Coordinator's name]
ADA Coordinator [and other title if appropriate]
[Insert ADA Coordinator's mailing address]**

Within 15 calendar days after receipt of the complaint, **[ADA Coordinator's name]** or **[his/her]** designee will meet with the complainant to discuss the complaint and the possible resolutions. Within 15 calendar days of the meeting, **[ADA Coordinator's name]** or **[his/her]** designee will respond in writing, and where appropriate, in a format accessible to the complainant, such as large print, Braille, or audio tape. The response will explain the position of the **[name of public entity]** and offer options for substantive resolution of the complaint.

If the response by **[ADA Coordinator's name]** or **[his/her]** designee does not satisfactorily resolve the issue, the complainant and/or his/her designee may appeal the decision within 15 calendar days after receipt of the response to the **[City Manager/County Commissioner/ other appropriate high-level official]** or **[his/her]** designee.

Within 15 calendar days after receipt of the appeal, the **[City Manager/County Commissioner/ other appropriate high-level official]** or **[his/her]** designee will meet with the complainant to discuss the complaint and possible resolutions. Within 15 calendar days after the meeting, the **[City Manager/County Commissioner/**

other appropriate high-level official] or **[his/her]** designee will respond in writing, and, where appropriate, in a format accessible to the complainant, with a final resolution of the complaint.

All written complaints received by **[name of ADA Coordinator]** or **[his/her]** designee, appeals to the **[City Manager/County Commissioner/ other appropriate high-level official]** or **[his/her]** designee, and responses from these two offices will be retained by the **[public entity]** for at least three years.

ADA Update: A Primer for State and Local Governments (2015)

Downloaded from DOJ website https://www.ada.gov/regs2010/titleII_2010/title_ii_primer.html

ADA Coordinator, Grievance Procedure, Self-Evaluations, and Transition Plans

Public entities that have 50 or more employees are required to have a grievance procedure and to designate at least one responsible employee to coordinate ADA compliance. Although the law does not require the use of the term "ADA Coordinator," it is commonly used by state and local governments across the country. The ADA Coordinator's role is to coordinate the government entity's efforts to comply with the ADA and investigate any complaints that the entity has violated the ADA. The Coordinator serves as the point of contact for individuals with disabilities to request auxiliary aids and services, policy modifications, and other accommodations or to file a complaint with the entity; for the general public to address ADA concerns; and often for other departments and employees of the public entity. The name, office address, and telephone number of the ADA Coordinator must be provided to all interested persons.

ADA BEST PRACTICES TOOL KIT FOR STATE AND LOCAL GOVERNMENTS

Downloaded from DOJ webpage: <https://www.ada.gov/pcatoolkit/toolkitmain.htm>

On December 5, 2006, February 27, 2007, May 7, 2007, and July 26, 2007, the Civil Rights Division of the U.S. Department of Justice issued installments of a new technical assistance document designed to assist state and local officials to improve compliance with Title II of the Americans with Disabilities Act (ADA) in their programs, services, activities, and facilities, entitled "The ADA Best Practices Tool Kit for State and Local Governments."

The Tool Kit is designed to teach state and local government officials how to identify and fix problems that prevent people with disabilities from gaining equal access to state and local government programs, services, and activities. It will also teach state and local officials how to conduct accessibility surveys of their buildings and facilities to identify and remove architectural barriers to access.

The first and second installments of the ADA Tool Kit, issued December 5, 2006, include:

About This Tool Kit (HTML) | (PDF)

Chapter 1, ADA Basics: Statutes and Regulations (HTML) | (PDF)

Chapter 2, ADA Coordinator: Notice and Grievance Procedure (HTML) | (PDF)

Chapter 2, Addendum: Title II Checklist (HTML) |

The third and fourth installments, issued February 27, 2007, include:

Chapter 3, General Effective Communication Requirements Under Title II of the ADA (HTML) | (PDF)

Chapter 3, Addendum: Title II Checklist (HTML) | (PDF)

Chapter 4, 9-1-1 and Emergency Communications Services (HTML) | (PDF)

Chapter 4, Addendum: Title II Checklist (HTML) | (PDF)

The fifth and sixth installments, issued May 7, 2007, include:

Chapter 5, Website Accessibility Under Title II of the ADA (HTML) | (PDF)

Chapter 5, Addendum: Title II Checklist (HTML) | (PDF)

Chapter 6, Curb Ramps and Pedestrian Crossings (HTML) | (PDF)

Chapter 6, Addendum: Title II Checklist (HTML) | (PDF)

Appendix 1, Survey Instructions: Curb Ramps (HTML) | (PDF)

Appendix 2, Survey Forms: Curb Ramps (HTML) | (PDF)

The seventh installment of the Tool Kit, issued July 26, 2007, includes:

[Chapter 7, Emergency Management under Title II of the ADA \(HTML\)](#) | [\(PDF\)](#)

[Chapter 7, Addendum 1: Title II Checklist \(Emergency Management\) \(HTML\)](#) | [\(PDF\)](#)

[Chapter 7, Addendum 2: The ADA and Emergency Shelters: Access for All in Emergencies and Disasters \(HTML\)](#) | [\(PDF\)](#)

[Chapter 7, Addendum 3: ADA Checklist for Emergency Shelters \(HTML\)](#) | [\(PDF\)](#)

[Introduction to Appendices 1 and 2 \(HTML\)](#) | [\(PDF\)](#)

While state and local governments are not required to use the ADA Best Practices Tool Kit, the Department encourages its use as one effective means of complying with the requirements of Title II of the ADA.



Questions and Answers on the Application of the ADA's Integration Mandate and *Olmstead v. L.C.* to Employment and Day Services for People with Disabilities

Nationally, a significant number of individuals with disabilities spend the majority of their daytime hours receiving public services in sheltered workshops and facility-based day programs. These settings segregate individuals from the community and provide little or no opportunity to interact with people without disabilities, other than paid staff.

The work of individuals with disabilities in segregated settings is often highly regimented and typically offers no opportunity for advancement. In many sheltered workshops, for example, people with disabilities perform highly repetitive, manual tasks, such as folding, sorting, and bagging, in shared spaces occupied only by other people with disabilities. They also often earn extremely low wages when compared to people with disabilities in integrated employment, resulting in stigmatization and a lack of economic independence. As long as individuals with disabilities who can and want to work remain in segregated work or day settings, they will be deprived of an important opportunity to interact with the community and the community will be deprived of their talents, skills, and contributions.

When people with disabilities are instead given access to supported employment services in the most integrated setting appropriate to their needs, they have the opportunity to live fuller lives, be more integrated into the community, and gain financial independence to "move proudly into the economic mainstream of American life."¹ These opportunities fulfill the core promises of the Americans with Disabilities Act to "assure equality of opportunity, full participation, independent living, and economic self-sufficiency."²

State and local governments that fail to provide services to people with disabilities in the most integrated setting appropriate to their needs may be failing to

¹ President George H.W. Bush, Remarks at the Signing of the Americans with Disabilities Act (July 26, 1990), <https://perma.cc/VNU4-HR7P>.

² 42 U.S.C. § 12101(a)(7).



comply with Title II of the Americans with Disabilities Act (ADA). The U.S. Department of Justice (the Department) has created this guidance to discuss and explain the requirements of the ADA's integration mandate and the Supreme Court's decision in *Olmstead v. L.C. ex rel. Zimring*, 527 U.S. 581 (1999), as applied to segregated employment settings and facility-based day programs.

This guidance complements and supplements, but does not supersede, the Department's 2011 *Olmstead* guidance, Statement of the Department of Justice on Enforcement of the Integration Mandate of Title II of the Americans with Disabilities Act and *Olmstead v. L.C.*

The ADA and Its Integration Mandate

In 1990, Congress enacted the ADA "to provide a clear and comprehensive national mandate for the elimination of discrimination against individuals with disabilities."³ In passing the ADA, Congress recognized that "historically, society has tended to isolate and segregate individuals with disabilities, and, despite some improvements, such forms of discrimination against individuals with disabilities continue to be a serious and pervasive social problem."⁴ Title II of the ADA prohibits public entities from discriminating against individuals with disabilities in the provision of public services.⁵ The Department's implementing regulation requires public entities to "administer services, programs, and activities in the most integrated setting appropriate to the needs of qualified individuals with disabilities."⁶ The Department has consistently interpreted "the most integrated setting appropriate" to mean one that "enables individuals with disabilities to interact with nondisabled persons to the fullest extent possible"⁷

In *Olmstead v. L.C.*, 527 U.S. 581 (1999), the Supreme Court, interpreting the ADA's integration mandate, held that Title II prohibits the unjustified segregation of individuals with disabilities. The Supreme Court held that public entities are required to provide community-based services to persons with disabilities when (a) such services are

³ *Id.* § 12101(b)(1).

⁴ *Id.* § 12101(a)(2).

⁵ *Id.* § 12132.

⁶ 28 C.F.R. § 35.130(d) (the "integration mandate").

⁷ Guidance on ADA Regulation on Nondiscrimination on the Basis of Disability in State and Local Government Services, 28 C.F.R. pt. 35, app. B (addressing 28 C.F.R. § 35.130).



appropriate; (b) the affected persons do not oppose community-based treatment; and (c) community-based services can be reasonably accommodated, taking into account the resources available to the entity and the needs of others who receive disability services from the entity.⁸

To comply with the ADA's integration mandate, public entities must make reasonable modifications to their policies, practices, or procedures when necessary to avoid discrimination on the basis of disability.⁹ The obligation to make reasonable modifications is not unlimited. A public entity is not required to make requested modifications if it can demonstrate that making the modifications would "fundamentally alter" the nature of the service, program, or activity.¹⁰

State and Local Employment and Day Services

Most states offer publicly-funded employment and day programs for eligible individuals with disabilities. These programs may include services that are available through multiple state agencies and funding streams, including vocational rehabilitation, Medicaid, and education agencies. They may be provided in a range of settings, including sheltered workshops, small group or enclave employment, facility-based day programs like day habilitation, day treatment, or adult day centers, or typical integrated workplaces. Supported employment services are provided in mainstream workplaces typical for employees without disabilities. Integrated day services are characterized by going out into the community and engaging in activities alongside people without disabilities.

- "Sheltered workshops" are segregated facilities that primarily or exclusively employ people with disabilities. Sheltered workshops are usually large, institutional facilities in which people with disabilities have little or no contact with non-disabled people besides paid staff. Often wages in sheltered workshops are extremely low compared to wages paid to people with disabilities in integrated employment, resulting in stigmatization and a lack of economic

⁸ *Olmstead v. L.C.*, 527 U.S. 581, 607 (1999).

⁹ 28 C.F.R. § 35.130(b)(7)(i).

¹⁰ *Id.*; see also *Olmstead*, 527 U.S. at 604–07.



Independence. Sometimes these workshops pay wages well below the minimum wage.¹¹

- “Small group” or “enclave” employment refers to work performed in regular business, industry, and community settings by small groups of individuals with disabilities (typically two to eight) under the supervision of an instructor or service provider.
- “Facility-based day programs” are programs in which people with disabilities participate in segregated non-work activities during the day, designed to habilitate or rehabilitate individuals with disabilities. They can include psychosocial rehabilitation programs that serve people with mental illness.
- “Supported employment services” allow people with disabilities to work in typical employment settings where they can interact with non-disabled coworkers, customers, and peers. Such services include job coaching, job training, vocational assessment, job discovery,¹² person-centered employment planning, job development, negotiation with prospective employers, benefits counseling, and other services that enable people with disabilities to succeed in securing and maintaining employment. These services help individuals with disabilities find meaningful jobs in the community and receive ongoing support from a team of professionals.
- “Integrated day services” are not facility-based and allow people with disabilities to engage in community activities of their choosing where they interact with

¹¹ See, e.g., Nat’l Council on Disability, National Disability Employment Policy: From the New Deal to the Real Deal 12 (2018), <https://perma.cc/5LXH-2CPA> (observing that “. . . there remain approximately 321,131 Americans with disabilities who, even while living in the community, still earn subminimum wages in segregated sheltered workshops under Section 14(c) of the Fair Labor Standards Act . . .”).

¹² Job discovery is a process that assists job seekers in identifying employment that would be a good fit for them and an employer. LEAD Center, Implementing Customized Employment, Guided Group Discovery and Self-Guided Discovery in a Variety of Settings and With a Variety of Partners 5 (2019), <https://perma.cc/Y6PW-SUVQ>.



U.S. Department of Justice
Civil Rights Division

people without disabilities. Such services provide access to mainstream social, educational, recreational, cultural, or other activities.

1. Does the ADA’s Title II integration mandate apply to public employment and day services?¹³

Yes. Title II of the ADA covers all services, programs, and activities of state and local government entities.¹⁴ A public entity may violate the ADA’s integration mandate when it plans, administers, operates, funds, or implements any services—including employment or day services—in a way that unjustifiably segregates individuals with disabilities.¹⁵

2. What is the most integrated setting under the ADA and *Olmstead* in the context of public employment and day services?

The Department has consistently interpreted “the most integrated employment setting appropriate” to mean one that “enables individuals with disabilities to interact with non-disabled people to the fullest extent possible . . .”¹⁶

Supported employment services allow people with disabilities to work in typical jobs in the community like individuals without disabilities. In typical employment settings, individuals with disabilities work on a full- or part-time basis, at or above minimum wage, at locations where they interact with individuals without disabilities, with access to the same opportunities for benefits and advancement that are provided to non-disabled workers. Such settings are commonly referred to as competitive integrated employment settings. Similarly, integrated day services support community engagement by allowing individuals to engage in self-directed activities of their

¹³ This guidance addresses state and local governments’ obligations under Title II of the ADA. Title I of the ADA covers public and private employers’ nondiscrimination obligations toward their own employees with disabilities. Title III of the ADA covers nondiscrimination obligations relating to public accommodations, including those of private providers of goods and services to people with disabilities.

¹⁴ 42 U.S.C. § 12132.

¹⁵ *Cf. Fry v. Napoleon Cmty. Schs.*, 580 U.S. 154, 169–70 (2017) (educational services are covered by Title II of the ADA).

¹⁶ Guidance on ADA Regulation on Nondiscrimination on the Basis of Disability in State and Local Government Services, 28 C.F.R. pt. 35, app. B; *cf. Olmstead*, 527 U.S. at 592.



choosing in the community, including mainstream recreational, social, educational, cultural, and athletic activities, or other pastimes that offer meaningful opportunities for learning, expanding skills, and developing relationships critical to employment and independent living.¹⁷ By contrast, in segregated employment settings, people with disabilities have little or no contact with non-disabled people besides paid supervisory staff.

Being fully integrated in a workplace means an individual has an opportunity to interact regularly and consistently with their non-disabled peers to the same extent as their non-disabled coworkers. Consistent with Title I of the ADA, an employee with disabilities should be treated similarly to employees without disabilities and participate equally in the customary benefits of the workplace. For example, individuals with disabilities should be compensated equally to their non-disabled peers performing the same work.¹⁸ They should have the same opportunities as their non-disabled peers, including opportunities for promotion and advancement; opportunities for privacy,

¹⁷ See U.S. Dep't of Educ., Off. Of Special Educ. And Rehab. Servs., et al., [A Framework for Community Engagement A Pathway to Competitive Integrated Employment](https://perma.cc/BZ6K-QRG7) (Aug. 3, 2022), <https://perma.cc/BZ6K-QRG7>.

¹⁸ Providing compensation and benefits to people with disabilities in an employment setting that are not equal to those offered to peers without disabilities performing the same job may also violate Title I or Title III of the ADA or other federal laws. Individual service provider entities, including sheltered workshops, have obligations not to discriminate against individuals with disabilities. Title I of the ADA covers employers with 15 or more employees. As such, Title I's coverage can include individual service provider entities or sheltered workshops in their capacity as private employers. Title I prohibits employers from discriminating on the basis of disability in job application procedures, hiring, firing, advancement, compensation, job training, and other terms, conditions, and privileges of employment and requires reasonable accommodations. 42 U.S.C. § 12112(a). Also, under Title III of the ADA, individuals with disabilities cannot be discriminated against on the basis of disability in the "full and equal enjoyment of the goods, services, facilities, privileges, advantages, or accommodations of any place of public accommodation by any person who owns, leases (or leases to), or operates a place of public accommodation." 42 U.S.C. § 12182(a). A "social service center establishment" is a place of public accommodation, 42 U.S.C. § 12181(7)(K), and can include an individual service provider entity or a sheltered workshop. Accordingly, individual service provider entities may also have obligations not to discriminate against their clients as places of public accommodation under Title III of the ADA.



U.S. Department of Justice
Civil Rights Division

autonomy, and the ability to manage their work schedules and assignments; access to the community during breaks; and other employment benefits.

3. What best practices can state and local governments' employment service systems adopt to ensure that people with disabilities have access to competitive integrated employment?

Research on supported employment services has yielded best practices for ensuring that individuals with disabilities are able to engage in employment in the most integrated setting appropriate, including ensuring that employment services are individualized, sufficiently intense and of sufficient duration, provided in integrated settings, and designed to achieve competitive integrated employment.¹⁹

a. Individualization of Services

The success of a person with a disability in competitive integrated employment often depends on identifying jobs and services that align with the particular person's skills, abilities, and interests. Individualization of services is achieved through a process by which a person with a disability identifies his or her particular interests, preferences, strengths, skills, and support needs for the purpose of finding, obtaining, and maintaining employment. This process includes: (1) assessments that evaluate the individual's skills, strengths, and support needs in an integrated setting; and (2) person-centered planning.²⁰ Individualization typically depends upon a career development plan developed by a qualified employment professional who is familiar with how to support people with disabilities in competitive integrated employment and how to connect a person with a disability with employment opportunities identified in the local

¹⁹ See, e.g., Nat'l Center on Leadership for the Emp. and Econ. Advancement of People with Disabilities (LEAD Center) & U.S. Dep't of Labor, Off. of Disability Emp. Pol'y (ODEP), Employment First Technical Brief #3: Criteria for Performance Excellence in *Employment First* State Systems Change & Provider Transformation 8–9 (2016), <https://perma.cc/L9TK-SKRU> ("ODEP encourages state governments to prioritize and financially incentivize the following types of employment services and evidence-based effective practices that lead to competitive, integrated employment for individuals with disabilities: Competitive Placement . . . Customized Employment . . . Supported Employment . . . Self-Employment . . . [and] Entrepreneurship or Small Business.").

²⁰ See LEAD Center, Nat'l Disability Inst. (NDI), & ODEP, Guided Group Discovery Facilitator Guide (2017), <https://perma.cc/3W6R-3VBK>.



U.S. Department of Justice
Civil Rights Division

job market. Employment professionals, like job developers and job coaches, typically identify how an employer's unmet needs may align with a person's distinct interests and capabilities to create a potential employment opportunity. Medicaid home- and community-based services can help state governments' employment service systems ensure that people with disabilities have person-centered plans.²¹

b. Intensity and Duration of Services

To be effective, supported employment services should be provided in a sufficient amount, intensity, and duration to enable a person with a disability to secure and maintain employment. The type, amount, and intensity of someone's services may change over time, but such services should be provided for a sufficient duration to ensure that the person can continue to succeed and to avoid placing the person at risk of unnecessary segregation. Supported employment services should be sufficient to allow individuals to work in a mainstream job for the maximum number of hours consistent with their abilities and preferences.

4. What evidence may a person with a disability use to establish that an integrated employment setting is appropriate for them?

A person with a disability in a segregated employment or day services setting may rely on a variety of evidence to establish that an integrated employment setting is appropriate. An assessment by a qualified public official, like a state vocational rehabilitation counselor or a healthcare professional, is one option.²² But this is not the only method of demonstrating the appropriateness of community-based employment for a particular individual. For example, appropriateness may also be established with evidence that:

- (1) people with similar impairments are working in integrated employment settings;
- (2) the individual has formerly worked in a more integrated employment setting;
- or

²¹ See, e.g., 42 C.F.R. § 441.301(c) (person-centered service planning process and requirements).

²² See *Olmstead*, 527 U.S. at 587.



U.S. Department of Justice
Civil Rights Division

(3) the individual currently performs tasks in a sheltered workshop that demonstrate his or her capability to perform work in a mainstream employment setting with services.²³

Such evidence may come from the person's employment service provider, community-based organizations that provide supported employment services, former employers, family members and friends, teachers, or any other relevant sources. Similarly, evidence from day service or other providers, employers, family members, friends, or other relevant sources may be used to show that individuals are appropriate for integrated day services.

Professional research has consistently shown that people with significant disabilities can work in typical jobs—that is, in competitive integrated employment.²⁴ In fact, numerous states have adopted Employment First policies that instruct states' disability service systems to prioritize competitive integrated employment for individuals with disabilities.²⁵ Such policies frequently include the directive that state systems must be driven by the presumption that individuals with disabilities can work, and that not working should be the exception.²⁶

²³ *Radaszewski ex rel. Radaszewski v. Maram*, 383 F.3d 599, 612–13 (7th Cir. 2004) (Medicaid-eligible person who lived at home with services demonstrated that community-based services were appropriate for him); *Townsend v. Quasim*, 328 F.3d 511, 516 (9th Cir. 2003) (same). For the same reasons, such an individual may similarly rely, for example, on evidence that the individual currently receives or formerly received integrated day services.

²⁴ See, e.g., Gary R. Bond et al., *An Update on Individual Placement and Support*, 19 *World Psychiatry* 390 (2020), <https://perma.cc/FG2H-LDDG>; Robert E. Drake & Michael A. Wallach, *Employment is a Critical Mental Health Intervention*, 29 *Epidemiology and Psychiatric Sciences* 178 (2020), <https://perma.cc/9466-V7CZ>; Robert E. Drake et al., *Assisting Social Security Disability Insurance Beneficiaries with Schizophrenia, Bipolar Disorder, or Major Depression in Returning to Work*, 170 *Am. J. of Psych.* 1433 (2013), <https://perma.cc/WDP6-6DSG>.

²⁵ See The Ass'n of People Supporting Emp. First (APSE), *APSE Fact Sheet: Employment First 2* (2019), <https://perma.cc/K3B9-LC2Z>; APSE, *Employment First Map: See What's Happening with Employment First Activities Across the Country* (2020), <https://perma.cc/JLM9-QP74> (map shows which states have legislation and directive/executive orders in place implementing Employment First policy).

²⁶ APSE, *APSE Fact Sheet: Employment First 1* (2019).



5. How is a determination made whether an individual does not oppose receiving services in an integrated employment or day services setting?

People with disabilities in or at risk of entering segregated employment or day services settings must have the opportunity to make an informed decision about whether to work in integrated employment settings.²⁷ Such individuals have often been told that they cannot work, and frequently have been tracked away from competitive integrated employment or steered to sheltered workshops or segregated day programs directly from secondary school settings. They also may have been absent from the competitive labor market for long periods of time, or been given scant information about supported employment services, integrated employment settings, or how individuals can work in jobs in the community. Consequently, individuals and their families may hesitate to explore work in an integrated employment setting or they may not ask for or be aware of supported employment services. Thus, public entities should take affirmative steps to ensure that individuals have accurate information about integrated employment opportunities sufficient to make meaningful decisions about where to receive employment services. Affirmative steps should include:

- providing information about the benefits of working in integrated employment settings;
- providing vocational and situational assessments, career development planning, and job discovery in mainstream workplaces;
- arranging peer-to-peer mentoring;
- facilitating visits to job sites;
- conducting job exploration and interest inventories, and providing work experiences in mainstream job settings; and
- providing benefits counseling to explain the impact of competitive work on an individual's public benefits and access to public benefits plans.

Only if an individual declines after a public entity takes these affirmative steps should the public entity determine that an individual is opposed to integrated

²⁷ Certain federal programs require participants to be offered opportunities for competitive integrated employment. *See, e.g.*, 29 U.S.C §§ 720(a)(3)(B), 794(g) (requiring State vocational rehabilitation programs to offer individuals with disabilities opportunities to obtain competitive integrated employment, including to individuals in sheltered workshops); 42 C.F.R. § 441.301(c)(4)(i) (requiring that providers of Medicaid home and community-based services ensure that recipients of services receive opportunities to seek employment and work in competitive integrated settings).



U.S. Department of Justice
Civil Rights Division

employment or day services. Individuals with disabilities may choose to accept the services based on the information provided to them but are not required to do so.²⁸

6. Do the ADA's integration mandate and *Olmstead* apply to people at serious risk of segregated employment or facility-based day settings?

Yes. The ADA's integration mandate and the *Olmstead* decision extend to people at serious risk of segregation, and are not limited to individuals currently in segregated settings.²⁹ This general principle applies to both employment and day services in segregated settings. For instance, people with disabilities could show serious risk of unnecessary segregation if a public entity's failure to provide supported employment services would likely lead to placement in a sheltered workshop. A serious risk of needless segregation may also exist when secondary school students with disabilities are not provided services to facilitate their post-school transition to adult supported employment. Individuals who are interested in mainstream employment or integrated day services are not required to wait until the harm of unnecessary segregation occurs to receive the protections of the ADA and *Olmstead*.

7. What remedies address violations of the ADA's integration mandate in the context of publicly-funded employment and day services?

A wide range of remedies may be appropriate to address violations of the ADA's integration mandate. In the employment services context, the Department has entered into settlement agreements with certain states that exemplify remedies that expand the variety, intensity, and duration of supported employment services. Remedies should ensure that people with disabilities who are interested in integrated employment can receive individualized services such as job discovery, person-centered career development planning, benefits counseling, job training, job coaching, and other ongoing services provided in integrated employment settings. Remedies should also

²⁸ 42 U.S.C. § 12201(d); 28 C.F.R. § 35.130(e)(1); *Olmstead*, 527 U.S. at 602 ("Nor is there any federal requirement that community-based treatment be imposed on patients who do not desire it.").

²⁹ *Steimel v. Wernert*, 823 F.3d 902, 911–13 (7th Cir. 2016); *Davis v. Shah*, 821 F.3d 231, 263 (2d Cir. 2016); *Pashby v. Delia*, 709 F.3d 307, 321–22 (4th Cir. 2013); *M.R. v. Dreyfus*, 663 F.3d 1100, 1116–18 (9th Cir. 2011), *amended by* 697 F.3d 706 (9th Cir. 2012); *Fisher v. Okla. Health Care Auth.*, 335 F.3d 1175, 1181–82 (10th Cir. 2003). *But see United States v. Mississippi*, 82 F.4th 387, 392–93 (5th Cir. 2023).



allow people with disabilities to work in integrated employment settings for the maximum number of hours consistent with their abilities and preferences. In addition, remedies should ensure access to integrated day services as an alternative to facility-based day services for people who are interested in participating in community activities with people without disabilities when they are not working.

Remedies should be designed so that people in segregated settings or at serious risk of segregation who are interested in more integrated settings can access the services necessary to allow them to find, obtain, retain, and advance in employment in integrated settings. These remedies should also ensure that currently segregated individuals have information about supported employment services, as well as opportunities to make informed decisions about working in competitive integrated employment (through, for example, meeting with people who formerly were in sheltered workshops and now are working in mainstream workplaces; speaking with community service providers; and visiting mainstream job sites).

For school-age populations, remedies may include transition planning and pre-employment transition services for students with disabilities who are preparing to exit school and begin employment. Examples of transition planning include (1) providing students with community-based trial work experiences, including paid work experiences, while in school; (2) crafting career development plans from age 14; and (3) ensuring that those plans include career goals based on the student's interests and specific action steps targeted to help the student achieve those goals. Examples of pre-employment transition services include (1) job exploration; (2) work-based learning experiences, which may include in-school or after school opportunities, experiences outside of the traditional school setting, or internships; (3) counseling on opportunities for enrollment in comprehensive transition or postsecondary educational programs; and (4) instruction in self-advocacy.

8. Does the ADA require an individual with a disability to work in an integrated employment setting or participate in integrated day services?

No. Individuals with disabilities may decline to accept a service in the most integrated setting appropriate for them.³⁰ State and local governments are not required

³⁰ 42 U.S.C. § 12201(d) ("Nothing in this chapter shall be construed to require an individual with a disability to accept an accommodation, aid, service, opportunity, or benefit which such individual chooses not to accept."); 28 C.F.R. § 35.130(e)(1) (same).



U.S. Department of Justice Civil Rights Division

to provide community-based services to individuals who oppose receiving those services.³¹ On the other hand, state and local governments have no obligation under the ADA to provide services in segregated settings.

9. What is the fundamental alteration defense?

A public entity's obligation under the ADA's integration mandate and *Olmstead* to provide services in the most integrated setting is not unlimited, such as in instances where a public entity can prove that the requested modification to its programs or services would "fundamentally alter" the nature of the public entity's service system.³² To demonstrate that making the requested modification would be a fundamental alteration, the public entity must prove "that, in the allocation of available resources, immediate relief for plaintiffs would be inequitable, given the responsibility the State [or local government] has undertaken for the care and treatment of a large and diverse population of persons with . . . disabilities."³³ It is the public entity's burden to establish that the requested modification would fundamentally alter its service system.

Additional Resources

For more information about the ADA, you may call the Department's toll-free ADA information line at 800-514-0301 or 833-610-1264 (TTY), or access its ADA website at <https://www.ada.gov/>. For more information about the Department's enforcement of the integration mandate of Title II of the ADA, please visit [Community Integration | ADA.gov](#).

Information regarding disability employment-related policies and practices can be found at: www.dol.gov/odep/; <https://acl.gov/programs/youth-transitions/employment>; and aoddisabilityemploymentcenter.com.

³¹ *Olmstead*, 527 U.S. at 602 ("Nor is there any federal requirement that community-based treatment be imposed on patients who do not desire it.").

³² 28 C.F.R. § 35.130(b)(7).

³³ *Olmstead*, 527 U.S. at 604.

APPENDIX B: ACCESSIBILITY SUMMARIES BY PARK TYPE

COMMUNITY AND SIGNATURE PARKS

Facility / Building	Priority 1		Priority 2		Priority 3		Priority 4		Priority 5		Total	
	Est. Cost	Items	Est. Cost	Items	Est. Cost	Items	Est. Cost	Items	Est. Cost	Items	Est. Cost	Items
Dash Point Park and Pier	\$68,640	28	\$17,300	4	\$8,739	19	\$644	1			\$95,323	53
Franklin Park	\$73,752	20	\$7,650	10	\$407	2	\$11,514	9			\$93,323	41
Heidelberg Davis Park	\$105,383	27	\$19,548	10	\$12,023	12	\$33,300	3			\$170,254	52
Jefferson Park	\$120,980	46	\$7,537	14	\$3,000	2	\$4,480	13			\$135,997	75
Kandle Park & Pool	\$57,655	17	\$800	2	\$9,935	17					\$68,391	36
Lincoln Eldridge Park	\$54,539	14	\$4,650	2	\$586	2					\$59,775	18
McKinley Park	\$359,653	51	\$4,013	4	\$434	2	\$7,679	7			\$371,778	64
Norpoint Park	\$242,761	74	\$7,504	13	\$4,386	15	\$560	2			\$255,211	104
Northeast Tacoma Playground	\$13,950	8	\$4,001	9							\$17,951	17
Peck Field	\$81,927	24	\$4,029	6	\$8,069	14	\$8,000	1			\$102,024	45
Portland Avenue Park	\$125,475	52	\$8,211	10	\$6,701	10					\$140,387	73
SERA Sports Complex	\$111,216	37	\$5,005	11	\$12,652	24	\$23,065	4			\$151,938	76
South Park	\$47,712	20	\$2,986	8	\$1,468	3	\$271,407	36			\$323,574	70
Stewart Heights Park & Pool	\$434,380	117	\$20,325	32	\$25,699	32	\$6,327	20			\$486,730	202
Swan Creek Park	\$43,700	37	\$4,723	17	\$596	4	\$96,671	65			\$145,691	125
Tacoma Nature Center and Snake Lake Natural Area	\$65,341	22	\$21,562	20	\$12,815	24	\$15,450	8			\$115,168	74
Titlow Park	\$235,697	43	\$14,933	9	\$27,094	35	\$9,886	6			\$287,610	93
Vassault Park	\$48,018	15	\$22,090	6	\$3,159	4	\$560	1			\$73,827	26
Verlo Playfield	\$103,880	9	\$2,434	6	\$5,214	6	\$13,312	5			\$124,840	26
Wapato Park & Pavilion	\$282,873	76	\$95,431	41	\$69,978	50	\$14,329	40	\$11,300	1	\$473,911	208
Wright Park and WW Seymour Botanical Conservatory	\$54,478	55	\$14,007	21	\$10,841	26	\$24,560	7			\$103,886	109
Grand Total	\$2,732,010	792	\$288,739	255	\$223,796	303	\$541,744	228	\$11,300	1	\$3,797,589	1587

COMMUNITY CENTERS AND BUILDINGS

Facility / Building	Priority 1		Priority 2		Priority 3		Priority 4		Priority 5		Total	
	Est. Cost	Items	Est. Cost	Items	Est. Cost	Items	Est. Cost	Items	Est. Cost	Items	Est. Cost	Items
Center at Norpoint	\$45,472	17	\$42,746	14	\$50,227	24	\$31,216	5			\$169,661	60
Eastside Community Center	\$62,989	69	\$13,347	49	\$7,922	22					\$84,258	140
Metro Parks Headquarters	\$60,344	26			\$5,598	15	\$11,999	2			\$77,941	43
People's Community Center	\$159,065	100	\$45,789	44	\$27,153	44	\$4,221	4			\$236,228	194
Portland Avenue Community Center	\$17,187	39	\$43,533	36	\$7,817	21	\$12,055	6			\$80,591	102
STAR Center	\$44,942	51	\$11,755	34	\$9,430	31			\$466	2	\$66,592	118
Grand Total	\$389,999	302	\$157,170	177	\$108,147	157	\$59,491	17	\$466	2	\$715,271	657

COMMUNITY PARKS

Facility / Building	Priority 1		Priority 2		Priority 3		Priority 4		Priority 5		Total	
	Est. Cost	Items	Est. Cost	Items	Est. Cost	Items	Est. Cost	Items	Est. Cost	Items	Est. Cost	Items
Alderwood Park	\$10,775	10	\$17,235	10			\$9,828	46			\$37,838	66
Alling Park	\$23,441	9	\$2,450	2	\$352	1	\$6,102	3			\$32,344	17
Baltimore Park	\$1,877	2	\$7,990	2			\$280	1			\$10,147	5
Browns Point Lighthouse Park	\$123,402	65	\$8,132	10	\$15,950	9				1	\$147,484	85
Browns Point Playfield	\$39,394	11	\$34,150	8			\$280	1			\$73,824	20
Charlotte's Blueberry Park	\$53,072	13	\$5,665	7	\$246	1	\$42,761	17			\$101,743	38
China Lake Park	\$11,860	3					\$280	1			\$12,140	4
Cloverdale Park	\$7,293	7	\$22,114	11	\$484	1	\$700	3			\$30,591	22
DeLong Park	\$34,885	17	\$230	4			\$10,632	9			\$45,747	30
Fern Hill Park	\$10,710	2	\$8,820	6	\$634	2	\$560	1			\$20,724	11
Ferry Park	\$19,091	8	\$42,155	7							\$61,246	15
Garfield Park	\$44,642	5	\$9,828	1							\$54,470	6
Irving Park	\$2,543	5	\$1,770	4			\$840	3			\$5,153	12
Jane Clark Park	\$30,246	5	\$1,875	2							\$32,121	7
Jerry Meeker Memorial	\$19,221	12									\$19,221	12
Julia's Gulch	\$1,792	1					\$560	2			\$2,352	3
Lincoln Heights Park	\$30,943	26	\$525	2							\$31,468	28
Lots for Tots	\$12,869	4	\$1,300	1							\$14,169	5
Manitou Park	\$6,272	1	\$25,440	11							\$31,712	13
Neighbors Park	\$35,323	15	\$5,658	7			\$5,439	3			\$46,420	25
North Slope Historic Park	2,953	3	\$1,300	1			\$315	1			\$4,567	5
Oak Tree Park	\$1,320	4					\$1,400	4			\$2,720	8
Oakland Madrona Park	\$20,410	9	\$10,833	8			\$840	1			\$32,083	18
Old Town Park	\$37,793	18	\$11,987	19	\$690	1	\$5,560	2			\$56,030	40
Optimist Park	\$21,570	6	\$66	1							\$21,636	8
People's Park	\$57,830	7	\$4,551	6			\$2,505	2			\$64,886	15
Proctor Community Garden	\$36,410	3	\$159,583	2							\$195,993	5
Puget Gulch							\$560	2			\$560	2
Puget Park	\$43,605	13	\$26,747	7			\$1,300	1			\$71,652	21
Rogers Playfield	\$42,998	11	\$6,130	8			\$8,000	1			\$57,128	20
Roosevelt Park	\$23,968	8	\$1,569	3							\$25,537	11
Ryan's Park	\$10,687	5	\$1,300	1			\$280	1			\$12,267	7
Sawyer Tot Lot	\$11,172	9	\$8,448	6			\$108	1			\$19,728	16
Sheridan Park	\$6,964	9	\$9,841	5			\$8,714	4			\$25,519	18
Ursich Park		1					\$560	4			\$560	5
Wapato Hills Park	\$62,467	37	\$11,985	14	\$2,437	9	\$6,800	9			\$83,689	69
Grand Total	\$899,798	364	\$449,677	176	\$20,793	24	\$115,204	123		1	\$1,485,469	692

APPENDIX C: PORTFOLIO ACCESSIBILITY SUMMARY



Facility / Building	Priority 1		Priority 2		Priority 3		Priority 4		Priority 5		Total	
	Est. Cost	Items	Est. Cost	Items	Est. Cost	Items	Est. Cost	Items	Est. Cost	Items	Est. Cost	Items
Alderwood Park	\$10,775	10	\$17,235	10			\$9,828	46			\$37,838	66
Alling Park	\$23,441	9	\$2,450	2	\$352	1	\$6,102	3			\$32,344	17
Baltimore Park	\$1,877	2	\$7,990	2			\$280	1			\$10,147	5
Browns Point Lighthouse Park	\$123,402	65	\$8,132	10	\$15,950	9				1	\$147,484	85
Browns Point Playfield	\$39,394	11	\$34,150	8			\$280	1			\$73,824	20
Center at Norpoint	\$45,472	17	\$42,746	14	\$50,227	24	\$31,216	5			\$169,661	60
Charlotte's Blueberry Park	\$53,072	13	\$5,665	7	\$246	1	\$42,761	17			\$101,743	38
China Lake Park	\$11,860	3					\$280	1			\$12,140	4
Chinese Reconciliation Park	\$448,018	75	\$420	8	\$1,760	1	\$1,400	4			\$451,598	88
Cloverdale Park	\$7,293	7	\$22,114	11	\$484	1	\$700	3			\$30,591	22
Cummings Park	\$131,958	20	\$2,757	3			\$4,093	4			\$138,809	27
Dash Point Park and Pier	\$68,640	27	\$17,300	4	\$8,739	19	\$644	1			\$95,323	52
DeLong Park	\$34,885	17	\$230	4			\$10,632	9			\$45,747	30
Dickman Mill Park	\$81,148	12	\$982	5	\$17,496	10	\$8,000	1			\$107,626	28
Dune Peninsula at Point Defiance Park	\$28,332	12	\$1,200	3	\$6,176	15	\$3,546	3			\$39,254	33
Eastside Community Center	\$62,989	69	\$13,347	49	\$7,922	22					\$84,258	140
Fern Hill Park	\$10,710	2	\$8,820	6	\$634	2	\$560	1			\$20,724	11
Ferry Park	\$19,091	8	\$42,155	7							\$61,246	15
Fort Nisqually Living History Museum	\$60,719	30	\$821	2	\$7,389	27					\$68,929	59
Franklin Park	\$73,752	18	\$7,650	10	\$407	2	\$11,514	9			\$93,323	39
Garfield Park	\$44,642	5	\$13,728	2	\$1,443	2					\$59,814	9
Hamilton Park	\$9,024	3	\$1,352	2			\$215	1			\$10,592	6
Heidelberg Davis Park	\$105,383	27	\$19,548	10	\$12,023	12	\$33,300	3			\$170,254	52
Irving Park	\$2,543	5	\$1,770	4			\$840	3			\$5,153	12
Jack Hyde Park	\$85,417	16	\$590	5	\$5,900	6	\$2,230	3			\$94,137	30
Jane Clark Park	\$30,246	5	\$6,250	3	\$986	2					\$37,482	10
Jefferson Park	\$120,980	46	\$7,537	14	\$3,000	2	\$4,480	13			\$135,997	75
Jerry Meeker Memorial	\$19,221	12									\$19,221	12
Judge Jack Tanner Park	\$80,924	11	\$3,876	4	\$141	1	\$1,300	1			\$86,242	17
Julia's Gulch	\$1,792	1					\$560	2			\$2,352	3
Kandle Park & Pool	\$57,655	17	\$800	2	\$9,935	17					\$68,391	36
Les Davis Pier	\$246,405	31	\$30,151	15	\$2,108	9	\$17,983	4			\$296,646	59
Lincoln Eldridge Park	\$54,539	14	\$4,650	2	\$586	2					\$59,775	18
Lincoln Heights Park	\$30,943	26	\$1,425	3							\$32,368	29
Lots for Tots	\$13,080	5	\$2,065	3							\$15,145	8
Manitou Park	\$6,272	1	\$25,440	11							\$31,712	13
McKinley Park	\$359,653	51	\$4,013	4	\$434	2	\$7,679	7			\$371,778	64
Meadow Park Golf Course	\$203,855	59	\$8,720	6	\$32,679	38	\$2,698	6			\$247,952	109
Metro Parks Headquarters	\$60,344	26			\$5,598	15	\$11,999	2			\$77,941	43
Neighbors Park	\$35,323	15	\$5,658	7			\$5,439	3			\$46,420	25
Norpoint Park	\$242,761	74	\$7,504	13	\$4,386	15	\$560	2			\$255,211	104
North Slope Historic Park	\$2,953	3	\$1,300	1			\$315	1			\$4,567	5
Northeast Tacoma Playground	\$13,950	8	\$4,001	9							\$17,951	17
NW Trek Wildlife Park	\$1,044,913	315	\$50,301	89	\$59,791	57	\$5,382	9	\$3,683	9	\$1,164,070	479
Oak Tree Park	\$1,320	4					\$1,400	4			\$2,720	8
Oakland Madrona Park	\$20,410	9	\$10,833	8			\$840	1			\$32,083	18
Old Town Dock	\$128,566	15	\$2,694	4			\$1,300	1			\$132,559	21
Old Town Park	\$37,793	18	\$11,987	19	\$690	1	\$5,560	2			\$56,030	40
Optimist Park	\$21,570	6	\$66	1							\$21,636	8
Peck Field	\$81,927	24	\$4,029	6	\$8,069	14	\$8,000	1			\$102,024	45
People's Community Center	\$159,065	100	\$45,789	44	\$27,153	44	\$4,221	4			\$236,228	194
People's Park	\$57,830	7	\$4,551	6			\$2,505	2			\$64,886	15
Point Defiance Marina	\$50,087	20	\$1,200	3	\$2,343	9	\$1,300	1			\$54,930	33
Point Defiance Park	\$501,246	87	\$15,192	24	\$27,323	72	\$46,154	25	\$560	1	\$590,474	209
Point Defiance Zoo & Aquarium	\$653,426	122	\$4,617	7	\$26,399	79	\$27,131	5	\$1,314	6	\$712,888	219
Portland Avenue Community Center	\$17,187	39	\$43,533	36	\$7,817	21	\$12,055	6			\$80,591	102
Portland Avenue Park	\$125,475	52	\$8,211	10	\$6,701	10					\$140,387	73
Proctor Community Garden	\$36,410	3	\$159,583	2							\$195,993	5
Puget Gulch							\$560	2			\$560	2
Puget Park	\$43,605	13	\$26,747	7			\$1,300	1			\$71,652	21
Rogers Playfield	\$42,998	11	\$6,130	8			\$8,000	1			\$57,128	20

Facility / Building	Priority 1		Priority 2		Priority 3		Priority 4		Priority 5		Total	
	Est. Cost	Items	Est. Cost	Items	Est. Cost	Items	Est. Cost	Items	Est. Cost	Items	Est. Cost	Items
Roosevelt Park	\$23,968	8	\$1,569	3							\$25,537	11
Ruston Way Areas 2-4	\$699,289	103	\$4,099	11	\$920	2	\$1,580	2			\$705,888	118
Ryan's Park	\$10,687	5	\$1,300	1			\$280	1			\$12,267	7
Sawyer Tot Lot	\$11,172	9	\$8,448	6			\$108	1			\$19,728	16
SERA Sports Complex	\$111,216	37	\$5,005	11	\$12,652	24	\$23,065	4			\$151,938	76
Sheridan Park	\$6,964	9	\$9,841	5			\$8,714	4			\$25,519	18
South Park	\$47,712	20	\$2,986	8	\$1,468	3	\$271,407	36			\$323,574	70
STAR Center	\$44,942	51	\$11,755	34	\$9,430	31			\$466	2	\$66,592	118
Stewart Heights Park & Pool	\$434,380	117	\$20,325	32	\$25,699	32	\$6,327	20			\$486,730	202
Swan Creek Park	\$43,700	37	\$4,723	17	\$596	4	\$96,671	65			\$145,691	125
Tacoma Nature Center and Snake Lake												
Natural Area	\$65,341	22	\$21,562	20	\$12,815	24	\$15,450	8			\$115,168	74
Thea's Park	\$39,825	24	\$6,447	13							\$46,272	37
Titlow Park	\$235,697	43	\$14,933	9	\$27,094	35	\$9,886	6			\$287,610	93
Ursich Park		1					\$560	4			\$560	5
Vassault Park	\$48,018	15	\$22,090	6	\$3,159	4	\$560	1			\$73,827	26
Verlo Playfield	\$103,880	9	\$2,434	6	\$5,214	6	\$13,312	5			\$124,840	26
Wapato Hills Park	\$62,467	37	\$11,985	14	\$2,437	9	\$6,800	9			\$83,689	69
Wapato Park & Pavilion	\$282,873	76	\$95,431	41	\$69,978	50	\$14,329	40	\$11,300	1	\$473,911	208
Wright Park and WW Seymour Botanical Conservatory	\$52,798	53	\$15,687	23	\$10,841	26	\$24,560	7			\$103,886	109
Grand Total	\$8,513,490	2409	\$1,042,623	819	\$545,588	814	\$840,748	438	\$17,323	20	\$10,959,773	4515

APPENDIX D: BARRIERS BY TRANSITION PLAN PHASE



PHASE ONE						
PARK	CATEGORY	BARRIER ID	BARRIER DESCRIPTION	ESTIMATE	PRIORITY	
Center at Norpoint	Entrance to Building	349921	The maneuvering clearance at the accessible door is not level and clear.	\$ 1,250	1	
Center at Norpoint	Entrance to Building	349922	The maneuvering clearance at the accessible door is not level and clear.	\$ 1,250	1	
Center at Norpoint	Restroom	349892	The height of controls are not compliant.	\$ 400	3	
Center at Norpoint	Restroom	349882	The heights of the dispensers are not compliant.	\$ 400	3	
Center at Norpoint	Restroom	349869	The height of the dispenser is not compliant.	\$ 200	3	
Center at Norpoint	Interior Access Route	349873	The threshold at the accessible door is greater than ½" in height.	\$ 179	1	
Center at Norpoint	Interior Access Route	349870	The minimum number of drinking fountains is not provided: 50% are not standing level.	\$ 16,318	4	
Center at Norpoint	Interior Access Route	349906	A standing height drinking fountain is not provided.	\$ 5,439	4	
Center at Norpoint	Kitchen	349915	A minimum 30" wide section of the counter is not a minimum height of 28" and maximum height of 34" with knee and toe clearance.	\$ 3,970	4	
Center at Norpoint	Kitchen	349913	The oven or built-in microwave does not have a compliant adjacent work surface.	\$ 3,970	4	
Center at Norpoint	Kitchen	349916	The location of the controls requires reaching across burners.	\$ 1,518	4	
Center at Norpoint	Locker and Dressing Rooms	349886	The locker room does not have a compliant bench located near accessible lockers.	\$ 1,972	3	
Center at Norpoint	Locker and Dressing Rooms	349877	The locker room does not have a compliant bench located near accessible lockers.	\$ 1,972	3	
Center at Norpoint	Swimming Pools	349902	The width between handrails at pool stairs is greater than 24".	\$ 14,635	1	
Center at Norpoint	Interior Access Route	349920	Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the interior accessible route.	\$ 1,456	1	
Center at Norpoint	Interior Access Route	349894	Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the interior accessible route.	\$ 1,456	1	
Center at Norpoint	Interior Access Route	349896	Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the interior accessible route.	\$ 1,456	1	
Center at Norpoint	Interior Access Route	349861	Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the interior accessible route.	\$ 728	1	
Center at Norpoint	Interior Access Route	349905	Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the interior accessible route.	\$ 728	1	
Center at Norpoint	Interior Access Route	349872	Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the interior accessible route.	\$ 5,824	1	
Center at Norpoint	Interior Access Route	349893	A ramp is required but not provided.	\$ 3,972	1	
Center at Norpoint	Interior Access Route	349897	Items requiring an unobstructed side reach motion are higher than 48" maximum and/or lower than 15" minimum height above finish floor.	\$ 600	2	
Center at Norpoint	Interior Access Route	349862	Items requiring an unobstructed side reach motion are higher than 48" maximum height above finish floor.	\$ 200	2	
Center at Norpoint	Interior Access Route	349908	Items requiring an unobstructed forward reach motion are higher than 48" maximum or lower than 15" minimum height above finish floor.	\$ 200	2	
Center at Norpoint	Interior Access Route	349909	Items requiring an unobstructed side reach motion are higher than 48" maximum and/or lower than 15" minimum height above finish floor.	\$ 200	2	
Center at Norpoint	Restroom	349867	The wheelchair stall door is not self closing.	\$ 586	3	
Center at Norpoint	Restroom	349889	The wheelchair stall door is not self closing.	\$ 586	3	
Center at Norpoint	Restroom	349879	The wheelchair stall door is not self closing.	\$ 586	3	
Center at Norpoint	Restroom	349887	The locker area does not have accessible lockers.	\$ 1,320	3	
Center at Norpoint	Restroom	349878	The locker area does not have accessible lockers.	\$ 1,320	3	
Center at Norpoint	Restroom	349881	The height of the water closet is not 17" minimum to 19" maximum above finished floor.	\$ 630	3	
Center at Norpoint	Restroom	364210	ANSI A117.1-: A vertical side grab bar is not located in the wheelchair stall.	\$ 887	3	
Center at Norpoint	Restroom	364051	ANSI A117.1-: A vertical side grab bar is not located in the wheelchair stall.	\$ 887	3	
Center at Norpoint	Restroom	364209	ANSI A117.1-: A vertical side grab bar is not located in the wheelchair stall.	\$ 887	3	
Center at Norpoint	Restroom	349890	WASHINGTON: The transfer shower stall is not compliant.	\$ 17,952	3	
Center at Norpoint	Restroom	349884	WASHINGTON: The transfer shower stall is not compliant.	\$ 17,952	3	
Center at Norpoint	Restroom	349891	The centerline of the toilet in the wheelchair stall is not 16" minimum to 18" maximum from the sidewall.	\$ 787	3	
Center at Norpoint	Kitchen	349911	Sinks do not have knee and/or toe clearance.	\$ 1,986	2	
Center at Norpoint	Kitchen	349912	The accessible sink is not installed with the front of the higher of the rim or counter surface 34" maximum above finished floor.	\$ 720	2	
Center at Norpoint	Kitchen	349914	Sinks do not have knee and/or toe clearance.	\$ 1,986	2	
Center at Norpoint	Swimming Pools	349903	The sloped entry does not have a set of two handrails.	\$ 4,890	1	
Center at Norpoint	Swimming Pools	349899	The spa does not have at least one accessible means of entry.	\$ 6,330	1	
Center at Norpoint	Playground	349919	The elevated play structure does not have a transfer platform.	\$ 25,000	2	
Center at Norpoint	Site Furnishings	349875	The vending machines are not accessible.	\$ 3,254	2	
Cloverdale Park	Exterior Access Route	328934	Sidewalk has areas of vertical level changes in excess of 1/4" that are not ramped.	\$ 31	1	
Dash Point Park and Pier / Exterior	Exterior Access Route	315309	Sidewalk has areas of vertical level changes in excess of 1/4" that are not ramped.	\$ 59	1	
Eastside Community Center	Interior Access Route	326947	The surface of the swinging door within 10 inches of the finish floor or ground for the full width of the door on the push side is not smooth.	\$ 100	2	
Eastside Community Center	Entrance to Building	326427	The clear floor space at the controls of an automatic or power assisted door is not located outside of any door swing	\$ 250	1	
Eastside Community Center	Interior Access Route	326980	Visible and audible signal fixtures indicating which car is answering the call and the car's direction of travel are not compliant.	\$ 1,100	3	
Eastside Community Center	Interior Access Route	326972	The height of the interior accessible route is less than 80" AFF.	\$ 910	1	
Eastside Community Center	Interior Access Route	326976	The height of the interior accessible route is less than 80" AFF.	\$ 910	1	
Eastside Community Center	Interior Access Route	326971	The operable part requires tight grasping to operate.	\$ 200	2	
Eastside Community Center	Accessible Parking	326404	The accessible drive-up electric vehicle charging station stall is not provided or is not compliant.	\$ 840	1	
Eastside Community Center	Accessible Parking	326421	The accessible drive-up electric vehicle charging station stall is not provided or is not compliant.	\$ 840	1	
Eastside Community Center	Accessible Parking	326423	WASHINGTON: A car stall, access aisle, and signage are not provided and the slope and/or ground surface is/are not compliant.	\$ 11,300	1	
Eastside Community Center	Accessible Parking	326424	WASHINGTON: The car stall slope is not compliant.	\$ 6,300	1	
Eastside Community Center	Accessible Parking	326426	WASHINGTON: The car access aisle slope is not compliant. Access aisle signage is not provided.	\$ 5,280	1	
Eastside Community Center	Accessible Parking	326425	WASHINGTON: The car stall slope is not compliant.	\$ 6,300	1	
Eastside Community Center	Accessible Parking	326405	The van access aisle is not on the passenger side of the van, where parking stalls are angled.	\$ 525	1	
Eastside Community Center	Restroom	327010	Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the interior accessible route.	\$ 728	1	
Eastside Community Center	Restroom	327011	The width between handrails at pool stairs is less than 20" and greater than 24".	\$ 1,000	1	

PHASE ONE					
PARK	CATEGORY	BARRIER ID	BARRIER DESCRIPTION	ESTIMATE	PRIORITY
Eastside Community Center	Interior Access Route	327007	Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the interior accessible route.	\$ 728	1
Eastside Community Center	Interior Access Route	327006	Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the interior accessible route.	\$ 728	1
Eastside Community Center	Interior Access Route	326908	Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the interior accessible route.	\$ 728	1
Eastside Community Center	Interior Access Route	326969	Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the interior accessible route.	\$ 728	1
Eastside Community Center	Restroom	326993	The restroom circulation path is not free of objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.	\$ 800	2
Eastside Community Center	Restroom	326968	The restroom circulation path is not free of objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.	\$ 100	2
Eastside Community Center	Restroom	326967	The restroom circulation path is not free of objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.	\$ 99	2
Eastside Community Center	Restroom	326970	The restroom circulation path is not free of objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.	\$ 100	2
Eastside Community Center	Restroom	326975	The restroom circulation path is not free of objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.	\$ 100	2
Eastside Community Center	Interior Access Route	326428	Items requiring an unobstructed forward reach motion are higher than 48" maximum or lower than 15" minimum height above finish floor.	\$ 100	2
Eastside Community Center	Restroom	326974	The shower spray unit is not compliant.	\$ 650	3
Eastside Community Center	Restroom	326978	The shower spray unit is not compliant.	\$ 650	3
Eastside Community Center	Restroom	327009	The side grab bar at the water closet is not compliant.	\$ 355	3
Eastside Community Center	Restroom	326916	The side grab bar at the water closet is not compliant.	\$ 355	3
Eastside Community Center	Restroom	326914	The side grab bar at the water closet is not compliant.	\$ 355	3
Eastside Community Center	Restroom	326918	The side grab bar at the water closet is not compliant.	\$ 355	3
Eastside Community Center	Restroom	326920	The side grab bar at the water closet is not compliant.	\$ 355	3
Eastside Community Center	Kitchen	326979	Sinks do not have knee and/or toe clearance.	\$ 1,986	2
Eastside Community Center	Site Furnishings	326911	The vending machines are not accessible.	\$ 3,254	2
Eastside Community Center	Restroom	326992	The side grab bar at the water closet is not compliant.	\$ 355	3
Eastside Community Center	Restroom	326895	The side grab bar at the water closet is not compliant.	\$ 355	3
Irving Park	Exterior Access Route	323777	Sidewalk has areas of vertical level changes in excess of 1/4" that are not ramped.	\$ 118	1
McKinley Park	Exterior Access Route	328889	Sidewalk has areas of vertical level changes in excess of 1/4" that are not ramped.	\$ 99	1
McKinley Park	Exterior Access Route	328849	Sidewalk has areas of vertical level changes in excess of 1/4" that are not ramped.	\$ 79	1
Norpoint Park	Exterior Access Route	302180	Sidewalk has areas of vertical level changes in excess of 1/4" that are not ramped.	\$ 178	1
Norpoint Park	Exterior Access Route	302181	Sidewalk has areas of vertical level changes in excess of 1/4" that are not ramped.	\$ 39	1
Norpoint Park	Exterior Access Route	302185	Sidewalk has areas of vertical level changes in excess of 1/4" that are not ramped.	\$ 118	1
Norpoint Park	Exterior Access Route	302131	Sidewalk has areas of vertical level changes in excess of 1/4" that are not ramped.	\$ 99	1
Norpoint Park	Exterior Access Route	302140	Sidewalk has areas of vertical level changes in excess of 1/4" that are not ramped.	\$ 17	1
Norpoint Park	Exterior Access Route	302169	Sidewalk has areas of vertical level changes in excess of 1/4" that are not ramped.	\$ 99	1
Norpoint Park	Exterior Access Route	302179	Sidewalk has areas of vertical level changes in excess of 1/4" that are not ramped.	\$ 59	1
Norpoint Park	Exterior Access Route	302183	Sidewalk has areas of vertical level changes in excess of 1/4" that are not ramped.	\$ 39	1
Norpoint Park	Exterior Access Route	302191	Sidewalk has areas of vertical level changes in excess of 1/4" that are not ramped.	\$ 19	1
NW Trek Wildlife Park	Exterior Access Route	342134	WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 668	3
NW Trek Wildlife Park	Site Furnishings	342363	BEST PRACTICE: An adjacent clear space is not provided at the bench.	\$ 52	2
NW Trek Wildlife Park	Site Furnishings	342189	BEST PRACTICE: An adjacent clear space is not provided at the bench.	\$ 52	2
NW Trek Wildlife Park	Site Furnishings	342126	BEST PRACTICE: An adjacent clear space is not provided at the bench.	\$ 52	2
NW Trek Wildlife Park	Site Furnishings	342160	BEST PRACTICE: An adjacent clear space is not provided at the bench.	\$ 52	2
NW Trek Wildlife Park	Site Furnishings	342161	BEST PRACTICE: An adjacent clear space is not provided at the bench.	\$ 52	2
NW Trek Wildlife Park	Site Furnishings	342164	BEST PRACTICE: An adjacent clear space is not provided at the bench.	\$ 52	2
NW Trek Wildlife Park	Site Furnishings	342167	BEST PRACTICE: An adjacent clear space is not provided at the bench.	\$ 52	2
NW Trek Wildlife Park	Site Furnishings	342171	BEST PRACTICE: An adjacent clear space is not provided at the bench.	\$ 52	2
NW Trek Wildlife Park	Site Furnishings	342174	BEST PRACTICE: An adjacent clear space is not provided at the bench.	\$ 52	2
NW Trek Wildlife Park	Site Furnishings	342400	BEST PRACTICE: An adjacent clear space is not provided at the bench.	\$ 52	2
NW Trek Wildlife Park	Site Furnishings	342153	BEST PRACTICE: An adjacent clear space is not provided at the bench.	\$ 52	2
NW Trek Wildlife Park	Site Furnishings	342158	BEST PRACTICE: An adjacent clear space is not provided at the bench.	\$ 52	2
NW Trek Wildlife Park	Site Furnishings	342177	BEST PRACTICE: An adjacent clear space is not provided at the bench.	\$ 52	2
NW Trek Wildlife Park	Site Furnishings	342348	BEST PRACTICE: An adjacent clear space is not provided at the bench.	\$ 52	2
NW Trek Wildlife Park	Site Furnishings	342103	BEST PRACTICE: An adjacent clear space is not provided at the bench.	\$ 52	2
NW Trek Wildlife Park	Site Furnishings	342111	BEST PRACTICE: An adjacent clear space is not provided at the bench.	\$ 52	2
NW Trek Wildlife Park	Site Furnishings	342116	BEST PRACTICE: An adjacent clear space is not provided at the bench.	\$ 52	2
NW Trek Wildlife Park	Site Furnishings	342118	BEST PRACTICE: An adjacent clear space is not provided at the bench.	\$ 52	2
NW Trek Wildlife Park	Site Furnishings	342121	BEST PRACTICE: An adjacent clear space is not provided at the bench.	\$ 52	2
NW Trek Wildlife Park	Site Furnishings	342130	BEST PRACTICE: An adjacent clear space is not provided at the bench.	\$ 52	2
NW Trek Wildlife Park	Site Furnishings	342553	BEST PRACTICE: An adjacent clear space is not provided at the bench.	\$ 52	2
NW Trek Wildlife Park	Site Furnishings	342327	BEST PRACTICE: An adjacent clear space is not provided at the bench.	\$ 52	2
NW Trek Wildlife Park	Site Furnishings	342328	BEST PRACTICE: An adjacent clear space is not provided at the bench.	\$ 52	2
NW Trek Wildlife Park	Site Furnishings	342344	BEST PRACTICE: An adjacent clear space is not provided at the bench.	\$ 52	2
NW Trek Wildlife Park	Site Furnishings	342346	BEST PRACTICE: An adjacent clear space is not provided at the bench.	\$ 52	2
NW Trek Wildlife Park	Site Furnishings	342323	BEST PRACTICE: An adjacent clear space is not provided at the bench.	\$ 52	2
NW Trek Wildlife Park	Site Furnishings	342320	BEST PRACTICE: An adjacent clear space is not provided at the bench.	\$ 52	2
NW Trek Wildlife Park	Site Furnishings	342321	BEST PRACTICE: An adjacent clear space is not provided at the bench.	\$ 52	2
NW Trek Wildlife Park	Site Furnishings	342404	BEST PRACTICE: An adjacent clear space is not provided at the bench.	\$ 52	2
NW Trek Wildlife Park	Site Furnishings	342407	BEST PRACTICE: An adjacent clear space is not provided at the bench.	\$ 52	2
NW Trek Wildlife Park	Site Furnishings	342413	BEST PRACTICE: An adjacent clear space is not provided at the bench.	\$ 52	2
NW Trek Wildlife Park	Site Furnishings	342419	BEST PRACTICE: An adjacent clear space is not provided at the bench.	\$ 52	2
NW Trek Wildlife Park	Entrance to Building	342559	The pull side of the accessible door does not have the required maneuvering clearances.	\$ 1,250	1

PHASE ONE						
PARK	CATEGORY	BARRIER ID	BARRIER DESCRIPTION	ESTIMATE	PRIORITY	
NW Trek Wildlife Park	Entrance to Building	342352	The maneuvering clearance at the accessible door is not level and clear.	\$ 1,250	1	
NW Trek Wildlife Park	Entrance to Building	342522	The push side of the accessible door does not have the required maneuvering clearances.	\$ 1,250	1	
NW Trek Wildlife Park	Entrance to Building	342180	The pull side of the accessible door does not have the required maneuvering clearances.	\$ 100	1	
NW Trek Wildlife Park	Entrance to Building	342184	The entry door does not have 80" minimum head clearance from finish floor, excluding door closer hinged bar and door stops which can be 78" minimum.	\$ 500	1	
NW Trek Wildlife Park	Entrance to Building	342426	The push side of the accessible door does not have the required maneuvering clearances.	\$ 1,250	1	
NW Trek Wildlife Park	Entrance to Building	342430	The push side of the accessible door does not have the required maneuvering clearances.	\$ 1,250	1	
NW Trek Wildlife Park	Entrance to Building	342528	The pull side of the accessible door does not have the required maneuvering clearances.	\$ 1,250	1	
NW Trek Wildlife Park	Entrance to Building	342543	The threshold at the accessible door is greater than 1/2" in height.	\$ 179	1	
NW Trek Wildlife Park	Entrance to Building	342544	The threshold at the accessible door is greater than 1/2" in height.	\$ 179	1	
NW Trek Wildlife Park	Entrance to Building	342547	The hardware at the accessible door is mounted below 34".	\$ 676	1	
NW Trek Wildlife Park	Entrance to Building	342548	The hardware at the accessible door is mounted below 34".	\$ 676	1	
NW Trek Wildlife Park	Entrance to Building	342248	The bottom of the entry door vision light is higher than 43".	\$ 5,200	2	
NW Trek Wildlife Park	Entrance to Building	342365	The threshold at the accessible door is greater than 1/2" in height.	\$ 179	1	
NW Trek Wildlife Park	Entrance to Building	342387	The pull side of the accessible door does not have the required maneuvering clearances.	\$ 1,250	1	
NW Trek Wildlife Park	Entrance to Building	342388	The bottom of the entry door vision light is higher than 43".	\$ 2,600	2	
NW Trek Wildlife Park	Entrance to Building	342389	The pull side of the accessible door does not have the required maneuvering clearances.	\$ 1,250	1	
NW Trek Wildlife Park	Entrance to Building	342446	The push side of the accessible door does not have the required maneuvering clearances.	\$ 1,250	1	
NW Trek Wildlife Park	Common Areas	342510	Controls and/or dispensers are not within an allowable reach range.	\$ 1,098	4	
NW Trek Wildlife Park	Interior Access Route	342529	The height of controls throughout the common area are not compliant.	\$ 1,000	1	
NW Trek Wildlife Park	Restroom	342540	The height of controls are not compliant.	\$ 200	3	
NW Trek Wildlife Park	Interior Access Route	342549	The height of controls throughout the common area are not compliant.	\$ 1,000	1	
NW Trek Wildlife Park	Interior Access Route	342375	The height of controls throughout the common area are not compliant.	\$ 500	1	
NW Trek Wildlife Park	Interior Access Route	342293	The height of controls throughout the common area are not compliant.	\$ 500	1	
NW Trek Wildlife Park	Interior Access Route	342250	The height of controls throughout the common area are not compliant.	\$ 2,000	1	
NW Trek Wildlife Park	Interior Access Route	342256	The height of controls throughout the common area are not compliant.	\$ 500	1	
NW Trek Wildlife Park	Interior Access Route	342309	The height of controls throughout the common area are not compliant.	\$ 500	1	
NW Trek Wildlife Park	Interior Access Route	342378	The height of controls throughout the common area are not compliant.	\$ 500	1	
NW Trek Wildlife Park	Interior Access Route	342294	The height of controls throughout the common area are not compliant.	\$ 500	1	
NW Trek Wildlife Park	Common Areas	342421	The sales or service counter does not have an accessible portion with maximum 36" height surface above finish floor or ground.	\$ 1,804	2	
NW Trek Wildlife Park	Common Areas	342561	The dining table does not have compliant knee and toe clearance.	\$ 1,000	2	
NW Trek Wildlife Park	Common Areas	342511	The dining table does not have compliant knee and toe clearance.	\$ 1,000	2	
NW Trek Wildlife Park	Common Areas	342512	A minimum of 5% ADA compliant dining seating and standing spaces are not provided.	\$ 1,000	2	
NW Trek Wildlife Park	Common Areas	342322	The dining table does not have compliant knee and toe clearance.	\$ 1,250	2	
NW Trek Wildlife Park	Interior Access Route	342568	The door has less than 32" clear width.	\$ 2,600	1	
NW Trek Wildlife Park	Interior Access Route	342569	The door has less than 32" clear width.	\$ 2,600	1	
NW Trek Wildlife Park	Interior Access Route	342570	The door has less than 32" clear width.	\$ 2,600	1	
NW Trek Wildlife Park	Interior Access Route	342438	The pull side of the accessible door does not have the required maneuvering clearances.	\$ 1,250	1	
NW Trek Wildlife Park	Interior Access Route	342260	The pull side of the accessible door does not have the required maneuvering clearances.	\$ 1,250	1	
NW Trek Wildlife Park	Interior Access Route	342534	The building does not have elevator access between stories.	\$ 80,000	1	
NW Trek Wildlife Park	Interior Access Route	342258	The building does not have elevator access between stories.	\$ 80,000	1	
NW Trek Wildlife Park	Interior Access Route	342318	The building does not have elevator access between stories.	\$ 80,000	1	
NW Trek Wildlife Park	Interior Access Route	342386	The building does not have elevator access between stories.	\$ 80,000	1	
NW Trek Wildlife Park	Exterior Access Route	342193	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 9,920	1	
NW Trek Wildlife Park	Exterior Access Route	342362	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 7,380	1	
NW Trek Wildlife Park	Exterior Access Route	342187	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 3,000	1	
NW Trek Wildlife Park	Exterior Access Route	342188	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 1,390	1	
NW Trek Wildlife Park	Exterior Access Route	342190	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 1,390	1	
NW Trek Wildlife Park	Exterior Access Route	342099	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 3,270	1	
NW Trek Wildlife Park	Exterior Access Route	342100	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 2,900	1	
NW Trek Wildlife Park	Exterior Access Route	342101	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 11,760	1	
NW Trek Wildlife Park	Exterior Access Route	342102	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 10,550	1	
NW Trek Wildlife Park	Exterior Access Route	342104	The accessible route has gaps in the surface greater than 1/2" wide.	\$ 80	1	
NW Trek Wildlife Park	Exterior Access Route	342133	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 6,890	1	
NW Trek Wildlife Park	Exterior Access Route	342159	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 1,100	1	
NW Trek Wildlife Park	Exterior Access Route	342162	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 3,150	1	
NW Trek Wildlife Park	Exterior Access Route	342163	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 360	1	
NW Trek Wildlife Park	Exterior Access Route	342165	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 3,460	1	
NW Trek Wildlife Park	Exterior Access Route	342166	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 3,120	1	
NW Trek Wildlife Park	Exterior Access Route	342168	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 7,110	1	
NW Trek Wildlife Park	Exterior Access Route	342169	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 13,700	1	
NW Trek Wildlife Park	Exterior Access Route	342170	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 3,300	1	
NW Trek Wildlife Park	Exterior Access Route	342172	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 2,780	1	
NW Trek Wildlife Park	Exterior Access Route	342173	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 2,170	1	
NW Trek Wildlife Park	Exterior Access Route	342175	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 3,470	1	
NW Trek Wildlife Park	Exterior Access Route	342350	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 1,040	1	
NW Trek Wildlife Park	Exterior Access Route	342351	The accessible route has gaps in the surface greater than 1/2" wide.	\$ 71	1	
NW Trek Wildlife Park	Exterior Access Route	342353	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 7,360	1	
NW Trek Wildlife Park	Exterior Access Route	342185	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 4,550	1	
NW Trek Wildlife Park	Exterior Access Route	342186	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 2,420	1	
NW Trek Wildlife Park	Exterior Access Route	342357	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 1,950	1	
NW Trek Wildlife Park	Exterior Access Route	342358	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 2,060	1	
NW Trek Wildlife Park	Exterior Access Route	342359	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 1,090	1	
NW Trek Wildlife Park	Exterior Access Route	342244	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 650	1	
NW Trek Wildlife Park	Exterior Access Route	342245	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 250	1	

PHASE ONE						
PARK	CATEGORY	BARRIER ID	BARRIER DESCRIPTION	ESTIMATE	PRIORITY	
NW Trek Wildlife Park	Exterior Access Route	342579	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 100	1	
NW Trek Wildlife Park	Exterior Access Route	342555	WASHINGTON: An exterior accessible route is not provided.	\$ 2,464	1	
NW Trek Wildlife Park	Exterior Access Route	342324	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 3,520	1	
NW Trek Wildlife Park	Playground	342326	An accessible route to at least one of each type of ground component within the play area has not been provided.	\$ 79	2	
NW Trek Wildlife Park	Exterior Access Route	342329	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 2,040	1	
NW Trek Wildlife Park	Exterior Access Route	342331	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 590	1	
NW Trek Wildlife Park	Exterior Access Route	342332	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 710	1	
NW Trek Wildlife Park	Exterior Access Route	342334	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 450	1	
NW Trek Wildlife Park	Exterior Access Route	342335	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 2,100	1	
NW Trek Wildlife Park	Exterior Access Route	342336	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 860	1	
NW Trek Wildlife Park	Exterior Access Route	342342	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 540	1	
NW Trek Wildlife Park	Exterior Access Route	342343	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 420	1	
NW Trek Wildlife Park	Exterior Access Route	342239	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 1,430	1	
NW Trek Wildlife Park	Exterior Access Route	342240	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 2,570	1	
NW Trek Wildlife Park	Exterior Access Route	342241	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 1,960	1	
NW Trek Wildlife Park	Exterior Access Route	342242	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 1,670	1	
NW Trek Wildlife Park	Exterior Access Route	342243	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 1,240	1	
NW Trek Wildlife Park	Exterior Access Route	342361	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 3,260	1	
NW Trek Wildlife Park	Exterior Access Route	342439	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 3,350	1	
NW Trek Wildlife Park	Exterior Access Route	342440	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 2,950	1	
NW Trek Wildlife Park	Exterior Access Route	342441	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 2,070	1	
NW Trek Wildlife Park	Exterior Access Route	342191	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 1,300	1	
NW Trek Wildlife Park	Exterior Access Route	342319	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 840	1	
NW Trek Wildlife Park	Exterior Access Route	342347	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 6,040	1	
NW Trek Wildlife Park	Exterior Access Route	342349	The accessible route has gaps in the surface greater than 1/2" wide.	\$ 8	1	
NW Trek Wildlife Park	Exterior Access Route	342195	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 870	1	
NW Trek Wildlife Park	Exterior Access Route	342354	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 6,880	1	
NW Trek Wildlife Park	Exterior Access Route	342355	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 2,750	1	
NW Trek Wildlife Park	Exterior Access Route	342356	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 4,480	1	
NW Trek Wildlife Park	Exterior Access Route	342415	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 2,210	1	
NW Trek Wildlife Park	Exterior Access Route	342416	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 1,110	1	
NW Trek Wildlife Park	Exterior Access Route	342417	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 3,360	1	
NW Trek Wildlife Park	Exterior Access Route	342418	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 1,260	1	
NW Trek Wildlife Park	Exterior Access Route	342403	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 2,760	1	
NW Trek Wildlife Park	Exterior Access Route	342405	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 1,290	1	
NW Trek Wildlife Park	Exterior Access Route	342406	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 5,430	1	
NW Trek Wildlife Park	Exterior Access Route	342408	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 3,300	1	
NW Trek Wildlife Park	Exterior Access Route	342409	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 8,500	1	
NW Trek Wildlife Park	Exterior Access Route	342412	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 9,720	1	
NW Trek Wildlife Park	Exterior Access Route	342414	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 2,630	1	
NW Trek Wildlife Park	Exterior Access Route	342125	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 4,760	1	
NW Trek Wildlife Park	Exterior Access Route	342127	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 3,870	1	
NW Trek Wildlife Park	Exterior Access Route	342178	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 1,860	1	
NW Trek Wildlife Park	Exterior Access Route	342176	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 1,760	1	
NW Trek Wildlife Park	Interior Access Route	342571	The carpet in the common area has an unstable pad or backing.	\$ 778	1	
NW Trek Wildlife Park	Interior Access Route	342572	The carpet in the common area has an unstable pad or backing.	\$ 239	1	
NW Trek Wildlife Park	Playground	342325	The ground surface has not been inspected and maintained regularly.	\$ 450	2	
NW Trek Wildlife Park	Playground	342330	The ground surface has not been inspected and maintained regularly.	\$ 450	2	
NW Trek Wildlife Park	Playground	342333	The ground surface has not been inspected and maintained regularly.	\$ 861	2	
NW Trek Wildlife Park	Interior Access Route	342292	The interior accessible route has non-compliant slopes.	\$ 852	1	
NW Trek Wildlife Park	Interior Access Route	342290	The interior accessible route has non-compliant slopes.	\$ 1,910	1	
NW Trek Wildlife Park	Interior Access Route	342291	The interior accessible route has non-compliant slopes.	\$ 2,046	1	
NW Trek Wildlife Park	Kitchen	342565	The accessible route in the U-shaped kitchen is less than 60" wide.	\$ 93	2	
NW Trek Wildlife Park	Kitchen	342562	The height of the counter is greater than 34".	\$ 1,986	2	
NW Trek Wildlife Park	Kitchen	342371	The height of the counter is greater than 34".	\$ 1,986	2	
NW Trek Wildlife Park	Kitchen	342373	The oven does not have a compliant adjacent work surface.	\$ 1,985	4	
NW Trek Wildlife Park	Kitchen	342374	The location of the controls requires reaching across burners.	\$ 759	4	
NW Trek Wildlife Park	Accessible Parking	342209	The slope of the parking space is greater than 1:50 (2%).	\$ 6,300	1	
NW Trek Wildlife Park	Accessible Parking	342211	The access aisle slope is greater than 1:50 (2%).	\$ 5,000	1	
NW Trek Wildlife Park	Accessible Parking	342212	The access aisle is less than 60" wide.	\$ 420	1	
NW Trek Wildlife Park	Accessible Parking	342213	Accessible car aisle markings do not define the aisle width.	\$ 420	1	
NW Trek Wildlife Park	Accessible Parking	342214	The slope of the parking space is greater than 1:50 (2%).	\$ 6,300	1	
NW Trek Wildlife Park	Accessible Parking	342215	The access aisle slope is greater than 1:50 (2%).	\$ 5,000	1	
NW Trek Wildlife Park	Accessible Parking	342216	The slope of the parking space is greater than 1:50 (2%).	\$ 6,300	1	
NW Trek Wildlife Park	Accessible Parking	342217	The slope of the parking space is greater than 1:50 (2%).	\$ 6,300	1	
NW Trek Wildlife Park	Accessible Parking	342218	The access aisle slope is greater than 1:50 (2%).	\$ 5,000	1	
NW Trek Wildlife Park	Accessible Parking	342220	The access aisle slope is greater than 1:50 (2%).	\$ 5,000	1	
NW Trek Wildlife Park	Accessible Parking	342225	The access aisle slope is greater than 1:50 (2%).	\$ 5,000	1	
NW Trek Wildlife Park	Accessible Parking	342228	The access aisle is less than 60" wide.	\$ 420	1	
NW Trek Wildlife Park	Accessible Parking	342231	The access aisle slope is greater than 1:50 (2%).	\$ 5,000	1	
NW Trek Wildlife Park	Accessible Parking	342236	The access aisle slope is greater than 1:50 (2%).	\$ 5,000	1	
NW Trek Wildlife Park	Accessible Parking	342237	The slope of the parking space is greater than 1:50 (2%).	\$ 6,300	1	
NW Trek Wildlife Park	Accessible Parking	342219	The parking space slope is greater than 1:50 (2%).	\$ 6,300	1	
NW Trek Wildlife Park	Accessible Parking	342222	The parking space slope is greater than 1:50 (2%).	\$ 6,300	1	
NW Trek Wildlife Park	Accessible Parking	342224	The parking space slope is greater than 1:50 (2%).	\$ 6,300	1	

PARK	CATEGORY	BARRIER ID	PHASE ONE		ESTIMATE	PRIORITY
			BARRIER DESCRIPTION			
NW Trek Wildlife Park	Accessible Parking	342226	The parking space slope is greater than 1:50 (2%).		\$ 6,300	1
NW Trek Wildlife Park	Accessible Parking	342229	The parking space slope is greater than 1:50 (2%).		\$ 6,300	1
NW Trek Wildlife Park	Accessible Parking	342232	The parking space slope is greater than 1:50 (2%).		\$ 6,300	1
NW Trek Wildlife Park	Accessible Parking	342234	The parking space slope is greater than 1:50 (2%).		\$ 6,300	1
NW Trek Wildlife Park	Accessible Parking	342554	WASHINGTON: A van stall, access aisle, and signage are not provided, and the slope and ground surface is not compliant.		\$ 11,300	1
NW Trek Wildlife Park	Site Furnishings	342192	The picnic table does not allow a clear space for forward wheelchair approach with knee and toe clearance.		\$ 1,300	2
NW Trek Wildlife Park	Site Furnishings	342360	The picnic table does not allow a clear space for forward wheelchair approach with knee and toe clearance.		\$ 1,300	2
NW Trek Wildlife Park	Site Furnishings	342402	The picnic table does not allow a clear space for forward wheelchair approach with knee and toe clearance.		\$ 1,300	2
NW Trek Wildlife Park	Exterior Access Route	342194	Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the accessible route.		\$ 728	1
NW Trek Wildlife Park	Interior Access Route	342523	Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the interior accessible route.		\$ 728	1
NW Trek Wildlife Park	Interior Access Route	342525	Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the interior accessible route.		\$ 728	1
NW Trek Wildlife Park	Interior Access Route	342503	Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the interior accessible route.		\$ 400	1
NW Trek Wildlife Park	Interior Access Route	342509	Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the interior accessible route.		\$ 400	1
NW Trek Wildlife Park	Restroom	342208	The restroom circulation path is not free of objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.		\$ 200	2
NW Trek Wildlife Park	Exterior Access Route	342249	Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the accessible route.		\$ 1,456	1
NW Trek Wildlife Park	Interior Access Route	342257	Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the interior accessible route.		\$ 1,456	1
NW Trek Wildlife Park	Interior Access Route	342453	Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the interior accessible route.		\$ 728	1
NW Trek Wildlife Park	Interior Access Route	342262	Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the interior accessible route.		\$ 728	1
NW Trek Wildlife Park	Exterior Access Route	342401	Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the accessible route.		\$ 728	1
NW Trek Wildlife Park	Restroom	342394	The restroom circulation path is not free of objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.		\$ 200	2
NW Trek Wildlife Park	Restroom	342399	The restroom circulation path is not free of objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.		\$ 200	2
NW Trek Wildlife Park	Restroom	342269	The restroom circulation path is not free of objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.		\$ 200	2
NW Trek Wildlife Park	Restroom	342270	The restroom circulation path is not free of objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.		\$ 500	2
NW Trek Wildlife Park	Exterior Access Route	342556	The ramp is required but not provided.		\$ 6,620	1
NW Trek Wildlife Park	Exterior Access Route	342140	WASHINGTON: The slopes of the ramp are not compliant.		\$ 1,986	1
NW Trek Wildlife Park	Exterior Access Route	342141	WASHINGTON: The slopes of the ramp are not compliant.		\$ 1,986	1
NW Trek Wildlife Park	Restroom	342567	The entire restroom is not compliant due to limited room dimensions.		\$ 15,000	3
NW Trek Wildlife Park	Restroom	342367	The entire restroom is not compliant due to limited room dimensions.		\$ 15,000	3
NW Trek Wildlife Park	Restroom	342577	The coat hook is not within an allowable reach range.		\$ 115	3
NW Trek Wildlife Park	Restroom	342541	The coat hook is not within an allowable reach range.		\$ 115	3
NW Trek Wildlife Park	Restroom	342206	The coat hook is not within an allowable reach range.		\$ 115	3
NW Trek Wildlife Park	Restroom	342280	The coat hook is not within an allowable reach range.		\$ 115	3
NW Trek Wildlife Park	Restroom	342283	The coat hook is not within an allowable reach range.		\$ 115	3
NW Trek Wildlife Park	Restroom	342273	The hardware at the wheelchair stall door is not compliant.		\$ 293	3
NW Trek Wildlife Park	Restroom	342271	The wheelchair stall door is not self closing.		\$ 293	3
NW Trek Wildlife Park	Restroom	342272	The hardware at the wheelchair stall door is not compliant.		\$ 293	3
NW Trek Wildlife Park	Restroom	342573	The lavatory faucet hardware is not compliant.		\$ 555	3
NW Trek Wildlife Park	Restroom	342574	The lavatory is mounted higher than 34" to the higher of the rim or counter.		\$ 720	3
NW Trek Wildlife Park	Restroom	342575	Knee clearance is not provided.		\$ 742	3
NW Trek Wildlife Park	Restroom	342578	Clear floor space is not provided.		\$ 3,000	3
NW Trek Wildlife Park	Restroom	342277	The ambulatory stall door is not compliant.		\$ 500	3
NW Trek Wildlife Park	Restroom	342279	The side grab bars are not compliant in the ambulatory stall.		\$ 1,420	3
NW Trek Wildlife Park	Restroom	342536	The water closet in a single user / unisex restroom does not have the required clearance.		\$ 1,368	3
NW Trek Wildlife Park	Restroom	342537	The rear grab bar at the water closet is not compliant.		\$ 355	3
NW Trek Wildlife Park	Restroom	342538	The side grab bar at the water closet is not compliant.		\$ 355	3
NW Trek Wildlife Park	Restroom	342539	WASHINGTON: The toilet paper dispenser location is not compliant.		\$ 293	3
NW Trek Wildlife Park	Restroom	342205	The toilet seat cover dispenser is not within an allowable reach range.		\$ 280	3
NW Trek Wildlife Park	Restroom	342198	The water closet in a wheelchair stall in a multi-stall restroom does not have the required clearance.		\$ 1,368	3
NW Trek Wildlife Park	Restroom	342199	WASHINGTON: The toilet paper dispenser location is not compliant.		\$ 293	3
NW Trek Wildlife Park	Restroom	342200	The space between the grab bar and projecting objects above the grab bar is less than 12" minimum.		\$ 100	3
NW Trek Wildlife Park	Restroom	342201	The side grab bar at the water closet is not compliant.		\$ 355	3
NW Trek Wildlife Park	Restroom	342202	The rear grab bar at the water closet is not compliant.		\$ 355	3
NW Trek Wildlife Park	Restroom	342203	The centerline of the toilet in the wheelchair stall is not 16" minimum to 18" maximum from the sidewall.		\$ 630	3
NW Trek Wildlife Park	Restroom	342204	The height of the water closet is not 17" minimum to 19" maximum above finished floor.		\$ 630	3
NW Trek Wildlife Park	Restroom	342282	The water closet in a wheelchair stall in a multi-stall restroom does not have the required clearance.		\$ 1,368	3
NW Trek Wildlife Park	Restroom	342285	WASHINGTON: The toilet paper dispenser location is not compliant.		\$ 293	3
NW Trek Wildlife Park	Restroom	342287	The rear grab bar at the water closet is not compliant.		\$ 355	3
NW Trek Wildlife Park	Restroom	342288	The centerline of the toilet in the wheelchair stall is not 16" minimum to 18" maximum from the sidewall.		\$ 630	3
NW Trek Wildlife Park	Restroom	342289	The height of the water closet is not 17" minimum to 19" maximum above finished floor.		\$ 630	3

PHASE ONE						
PARK	CATEGORY	BARRIER ID	BARRIER DESCRIPTION	ESTIMATE	PRIORITY	
NW Trek Wildlife Park	Restroom	342207	An ambulatory stall is not provided.	\$ 1,975	3	
NW Trek Wildlife Park	Restroom	342278	The ambulatory stall does not have the required dimensions and vertical grab bars are missing.	\$ 1,975	3	
NW Trek Wildlife Park	Restroom	363276	ANSI A117.1: A vertical side grab bar is not located above the horizontal bar.	\$ 443	3	
NW Trek Wildlife Park	Restroom	363272	ANSI A117.1-: A vertical side grab bar is not located in the wheelchair stall.	\$ 443	3	
NW Trek Wildlife Park	Restroom	342286	WASHINGTON: A vertical side grab bar is not present in the wheelchair stall. The side grab bar is not compliant.	\$ 443	3	
NW Trek Wildlife Park	Restroom	342284	WASHINGTON: The toilet paper dispenser location is not compliant.	\$ 366	3	
NW Trek Wildlife Park	Restroom	342281	WASHINGTON: The toilet paper dispenser location is not compliant.	\$ 366	3	
NW Trek Wildlife Park	Concession Stand	342500	The service counter height is greater than 36" and/or the counter length is less than 36", where a parallel approach is present.	\$ 1,804	2	
NW Trek Wildlife Park	Concession Stand	342501	The service counter height is greater than 36" where a parallel approach is present.	\$ 1,804	2	
NW Trek Wildlife Park	Concession Stand	342502	The items on the self service shelves and the dispensing devices must be within reach range.	\$ -	2	
NW Trek Wildlife Park	Trail	342492	The inaccessible trail or trail segment does not have signage with trail details.	\$ 350	4	
NW Trek Wildlife Park	Trail	342493	The inaccessible trail or trail segment does not have signage with trail details.	\$ 280	4	
NW Trek Wildlife Park	Trail	342479	BEST PRACTICE: The inaccessible trail or trail segment does not have signage with trail details.	\$ 350	4	
NW Trek Wildlife Park	Trail	342480	The inaccessible trail or trail segment does not have signage with trail details.	\$ 280	4	
NW Trek Wildlife Park	Trail	342462	BEST PRACTICE: The inaccessible trail or trail segment does not have signage with trail details.	\$ -	4	
NW Trek Wildlife Park	Trail	342463	BEST PRACTICE: The inaccessible trail or trail segment does not have signage with trail details.	\$ 280	4	
NW Trek Wildlife Park	Kitchen	342563	The accessible sink is not installed with the front of the higher of the rim 34" maximum above finished floor.	\$ 720	2	
NW Trek Wildlife Park	Kitchen	342564	Sinks do not have knee and/or toe clearance.	\$ 1,986	2	
NW Trek Wildlife Park	Kitchen	342372	The kitchen sink does not have knee and toe clearance and the height of the sink rim is greater than 34".	\$ 900	2	
NW Trek Wildlife Park	Exterior Access Route	342135	Handrail extensions are not compliant.	\$ 326	1	
NW Trek Wildlife Park	Exterior Access Route	342410	Handrail extensions are not compliant.	\$ 326	1	
NW Trek Wildlife Park	Exterior Access Route	342411	Treads have slopes greater than 1:48.	\$ 2,142	1	
NW Trek Wildlife Park	Interior Access Route	342530	Stairs have open risers.	\$ 10,920	1	
NW Trek Wildlife Park	Interior Access Route	342531	Handrails are not compliant.	\$ 2,445	1	
NW Trek Wildlife Park	Interior Access Route	342532	Handrails are not provided.	\$ 2,445	1	
NW Trek Wildlife Park	Interior Access Route	342533	Handrail extensions are not compliant.	\$ 326	1	
NW Trek Wildlife Park	Exterior Access Route	342557	Stairs have open risers.	\$ 2,520	1	
NW Trek Wildlife Park	Exterior Access Route	342558	Handrails are not provided.	\$ 1,304	1	
NW Trek Wildlife Park	Interior Access Route	342303	ADVISORY: The stair treads and edge of top landing do not have visual contrast on the leading edge.	\$ -	2	
NW Trek Wildlife Park	Interior Access Route	342304	Handrails are not provided.	\$ 1,956	1	
NW Trek Wildlife Park	Interior Access Route	342305	Steps do not have compliant tread depths.	\$ 765	1	
NW Trek Wildlife Park	Interior Access Route	342307	Handrails are not provided.	\$ 1,956	1	
NW Trek Wildlife Park	Interior Access Route	342308	Steps do not have compliant tread depths.	\$ 765	1	
NW Trek Wildlife Park	Interior Access Route	342310	ADVISORY: The stair treads and edge of top landing do not have visual contrast on the leading edge.	\$ -	2	
NW Trek Wildlife Park	Interior Access Route	342311	Handrails are not provided.	\$ 1,956	1	
NW Trek Wildlife Park	Interior Access Route	342312	Steps do not have compliant tread depths.	\$ 765	1	
NW Trek Wildlife Park	Interior Access Route	342313	ADVISORY: The stair treads and edge of top landing do not have visual contrast on the leading edge.	\$ -	2	
NW Trek Wildlife Park	Interior Access Route	342314	Handrails are not provided.	\$ 978	1	
NW Trek Wildlife Park	Interior Access Route	342315	Handrails are not compliant.	\$ 978	1	
NW Trek Wildlife Park	Interior Access Route	342316	Handrail extensions are not compliant.	\$ 163	1	
NW Trek Wildlife Park	Interior Access Route	342514	ADVISORY: The stair treads and edge of top landing do not have visual contrast on the leading edge.	\$ -	2	
NW Trek Wildlife Park	Interior Access Route	342515	Handrails are not compliant.	\$ 2,445	1	
NW Trek Wildlife Park	Interior Access Route	342516	Handrail extensions are not compliant.	\$ 489	1	
NW Trek Wildlife Park	Exterior Access Route	342139	Handrails are not compliant.	\$ 407	1	
NW Trek Wildlife Park	Exterior Access Route	342252	Handrails are not provided.	\$ 3,667	1	
NW Trek Wildlife Park	Interior Access Route	342253	Handrail extensions are not compliant.	\$ 326	1	
NW Trek Wildlife Park	Interior Access Route	342254	ADVISORY: The stair treads and edge of top landing do not have visual contrast on the leading edge.	\$ -	2	
NW Trek Wildlife Park	Interior Access Route	342255	Stairways along the means of egress are not compliant.	\$ 14,280	1	
NW Trek Wildlife Park	Exterior Access Route	342337	Handrails are not provided.	\$ 2,119	1	
NW Trek Wildlife Park	Exterior Access Route	342338	Handrails are not compliant.	\$ 2,119	1	
NW Trek Wildlife Park	Exterior Access Route	342341	Handrails are not provided.	\$ 1,304	1	
NW Trek Wildlife Park	Exterior Access Route	342345	Handrails are not provided.	\$ 9,291	1	
NW Trek Wildlife Park	Exterior Access Route	342296	Stairs have open risers.	\$ 15,120	1	
NW Trek Wildlife Park	Exterior Access Route	342297	Steps do not have uniform and compliant riser heights.	\$ 5,661	1	
NW Trek Wildlife Park	Exterior Access Route	342298	Handrails are not compliant.	\$ 4,401	1	
NW Trek Wildlife Park	Exterior Access Route	342299	Handrail extensions are not compliant.	\$ 652	1	
NW Trek Wildlife Park	Exterior Access Route	342381	Handrail extensions are not compliant.	\$ 326	1	
NW Trek Wildlife Park	Exterior Access Route	342382	Handrails are not compliant.	\$ 4,075	1	
NW Trek Wildlife Park	Exterior Access Route	342383	Handrails are not provided.	\$ 815	1	
NW Trek Wildlife Park	Exterior Access Route	342384	Steps do not have compliant riser heights.	\$ 3,672	1	
NW Trek Wildlife Park	Site Furnishings	342267	The vending machines are not accessible.	\$ 6,508	2	
NW Trek Wildlife Park	Employee Work Areas	342261	The work surface is not compliant.	\$ 1,030	2	
NW Trek Wildlife Park	Exterior Access Route	342138	Handrails are not compliant.	\$ 407	1	
Old Town Dock	Exterior Access Route	326040	Sidewalk has areas of vertical level changes in excess of 1/4" that are not ramped.	\$ 79	1	
Old Town Dock	Exterior Access Route	326035	Sidewalk has areas of vertical level changes in excess of 1/4" that are not ramped.	\$ 356	1	
Old Town Dock	Exterior Access Route	326032	Sidewalk has areas of vertical level changes in excess of 1/4" that are not ramped.	\$ 118	1	
Old Town Dock	Exterior Access Route	326036	Sidewalk has areas of vertical level changes in excess of 1/4" that are not ramped. Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the interior accessible route.	\$ 198	1	
People's Community Center	Interior Access Route	324497		\$ 728	1	
People's Community Center	Exterior Access Route	319545	WASHINGTON: The slope of the curb ramp run is not compliant.	\$ 1,750	1	
People's Community Center	Exterior Access Route	319554	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 5,549	1	
People's Community Center	Exterior Access Route	319540	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 1,090	1	
People's Community Center	Exterior Access Route	319541	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 3,468	1	

PHASE ONE						
PARK	CATEGORY	BARRIER ID	BARRIER DESCRIPTION	ESTIMATE	PRIORITY	
People's Community Center	Exterior Access Route	319542	The accessible route has areas of vertical level changes in excess of 1/4" that are not beveled or ramped.	\$ 8	1	
People's Community Center	Exterior Access Route	319543	The accessible route has areas of vertical level changes in excess of 1/4" that are not beveled or ramped.	\$ 8	1	
People's Community Center	Exterior Access Route	319544	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 4,637	1	
People's Community Center	Exterior Access Route	319548	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 2,616	1	
People's Community Center	Exterior Access Route	319549	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 3,825	1	
People's Community Center	Exterior Access Route	319550	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 2,299	1	
People's Community Center	Exterior Access Route	319551	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 991	1	
People's Community Center	Exterior Access Route	319552	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 3,052	1	
People's Community Center	Accessible Parking	319558	The slope of the parking space is greater than 1:50 (2%).	\$ 6,300	1	
People's Community Center	Accessible Parking	319561	The access aisle slope is greater than 1:50 (2%).	\$ 5,000	1	
People's Community Center	Accessible Parking	319562	The parking space slope is greater than 1:50 (2%).	\$ 6,300	1	
People's Community Center	Site Furnishings	319547	The picnic table does not allow a clear space for forward wheelchair approach with knee and toe clearance. WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 1,300	2	
People's Community Center	Exterior Access Route	319553	WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 140	3	
People's Community Center	Exterior Access Route	319555	WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 176	3	
People's Community Center	Exterior Access Route	319556	Handrails are not provided on one side of the stairway.	\$ 978	1	
People's Community Center	Exterior Access Route	319557	Handrails are not compliant.	\$ 978	1	
People's Community Center	Amenity not evaluated	319437	The amenity cannot be accessed and, therefore, cannot be evaluated.	\$ -	0	
People's Community Center	Amenity not evaluated	319486	The amenity cannot be accessed and, therefore, cannot be evaluated.	\$ -	0	
People's Community Center	Entrance to Building	319492	The threshold at the accessible door is greater than 1/2" in height.	\$ 179	1	
People's Community Center	Entrance to Building	319516	The bottom of the entry door vision light is higher than 43".	\$ 5,200	2	
People's Community Center	Entrance to Building	319419	The accessible door has less than 80" head clearance (excluding closer).	\$ 2,600	1	
People's Community Center	Entrance to Building	319491	The threshold at the accessible door is greater than 1/2" in height.	\$ 179	1	
People's Community Center	Entrance to Building	319456	The push side of the accessible door does not have the required maneuvering clearances.	\$ 1,250	1	
People's Community Center	Entrance to Building	319458	The threshold at the accessible door is greater than 1/2" in height.	\$ 179	1	
People's Community Center	Interior Access Route	319438	The height of controls throughout the common area are not compliant.	\$ 500	1	
People's Community Center	Interior Access Route	319441	The height of controls throughout the common area are not compliant.	\$ 1,000	1	
People's Community Center	Interior Access Route	319431	The height of controls throughout the common area are not compliant.	\$ 500	1	
People's Community Center	Interior Access Route	319445	The height of controls throughout the common area are not compliant.	\$ 500	1	
People's Community Center	Interior Access Route	319496	The height of controls throughout the common area are not compliant.	\$ 500	1	
People's Community Center	Interior Access Route	319468	The height of controls are not compliant.	\$ 500	1	
People's Community Center	Interior Access Route	319522	The height of controls throughout the common area are not compliant.	\$ 500	1	
People's Community Center	Interior Access Route	319479	The height of controls throughout the common area are not compliant.	\$ 500	1	
People's Community Center	Interior Access Route	319435	The door does not have 80" minimum head clearance from finish floor, excluding door closer hinged bar and door stops which can be 78" minimum.	\$ 5,200	1	
People's Community Center	Interior Access Route	319512	The push side of the accessible door does not have the required maneuvering clearances.	\$ 1,250	1	
People's Community Center	Interior Access Route	319513	The bottom of the door vision light is higher than 43" and less than 66".	\$ 2,600	2	
People's Community Center	Interior Access Route	319461	The door does not have 80" minimum head clearance from finish floor, excluding door closer hinged bar and door stops which can be 78" minimum.	\$ 5,200	1	
People's Community Center	Interior Access Route	319498	The door does not have 80" minimum head clearance from finish floor, excluding door closer hinged bar and door stops which can be 78" minimum.	\$ 5,200	1	
People's Community Center	Interior Access Route	319444	The door does not have 80" minimum head clearance from finish floor, excluding door closer hinged bar and door stops which can be 78" minimum.	\$ 5,200	1	
People's Community Center	Interior Access Route	319518	The bottom of the door vision light is higher than 43" and less than 66".	\$ 5,200	2	
People's Community Center	Interior Access Route	319501	The bottom of the door vision light is higher than 43" and less than 66".	\$ 5,200	2	
People's Community Center	Interior Access Route	319464	The bottom of the door vision light is higher than 43" and less than 66".	\$ 2,600	2	
People's Community Center	Interior Access Route	319471	The push side of the accessible door does not have the required maneuvering clearances.	\$ 100	1	
People's Community Center	Interior Access Route	319472	The pull side of the accessible door does not have the required maneuvering clearances.	\$ 1,250	1	
People's Community Center	Interior Access Route	319424	The door does not have 80" minimum head clearance from finish floor, excluding door closer hinged bar and door stops which can be 78" minimum.	\$ 5,200	1	
People's Community Center	Interior Access Route	319447	The door does not have 80" minimum head clearance from finish floor, excluding door closer hinged bar and door stops which can be 78" minimum.	\$ 2,600	1	
People's Community Center	Interior Access Route	319384	The door does not have 80" minimum head clearance from finish floor, excluding door closer hinged bar and door stops which can be 78" minimum.	\$ 2,600	1	
People's Community Center	Interior Access Route	319520	The bottom of the door vision light is higher than 43" and less than 66".	\$ 5,200	2	
People's Community Center	Interior Access Route	319507	The bottom of the door vision light is higher than 43" and less than 66".	\$ 2,600	2	
People's Community Center	Interior Access Route	319509	The pull side of the accessible door does not have the required maneuvering clearances.	\$ 200	1	
People's Community Center	Interior Access Route	319524	The bottom of the door vision light is higher than 43" and less than 66".	\$ 2,600	2	
People's Community Center	Interior Access Route	319414	The door does not have 80" minimum head clearance from finish floor, excluding door closer hinged bar and door stops which can be 78" minimum.	\$ 2,600	1	
People's Community Center	Interior Access Route	319477	The bottom of the door vision light is higher than 43" and less than 66".	\$ 5,200	2	
People's Community Center	Interior Access Route	319451	The door does not have 80" minimum head clearance from finish floor, excluding door closer hinged bar and door stops which can be 78" minimum.	\$ 5,200	1	
People's Community Center	Interior Access Route	319405	Knee and toe clearance is not provided at the lower level fountain. A minimum 30" wide section of the counter is not a minimum height of 28" and maximum height of 34" with knee and toe clearance.	\$ 980	4	
People's Community Center	Kitchen	319466	The oven or built-in microwave does not have a compliant adjacent work surface.	\$ 794	4	
People's Community Center	Kitchen	319467	The oven or built-in microwave does not have a compliant adjacent work surface.	\$ 2,382	4	
People's Community Center	Locker and Dressing Rooms	319386	The locker room does not have a compliant bench. The pool lift seat does not allow a stop at 16" minimum and 19" maximum measured from the deck to the top of the seat surface when in the raised (load) position.	\$ 789	3	
People's Community Center	Swimming Pools	319538	The pool lift seat does not allow a stop at 16" minimum and 19" maximum measured from the deck to the top of the seat surface when in the raised (load) position.	\$ 4,140	1	
People's Community Center	Swimming Pools	319539	A clear deck space on the side of the seat opposite the water is not provided.	\$ 1,789	1	
People's Community Center	Interior Access Route	319429	Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the interior accessible route.	\$ 1,456	1	
People's Community Center	Interior Access Route	319469	Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the interior accessible route.	\$ 1,456	1	
People's Community Center	Interior Access Route	319426	Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the interior accessible route.	\$ 728	1	

PHASE ONE					
PARK	CATEGORY	BARRIER ID	BARRIER DESCRIPTION	ESTIMATE	PRIORITY
People's Community Center	Interior Access Route	319448	Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the interior accessible route.	\$ 728	1
People's Community Center	Restroom	319387	The restroom circulation path is not free of objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.	\$ 250	2
People's Community Center	Restroom	319375	The restroom circulation path is not free of objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.	\$ 500	2
People's Community Center	Interior Access Route	319508	Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the interior accessible route.	\$ 728	1
People's Community Center	Interior Access Route	319532	Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the interior accessible route.	\$ 1,456	1
People's Community Center	Interior Access Route	319533	Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the interior accessible route.	\$ 1,456	1
People's Community Center	Interior Access Route	319534	Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the interior accessible route.	\$ 728	1
People's Community Center	Interior Access Route	319478	Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the interior accessible route.	\$ 728	1
People's Community Center	Restroom	319397	The restroom circulation path is not free of objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.	\$ 250	2
People's Community Center	Restroom	319376	The restroom circulation path is not free of objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.	\$ 500	2
People's Community Center	Interior Access Route	319462	The ramp running slope exceeds 1:12 (8.33%).	\$ 19,860	1
People's Community Center	Restroom	319388	The wheelchair stall door is not self closing.	\$ 293	3
People's Community Center	Restroom	319393	The push side of the door does not have the required maneuvering clearances.	\$ 2,600	3
People's Community Center	Restroom	319395	The pull side of the accessible door does not have the required maneuvering clearances.	\$ 2,600	3
People's Community Center	Restroom	319371	The pull side of the accessible door does not have the required maneuvering clearance.	\$ 2,600	3
People's Community Center	Restroom	319373	The push side of the door does not have the required maneuvering clearances.	\$ 2,600	3
People's Community Center	Restroom	319380	The wheelchair stall door is not self closing.	\$ 293	3
People's Community Center	Restroom	319385	The door does not have 80" minimum head clearance from finish floor, excluding door closer hinged bar, which can be 78" minimum.	\$ 2,600	1
People's Community Center	Restroom	319402	The pull side of the accessible door does not have the required maneuvering clearances.	\$ 1,250	3
People's Community Center	Restroom	319372	The pull side of the accessible door does not have the required maneuvering clearances.	\$ 2,600	3
People's Community Center	Restroom	319377	The wheelchair stall door is not self closing.	\$ 293	3
People's Community Center	Restroom	319411	The lavatory is mounted higher than 34" to the higher of the rim or counter.	\$ 720	3
People's Community Center	Restroom	319398	Pipes are not insulated.	\$ 65	4
People's Community Center	Restroom	319390	The rear grab bar at the water closet is not compliant.	\$ 355	3
People's Community Center	Restroom	319391	The centerline of the toilet in the wheelchair stall is not 16" minimum to 18" maximum from the sidewall.	\$ 630	3
People's Community Center	Restroom	319406	The water closet in a single user / unisex restroom does not have the required clearance.	\$ 1,368	3
People's Community Center	Restroom	319407	The rear grab bar at the water closet is not compliant.	\$ 355	3
People's Community Center	Restroom	319408	The water closet in a single user / unisex restroom does not have the required clearance.	\$ 1,368	3
People's Community Center	Restroom	319409	The rear grab bar at the water closet is not compliant.	\$ 355	3
People's Community Center	Restroom	319410	The side grab bar at the water closet is not compliant.	\$ 355	3
People's Community Center	Restroom	319400	The centerline of the toilet in the wheelchair stall is not 16" minimum to 18" maximum from the sidewall.	\$ 630	3
People's Community Center	Restroom	319401	The rear grab bar at the water closet is not compliant.	\$ 355	3
People's Community Center	Restroom	319381	The flush control is located on the closed side.	\$ 313	3
People's Community Center	Interior Access Route	319495	Handrails are not compliant.	\$ 1,467	1
People's Community Center	Interior Access Route	319473	Handrails are not provided.	\$ 815	1
People's Community Center	Interior Access Route	319474	Handrail extensions are not compliant.	\$ 326	1
People's Community Center	Interior Access Route	319420	Handrails are not provided.	\$ 1,141	1
People's Community Center	Interior Access Route	319422	Handrail extensions are not compliant.	\$ 163	1
People's Community Center	Common Areas	319412	The vending machines have operable parts which are not within reach range.	\$ 3,254	2
Point Defiance Park	Exterior Access Route	332575	Stairs have open risers.	\$ 8,400	1
Point Defiance Zoo & Aquarium	Interior Access Route	333052	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ -	1
Point Defiance Zoo & Aquarium	Site Furnishings	334601	BEST PRACTICES: An adjacent clear space is not provided at the bench.	\$ 131	2
Point Defiance Zoo & Aquarium	Entrance to Building	333013	The maneuvering clearance at the accessible door is not level and clear.	\$ 1,250	1
Point Defiance Zoo & Aquarium	Entrance to Building	332992	The maneuvering clearance at the accessible door is not level and clear.	\$ 1,250	1
Point Defiance Zoo & Aquarium	Entrance to Building	332991	The maneuvering clearance at the accessible door is not level and clear.	\$ 1,250	1
Point Defiance Zoo & Aquarium	Entrance to Building	333059	The maneuvering clearance at the accessible door is not level and clear.	\$ 1,250	1
Point Defiance Zoo & Aquarium	Entrance to Building	334589	The maneuvering clearance at the accessible door is not level and clear.	\$ 1,250	1
Point Defiance Zoo & Aquarium	Entrance to Building	332999	The maneuvering clearance at the accessible door is not level and clear.	\$ 1,250	1
Point Defiance Zoo & Aquarium	Entrance to Building	334581	The accessible door has less than 32" clear width.	\$ 2,480	1
Point Defiance Zoo & Aquarium	Entrance to Building	334582	The maneuvering clearance at the accessible door is not level and clear.	\$ 1,250	1
Point Defiance Zoo & Aquarium	Entrance to Building	334569	The opening force of the fire door is more than the minimum allowable by the appropriate administrative authority.	\$ 457	1
Point Defiance Zoo & Aquarium	Restroom	334574	The height of controls are not compliant.	\$ 200	3
Point Defiance Zoo & Aquarium	Common Areas	333046	The sales or service counter does not have an accessible portion with maximum 36" height surface above finish floor or ground.	\$ 1,503	2
Point Defiance Zoo & Aquarium	Common Areas	333043	The sales or service counter does not have an accessible portion with maximum 36" height surface above finish floor or ground.	\$ 1,503	2

PHASE ONE						
PARK	CATEGORY	BARRIER ID	BARRIER DESCRIPTION	ESTIMATE	PRIORITY	
Point Defiance Zoo & Aquarium	Interior Access Route	334596	The opening force required to open the accessible, hinged, non-fire door is more than 5 pounds.	\$ 366	1	
Point Defiance Zoo & Aquarium	Interior Access Route	334579	The push side of the accessible door does not have the required maneuvering clearances.	\$ 1,250	1	
Point Defiance Zoo & Aquarium	Common Areas	333018	The minimum number and types of drinking fountains are not provided.	\$ 8,000	4	
Point Defiance Zoo & Aquarium	Exterior Access Route	334604	The spout of the standing height drinking fountain is not between 38" minimum and 43" maximum.	\$ 3,131	4	
Point Defiance Zoo & Aquarium	Site Furnishings	334602	The minimum number and types of drinking fountains are not provided.	\$ 8,000	4	
Point Defiance Zoo & Aquarium	Site Furnishings	334562	The minimum number and types of drinking fountains are not provided.	\$ 8,000	4	
Point Defiance Zoo & Aquarium	Exterior Access Route	334554	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 4,000	1	
Point Defiance Zoo & Aquarium	Exterior Access Route	334551	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 4,800	1	
Point Defiance Zoo & Aquarium	Exterior Access Route	334613	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 6,000	1	
Point Defiance Zoo & Aquarium	Exterior Access Route	334557	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 16,200	1	
Point Defiance Zoo & Aquarium	Exterior Access Route	334606	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 6,000	1	
Point Defiance Zoo & Aquarium	Exterior Access Route	334615	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 6,000	1	
Point Defiance Zoo & Aquarium	Exterior Access Route	334614	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 43,500	1	
Point Defiance Zoo & Aquarium	Exterior Access Route	334612	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 4,500	1	
Point Defiance Zoo & Aquarium	Exterior Access Route	334624	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 3,360	1	
Point Defiance Zoo & Aquarium	Exterior Access Route	334623	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 7,500	1	
Point Defiance Zoo & Aquarium	Exterior Access Route	334622	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 800	1	
Point Defiance Zoo & Aquarium	Exterior Access Route	334605	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 3,600	1	
Point Defiance Zoo & Aquarium	Exterior Access Route	334607	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 12,000	1	
Point Defiance Zoo & Aquarium	Exterior Access Route	334610	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 7,135	1	
Point Defiance Zoo & Aquarium	Exterior Access Route	334609	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 2,400	1	
Point Defiance Zoo & Aquarium	Exterior Access Route	334608	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 3,600	1	
Point Defiance Zoo & Aquarium	Exterior Access Route	334555	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 16,200	1	
Point Defiance Zoo & Aquarium	Exterior Access Route	334611	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 6,000	1	
Point Defiance Zoo & Aquarium	Exterior Access Route	334564	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 8,000	1	
Point Defiance Zoo & Aquarium	Exterior Access Route	334550	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 17,838	1	
Point Defiance Zoo & Aquarium	Exterior Access Route	334603	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 8,186	1	
Point Defiance Zoo & Aquarium	Exterior Access Route	363473	WASHINGTON: An exterior accessible route is not provided.	\$ 1,907	1	
Point Defiance Zoo & Aquarium	Common Areas	333047	The ramp running slope exceeds 1:12 (8.33%).	\$ 2,648	1	
Point Defiance Zoo & Aquarium	Accessible Parking	333042	The access aisle slope is greater than 1:50 (2%).	\$ 5,000	1	
Point Defiance Zoo & Aquarium	Accessible Parking	332624	Accessible car stall markings do not define the stall width.	\$ 6,300	1	
Point Defiance Zoo & Aquarium	Accessible Parking	332626	Accessible van stall markings do not define the stall width.	\$ 1,260	1	
Point Defiance Zoo & Aquarium	Accessible Parking	332621	The slope of the parking space is greater than 1:50 (2%).	\$ 6,300	1	
Point Defiance Zoo & Aquarium	Accessible Parking	332588	The slope of the parking space is greater than 1:50 (2%).	\$ 6,300	1	
Point Defiance Zoo & Aquarium	Accessible Parking	332586	The access aisle slope is greater than 1:50 (2%).	\$ 5,000	1	
Point Defiance Zoo & Aquarium	Accessible Parking	332589	The slope of the parking space is greater than 1:50 (2%).	\$ 6,300	1	
Point Defiance Zoo & Aquarium	Accessible Parking	332590	The access aisle slope is greater than 1:50 (2%).	\$ 5,000	1	
Point Defiance Zoo & Aquarium	Accessible Parking	332592	The slope of the parking space is greater than 1:50 (2%).	\$ 6,300	1	
Point Defiance Zoo & Aquarium	Accessible Parking	332591	The access aisle slope is greater than 1:50 (2%).	\$ 5,000	1	
Point Defiance Zoo & Aquarium	Accessible Parking	332594	The slope of the parking space is greater than 1:50 (2%).	\$ 6,300	1	
Point Defiance Zoo & Aquarium	Accessible Parking	332593	The access aisle slope is greater than 1:50 (2%).	\$ 5,000	1	
Point Defiance Zoo & Aquarium	Accessible Parking	332596	The slope of the parking space is greater than 1:50 (2%).	\$ 6,300	1	
Point Defiance Zoo & Aquarium	Accessible Parking	332598	The slope of the parking space is greater than 1:50 (2%).	\$ 6,300	1	

PHASE ONE						
PARK	CATEGORY	BARRIER ID	BARRIER DESCRIPTION	ESTIMATE	PRIORITY	
Point Defiance Zoo & Aquarium	Accessible Parking	332595	The access aisle slope is greater than 1:50 (2%).	\$ 5,000	1	
Point Defiance Zoo & Aquarium	Accessible Parking	332597	The access aisle slope is greater than 1:50 (2%).	\$ 5,000	1	
Point Defiance Zoo & Aquarium	Accessible Parking	332601	The slope of the parking space is greater than 1:50 (2%).	\$ 6,300	1	
Point Defiance Zoo & Aquarium	Accessible Parking	332600	The access aisle slope is greater than 1:50 (2%).	\$ 5,000	1	
Point Defiance Zoo & Aquarium	Accessible Parking	332603	The slope of the parking space is greater than 1:50 (2%).	\$ 6,300	1	
Point Defiance Zoo & Aquarium	Accessible Parking	332602	The access aisle slope is greater than 1:50 (2%).	\$ 5,000	1	
Point Defiance Zoo & Aquarium	Accessible Parking	332605	The slope of the parking space is greater than 1:50 (2%).	\$ 6,300	1	
Point Defiance Zoo & Aquarium	Accessible Parking	332604	The access aisle slope is greater than 1:50 (2%).	\$ 5,000	1	
Point Defiance Zoo & Aquarium	Accessible Parking	332607	The slope of the parking space is greater than 1:50 (2%).	\$ 6,300	1	
Point Defiance Zoo & Aquarium	Accessible Parking	332609	The slope of the parking space is greater than 1:50 (2%).	\$ 6,300	1	
Point Defiance Zoo & Aquarium	Accessible Parking	332606	The access aisle slope is greater than 1:50 (2%).	\$ 5,000	1	
Point Defiance Zoo & Aquarium	Accessible Parking	332610	The access aisle slope is greater than 1:50 (2%).	\$ 5,000	1	
Point Defiance Zoo & Aquarium	Accessible Parking	332608	The access aisle slope is greater than 1:50 (2%).	\$ 5,000	1	
Point Defiance Zoo & Aquarium	Accessible Parking	332617	The slope of the parking space is greater than 1:50 (2%).	\$ 6,300	1	
Point Defiance Zoo & Aquarium	Accessible Parking	332618	The access aisle slope is greater than 1:50 (2%).	\$ 5,000	1	
Point Defiance Zoo & Aquarium	Accessible Parking	332619	The slope of the parking space is greater than 1:50 (2%).	\$ 6,300	1	
Point Defiance Zoo & Aquarium	Accessible Parking	332620	The access aisle slope is greater than 1:50 (2%).	\$ 5,000	1	
Point Defiance Zoo & Aquarium	Accessible Parking	332622	The access aisle slope is greater than 1:50 (2%).	\$ 5,000	1	
Point Defiance Zoo & Aquarium	Accessible Parking	332623	The slope of the parking space is greater than 1:50 (2%).	\$ 6,300	1	
Point Defiance Zoo & Aquarium	Accessible Parking	333040	WASHINGTON: A car stall, access aisle, and signage are not provided and the slope and/or ground surface is/are not compliant.	\$ 23,720	1	
Point Defiance Zoo & Aquarium	Accessible Parking	332584	The access aisle slope is greater than 1:50 (2%).	\$ 5,000	1	
Point Defiance Zoo & Aquarium	Accessible Parking	332611	The parking space slope is greater than 1:50 (2%).	\$ 6,300	1	
Point Defiance Zoo & Aquarium	Accessible Parking	332612	The access aisle slope is greater than 1:50 (2%).	\$ 5,000	1	
Point Defiance Zoo & Aquarium	Accessible Parking	332614	The parking space slope is greater than 1:50 (2%).	\$ 6,300	1	
Point Defiance Zoo & Aquarium	Accessible Parking	332615	The access aisle slope is greater than 1:50 (2%).	\$ 5,000	1	
Point Defiance Zoo & Aquarium	Accessible Parking	333039	WASHINGTON: A van stall, access aisle, and signage are not provided and the slope of the ground surface is not compliant.	\$ 11,860	1	
Point Defiance Zoo & Aquarium	Accessible Parking	332625	Accessible car aisle markings do not define the aisle width.	\$ 6,300	1	
Point Defiance Zoo & Aquarium	Accessible Parking	332627	Accessible van stall and aisle markings do not define the aisle width.	\$ 1,260	1	
Point Defiance Zoo & Aquarium	Picnic Shelter	333029	BEST PRACTICE: The total number of accessible picnic tables is less than the required 20%.	\$ -	4	
Point Defiance Zoo & Aquarium	Exterior Access Route	363472	Protruding objects in the 27" to 80" range above grade protrude more than 4" along the accessible route.	\$ 910	1	
Point Defiance Zoo & Aquarium	Interior Access Route	333036	The ramp running slope exceeds 1:12 (8.33%).	\$ 27,804	1	
Point Defiance Zoo & Aquarium	Exterior Access Route	333064	The ramp has a running slope in excess of 1:12 (8.33%) and/or cross slope in excess of 1:48 (2.08%).	\$ 26,480	1	
Point Defiance Zoo & Aquarium	Exterior Access Route	333065	The ramp does not have a level landing at the top and/or bottom of each run.	\$ 5,584	1	
Point Defiance Zoo & Aquarium	Exterior Access Route	332631	The ramp does not have a level landing.	\$ 10,470	1	
Point Defiance Zoo & Aquarium	Exterior Access Route	332632	WASHINGTON: The slopes of the ramp are not compliant.	\$ 26,480	1	
Point Defiance Zoo & Aquarium	Exterior Access Route	332633	WASHINGTON: The slopes of the ramp are not compliant.	\$ 19,860	1	
Point Defiance Zoo & Aquarium	Interior Access Route	334587	Handrails are not continuous or are not at a continuous height above the ramp surface.	\$ 2,445	1	
Point Defiance Zoo & Aquarium	Interior Access Route	333037	The ramp running slope exceeds 1:12 (8.33%).	\$ 26,480	1	
Point Defiance Zoo & Aquarium	Interior Access Route	333038	The ramp running slope exceeds 1:12 (8.33%).	\$ 26,480	1	
Point Defiance Zoo & Aquarium	Exterior Access Route	334580	A ramp is required but not provided. Items requiring an unobstructed forward reach motion are higher than 48" maximum or lower than 15" minimum height above finish floor.	\$ 3,310	1	
Point Defiance Zoo & Aquarium	Site Furnishings	332628		\$ 400	2	
Point Defiance Zoo & Aquarium	Restroom	333016	The space between the grab bar and projecting objects above the grab bar is less than 12" minimum.	\$ 100	3	
Point Defiance Zoo & Aquarium	Restroom	333024	The space between the grab bar and projecting objects above the grab bar is less than 12" minimum.	\$ 100	3	

PHASE ONE						
PARK	CATEGORY	BARRIER ID	BARRIER DESCRIPTION	ESTIMATE	PRIORITY	
Point Defiance Zoo & Aquarium	Restroom	332995	The space between the grab bar and the toilet paper dispenser above the grab bar is less than 12" minimum.	\$ 100	3	
Point Defiance Zoo & Aquarium	Restroom	363326	The space between the grab bar and projecting objects above the grab bar is less than 12" minimum.	\$ 100	3	
Point Defiance Zoo & Aquarium	Restroom	332985	The centerline of the toilet in the wheelchair stall is not 16" minimum to 18" maximum from the sidewall.	\$ 630	3	
Point Defiance Zoo & Aquarium	Restroom	333053	The centerline of the toilet in the wheelchair stall is not 16" minimum to 18" maximum from the sidewall.	\$ 630	3	
Point Defiance Zoo & Aquarium	Restroom	333055	The space between the grab bar and projecting objects above the grab bar is less than 12" minimum.	\$ 100	3	
Point Defiance Zoo & Aquarium	Restroom	333012	The space between the grab bar and projecting objects above the grab bar is less than 12" minimum.	\$ 100	3	
Point Defiance Zoo & Aquarium	Restroom	334597	The centerline of the toilet in the wheelchair stall is not 16" minimum to 18" maximum from the sidewall.	\$ 630	3	
Point Defiance Zoo & Aquarium	Restroom	334599	The space between the grab bar and projecting objects above the grab bar is less than 12" minimum.	\$ 100	3	
Point Defiance Zoo & Aquarium	Restroom	334593	The centerline of the toilet in the wheelchair stall is not 16" minimum to 18" maximum from the sidewall.	\$ 630	3	
Point Defiance Zoo & Aquarium	Restroom	334594	The space between the grab bar and projecting objects above the grab bar is less than 12" minimum.	\$ 100	3	
Point Defiance Zoo & Aquarium	Restroom	333026	The space between the grab bar and projecting objects above the grab bar is less than 12" minimum.	\$ 100	3	
Point Defiance Zoo & Aquarium	Restroom	334572	The height of the water closet is not 17" minimum to 19" maximum above finished floor.	\$ 630	3	
Point Defiance Zoo & Aquarium	Restroom	333007	The space between the grab bar and projecting objects above the grab bar is less than 12" minimum.	\$ 100	3	
Point Defiance Zoo & Aquarium	Restroom	333000	The space between the grab bar and the toilet paper dispenser above the grab bar is less than 12" minimum.	\$ 100	3	
Point Defiance Zoo & Aquarium	Restroom	333015	The hardware at the wheelchair stall door is not compliant.	\$ 366	3	
Point Defiance Zoo & Aquarium	Restroom	333023	The hardware at the wheelchair stall door is not compliant.	\$ 366	3	
Point Defiance Zoo & Aquarium	Restroom	332997	The hardware at the wheelchair stall door is not compliant.	\$ 366	3	
Point Defiance Zoo & Aquarium	Restroom	332998	The hardware at the wheelchair stall door is not compliant.	\$ 366	3	
Point Defiance Zoo & Aquarium	Restroom	334598	The hardware at the wheelchair stall door is not compliant.	\$ 366	3	
Point Defiance Zoo & Aquarium	Restroom	334595	The hardware at the wheelchair stall door is not compliant.	\$ 366	3	
Point Defiance Zoo & Aquarium	Restroom	333025	The wheelchair stall door is not self closing.	\$ 366	3	
Point Defiance Zoo & Aquarium	Restroom	333028	The wheelchair stall door is not self closing.	\$ 366	3	
Point Defiance Zoo & Aquarium	Restroom	333009	The hardware at the wheelchair stall door is not compliant.	\$ 366	3	
Point Defiance Zoo & Aquarium	Restroom	333002	The hardware at the wheelchair stall door is not compliant.	\$ 366	3	
Point Defiance Zoo & Aquarium	Restroom	363334	ANSI A117.1-: A vertical side grab bar is not located in the wheelchair stall.	\$ 443	3	
Point Defiance Zoo & Aquarium	Restroom	363335	ANSI A117.1-: A vertical side grab bar is not located in the wheelchair stall.	\$ 443	3	
Point Defiance Zoo & Aquarium	Restroom	363327	ANSI A117.1-: A vertical side grab bar is not located in the wheelchair stall.	\$ 443	3	
Point Defiance Zoo & Aquarium	Restroom	363120	ANSI A117.1-: A vertical side grab bar is not located in the wheelchair stall.	\$ 443	3	
Point Defiance Zoo & Aquarium	Restroom	363332	ANSI A117.1-: A vertical side grab bar is not located in the wheelchair stall.	\$ 443	3	
Point Defiance Zoo & Aquarium	Restroom	363470	ANSI A117.1-: A vertical side grab bar is not located in the wheelchair stall.	\$ 443	3	
Point Defiance Zoo & Aquarium	Restroom	363469	ANSI A117.1-: A vertical side grab bar is not located in the wheelchair stall.	\$ 443	3	
Point Defiance Zoo & Aquarium	Restroom	363468	ANSI A117.1-: A vertical side grab bar is not located in the wheelchair stall.	\$ 443	3	
Point Defiance Zoo & Aquarium	Restroom	363331	ANSI A117.1-: A vertical side grab bar is not located in the restroom.	\$ 443	3	
Point Defiance Zoo & Aquarium	Restroom	363329	ANSI A117.1-: A vertical side grab bar is not located in the wheelchair stall.	\$ 443	3	
Point Defiance Zoo & Aquarium	Restroom	332986	WASHINGTON: The toilet paper dispenser location is not compliant.	\$ 366	3	
Point Defiance Zoo & Aquarium	Kitchen	334591	Exposed pipes lack insulation and/or sharp or abrasive surfaces are present under the sink.	\$ 243	2	
Point Defiance Zoo & Aquarium	Kitchen	334568	Exposed pipes lack insulation and/or sharp or abrasive surfaces are present under the sink.	\$ 675	2	
Point Defiance Zoo & Aquarium	Exterior Access Route	334617	Handrails are not provided.	\$ 1,630	1	
Point Defiance Zoo & Aquarium	Exterior Access Route	334619	Handrails are not provided.	\$ 1,630	1	
Portland Avenue Community Center	Entrance to Building	328755	The threshold at the accessible door is greater than ½" in height.	\$ 179	1	
Portland Avenue Community Center	Entrance to Building	328720	The threshold at the accessible door is greater than ½" in height.	\$ 179	1	
Portland Avenue Community Center	Entrance to Building	328766	The threshold at the accessible door is greater than ½" in height.	\$ 179	1	
Portland Avenue Community Center	Interior Access Route	328747	The height of controls throughout the common area are not compliant.	\$ 500	1	

PHASE ONE						
PARK	CATEGORY	BARRIER ID	BARRIER DESCRIPTION	ESTIMATE	PRIORITY	
Portland Avenue Community Center	Interior Access Route	328709	The height of controls throughout the common area are not compliant.	\$ 500	1	
Portland Avenue Community Center	Interior Access Route	328712	The height of controls throughout the common area are not compliant.	\$ 500	1	
Portland Avenue Community Center	Interior Access Route	328751	The height of controls throughout the common area are not compliant.	\$ 500	1	
Portland Avenue Community Center	Interior Access Route	328767	The height of controls throughout the common area are not compliant.	\$ 1,500	1	
Portland Avenue Community Center	Interior Access Route	328760	The height of controls throughout the common area are not compliant.	\$ 1,000	1	
Portland Avenue Community Center	Common Areas	328771	Controls and/or dispensers are not within an allowable reach range.	\$ 3,294	4	
Portland Avenue Community Center	Common Areas	328776	The sales or service counter does not have an accessible portion with maximum 36" height surface above finish floor or ground.	\$ 1,804	2	
Portland Avenue Community Center	Common Areas	328710	The dining or work surface does not have a minimum 28" and maximum 34" height with knee and toe clearance.	\$ 2,382	2	
Portland Avenue Community Center	Interior Access Route	328744	The bottom of the door vision light is higher than 43" and less than 66".	\$ 2,600	2	
Portland Avenue Community Center	Interior Access Route	328749	The bottom of the door vision light is higher than 43" and less than 66".	\$ 2,600	2	
Portland Avenue Community Center	Interior Access Route	328705	The bottom of the door vision light is higher than 43" and less than 66".	\$ 2,600	2	
Portland Avenue Community Center	Interior Access Route	328708	The push side of the accessible door does not have the required maneuvering clearances.	\$ 1,250	1	
Portland Avenue Community Center	Interior Access Route	328713	The bottom of the door vision light is higher than 43" and less than 66".	\$ 2,600	2	
Portland Avenue Community Center	Interior Access Route	328785	The bottom of the door vision light is higher than 43" and less than 66".	\$ 2,600	2	
Portland Avenue Community Center	Interior Access Route	328750	The pull side of the accessible door does not have the required maneuvering clearances.	\$ 1,250	1	
Portland Avenue Community Center	Interior Access Route	328752	The bottom of the door vision light is higher than 43" and less than 66".	\$ 2,600	2	
Portland Avenue Community Center	Interior Access Route	328753	The push side of the accessible door does not have the required maneuvering clearances.	\$ 1,250	1	
Portland Avenue Community Center	Interior Access Route	328772	The bottom of the door vision light is higher than 43" and less than 66".	\$ 2,600	2	
Portland Avenue Community Center	Interior Access Route	328757	The bottom of the door vision light is higher than 43" and less than 66".	\$ 2,600	2	
Portland Avenue Community Center	Interior Access Route	328781	The bottom of the door vision light is higher than 43" and less than 66".	\$ 2,600	2	
Portland Avenue Community Center	Interior Access Route	328783	The push side of the accessible door does not have the required maneuvering clearances.	\$ 1,250	1	
Portland Avenue Community Center	Interior Access Route	328779	The bottom of the door vision light is higher than 43" and less than 66".	\$ 2,600	2	
Portland Avenue Community Center	Interior Access Route	328774	The minimum number of drinking fountains is not provided.	\$ 5,439	4	
Portland Avenue Community Center	Kitchen	328800	The height of the counter is greater than 34".	\$ 1,986	2	
Portland Avenue Community Center	Kitchen	328801	The height of the counter is greater than 34".	\$ 1,986	2	
Portland Avenue Community Center	Kitchen	328797	A minimum 30" wide section of the counter is not a minimum height of 28" and maximum height of 34" with knee and toe clearance.	\$ 2,481	4	
Portland Avenue Community Center	Interior Access Route	328748	Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the interior accessible route.	\$ 250	1	
Portland Avenue Community Center	Interior Access Route	328711	Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the interior accessible route.	\$ 728	1	
Portland Avenue Community Center	Interior Access Route	328775	Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the interior accessible route.	\$ 728	1	
Portland Avenue Community Center	Restroom	328725	The restroom circulation path is not free of objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.	\$ 250	2	
Portland Avenue Community Center	Interior Access Route	328761	Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the interior accessible route.	\$ 100	1	
Portland Avenue Community Center	Restroom	328735	The restroom circulation path is not free of objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.	\$ 200	2	
Portland Avenue Community Center	Restroom	328738	The coat hook is not within an allowable reach range.	\$ 115	3	
Portland Avenue Community Center	Restroom	328724	The pull side of the accessible door does not have the required maneuvering clearances.	\$ 100	3	
Portland Avenue Community Center	Restroom	328737	The hardware at the wheelchair stall door is not compliant.	\$ 293	3	
Portland Avenue Community Center	Restroom	328793	The pull side of the accessible door does not have the required maneuvering clearances.	\$ 100	3	
Portland Avenue Community Center	Restroom	328726	The lavatory is mounted higher than 34" to the higher of the rim or counter.	\$ 720	3	
Portland Avenue Community Center	Restroom	328736	The lavatory is mounted higher than 34" to the higher of the rim or counter.	\$ 720	3	
Portland Avenue Community Center	Restroom	328727	The urinal dimensions are not compliant.	\$ 935	3	
Portland Avenue Community Center	Restroom	328730	The centerline of the toilet in the wheelchair stall is not 16" minimum to 18" maximum from the sidewall.	\$ 630	3	
Portland Avenue Community Center	Restroom	328739	The centerline of the toilet in the wheelchair stall is not 16" minimum to 18" maximum from the sidewall.	\$ 630	3	
Portland Avenue Community Center	Restroom	328740	The height of the water closet is not 17" minimum to 19" maximum above finished floor.	\$ 630	3	
Portland Avenue Community Center	Kitchen	328798	The accessible sink is not installed with the front of the higher of the rim or counter surface 34" maximum above finished floor.	\$ 720	2	

PHASE ONE						
PARK	CATEGORY	BARRIER ID	BARRIER DESCRIPTION	ESTIMATE	PRIORITY	
Portland Avenue Community Center	Kitchen	328799	The kitchen sink does not have knee and toe clearance.	\$ 720	2	
Portland Avenue Community Center	Common Areas	328770	The vending machines have operable parts which are not within reach range.	\$ 3,254	2	
Portland Avenue Community Center	Employee Work Areas	328777	The work surface is not compliant.	\$ 1,030	2	
Portland Avenue Community Center	Restroom	394735	ANSI A117.1-2009 : A vertical side grab bar is not present in the wheelchair stall.	\$ 443	3	
Portland Avenue Community Center	Restroom	394736	ANSI A117.1-2009 : A vertical side grab bar is not present in the wheelchair stall.	\$ 443	3	
Ruston Way Areas 2-4	Exterior Access Route	331243	Sidewalk has areas of vertical level changes in excess of 1/4" that are not ramped.	\$ 198	1	
Ruston Way Areas 2-4	Exterior Access Route	331250	Sidewalk has areas of vertical level changes in excess of 1/4" that are not ramped.	\$ 198	1	
Ruston Way Areas 2-4	Exterior Access Route	331251	Sidewalk has areas of vertical level changes in excess of 1/4" that are not ramped.	\$ 198	1	
Ruston Way Areas 2-4	Exterior Access Route	331253	Sidewalk has areas of vertical level changes in excess of 1/4" that are not ramped.	\$ 198	1	
Ruston Way Areas 2-4	Exterior Access Route	331254	Sidewalk has areas of vertical level changes in excess of 1/4" that are not ramped.	\$ 198	1	
Ruston Way Areas 2-4	Exterior Access Route	331165	Sidewalk has areas of vertical level changes in excess of 1/4" that are not ramped.	\$ 198	1	
STAR Center	Kitchen	326222	Clear floor space at all sinks, works surfaces, operable parts and appliances is not provided. The hardware at the accessible door (including sliding doors - both sides) requires tight grasping, pinching or twisting of the wrist to operate.	\$ 1,000	2	
STAR Center	Interior Access Route	326180		\$ 300	1	
STAR Center	Interior Access Route	326122	The automatic door does not comply with ANSI requirements or is not functional.	\$ 200	1	
STAR Center	Interior Access Route	326208	Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the interior accessible route.	\$ 728	1	
STAR Center	Accessible Parking	326119	WASHINGTON: A car stall, access aisle, and signage are not provided and the slope and/or ground surface is/are not compliant.	\$ 125	1	
STAR Center	Accessible Parking	326116	WASHINGTON: Van stall and access aisle signage is not provided. The markings are not compliant.	\$ 1,120	1	
STAR Center	Accessible Parking	326130	The accessible drive-up electric vehicle charging station stall is not provided or is not compliant.	\$ 1,050	1	
STAR Center	Accessible Parking	326114	WASHINGTON: The van stall and access aisle markings are not compliant.	\$ 1,050	1	
STAR Center	Accessible Parking	326115	WASHINGTON: The van access aisle slope is not compliant. Access aisle signage is not provided.	\$ 5,280	1	
STAR Center	Accessible Parking	326120	The van parking space is less than 132" wide, where the van aisle is less than 96" wide.	\$ 525	1	
STAR Center	Accessible Parking	326121	The parking space slope is greater than 1:50 (2%).	\$ 7,875	1	
STAR Center	Interior Access Route	326219	Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the interior accessible route.	\$ 728	1	
STAR Center	Interior Access Route	326213	Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the interior accessible route.	\$ 728	1	
STAR Center	Restroom	326198	The restroom circulation path is not free of objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.	\$ 100	2	
STAR Center	Restroom	326206	The restroom circulation path is not free of objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.	\$ 100	2	
STAR Center	Restroom	326197	The restroom circulation path is not free of objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.	\$ 100	2	
STAR Center	Restroom	326175	The restroom circulation path is not free of objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.	\$ 100	2	
STAR Center	Restroom	326163	The restroom circulation path is not free of objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.	\$ 100	2	
STAR Center	Restroom	326165	The restroom circulation path is not free of objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.	\$ 100	2	
STAR Center	Interior Access Route	326132	A ramp is required but not provided.	\$ 3,310	1	
STAR Center	Interior Access Route	326140	Items that require a forward reach motion require more than 48" height reach.	\$ 100	2	
STAR Center	Restroom	326195	Controls on dispensers are not compliant.	\$ 225	3	
STAR Center	Restroom	326199	Controls on dispensers are not compliant.	\$ 225	3	
STAR Center	Restroom	326172	The hardware at the wheelchair stall door is not compliant.	\$ 300	3	
STAR Center	Restroom	326166	The hardware at the wheelchair stall door is not compliant.	\$ 300	3	
STAR Center	Restroom	326174	The side grab bar at the water closet is not compliant.	\$ 355	3	
STAR Center	Restroom	326177	The side grab bar at the water closet is not compliant.	\$ 355	3	
STAR Center	Restroom	326170	The side grab bar at the water closet is not compliant.	\$ 355	3	
STAR Center	Restroom	326173	The hardware at the wheelchair stall door is not compliant.	\$ 300	3	
STAR Center	Restroom	326179	The hardware at the wheelchair stall door is not compliant.	\$ 300	3	
STAR Center	Restroom	328202	The wheelchair stall door is not self closing.	\$ 300	3	
STAR Center	Restroom	328203	The wheelchair stall door is not self closing.	\$ 300	3	
STAR Center	Restroom	357222	The hardware at the wheelchair stall door is not compliant.	\$ 300	3	
STAR Center	Restroom	326168	The hardware at the wheelchair stall door is not compliant.	\$ 300	3	
STAR Center	Restroom	328113	The wheelchair stall door is not self closing.	\$ 300	3	
STAR Center	Restroom	326185	The lavatory is mounted higher than 34" to the higher of the rim or counter.	\$ 720	3	
STAR Center	Restroom	328339	A shower seat is not provided or is not compliantly installed.	\$ 604	3	
STAR Center	Restroom	326183	The shower controls are not mounted on the side wall opposite the transfer shower seat.	\$ 325	3	
STAR Center	Restroom	326181	The shower controls are not mounted on the side wall opposite the transfer shower seat.	\$ 325	3	
STAR Center	Restroom	326176	The clear floor space at the urinal is less than minimum 30" by minimum 48".	\$ 200	3	
STAR Center	Interior Access Route	327915	ADVISORY: The stair treads and edge of top landing do not have visual contrast on the leading edge.	\$ 873	2	
STAR Center	Exterior Access Route	326144	WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 308	3	
STAR Center	Interior Access Route	326145	ADVISORY: The stair treads and edge of top landing do not have visual contrast on the leading edge.	\$ 87	2	
STAR Center	Exterior Access Route	326209	WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 422	3	
STAR Center	Interior Access Route	328335	Stairs have open risers.	\$ 2,400	1	
STAR Center	Playground	328334	The transfer steps are less than 24" wide and/or 14" deep.	\$ 3,255	2	
STAR Center	Site Furnishings	326220	The vending machines are not accessible.	\$ 3,254	2	
STAR Center	Interior Access Route	326221	Objects along the interior accessible route suspend from the ceilings lower than 80" AFF.	\$ 1,820	1	
STAR Center	Interior Access Route	327914	Handrails are not compliant.	\$ 1,141	1	
Stewart Heights Park & Pool	Exterior Access Route	327378	Sidewalk has areas of vertical level changes in excess of 1/4" that are not ramped.	\$ 118	1	
Stewart Heights Park & Pool	Exterior Access Route	327395	Sidewalk has areas of vertical level changes in excess of 1/4" that are not ramped.	\$ 35	1	

PHASE ONE						
PARK	CATEGORY	BARRIER ID	BARRIER DESCRIPTION	ESTIMATE	PRIORITY	
Titlow Park	Exterior Access Route	324770	Sidewalk has areas of vertical level changes in excess of 1/4" that are not ramped.	\$ 44	1	
Wapato Hills Park	Exterior Access Route	322599	Sidewalk has areas of vertical level changes in excess of 1/4" that are not ramped.	\$ 118	1	
Wapato Hills Park	Exterior Access Route	322631	Sidewalk has areas of vertical level changes in excess of 1/4" that are not ramped.	\$ 99	1	
Wapato Hills Park	Exterior Access Route	322604	Sidewalk has areas of vertical level changes in excess of 1/4" that are not ramped.	\$ 198	1	
Wapato Hills Park	Exterior Access Route	322602	Sidewalk has areas of vertical level changes in excess of 1/4" that are not ramped.	\$ 198	1	
Wapato Hills Park	Exterior Access Route	322605	Sidewalk has areas of vertical level changes in excess of 1/4" that are not ramped.	\$ 198	1	
Wapato Hills Park	Exterior Access Route	322607	Sidewalk has areas of vertical level changes in excess of 1/4" that are not ramped.	\$ 198	1	
Wapato Hills Park	Exterior Access Route	322608	Sidewalk has areas of vertical level changes in excess of 1/4" that are not ramped.	\$ 198	1	
Wapato Hills Park	Exterior Access Route	322612	Sidewalk has areas of vertical level changes in excess of 1/4" that are not ramped.	\$ 198	1	
Wapato Hills Park	Exterior Access Route	322603	Sidewalk has areas of vertical level changes in excess of 1/4" that are not ramped.	\$ 99	1	
Wapato Hills Park	Exterior Access Route	322639	Sidewalk has areas of vertical level changes in excess of 1/4" that are not ramped.	\$ 198	1	
Wapato Hills Park	Exterior Access Route	322601	Sidewalk has areas of vertical level changes in excess of 1/4" that are not ramped.	\$ 198	1	
Wapato Hills Park	Exterior Access Route	322638	Sidewalk has areas of vertical level changes in excess of 1/4" that are not ramped.	\$ 198	1	
Wapato Park & Pavilion	Entrance to Building	301490	The edges of the carpet are not securely attached.	\$ 270	1	
Wright Park and WW Seymour Botanical Conservatory	Exterior Access Route	317184	Water accumulates on surface.	\$ 700	1	
TOTAL				\$ 2,350,859		

PHASE TWO						
PARK	CATEGORY	BARRIER ID	BARRIER DESCRIPTION	ESTIMATE	PRIORITY	
Browns Point Lighthouse Park	Entrance to Building	315390	An accessible entrance is not provided.	\$ 2,480	1	
Browns Point Lighthouse Park	Entrance to Building	331094	The threshold at the accessible door is greater than 1/2" in height.	\$ 179	1	
Browns Point Lighthouse Park	Entrance to Building	331096	The hardware at the accessible door requires tight grasping and twisting of the wrist to operate.	\$ 676	1	
Browns Point Lighthouse Park	Entrance to Building	331086	The locking mechanism is out of reach range.	\$ 676	1	
Browns Point Lighthouse Park	Entrance to Building	331090	The hardware at the accessible door requires tight grasping and twisting of the wrist to operate.	\$ 676	1	
Browns Point Lighthouse Park	Entrance to Building	331134	An accessible entrance is not provided.	\$ 2,480	1	
Browns Point Lighthouse Park	Entrance to Building	331098	An accessible entrance is not provided.	\$ 2,480	1	
Browns Point Lighthouse Park	Entrance to Building	331085	An accessible entrance is not provided.	\$ 2,480	1	
Browns Point Lighthouse Park	Entrance to Building	331091	An accessible entrance is not provided.	\$ 2,480	1	
Browns Point Lighthouse Park	Exterior Access Route	315369	WASHINGTON: An exterior accessible route is not provided.	\$ 1,550	1	
Browns Point Lighthouse Park	Exterior Access Route	315377	WASHINGTON: The clear width of the exterior accessible route is less than 44".	\$ 35	1	
Browns Point Lighthouse Park	Exterior Access Route	331123	WASHINGTON: The clear width of the exterior accessible route is less than 44".	\$ 237	1	
Browns Point Lighthouse Park	Historic Structure	331133	The exterior accessible route to the building is not compliant.	\$ 535	1	
Browns Point Lighthouse Park	Exterior Access Route	331119	WASHINGTON: The clear width of the exterior accessible route is less than 44".	\$ 891	1	
Browns Point Lighthouse Park	Exterior Access Route	331124	WASHINGTON: The clear width of the exterior accessible route is less than 44".	\$ 323	1	
Browns Point Lighthouse Park	Exterior Access Route	331118	WASHINGTON: The clear width of the exterior accessible route is less than 44".	\$ 1,030	1	
Browns Point Lighthouse Park	Exterior Access Route	315378	WASHINGTON: An exterior accessible route is not provided.	\$ 1,576	1	
Browns Point Lighthouse Park	Exterior Access Route	315381	WASHINGTON: The clear width of the exterior accessible route is less than 44".	\$ 3,290	1	
Browns Point Lighthouse Park	Exterior Access Route	315383	The accessible route has areas of vertical level changes in excess of 1/4" that are not beveled or ramped.	\$ 39	1	
Browns Point Lighthouse Park	Exterior Access Route	315387	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 3,290	1	
Browns Point Lighthouse Park	Exterior Access Route	315370	WASHINGTON: The clear width of the exterior accessible route is less than 44".	\$ 5,946	1	
Browns Point Lighthouse Park	Exterior Access Route	315371	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 3,171	1	
Browns Point Lighthouse Park	Exterior Access Route	315372	WASHINGTON: The clear width of the exterior accessible route is less than 44".	\$ 500	1	
Browns Point Lighthouse Park	Exterior Access Route	315363	WASHINGTON: The clear width of the exterior accessible route is less than 44".	\$ 1,656	1	
Browns Point Lighthouse Park	Exterior Access Route	315365	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 812	1	
Browns Point Lighthouse Park	Exterior Access Route	315366	The accessible route has areas of vertical level changes in excess of 1/4" that are not beveled or ramped.	\$ 138	1	
Browns Point Lighthouse Park	Exterior Access Route	331112	WASHINGTON: The clear width of the exterior accessible route is less than 44".	\$ 3,488	1	
Browns Point Lighthouse Park	Exterior Access Route	331105	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 1,843	1	
Browns Point Lighthouse Park	Exterior Access Route	315362	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 356	1	
Browns Point Lighthouse Park	Exterior Access Route	315367	WASHINGTON: An exterior accessible route is not provided.	\$ 3,745	1	
Browns Point Lighthouse Park	Exterior Access Route	331125	The gate does not have a smooth surface within 10" of the ground.	\$ 160	2	
Browns Point Lighthouse Park	Exterior Access Route	331126	The gate hardware is not compliant.	\$ 200	1	
Browns Point Lighthouse Park	Exterior Access Route	331127	The gate is less than 32" wide.	\$ 1,250	1	
Browns Point Lighthouse Park	Exterior Access Route	331128	The gate maneuvering clearance area is not compliant.	\$ 1,136	1	
Browns Point Lighthouse Park	Exterior Access Route	331129	The gate maneuvering clearance area is not compliant.	\$ 1,136	1	
Browns Point Lighthouse Park	Exterior Access Route	331130	The gate hardware is not compliant.	\$ 200	1	
Browns Point Lighthouse Park	Exterior Access Route	331131	The gate does not have a smooth surface within 10" of the ground.	\$ 160	2	
Browns Point Lighthouse Park	Exterior Access Route	331110	The gate hardware is not compliant.	\$ 200	1	
Browns Point Lighthouse Park	Exterior Access Route	331111	The gate does not have a smooth surface within 10" of the ground.	\$ 160	2	
Browns Point Lighthouse Park	Exterior Access Route	331103	The gate hardware is not compliant.	\$ 200	1	
Browns Point Lighthouse Park	Exterior Access Route	331104	The gate does not have a smooth surface within 10" of the ground.	\$ 160	2	
Browns Point Lighthouse Park	Historic Structure	320978	WASHINGTON: The historic property requires alteration to make it accessible.	\$ -	1	
Browns Point Lighthouse Park	Historic Structure	331093	The door does not have 32" minimum clear width.	\$ 2,600	1	
Browns Point Lighthouse Park	Historic Structure	331095	The interior of the historical building is not accessible	\$ 7,062	1	
Browns Point Lighthouse Park	Historic Structure	331081	The door does not have 32" minimum clear width.	\$ 2,600	1	
Browns Point Lighthouse Park	Historic Structure	331082	The door does not have 32" minimum clear width.	\$ 2,600	1	
Browns Point Lighthouse Park	Historic Structure	331083	The door does not have 32" minimum clear width.	\$ 2,600	1	
Browns Point Lighthouse Park	Kitchen	331087	The height of the counter is greater than 34".	\$ 1,986	2	
Browns Point Lighthouse Park	Kitchen	331089	The height of the counter is greater than 34".	\$ 1,986	2	
Browns Point Lighthouse Park	Historic Structure	331084	The building is more than one story.	\$ 16,660	1	
Browns Point Lighthouse Park	Accessible Parking	315360	The parking space slope is greater than 1:50 (2%).	\$ 6,300	1	
Browns Point Lighthouse Park	Accessible Parking	315361	The access aisle slope is greater than 1:50 (2%).	\$ 5,000	1	
Browns Point Lighthouse Park	Site Furnishings	315364	The picnic table does not allow a clear space for forward wheelchair approach with knee and toe clearance.	\$ 1,300	2	
Browns Point Lighthouse Park	Site Furnishings	315368	The picnic table does not allow a clear space for forward wheelchair approach with knee and toe clearance.	\$ 1,300	2	
Browns Point Lighthouse Park	Interior Access Route	331092	A ramp is required but not provided.	\$ 4,137	1	
Browns Point Lighthouse Park	Interior Access Route	362062	A ramp is required but not provided.	\$ 4,137	1	
Browns Point Lighthouse Park	Historic Structure	331080	The provided toilet room is not accessible.	\$ 12,000	3	
Browns Point Lighthouse Park	Kitchen	331088	The accessible sink is not installed with the front of the higher of the rim or counter surface 34" maximum above finished floor.	\$ 720	2	
Browns Point Lighthouse Park	Exterior Access Route	315373	WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 105	3	
Browns Point Lighthouse Park	Exterior Access Route	315374	Handrails are not compliant.	\$ 489	1	
Browns Point Lighthouse Park	Exterior Access Route	315375	Steps do not have uniform and compliant tread depths.	\$ 306	1	
Browns Point Lighthouse Park	Exterior Access Route	315376	Handrail extensions are not compliant.	\$ 326	1	
Browns Point Lighthouse Park	Exterior Access Route	315379	WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 105	3	
Browns Point Lighthouse Park	Exterior Access Route	315380	Handrails are not compliant.	\$ 1,956	1	
Browns Point Lighthouse Park	Exterior Access Route	331099	WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 105	3	
Browns Point Lighthouse Park	Exterior Access Route	331100	Handrails are not provided.	\$ 815	1	
Browns Point Lighthouse Park	Exterior Access Route	331101	Handrail extensions are not provided.	\$ 326	1	
Browns Point Lighthouse Park	Exterior Access Route	331102	Steps do not have uniform and compliant riser heights and/or tread depths.	\$ 229	1	
Browns Point Lighthouse Park	Exterior Access Route	331106	WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 246	3	
Browns Point Lighthouse Park	Exterior Access Route	331107	Handrails are not compliant or are not provided.	\$ 2,119	1	
Browns Point Lighthouse Park	Exterior Access Route	331108	Handrail extensions are not compliant.	\$ 326	1	

PHASE TWO						
PARK	CATEGORY	BARRIER ID	BARRIER DESCRIPTION	ESTIMATE	PRIORITY	
Browns Point Lighthouse Park	Exterior Access Route	331109	Steps do not have uniform and compliant riser heights and/or tread depths.	\$ 3,595	1	
Browns Point Lighthouse Park	Exterior Access Route	331113	Treads have slopes greater than 1:48.	\$ 1,147	1	
Browns Point Lighthouse Park	Exterior Access Route	331114	Handrails are not compliant.	\$ 652	1	
Browns Point Lighthouse Park	Exterior Access Route	331115	Handrails are not provided.	\$ 652	1	
Browns Point Lighthouse Park	Exterior Access Route	331116	Handrail extensions are not compliant.	\$ 489	1	
Browns Point Lighthouse Park	Exterior Access Route	331117	WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 140	3	
Browns Point Lighthouse Park	Exterior Access Route	331120	WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 246	3	
Browns Point Lighthouse Park	Exterior Access Route	331121	Handrails are not provided.	\$ 1,304	1	
Browns Point Lighthouse Park	Exterior Access Route	331122	Handrails are not compliant.	\$ 1,304	1	
Browns Point Lighthouse Park	Exterior Access Route	331132	Handrails are not compliant.	\$ -	5	
Cummings Park	Site Furnishings	327030	An adjacent clear space is not provided at the bench.	\$ 157	2	
Cummings Park	Exterior Access Route	354627	WASHINGTON: The slope of the curb ramp run is not compliant.	\$ 2,187	1	
Cummings Park	Exterior Access Route	327039	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 5,708	1	
Cummings Park	Exterior Access Route	327035	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 18,551	1	
Cummings Park	Exterior Access Route	327038	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 74,206	1	
Cummings Park	Exterior Access Route	327015	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 198	1	
Cummings Park	Exterior Access Route	327031	The accessible route has gaps in the surface greater than 1/2" wide.	\$ 107	1	
Cummings Park	Exterior Access Route	327032	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 1,427	1	
Cummings Park	Exterior Access Route	327029	WASHINGTON: An exterior accessible route is not provided.	\$ 4,354	1	
Cummings Park	Exterior Access Route	327034	WASHINGTON: An exterior accessible route is not provided.	\$ 237	1	
Cummings Park	Accessible Parking	327018	The slope of the parking space is greater than 1:50 (2%).	\$ 6,300	1	
Cummings Park	Accessible Parking	327020	Accessible car stall markings do not define the stall width.	\$ 420	1	
Cummings Park	Accessible Parking	327019	The access aisle slope is greater than 1:50 (2%).	\$ 5,000	1	
Cummings Park	Accessible Parking	327022	The parking space slope is greater than 1:50 (2%).	\$ 6,300	1	
Cummings Park	Accessible Parking	327023	Accessible van stall markings do not define the stall width.	\$ 420	1	
Cummings Park	Accessible Parking	327024	Accessible van aisle markings do not define the aisle width.	\$ 420	1	
Cummings Park	Accessible Parking	327026	The access aisle slope is greater than 1:50 (2%).	\$ 5,000	1	
Cummings Park	Picnic Area	327027	BEST PRACTICE: The table does not have minimum 36" wide clear ground space on all usable sides of the table.	\$ 792	4	
Cummings Park	Picnic Area	327028	The picnic table does not allow a clear space for forward wheelchair approach with knee and toe clearance.	\$ 1,300	2	
Cummings Park	Picnic Area	349715	The picnic table does not allow a clear space for forward wheelchair approach with knee and toe clearance.	\$ 1,300	2	
Cummings Park	Picnic Area	327036	A compliant picnic table is not provided.	\$ 1,300	4	
Cummings Park	Scenic Viewing Area	327033	BEST PRACTICE: At least 20% or minimum one of each of the telescopes and periscopes do not have eyepiece at 43" minimum and 51" maximum height above ground surface.	\$ 1,000	4	
Cummings Park	Scenic Viewing Area	327037	BEST PRACTICE: At least 20% or minimum one of each of the telescopes and periscopes do not have eyepiece at 43" minimum and 51" maximum height above ground surface.	\$ 1,000	4	
Dickman Mill Park	Beach	326862	BEST PRACTICE: The beach access route is not compliant or is not provided.	\$ 5,296	1	
Dickman Mill Park	Beach	326881	BEST PRACTICE: The beach access route is not compliant or is not provided.	\$ 247	2	
Dickman Mill Park	Beach	326886	BEST PRACTICE: The beach access route is not compliant.	\$ 1,750	1	
Dickman Mill Park	Site Furnishings	326884	BEST PRACTICE: An adjacent clear space is not provided at the bench.	\$ 99	2	
Dickman Mill Park	Restroom	326875	The height of controls are not compliant.	\$ 200	3	
Dickman Mill Park	Site Furnishings	326863	The minimum number and types of drinking fountains are not provided.	\$ 8,000	4	
Dickman Mill Park	Exterior Access Route	326859	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 750	1	
Dickman Mill Park	Exterior Access Route	326860	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 1,000	1	
Dickman Mill Park	Exterior Access Route	326861	The accessible route has gaps in the surface greater than 1/2" wide.	\$ 1,500	1	
Dickman Mill Park	Exterior Access Route	326885	Walkway has areas of vertical level changes in excess of 1/4" that are not ramped.	\$ 123	1	
Dickman Mill Park	Exterior Access Route	326882	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 5,000	1	
Dickman Mill Park	Exterior Access Route	326883	The accessible route has gaps in the surface greater than 1/2" wide.	\$ 247	1	
Dickman Mill Park	Exterior Access Route	326887	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 64,428	1	
Dickman Mill Park	Exterior Access Route	326876	BEST PRACTICE: Clear ground space is not provided at the sign.	\$ 297	2	
Dickman Mill Park	Exterior Access Route	326877	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 297	1	
Dickman Mill Park	Exterior Access Route	326878	Walkway has areas of vertical level changes in excess of 1/4" that are not ramped.	\$ 297	1	
Dickman Mill Park	Restroom	326864	The pull side of the accessible door does not have the required maneuvering clearances.	\$ 1,250	3	
Dickman Mill Park	Restroom	326869	The lavatory is mounted higher than 34" to the higher of the rim or counter.	\$ 720	3	
Dickman Mill Park	Restroom	326871	The height of the water closet is not 17" minimum to 19" maximum above finished floor.	\$ 630	3	
Dickman Mill Park	Restroom	326872	The grab bars at the water closet are not compliant.	\$ 710	3	
Dickman Mill Park	Restroom	326873	WASHINGTON: The toilet paper dispenser location is not compliant.	\$ 293	3	
Dickman Mill Park	Restroom	326874	The opening force of the fire door is more than 15#s at the latch, more than 30#s to set door in motion, and more than #15 to move door to fully open.	\$ 457	1	
Dickman Mill Park	Restroom	326868	A level turning space and clear floor space within the restroom is not provided.	\$ 11,562	3	
Dickman Mill Park	Restroom	346701	The water closet in the unisex restroom does not have the required clearance.	\$ 1,710	3	
Dickman Mill Park	Site Furnishings	326888	Clear ground space is not provided at the trash receptacle with lid requiring operation.	\$ 237	2	
Dune Peninsula at Point Defiance Park	Exterior Access Route	324994	BEST PRACTICE: Segments of running slope from 1:20 (5%) to 1:12 (8.3%) exceed 200 LF and/or resting intervals are not provided at both ends of the segment.	\$ 1,070	4	
Dune Peninsula at Point Defiance Park	Accessible Parking	324978	WASHINGTON: Compliant signage is not provided at access aisle.	\$ 1,400	1	
Dune Peninsula at Point Defiance Park	Restroom	324983	The height of the water closet is not 17" minimum to 19" maximum above finished floor.	\$ 630	3	
Dune Peninsula at Point Defiance Park	Restroom	324984	WASHINGTON: The toilet paper dispenser location is not compliant.	\$ 293	3	
Dune Peninsula at Point Defiance Park	Restroom	324987	The flush control is located on the closed side and/or is not within reach range.	\$ 313	3	
Dune Peninsula at Point Defiance Park	Restroom	324988	The height of the water closet is not 17" minimum to 19" maximum above finished floor.	\$ 630	3	
Dune Peninsula at Point Defiance Park	Restroom	324989	The flush control is located on the closed side and/or is not within reach range.	\$ 313	3	
Dune Peninsula at Point Defiance Park	Restroom	324990	WASHINGTON: The toilet paper dispenser location is not compliant.	\$ 293	3	
Dune Peninsula at Point Defiance Park	Restroom	324997	The height of the water closet is not 17" minimum to 19" maximum above finished floor.	\$ 630	3	
Dune Peninsula at Point Defiance Park	Restroom	324998	WASHINGTON: The toilet paper dispenser location is not compliant.	\$ 293	3	
Dune Peninsula at Point Defiance Park	Restroom	324999	The flush control is located on the closed side and/or is not within reach range.	\$ 313	3	
Dune Peninsula at Point Defiance Park	Restroom	325000	The height of the water closet is not 17" minimum to 19" maximum above finished floor.	\$ 630	3	

PHASE TWO					
PARK	CATEGORY	BARRIER ID	BARRIER DESCRIPTION	ESTIMATE	PRIORITY
Dune Peninsula at Point Defiance Park	Restroom	325001	WASHINGTON: The toilet paper dispenser location is not compliant.	\$ 293	3
Dune Peninsula at Point Defiance Park	Restroom	325002	The flush control is located on the closed side and/or is not within reach range. BEST PRACTICE: Segments of running slope from 1:20 (5%) to 1:12 (8.3%) exceed 200 LF and/or resting intervals are not provided at both ends of the segment.	\$ 313	3
Dune Peninsula at Point Defiance Park	Trail	324993		\$ 1,075	4
Dune Peninsula at Point Defiance Park	Trail	358024	BEST PRACTICE: The accessible trail or trail segment does not have signage with trail details.	\$ 1,400	4
Dune Peninsula at Point Defiance Park	Exterior Access Route	324979	Handrails are not provided.	\$ 7,498	1
Dune Peninsula at Point Defiance Park	Exterior Access Route	324992	Handrails are not provided.	\$ 8,802	1
Dune Peninsula at Point Defiance Park	Exterior Access Route	324996	Handrails are not provided.	\$ 8,802	1
Fort Nisqually Living History Museum	Restroom	325188	WASHINGTON: The toilet paper dispenser location is not compliant.	\$ 366	3
Fort Nisqually Living History Museum	Entrance to Building	325214	The push side of the accessible door does not have the required maneuvering clearances.	\$ 1,250	1
Fort Nisqually Living History Museum	Entrance to Building	325222	The push side of the accessible door does not have the required maneuvering clearances. The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ 1,250	1
Fort Nisqually Living History Museum	Entrance to Building	325224		\$ -	1
Fort Nisqually Living History Museum	Entrance to Building	325225	The push side of the accessible door does not have the required maneuvering clearances.	\$ 1,250	1
Fort Nisqually Living History Museum	Entrance to Building	325202	The pull side of the accessible door does not have the required maneuvering clearances.	\$ 1,250	1
Fort Nisqually Living History Museum	Entrance to Building	325179	The pull side of the accessible door does not have the required maneuvering clearances.	\$ 1,250	1
Fort Nisqually Living History Museum	Entrance to Building	325177	The pull side of the accessible door does not have the required maneuvering clearances. The opening force of the fire door is more than the minimum allowable by the appropriate administrative authority.	\$ 1,250	1
Fort Nisqually Living History Museum	Entrance to Building	325223		\$ 457	1
Fort Nisqually Living History Museum	Exterior Access Route	325197	WASHINGTON: The clear width of the exterior accessible route is less than 44".	\$ 448	1
Fort Nisqually Living History Museum	Exterior Access Route	325200	WASHINGTON: An exterior accessible route is not provided.	\$ 3,046	1
Fort Nisqually Living History Museum	Exterior Access Route	325167	WASHINGTON: An exterior accessible route is not provided.	\$ 1,684	1
Fort Nisqually Living History Museum	Exterior Access Route	325196	WASHINGTON: An exterior accessible route is not provided.	\$ 1,164	1
Fort Nisqually Living History Museum	Historic Structure	325174	WASHINGTON: The historic property requires alteration to make it accessible.	\$ -	1
Fort Nisqually Living History Museum	Common Areas	325212	At least one each of shelves, clothes rod, drawer, hook, closets or cabinets are not within reach range.	\$ 101	2
Fort Nisqually Living History Museum	Accessible Parking	325199	WASHINGTON: A car stall, access aisle, and signage are not provided.	\$ 6,580	1
Fort Nisqually Living History Museum	Accessible Parking	325198	WASHINGTON: A van stall, access aisle, and signage are not provided.	\$ 11,860	1
Fort Nisqually Living History Museum	Accessible Parking	325172	WASHINGTON: The car stall slope is not compliant.	\$ 14,125	1
Fort Nisqually Living History Museum	Accessible Parking	325170	WASHINGTON: The van stall access aisle slope is not compliant.	\$ 1,050	1
Fort Nisqually Living History Museum	Accessible Parking	325173	WASHINGTON: The van stall slope is not compliant.	\$ 1,050	1
Fort Nisqually Living History Museum	Accessible Parking	325168	WASHINGTON: The van stall slope is not compliant.	\$ 1,050	1
Fort Nisqually Living History Museum	Exterior Access Route	325215	WASHINGTON: Handrails are not provided where the ramp rises more than 6" or are not compliant.	\$ 5,868	1
Fort Nisqually Living History Museum	Restroom	325182	The urinal dimensions are not compliant.	\$ 935	3
Fort Nisqually Living History Museum	Restroom	325185	The flush control is located on the closed side and/or is not within reach range.	\$ 313	3
Fort Nisqually Living History Museum	Restroom	325186	The height of the water closet is not 17" minimum to 19" maximum above finished floor.	\$ 630	3
Fort Nisqually Living History Museum	Restroom	325193	The height of the water closet is not 17" minimum to 19" maximum above finished floor.	\$ 630	3
Fort Nisqually Living History Museum	Restroom	325195	ANSI A117.1-2009 : A vertical side grab bar is not present in the wheelchair stall. The sink rim is higher than 34", and does not have knee and toe clearance (does not apply to mop basins, utility sinks, or bar sinks).	\$ 443	3
Fort Nisqually Living History Museum	Common Areas	325213		\$ 720	2
Fort Nisqually Living History Museum	Exterior Access Route	325217	Handrails are not compliant.	\$ 1,630	1
Fort Nisqually Living History Museum	Exterior Access Route	325216	Handrails are not compliant.	\$ 815	1
Hamilton Park	Site Furnishings	327044	BEST PRACTICE: An adjacent clear space is not provided at the bench.	\$ 52	2
Hamilton Park	Exterior Access Route	327047	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 5,946	1
Hamilton Park	Exterior Access Route	327040	A compliant turning space is not provided at a change of direction.	\$ 224	1
Hamilton Park	Exterior Access Route	327041	The walkway does not have a compliant turning space at a change of direction.	\$ 2,854	1
Hamilton Park	Picnic Area	327045	The picnic table does not allow a clear space for forward wheelchair approach with knee and toe clearance.	\$ 1,300	2
Hamilton Park	Site Furnishings	327046	BEST PRACTICE: The table does not have minimum 36" wide clear ground space on all usable sides of the table.	\$ 215	4
Jack Hyde Park	Beach	319591	BEST PRACTICE: A beach access route is not provided.	\$ 3,567	1
Jack Hyde Park	Site Furnishings	319570	BEST PRACTICE: An adjacent clear space is not provided at the bench.	\$ 52	2
Jack Hyde Park	Picnic Area	319574	The amenity is not located on an accessible route.	\$ 1,209	3
Jack Hyde Park	Trail	319589	The accessible route has gaps in the surface greater than 1/2" wide.	\$ 1,200	1
Jack Hyde Park	Exterior Access Route	319579	Handrails are not compliant or are not provided.	\$ 7,824	1
Jack Hyde Park	Exterior Access Route	319582	Handrails are not compliant or are not provided.	\$ 7,824	1
Jack Hyde Park	Exterior Access Route	319580	Handrails are not compliant or are not provided.	\$ 163	1
Jack Hyde Park	Exterior Access Route	319592	The accessible route has greater than 1:20 (5%) running slope and 1:50 (2%) cross slope.	\$ 2,150	1
Jack Hyde Park	Exterior Access Route	319593	The accessible route has gaps in the surface greater than 1/2" wide.	\$ 17	1
Jack Hyde Park	Exterior Access Route	319590	Ground surfaces are not firm, stable and slip resistant.	\$ 10,000	1
Jack Hyde Park	Exterior Access Route	319567	Ground surfaces are not firm, stable and slip resistant.	\$ 200	1
Jack Hyde Park	Trail	319588	BEST PRACTICE: The rinsing shower does not have two fixed shower heads or one hand-held shower spray unit and one fixed shower head at compliant heights.	\$ 650	4
Jack Hyde Park	Picnic Area	319565	BEST PRACTICE: Clear ground space around the picnic table is less than 36" width.	\$ 537	2
Jack Hyde Park	Picnic Area	319595	The picnic table does not allow a clear space for forward wheelchair approach with knee and toe clearance.	\$ -	2
Jack Hyde Park	Picnic Area	319572	BEST PRACTICE: Clear ground space around the picnic table is less than 36" width.	\$ -	2
Jack Hyde Park	Picnic Area	319573	The picnic table does not allow a clear space for forward wheelchair approach with knee and toe clearance. Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the accessible route.	\$ -	2
Jack Hyde Park	Exterior Access Route	319568		\$ 728	1
Jack Hyde Park	Exterior Access Route	319585	WASHINGTON: The slopes of the ramp are not compliant.	\$ 26,480	1
Jack Hyde Park	Exterior Access Route	319586	WASHINGTON: Handrails are not provided where the ramp rises more than 6" or are not compliant.	\$ 5,868	1
Jack Hyde Park	Exterior Access Route	319576	A ramp is required but not provided.	\$ 7,944	1
Jack Hyde Park	Exterior Access Route	319577	The accessible route to the facility has a stairway, which does not comply with vertical rise requirements.	\$ 1,200	1
Jack Hyde Park	Campground	319566	The picnic table is not a compliant height.	\$ 1,300	4
Jack Hyde Park	Exterior Access Route	319583	WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 200	3
Jack Hyde Park	Exterior Access Route	319584	WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 450	3

PHASE TWO						
PARK	CATEGORY	BARRIER ID	BARRIER DESCRIPTION	ESTIMATE	PRIORITY	
Jack Hyde Park	Exterior Access Route	319578	WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 2,816	3	
Jack Hyde Park	Exterior Access Route	319569	WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 520	3	
Jack Hyde Park	Exterior Access Route	319581	WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 704	3	
Jack Hyde Park	Accessible Route	319587	A compliant accessible route is not provided from the public access to the amenity.	\$ 10,000	1	
Jack Hyde Park	Trail	319575	The inaccessible trail or trail segment does not have signage with trail details.	\$ 280	4	
Judge Jack Tanner Park	Beach	327052	BEST PRACTICE: The beach access route is not compliant.	\$ 44,800	1	
Judge Jack Tanner Park	Exterior Access Route	327062	WASHINGTON: The slope of the curb ramp run is not compliant.	\$ 1,750	1	
Judge Jack Tanner Park	Exterior Access Route	327063	The slope of the curb ramp flare is greater than 1:10 (10%). The curb ramp landing is not level. The slope of the curb ramp landing exceeds the maximum allowable 1:48 (2.08%).	\$ -	1	
Judge Jack Tanner Park	Exterior Access Route	327064	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 1,289	1	
Judge Jack Tanner Park	Exterior Access Route	327059	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 237	1	
Judge Jack Tanner Park	Exterior Access Route	327048	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 320	1	
Judge Jack Tanner Park	Exterior Access Route	327053	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 4,756	1	
Judge Jack Tanner Park	Exterior Access Route	327055	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 23,784	1	
Judge Jack Tanner Park	Exterior Access Route	327057	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 2,774	1	
Judge Jack Tanner Park	Picnic Area	327049	A compliant picnic table is not provided.	\$ 1,300	4	
Judge Jack Tanner Park	Picnic Area	327050	BEST PRACTICE: Clear ground space around the picnic table is less than 36" width. BEST PRACTICE: The picnic table does not allow a clear space for forward wheelchair approach with knee and toe clearance.	\$ 713	2	
Judge Jack Tanner Park	Picnic Area	327056	The clear space at the accessible table is not firm and stable.	\$ 1,300	2	
Judge Jack Tanner Park	Site Furnishings	327294	Handrail extensions are not compliant.	\$ 1,625	2	
Judge Jack Tanner Park	Exterior Access Route	327051	WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 652	1	
Judge Jack Tanner Park	Exterior Access Route	327292	Clear ground space is not provided at the trash receptacle with lid requiring operation.	\$ 140	3	
Judge Jack Tanner Park	Site Furnishings	327058	Clear floor space at all sinks, works surfaces, operable parts and appliances is not provided.	\$ 237	2	
Les Davis Pier	Kitchen	328374	BEST PRACTICE: An adjacent clear space is not provided at the bench.	\$ 20,000	2	
Les Davis Pier	Site Furnishings	328387	BEST PRACTICE: An adjacent clear space is not provided at the bench.	\$ 396	2	
Les Davis Pier	Site Furnishings	328401	The curb ramp projects into the parking space.	\$ 237	2	
Les Davis Pier	Exterior Access Route	328399	The hardware at the accessible door (including sliding doors - both sides) requires tight grasping, pinching or twisting of the wrist to operate OR is mounted below 34" or above 48".	\$ 1,750	1	
Les Davis Pier	Interior Access Route	328379	The surface of the swinging door within 10 inches of the finish floor or ground for the full width of the door on the push side is not smooth.	\$ 1,758	1	
Les Davis Pier	Interior Access Route	328380	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 100	2	
Les Davis Pier	Exterior Access Route	328367	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 1,585	1	
Les Davis Pier	Exterior Access Route	328368	The accessible route has gaps in the surface greater than 1/2" wide.	\$ 792	1	
Les Davis Pier	Exterior Access Route	328389	The walkway has areas of vertical level changes in excess of 1/4" that are not ramped.	\$ 89,600	1	
Les Davis Pier	Exterior Access Route	328391	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 158	1	
Les Davis Pier	Exterior Access Route	328400	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 59,460	1	
Les Davis Pier	Exterior Access Route	328346	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 4,756	1	
Les Davis Pier	Exterior Access Route	328347	A compliant turning space is not provided at a change of direction.	\$ 716	1	
Les Davis Pier	Exterior Access Route	328350	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 1,545	1	
Les Davis Pier	Exterior Access Route	328351	A compliant turning space is not provided at a change of direction.	\$ 991	1	
Les Davis Pier	Boating and Fishing	328390	The pier or platform does not have at least 25% of the railings set at a maximum height of 34".	\$ 40,750	1	
Les Davis Pier	Kitchen	328373	Less than minimum one of each type of operable part is within reach range.	\$ 2,600	2	
Les Davis Pier	Kitchen	328378	The kitchen does not have an accessible means of egress. A minimum 30" wide section of the counter is not a minimum height of 28" and maximum height of 34" with knee and toe clearance.	\$ 2,600	2	
Les Davis Pier	Kitchen	328375	The clearance between opposing base cabinets, counter tops, appliances or walls within kitchen work areas are less than 40".	\$ 992	4	
Les Davis Pier	Kitchen	328370	An access aisle is not provided.	\$ 12,312	4	
Les Davis Pier	Accessible Parking	328396	The slope of the parking space is greater than 1:50 (2%).	\$ 420	1	
Les Davis Pier	Accessible Parking	328398	A van access aisle is not provided.	\$ 6,300	1	
Les Davis Pier	Accessible Parking	328392	The minimum number of accessible parking spaces is not provided.	\$ 420	1	
Les Davis Pier	Accessible Parking	328394	BEST PRACTICE: Clear ground space around the picnic table is less than 36" width.	\$ 1,130	1	
Les Davis Pier	Picnic Area	328364	A compliant picnic table is not provided.	\$ 322	2	
Les Davis Pier	Picnic Area	328365	The picnic table does not allow a clear space for forward wheelchair approach with knee and toe clearance.	\$ 1,300	4	
Les Davis Pier	Picnic Area	328366	BEST PRACTICE: Clear ground space around the picnic table is less than 36" width.	\$ 237	2	
Les Davis Pier	Picnic Area	328388	WASHINGTON: The clear width of the ramp is less than 44".	\$ 53	2	
Les Davis Pier	Exterior Access Route	328359	WASHINGTON: Handrails are not provided where the ramp rises more than 6" or are not compliant.	\$ 11,254	1	
Les Davis Pier	Exterior Access Route	328360	The ramp does not have a level landing at the bottom of each run.	\$ 2,771	1	
Les Davis Pier	Exterior Access Route	328361	The ramp run rises greater than 6", however no edge protection is provided.	\$ 125	1	
Les Davis Pier	Exterior Access Route	328362	Handrails are not continuous and at a consistent height above ramp surface.	\$ 2,771	1	
Les Davis Pier	Exterior Access Route	328363	Items that require a forward reach motion require more than 48" height reach.	\$ 2,771	1	
Les Davis Pier	Interior Access Route	328377	The centerline of the toilet in the wheelchair stall is not 16" minimum to 18" maximum from the sidewall.	\$ 93	2	
Les Davis Pier	Restroom	328386	The service counter height is greater than 36" where a parallel approach is present.	\$ 630	3	
Les Davis Pier	Concession Stand	328381	Less than 5% or at least one of each type of sink is not accessible.	\$ 1,804	2	
Les Davis Pier	Kitchen	328369	The accessible sink is not installed with the front of the higher of the rim or counter surface 34" maximum above finished floor.	\$ 720	2	
Les Davis Pier	Kitchen	328431	Steps do not have uniform and compliant riser heights and/or tread depths.	\$ 720	2	
Les Davis Pier	Exterior Access Route	328341	Handrails are not compliant.	\$ 3,060	1	
Les Davis Pier	Exterior Access Route	328342	Handrails are not compliant.	\$ 1,956	1	
Les Davis Pier	Exterior Access Route	328343	Handrails are not compliant.	\$ 1,304	1	
Les Davis Pier	Exterior Access Route	328344	Steps do not have uniform and compliant riser heights and/or tread depths.	\$ 1,836	1	
Les Davis Pier	Exterior Access Route	328353	Handrails are not compliant.	\$ 978	1	
Les Davis Pier	Exterior Access Route	328354	Handrails are not compliant.	\$ 978	1	
Les Davis Pier	Exterior Access Route	328357	Handrails are not compliant.	\$ 1,304	1	
Les Davis Pier	Exterior Access Route	328358	Steps do not have uniform and compliant riser heights and/or tread depths.	\$ 2,601	1	

PHASE TWO						
PARK	CATEGORY	BARRIER ID	BARRIER DESCRIPTION	ESTIMATE	PRIORITY	
Les Davis Pier	Kitchen	328376	The storage does not have at least 50% of cabinet shelf space within reach ranges.	\$ 3,377	4	
Meadow Park Golf Course	Entrance to Building	324171	The non-fire, automatic accessible door requires more than 5 pounds of pressure to operate.	\$ 366	1	
Meadow Park Golf Course	Entrance to Building	324144	The maneuvering clearance at the entry door is not compliant.	\$ 1,000	1	
Meadow Park Golf Course	Interior Access Route	324512	Controls throughout the common area are not compliant.	\$ 2,250	1	
Meadow Park Golf Course	Common Areas	324203	Controls are not within an allowable reach range.	\$ 1,098	4	
Meadow Park Golf Course	Common Areas	324173	The sales or service counter does not have an accessible portion with maximum 36" height surface above finish floor.	\$ 1,804	2	
Meadow Park Golf Course	Exterior Access Route	324138	A compliant parallel curb ramp is not provided.	\$ 1,750	1	
Meadow Park Golf Course	Exterior Access Route	324141	A compliant parallel curb ramp is not provided.	\$ 1,750	1	
Meadow Park Golf Course	Exterior Access Route	324143	WASHINGTON: The slope of the curb ramp run is not compliant.	\$ 1,750	1	
Meadow Park Golf Course	Exterior Access Route	324165	A compliant parallel curb ramp is not provided.	\$ 2,187	1	
Meadow Park Golf Course	Exterior Access Route	324163	A compliant parallel curb ramp is not provided.	\$ 2,187	1	
Meadow Park Golf Course	Exterior Access Route	324164	A compliant parallel curb ramp is not provided.	\$ 2,187	1	
Meadow Park Golf Course	Exterior Access Route	324162	WASHINGTON: The slope of the curb ramp run is not compliant.	\$ 3,500	1	
Meadow Park Golf Course	Exterior Access Route	324541	WASHINGTON: The slope of the curb ramp run is not compliant.	\$ 1,750	1	
Meadow Park Golf Course	Exterior Access Route	324153	Knee and toe clearance is not provided at the lower level fountain.	\$ 200	4	
Meadow Park Golf Course	Sports Facilities	324206	A compliant accessible route is not provided to teeing grounds, practice teeing grounds, putting greens, practice putting greens, teeing stations at driving ranges, course weather shelters, golf car rental areas, bag drop areas, and course restrooms.	\$ 1,585	1	
Meadow Park Golf Course	Sports Facilities	324152	A compliant accessible route is not provided to teeing grounds, practice teeing grounds, putting greens, practice putting greens, teeing stations at driving ranges, course weather shelters, golf car rental areas, bag drop areas, and course restrooms.	\$ 5,073	1	
Meadow Park Golf Course	Sports Facilities	324204	The accessible route has greater than 1:20 (5%) running slope and 1:50 (2%) cross slope.	\$ 7,360	1	
Meadow Park Golf Course	Sports Facilities	324207	A compliant accessible route is not provided to teeing grounds, practice teeing grounds, putting greens, practice putting greens, teeing stations at driving ranges, course weather shelters, golf car rental areas, bag drop areas, and course restrooms.	\$ 20,295	1	
Meadow Park Golf Course	Sports Facilities	324208	A compliant accessible route is not provided to teeing grounds, practice teeing grounds, putting greens, practice putting greens, teeing stations at driving ranges, course weather shelters, golf car rental areas, bag drop areas, and course restrooms.	\$ 22,198	1	
Meadow Park Golf Course	Sports Facilities	324205	A compliant accessible route is not provided to teeing grounds, practice teeing grounds, putting greens, practice putting greens, teeing stations at driving ranges, course weather shelters, golf car rental areas, bag drop areas, and course restrooms.	\$ 317	1	
Meadow Park Golf Course	Sports Facilities	324119	A compliant accessible route is not provided to teeing grounds, practice teeing grounds, putting greens, practice putting greens, teeing stations at driving ranges, course weather shelters, golf car rental areas, bag drop areas, and course restrooms.	\$ 247	1	
Meadow Park Golf Course	Sports Facilities	324148	A compliant accessible route with turning space is not provided to teeing grounds, practice teeing grounds, putting greens, practice putting greens, teeing stations at driving ranges, course weather shelters, golf car rental areas, bag drop areas, and course restrooms.	\$ 237	1	
Meadow Park Golf Course	Exterior Access Route	324149	The accessible route has gaps in the surface greater than 1/2" wide.	\$ 19	1	
Meadow Park Golf Course	Exterior Access Route	324150	The accessible route has gaps in the surface greater than 1/2" wide.	\$ 39	1	
Meadow Park Golf Course	Exterior Access Route	324209	The accessible route has gaps in the surface greater than 1/2" wide.	\$ 832	1	
Meadow Park Golf Course	Sports Facilities	324151	A compliant accessible route with turning space is not provided to teeing grounds, practice teeing grounds, putting greens, practice putting greens, teeing stations at driving ranges, course weather shelters, golf car rental areas, bag drop areas, and course restrooms.	\$ 237	1	
Meadow Park Golf Course	Exterior Access Route	324169	WASHINGTON: An exterior accessible route is not provided.	\$ 8,027	1	
Meadow Park Golf Course	Exterior Access Route	324161	WASHINGTON: An exterior accessible route is not provided.	\$ 800	1	
Meadow Park Golf Course	Exterior Access Route	324166	WASHINGTON: An exterior accessible route is not provided.	\$ 2,100	1	
Meadow Park Golf Course	Exterior Access Route	324167	WASHINGTON: An exterior accessible route is not provided.	\$ 1,783	1	
Meadow Park Golf Course	Exterior Access Route	324168	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 1,008	1	
Meadow Park Golf Course	Accessible Parking	324129	The accessible route has gaps in the surface greater than 1/2" wide.	\$ 750	1	
Meadow Park Golf Course	Exterior Access Route	324515	ADVISORY: A marked crosswalk is not provided where the accessible route crosses a vehicular way between the accessible parking aisle and the building entrance.	\$ -	1	
Meadow Park Golf Course	Exterior Access Route	324123	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 16,250	1	
Meadow Park Golf Course	Exterior Access Route	324140	The accessible route has gaps in the surface greater than 1/2" wide.	\$ 158	1	
Meadow Park Golf Course	Sports Facilities	324118	Title II government entity program accessibility: Where golf car rentals are provided, an accessible golf car is not provided for rent.	\$ 10,000	1	
Meadow Park Golf Course	Exterior Access Route	324155	Ground surfaces are not firm, stable and slip resistant.	\$ 3,500	1	
Meadow Park Golf Course	Exterior Access Route	324147	An accessible passenger loading/unloading zone is not provided where a loading/unloading area is present.	\$ 1,750	1	
Meadow Park Golf Course	Accessible Parking	324121	WASHINGTON: The car stall and access aisle slopes are not compliant.	\$ 11,300	1	
Meadow Park Golf Course	Accessible Parking	324131	WASHINGTON: The car access aisle slope is not compliant.	\$ 5,000	1	
Meadow Park Golf Course	Accessible Parking	324132	WASHINGTON: The car stall slope is not compliant.	\$ 6,300	1	
Meadow Park Golf Course	Accessible Parking	324133	WASHINGTON: The car stall slope is not compliant.	\$ 6,300	1	
Meadow Park Golf Course	Accessible Parking	324134	WASHINGTON: The car access aisle slope is not compliant.	\$ 5,000	1	
Meadow Park Golf Course	Accessible Parking	324135	WASHINGTON: The car stall slope is not compliant.	\$ 6,300	1	
Meadow Park Golf Course	Accessible Parking	324136	WASHINGTON: The car stall slope is not compliant.	\$ 6,300	1	
Meadow Park Golf Course	Accessible Parking	324137	WASHINGTON: The car access aisle slope is not compliant.	\$ 5,000	1	
Meadow Park Golf Course	Accessible Parking	324120	WASHINGTON: The van stall and access aisle markings are not compliant.	\$ 840	1	
Meadow Park Golf Course	Accessible Parking	324124	WASHINGTON: The van stall and access aisle slopes are not compliant.	\$ 11,300	1	
Meadow Park Golf Course	Accessible Parking	324130	WASHINGTON: The van access aisle slope is not compliant.	\$ 5,000	1	
Meadow Park Golf Course	Picnic Area	324156	Clear ground space around the picnic table is less than 36" width.	\$ 107	2	
Meadow Park Golf Course	Portable Restroom	324159	An ADA portable restroom is not provided.	\$ 3,750	3	
Meadow Park Golf Course	Interior Access Route	324211	The ramp running slope is greater than 1:12 (8.33%) and the cross slope is greater than 1:48 (2.08%).	\$ 1,324	1	
Meadow Park Golf Course	Interior Access Route	324212	Handrail heights are not compliant.	\$ 2,400	1	
Meadow Park Golf Course	Common Areas	324154	The vending machines have operable parts which are not within reach range.	\$ 6,508	2	
Meadow Park Golf Course	Restroom	324188	Dispenser opening is not within an allowable reach range.	\$ 100	3	
Meadow Park Golf Course	Restroom	324192	Dispenser controls are not within an allowable reach range.	\$ 100	3	
Meadow Park Golf Course	Restroom	324157	An ADA portable restroom is not provided.	\$ 3,000	3	
Meadow Park Golf Course	Restroom	324175	The entire restroom is not compliant due to limited room dimensions.	\$ 12,000	3	
Meadow Park Golf Course	Restroom	324200	The height of controls are not compliant.	\$ 200	3	

PHASE TWO					
PARK	CATEGORY	BARRIER ID	BARRIER DESCRIPTION	ESTIMATE	PRIORITY
Meadow Park Golf Course	Restroom	324213	The opening force required to open the accessible, hinged, non-fire door is more than 5 pounds.	\$ 366	1
Meadow Park Golf Course	Restroom	324187	The lavatory is mounted higher than 34" to the higher of the rim or counter.	\$ 720	3
Meadow Park Golf Course	Restroom	324185	The lavatory is mounted higher than 34" to the higher of the rim or counter.	\$ 720	3
Meadow Park Golf Course	Restroom	324183	The clear floor space at the urinal is less than minimum 30" by minimum 48".	\$ 1,100	3
Meadow Park Golf Course	Restroom	324210	The space between the grab bar and projecting objects above the grab bar is less than 12" minimum.	\$ 100	3
Meadow Park Golf Course	Portable Restroom	324158	The accessible door does not have the required pull side maneuvering clearances.	\$ 475	3
Meadow Park Golf Course	Restroom	324199	The pull side of the accessible door does not have the required maneuvering clearances.	\$ 1,250	3
Meadow Park Golf Course	Restroom	324190	The wheelchair stall with a floor mounted water closet, in a multi-stall restroom, is less than 60" wide and 59" deep.	\$ 1,368	3
Meadow Park Golf Course	Restroom	394730	ANSI A117.1-2009 : A vertical side grab bar is not present in the wheelchair stall.	\$ 443	3
Meadow Park Golf Course	Restroom	324189	The wheelchair stall with a floor mounted water closet, in a multi-stall restroom, is less than 60" wide and 59" deep.	\$ 1,368	3
Meadow Park Golf Course	Restroom	324195	The rear grab bar in the wheelchair stall is not compliant.	\$ 355	3
Meadow Park Golf Course	Restroom	324184	The urinal dimensions are not compliant.	\$ 935	3
Meadow Park Golf Course	Restroom	324191	The side grab bar at the water closet is not compliant.	\$ 355	3
Meadow Park Golf Course	Restroom	324201	The dispenser controls are not within reach ranges.	\$ 280	3
Meadow Park Golf Course	Restroom	394731	ANSI A117.1-2009 : A vertical side grab bar is not present in the wheelchair stall.	\$ 443	3
Meadow Park Golf Course	Exterior Access Route	324513	Handrails are not provided.	\$ 2,608	1
Meadow Park Golf Course	Interior Access Route	324544	Handrails are not compliant.	\$ 400	1
Old Town Dock	Amenity not evaluated	326045	The amenity cannot be accessed and, therefore, cannot be evaluated.	\$ -	0
Old Town Dock	Exterior Access Route	326042	The accessible route has gaps in the surface greater than 1/2" wide.	\$ 71,680	1
Old Town Dock	Exterior Access Route	326041	A compliant turning space is not provided at a change of direction.	\$ 6,139	1
Old Town Dock	Exterior Access Route	326043	The accessible route has gaps in the surface greater than 1/2" wide.	\$ 198	1
Old Town Dock	Exterior Access Route	326046	The accessible route has running slopes greater than 1:20 (5%).	\$ 13,644	1
Old Town Dock	Exterior Access Route	326028	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 5,946	1
Old Town Dock	Exterior Access Route	326029	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 1,189	1
Old Town Dock	Exterior Access Route	326030	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 5,946	1
Old Town Dock	Exterior Access Route	326031	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 4,756	1
Old Town Dock	Exterior Access Route	326026	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 237	1
Old Town Dock	Exterior Access Route	326027	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 3,567	1
Old Town Dock	Boating and Fishing	326044	The pier or platform does not have at least 25% of the railings set at a maximum height of 34".	\$ 14,507	1
Old Town Dock	Picnic Area	326033	A compliant picnic table is not provided.	\$ 1,300	4
Old Town Dock	Picnic Area	326034	BEST PRACTICE: Clear ground space around the picnic table is less than 36" width.	\$ 430	2
Old Town Dock	Restroom	326038	The slope of the floor surface is greater than 2% cross or 5% running	\$ 475	2
Old Town Dock	Restroom	326039	The baby changing table height is not compliant.	\$ 1,588	2
Point Defiance Marina	Picnic Area	336551	An accessible picnic table with wheelchair space is not provided.	\$ 1,300	4
Point Defiance Marina	Exterior Access Route	332072	WASHINGTON: The slope of the curb ramp run is not compliant. The curb ramp landing is not level. The slope of the curb ramp landing exceeds the maximum allowable 1:48 (2.08%).	\$ 1,750	1
Point Defiance Marina	Exterior Access Route	332111		\$ 1,289	1
Point Defiance Marina	Exterior Access Route	332115	A curb ramp is not provided where the accessible route crosses a curb.	\$ 1,750	1
Point Defiance Marina	Exterior Access Route	332109	A curb ramp is not provided where the accessible route crosses a curb.	\$ 1,750	1
Point Defiance Marina	Exterior Access Route	332110	A curb ramp is not provided where the accessible route crosses a curb.	\$ 1,750	1
Point Defiance Marina	Accessible Parking	332105	The slope of the parking space is greater than 1:50 (2%).	\$ 6,300	1
Point Defiance Marina	Accessible Parking	332107	The parking space slope is greater than 1:50 (2%).	\$ 6,300	1
Point Defiance Marina	Accessible Parking	332074	WASHINGTON: A car stall, access aisle, and signage are not provided and the slope and/or ground surface is/are not compliant.	\$ 14,125	1
Point Defiance Marina	Interior Access Route	332102	The ramp run rises 6" or greater but has no handrails.	\$ 4,800	1
Point Defiance Marina	Restroom	332076	The flush control is located on the closed side of the toilet.	\$ 313	3
Point Defiance Marina	Interior Access Route	332104	Handrails are not provided.	\$ 1,304	1
Point Defiance Marina	Exterior Access Route	336553	Handrails are not compliant or are not provided.	\$ 5,216	1
Point Defiance Park	Site Furnishings	360917	BEST PRACTICE: An adjacent clear space is not provided at the bench.	\$ 131	2
Point Defiance Park	Entrance to Building	325243	The push side of the accessible door does not have the required maneuvering clearances. The counter oriented for a forward approach does not have clear floor space for a forward approach with toe and knee clearance.	\$ 1,250	1
Point Defiance Park	Common Areas	325262		\$ 202	2
Point Defiance Park	Exterior Access Route	332152	A landing at the top of the curb ramp is not present.	\$ 2,578	1
Point Defiance Park	Exterior Access Route	332117	WASHINGTON: The slope of the curb ramp run is not compliant.	\$ 1,750	1
Point Defiance Park	Common Areas	325272	Controls and/or dispensers are not within an allowable reach range.	\$ 13,176	4
Point Defiance Park	Site Furnishings	332174	The minimum number and types of drinking fountains are not provided.	\$ 10,000	4
Point Defiance Park	Interior Access Route	392390	The building does not have elevator access between stories.	\$ 100,000	1
Point Defiance Park	Exterior Access Route	332153	WASHINGTON: An exterior accessible route is not provided.	\$ 13,440	1
Point Defiance Park	Exterior Access Route	332233	WASHINGTON: An exterior accessible route is not provided.	\$ 3,360	1
Point Defiance Park	Exterior Access Route	334547	WASHINGTON: An exterior accessible route is not provided.	\$ 2,016	1
Point Defiance Park	Exterior Access Route	334545	WASHINGTON: An exterior accessible route is not provided.	\$ 6,720	1
Point Defiance Park	Exterior Access Route	332151	WASHINGTON: An exterior accessible route is not provided.	\$ 1,344	1
Point Defiance Park	Exterior Access Route	332165	WASHINGTON: An exterior accessible route is not provided.	\$ 134	1
Point Defiance Park	Exterior Access Route	332170	WASHINGTON: An exterior accessible route is not provided.	\$ 22,680	1
Point Defiance Park	Exterior Access Route	332194	WASHINGTON: An exterior accessible route is not provided.	\$ 6,720	1
Point Defiance Park	Exterior Access Route	332578	WASHINGTON: An exterior accessible route is not provided.	\$ 1,585	1
Point Defiance Park	Exterior Access Route	332583	WASHINGTON: An exterior accessible route is not provided.	\$ 2,329	1
Point Defiance Park	Exterior Access Route	332155	WASHINGTON: An exterior accessible route is not provided.	\$ 100,800	1
Point Defiance Park	Exterior Access Route	332158	WASHINGTON: An exterior accessible route is not provided.	\$ 6,720	1
Point Defiance Park	Exterior Access Route	332197	WASHINGTON: An exterior accessible route is not provided.	\$ 3,360	1
Point Defiance Park	Exterior Access Route	332200	WASHINGTON: An exterior accessible route is not provided.	\$ 12,096	1
Point Defiance Park	Historic Structure	332579	WASHINGTON: The historic property requires alteration to make it accessible.	\$ -	1
Point Defiance Park	Historic Structure	325229	WASHINGTON: The historic property requires alteration to make it accessible. A minimum 30" wide section of the counter is not a minimum height of 28" and maximum height of 34" with knee and toe clearance.	\$ -	1
Point Defiance Park	Kitchen	325271		\$ 2,977	4
Point Defiance Park	Accessible Parking	332204	The slope of the parking space is greater than 1:50 (2%).	\$ 6,300	1

PHASE TWO						
PARK	CATEGORY	BARRIER ID	BARRIER DESCRIPTION	ESTIMATE	PRIORITY	
Point Defiance Park	Accessible Parking	332205	The access aisle slope is greater than 1:50 (2%).	\$ 5,000	1	
Point Defiance Park	Accessible Parking	332206	The slope of the parking space is greater than 1:50 (2%).	\$ 6,300	1	
Point Defiance Park	Accessible Parking	332207	The access aisle slope is greater than 1:50 (2%).	\$ 5,000	1	
Point Defiance Park	Accessible Parking	332116	The slope of the parking space is greater than 1:50 (2%).	\$ 6,300	1	
Point Defiance Park	Accessible Parking	332118	The slope of the parking space is greater than 1:50 (2%).	\$ 6,300	1	
Point Defiance Park	Accessible Parking	332120	The access aisle slope is greater than 1:50 (2%).	\$ 5,280	1	
Point Defiance Park	Accessible Parking	332123	The slope of the parking space is greater than 1:50 (2%).	\$ 6,300	1	
Point Defiance Park	Accessible Parking	332124	The slope of the parking space is greater than 1:50 (2%).	\$ 6,300	1	
Point Defiance Park	Accessible Parking	332149	WASHINGTON: A car stall, access aisle, and signage are not provided and the slope and/or ground surface is/are not compliant.	\$ 11,860	1	
Point Defiance Park	Accessible Parking	334546	WASHINGTON: A van stall, access aisle, and signage are not provided and the slope and/or ground surface is/are not compliant.	\$ 11,860	1	
Point Defiance Park	Accessible Parking	332173	The parking space slope is greater than 1:50 (2%).	\$ 6,300	1	
Point Defiance Park	Accessible Parking	332201	The parking space slope is greater than 1:50 (2%).	\$ 6,300	1	
Point Defiance Park	Accessible Parking	332202	The access aisle slope is greater than 1:50 (2%).	\$ 5,000	1	
Point Defiance Park	Accessible Parking	332203	The parking space slope is greater than 1:50 (2%).	\$ 6,300	1	
Point Defiance Park	Accessible Parking	332126	The access aisle slope is greater than 1:50 (2%).	\$ 5,000	1	
Point Defiance Park	Accessible Parking	332125	The parking space slope is greater than 1:50 (2%).	\$ 6,300	1	
Point Defiance Park	Accessible Parking	332150	WASHINGTON: A van stall, access aisle, and signage are not provided and the slope and/or ground surface is/are not compliant.	\$ 11,860	1	
Point Defiance Park	Accessible Parking	332195	WASHINGTON: A van stall, access aisle, and signage are not provided and the slope and/or ground surface is/are not compliant.	\$ 11,860	1	
Point Defiance Park	Accessible Parking	332572	WASHINGTON: The slope of the van access aisle is not compliant.	\$ 5,000	1	
Point Defiance Park	Picnic Shelter	332169	BEST PRACTICE: Clear ground space around the picnic table is less than 36" wide.	\$ 304	2	
Point Defiance Park	Picnic Shelter	332178	BEST PRACTICE: Clear ground space around the picnic table is less than 36" wide.	\$ 304	2	
Point Defiance Park	Restroom	334524	The restroom circulation path is not free of objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.	\$ 116	2	
Point Defiance Park	Restroom	332212	The restroom circulation path is not free of objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.	\$ 116	2	
Point Defiance Park	Restroom	332218	The restroom circulation path is not free of objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.	\$ 116	2	
Point Defiance Park	Restroom	332219	The restroom circulation path is not free of objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.	\$ 116	2	
Point Defiance Park	Exterior Access Route	332580	The ramp run rises greater than 6", however no edge protection is provided.	\$ 10,595	1	
Point Defiance Park	Exterior Access Route	332581	WASHINGTON: The slopes of the ramp are not compliant. A landing is not provided at a change in direction of the ramp.	\$ 21,184	1	
Point Defiance Park	Exterior Access Route	332157	WASHINGTON: The ramp handrails are not compliant.	\$ 3,260	1	
Point Defiance Park	Restroom	332146	The wheelchair stall door is not compliant.	\$ 500	3	
Point Defiance Park	Restroom	325256	The wheelchair stall door is not compliant.	\$ 500	3	
Point Defiance Park	Restroom	332148	The urinal dimensions are not compliant.	\$ 935	3	
Point Defiance Park	Restroom	334541	The urinal dimensions are not compliant.	\$ 935	3	
Point Defiance Park	Restroom	334542	The clear floor space at the urinal is less than minimum 30" by minimum 48".	\$ 1,100	3	
Point Defiance Park	Restroom	332180	The urinal dimensions are not compliant.	\$ 935	3	
Point Defiance Park	Restroom	332142	The side grab bar at the water closet is not compliant.	\$ 355	3	
Point Defiance Park	Restroom	332143	The grab bars at the water closet are not compliant.	\$ 1,420	3	
Point Defiance Park	Restroom	332144	The flush control is located on the closed side and/or is not within reach range.	\$ 313	3	
Point Defiance Park	Restroom	332147	The height of the water closet is not 17" minimum to 19" maximum above finished floor.	\$ 630	3	
Point Defiance Park	Restroom	332131	The side grab bar at the water closet is not compliant.	\$ 355	3	
Point Defiance Park	Restroom	332132	The grab bars at the water closet are not compliant.	\$ 710	3	
Point Defiance Park	Restroom	332133	The flush control is located partially on the closed side and is within 12" of the top of the grab bar.	\$ 313	3	
Point Defiance Park	Restroom	332136	The height of the water closet is not 17" minimum to 19" maximum above finished floor.	\$ 630	3	
Point Defiance Park	Restroom	334539	The flush control is located partially on the closed side and is located within 12" of the top of the grab bar.	\$ 313	3	
Point Defiance Park	Restroom	334534	The flush control is located partially on the closed side and is within 12" of the top of the grab bar.	\$ 313	3	
Point Defiance Park	Restroom	332184	The height of the water closet is not 17" minimum to 19" maximum above finished floor.	\$ 630	3	
Point Defiance Park	Restroom	332190	The height of the water closet is not 17" minimum to 19" maximum above finished floor.	\$ 630	3	
Point Defiance Park	Restroom	394734	ANSI A117.1-2009 : A vertical side grab bar is not present in the wheelchair stall.	\$ 443	3	
Point Defiance Park	Restroom	332135	The hardware at the wheelchair stall door is not compliant.	\$ 366	3	
Point Defiance Park	Restroom	334537	The hardware at the wheelchair stall door is not compliant.	\$ 366	3	
Point Defiance Park	Restroom	334532	The hardware at the wheelchair stall door is not compliant.	\$ 366	3	
Point Defiance Park	Restroom	332186	The hardware at the wheelchair stall door is not compliant.	\$ 366	3	
Point Defiance Park	Restroom	332192	The hardware at the wheelchair stall door is not compliant.	\$ 366	3	
Point Defiance Park	Restroom	394733	ANSI A117.1-2009 : A vertical side grab bar is not present in the wheelchair stall.	\$ 443	3	
Point Defiance Park	Restroom	394732	ANSI A117.1-2009 : A vertical side grab bar is not present in the wheelchair stall.	\$ 443	3	
Point Defiance Park	Restroom	334536	ANSI A117.1-2009 : A vertical side grab bar is not present in the wheelchair stall.	\$ 443	3	
Point Defiance Park	Restroom	334540	The grab bars at the water closet are not compliant.	\$ 887	3	
Point Defiance Park	Restroom	332182	The grab bars at the water closet are not compliant.	\$ 887	3	
Point Defiance Park	Trail	325236	BEST PRACTICE: The inaccessible trail or trail segment does not have signage with trail details.	\$ 560	4	
Point Defiance Park	Trail	325235	BEST PRACTICE: The inaccessible trail or trail segment does not have signage with trail details.	\$ 840	4	
Point Defiance Park	Trail	325237	BEST PRACTICE: The inaccessible trail or trail segment does not have signage with trail details.	\$ 560	4	
Point Defiance Park	Trail	325238	BEST PRACTICE: The inaccessible trail or trail segment does not have signage with trail details.	\$ 560	4	
Point Defiance Park	Trail	325234	BEST PRACTICE: The inaccessible trail or trail segment does not have signage with trail details.	\$ 840	4	
Point Defiance Park	Trail	332582	BEST PRACTICE: The inaccessible trail or trail segment does not have signage with trail details.	\$ 280	4	
Point Defiance Park	Common Areas	325269	Sinks do not have knee and/or toe clearance.	\$ 1,986	2	
Point Defiance Park	Exterior Access Route	325228	Handrails are not compliant or are not provided.	\$ 1,304	1	
Point Defiance Park	Exterior Access Route	325231	Handrails are not compliant.	\$ 7,498	1	
Point Defiance Park	Exterior Access Route	332576	Handrails are not compliant or are not provided.	\$ 1,304	1	
Point Defiance Park	Exterior Access Route	332156	Handrails are not provided.	\$ 3,912	1	
Point Defiance Park	Site Furnishings	360918	A trash receptacle is not located on an accessible route and within reach range.	\$ 143	2	

PHASE TWO						
PARK	CATEGORY	BARRIER ID	BARRIER DESCRIPTION	ESTIMATE	PRIORITY	
Point Defiance Park	Restroom	332189	The flush control is located on the closed side of the toilet.	\$ 313	3	
Point Defiance Park	Trail	332160	BEST PRACTICE: The inaccessible trail or trail segment does not have signage with trail details.	\$ 560	4	
Point Defiance Park	Trail	332161	BEST PRACTICE: The accessible trail or trail segment does not have signage with trail details.	\$ 280	4	
Point Defiance Park	Trail	332164	BEST PRACTICE: The inaccessible trail or trail segment does not have signage with trail details.	\$ 280	4	
Point Defiance Park	Picnic Area	332168	The picnic table does not allow a clear space for forward wheelchair approach with knee and toe clearance.	\$ 1,625	2	
Point Defiance Park	Picnic Area	332176	A compliant picnic table is not provided.	\$ 1,625	4	
Point Defiance Park	Picnic Area	332177	A compliant picnic table is not provided.	\$ 1,625	4	
Point Defiance Park	Trail	332183	BEST PRACTICE: The inaccessible trail or trail segment does not have signage with trail details.	\$ 280	4	
Point Defiance Park	Picnic Shelter	332196	The picnic table does not allow a clear space for forward wheelchair approach with knee and toe clearance.	\$ 1,625	2	
Point Defiance Park	Exterior Access Route	332198	BEST PRACTICE: The inaccessible trail or trail segment does not have signage with trail details.	\$ 280	4	
Point Defiance Park	Picnic Shelter	332199	The picnic table does not allow a clear space for forward wheelchair approach with knee and toe clearance.	\$ 1,625	2	
Point Defiance Park	Picnic Area	332225	BEST PRACTICE: The total number of accessible picnic tables is less than the required 20% or not less than one.	\$ 1,625	4	
Point Defiance Park	Picnic Area	332226	A compliant picnic table is not provided.	\$ 1,625	4	
Point Defiance Park	Trail	332227	BEST PRACTICE: The inaccessible trail or trail segment does not have signage with trail details.	\$ 280	4	
Point Defiance Park	Picnic Area	332228	A compliant picnic table is not provided.	\$ 1,625	4	
Point Defiance Park	Trail	332232	BEST PRACTICE: The inaccessible trail or trail segment does not have signage with trail details.	\$ 1,120	4	
Point Defiance Park	Picnic Area	332234	A compliant picnic table is not provided.	\$ 1,625	4	
Point Defiance Park	Picnic Area	334543	A compliant picnic table is not provided.	\$ 1,625	4	
Point Defiance Park	Picnic Area	334544	A compliant picnic table is not provided.	\$ 1,625	4	
Point Defiance Park	Trail	334548	BEST PRACTICE: The inaccessible trail or trail segment does not have signage with trail details.	\$ 280	4	
Thea's Park	Exterior Access Route	319013	WASHINGTON: The slope of the curb ramp run is not compliant.	\$ 1,750	1	
Thea's Park	Exterior Access Route	319026	WASHINGTON: The slope of the curb ramp run is not compliant.	\$ 1,750	1	
Thea's Park	Exterior Access Route	319027	WASHINGTON: The slope of the curb ramp run is not compliant.	\$ 1,750	1	
Thea's Park	Exterior Access Route	319007	The landing at the top of the curb ramp is not a compliant size.	\$ 1,289	1	
Thea's Park	Exterior Access Route	319006	WASHINGTON: The slope of the curb ramp run is not compliant.	\$ 1,750	1	
Thea's Park	Exterior Access Route	319028	The accessible route has cross slopes greater than 1:50 (2%).	\$ 396	1	
Thea's Park	Exterior Access Route	319029	The accessible route has gaps in the surface greater than 1/2" wide.	\$ 19	1	
Thea's Park	Exterior Access Route	319030	The accessible route has cross slopes greater than 1:50 (2%).	\$ 396	1	
Thea's Park	Exterior Access Route	319031	The accessible route has gaps in the surface greater than 1/2" wide.	\$ 268	1	
Thea's Park	Exterior Access Route	319033	The accessible route has areas of vertical level changes in excess of 1/4" that are not beveled or ramped. ADVISORY: A marked crosswalk is not provided where the accessible route crosses a vehicular way between the accessible parking aisle and the building entrance.	\$ 396	1	
Thea's Park	Exterior Access Route	319009		\$ -	1	
Thea's Park	Exterior Access Route	319004	The accessible route has areas of vertical level changes in excess of 1/4" that are not beveled or ramped.	\$ 107	1	
Thea's Park	Exterior Access Route	319012	An accessible passenger loading/unloading zone is not provided where a loading/unloading area is present.	\$ 1,000	1	
Thea's Park	Accessible Parking	319003	WASHINGTON: The van stall and access aisle markings are not compliant.	\$ 840	1	
Thea's Park	Accessible Parking	319002	WASHINGTON: A van stall and access aisle slopes are not compliant.	\$ 11,300	1	
Thea's Park	Accessible Parking	319011	BEST PRACTICE: The ISA markings are fading.	\$ 200	1	
Thea's Park	Accessible Parking	319005	WASHINGTON: Compliant signage is not provided at the van space.	\$ 280	1	
Thea's Park	Exterior Access Route	319008	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 1,902	1	
Thea's Park	Picnic Area	319017	The picnic table does not allow a clear space for forward wheelchair approach with knee and toe clearance.	\$ 1,300	2	
Thea's Park	Picnic Area	319018	BEST PRACTICE: Clear ground space around the picnic table is less than 36" width.	\$ 286	2	
Thea's Park	Picnic Area	319019	The picnic table surface height exceeds 34" or is lower than 28" above grade.	\$ -	2	
Thea's Park	Picnic Area	319014	The picnic table does not allow a clear space for forward wheelchair approach with knee and toe clearance.	\$ 1,300	2	
Thea's Park	Picnic Area	319015	BEST PRACTICE: Clear ground space around the picnic table is less than 36" width.	\$ 286	2	
Thea's Park	Picnic Area	319016	The picnic table surface height exceeds 34" or is lower than 28" above grade.	\$ -	2	
Thea's Park	Picnic Area	319020	The picnic table does not allow a clear space for forward wheelchair approach with knee and toe clearance.	\$ 1,300	2	
Thea's Park	Picnic Area	319021	BEST PRACTICE: Clear ground space around the picnic table is less than 36" width.	\$ 286	2	
Thea's Park	Picnic Area	319022	The picnic table surface height exceeds 34" or is lower than 28" above grade.	\$ -	2	
Thea's Park	Picnic Area	319023	The picnic table does not allow a clear space for forward wheelchair approach with knee and toe clearance.	\$ 1,300	2	
Thea's Park	Picnic Area	319024	BEST PRACTICE: Clear ground space around the picnic table is less than 36" width.	\$ 286	2	
Thea's Park	Picnic Area	319025	The picnic table surface height exceeds 34" or is lower than 28" above grade.	\$ -	2	
Thea's Park	Exterior Access Route	319035	The bottom of the free-standing post-mounted interpretive panel is greater than 27" above grade.	\$ 326	1	
Thea's Park	Exterior Access Route	319037	The bottom of the free-standing post-mounted interpretive panel is greater than 27" above grade.	\$ 326	1	
Thea's Park	Exterior Access Route	319034	A ramp is required but not provided.	\$ 4,634	1	
Thea's Park	Exterior Access Route	319010	The handrails are not compliant.	\$ 4,890	1	
Thea's Park	Exterior Access Route	319032	A ramp is required but not provided.	\$ 3,972	1	
Thea's Park	Site Furnishings	319001	Items requiring an unobstructed side reach motion are higher than 48" maximum and/or lower than 15" minimum height above finish floor.	\$ 100	2	
TOTAL				\$ 1,986,434		

PHASE THREE						
PARK	CATEGORY	BARRIER ID	BARRIER DESCRIPTION	ESTIMATE	PRIORITY	
Chinese Reconciliation Park	Beach	321076	BEST PRACTICE: A beach access route is not provided.	\$ 3,000	1	
Chinese Reconciliation Park	Site Furnishings	319225	BEST PRACTICE: An adjacent clear space is not provided at the bench.	\$ 52	2	
Chinese Reconciliation Park	Site Furnishings	319222	BEST PRACTICE: An adjacent clear space is not provided at the bench.	\$ 52	2	
Chinese Reconciliation Park	Site Furnishings	319200	BEST PRACTICE: An adjacent clear space is not provided at the bench.	\$ 52	2	
Chinese Reconciliation Park	Site Furnishings	319202	BEST PRACTICE: An adjacent clear space is not provided at the bench.	\$ 52	2	
Chinese Reconciliation Park	Site Furnishings	319210	BEST PRACTICE: An adjacent clear space is not provided at the bench.	\$ 52	2	
Chinese Reconciliation Park	Site Furnishings	319211	BEST PRACTICE: An adjacent clear space is not provided at the bench.	\$ 52	2	
Chinese Reconciliation Park	Site Furnishings	319220	BEST PRACTICE: An adjacent clear space is not provided at the bench.	\$ 52	2	
Chinese Reconciliation Park	Site Furnishings	319204	BEST PRACTICE: An adjacent clear space is not provided at the bench.	\$ 52	2	
Chinese Reconciliation Park	Exterior Access Route	319189	WASHINGTON: Where a detectable warning is located on a curb ramp run, the detectable warning is not compliant.	\$ 640	1	
Chinese Reconciliation Park	Exterior Access Route	322548	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 5,450	1	
Chinese Reconciliation Park	Exterior Access Route	322523	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 8,960	1	
Chinese Reconciliation Park	Exterior Access Route	322528	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 4,480	1	
Chinese Reconciliation Park	Exterior Access Route	322537	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 8,960	1	
Chinese Reconciliation Park	Exterior Access Route	322561	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 2,956	1	
Chinese Reconciliation Park	Exterior Access Route	322550	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 8,531	1	
Chinese Reconciliation Park	Exterior Access Route	322551	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 3,584	1	
Chinese Reconciliation Park	Exterior Access Route	322552	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 4,032	1	
Chinese Reconciliation Park	Exterior Access Route	322553	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 4,480	1	
Chinese Reconciliation Park	Exterior Access Route	322556	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 6,272	1	
Chinese Reconciliation Park	Exterior Access Route	322557	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 6,272	1	
Chinese Reconciliation Park	Exterior Access Route	322558	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 896	1	
Chinese Reconciliation Park	Exterior Access Route	322560	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 35,840	1	
Chinese Reconciliation Park	Exterior Access Route	322559	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 6,720	1	
Chinese Reconciliation Park	Exterior Access Route	322549	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 8,960	1	
Chinese Reconciliation Park	Exterior Access Route	322546	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 896	1	
Chinese Reconciliation Park	Exterior Access Route	322538	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 4,480	1	
Chinese Reconciliation Park	Exterior Access Route	322543	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 10,752	1	
Chinese Reconciliation Park	Exterior Access Route	322541	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 7,168	1	
Chinese Reconciliation Park	Exterior Access Route	322542	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 896	1	
Chinese Reconciliation Park	Exterior Access Route	322539	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 8,960	1	
Chinese Reconciliation Park	Exterior Access Route	322540	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 8,960	1	
Chinese Reconciliation Park	Exterior Access Route	322527	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 4,480	1	
Chinese Reconciliation Park	Exterior Access Route	322544	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 896	1	
Chinese Reconciliation Park	Exterior Access Route	322562	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 8,960	1	
Chinese Reconciliation Park	Exterior Access Route	322563	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 8,960	1	
Chinese Reconciliation Park	Exterior Access Route	322564	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 8,960	1	
Chinese Reconciliation Park	Exterior Access Route	322565	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 21,504	1	
Chinese Reconciliation Park	Exterior Access Route	319197	WASHINGTON: An exterior accessible route is not provided.	\$ 465	1	
Chinese Reconciliation Park	Exterior Access Route	321402	WASHINGTON: Compliant surfacing for an exterior accessible route is not provided.	\$ 53,880	1	
Chinese Reconciliation Park	Exterior Access Route	322545	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 896	1	
Chinese Reconciliation Park	Exterior Access Route	322555	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 3,584	1	
Chinese Reconciliation Park	Exterior Access Route	319203	The accessible route has gaps in the surface greater than 1/2" wide.	\$ 800	1	
Chinese Reconciliation Park	Exterior Access Route	319227	The accessible route has areas of vertical level changes in excess of 1/4" that are not beveled or ramped.	\$ 107	1	

PHASE THREE					
PARK	CATEGORY	BARRIER ID	BARRIER DESCRIPTION	ESTIMATE	PRIORITY
Chinese Reconciliation Park	Exterior Access Route	319201	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 2,150	1
Chinese Reconciliation Park	Exterior Access Route	322554	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 896	1
Chinese Reconciliation Park	Exterior Access Route	319224	The accessible route has areas of vertical level changes in excess of 1/4" that are not beveled or ramped.	\$ 107	1
Chinese Reconciliation Park	Exterior Access Route	322526	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 4,480	1
Chinese Reconciliation Park	Exterior Access Route	322547	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 896	1
Chinese Reconciliation Park	Exterior Access Route	319218	The accessible route has gaps in the surface greater than 1/2" wide.	\$ 26	1
Chinese Reconciliation Park	Exterior Access Route	322520	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 17,920	1
Chinese Reconciliation Park	Exterior Access Route	322521	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 8,960	1
Chinese Reconciliation Park	Exterior Access Route	322522	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 8,960	1
Chinese Reconciliation Park	Exterior Access Route	322524	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 4,480	1
Chinese Reconciliation Park	Exterior Access Route	322530	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 8,960	1
Chinese Reconciliation Park	Exterior Access Route	322531	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 8,960	1
Chinese Reconciliation Park	Exterior Access Route	322532	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 8,960	1
Chinese Reconciliation Park	Exterior Access Route	322533	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 8,960	1
Chinese Reconciliation Park	Exterior Access Route	322534	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 8,960	1
Chinese Reconciliation Park	Exterior Access Route	322535	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 8,960	1
Chinese Reconciliation Park	Exterior Access Route	322536	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 8,960	1
Chinese Reconciliation Park	Exterior Access Route	322525	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 896	1
Chinese Reconciliation Park	Exterior Access Route	322529	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 8,960	1
Chinese Reconciliation Park	Exterior Access Route	319213	Signage directing pedestrians to the nearest accessible building entrance on an accessible route is not present.	\$ 280	4
Chinese Reconciliation Park	Exterior Access Route	319196	Ground surfaces are not firm, stable and slip resistant.	\$ 60	1
Chinese Reconciliation Park	Exterior Access Route	319226	Ground surfaces are not firm, stable and slip resistant.	\$ 120	1
Chinese Reconciliation Park	Exterior Access Route	319209	Ground surfaces are not firm, stable and slip resistant.	\$ 400	1
Chinese Reconciliation Park	Exterior Access Route	319206	Ground surfaces are not firm, stable and slip resistant.	\$ 400	1
Chinese Reconciliation Park	Exterior Access Route	319207	Ground surfaces are not firm, stable and slip resistant.	\$ 400	1
Chinese Reconciliation Park	Exterior Access Route	319208	Ground surfaces are not firm, stable and slip resistant.	\$ 120	1
Chinese Reconciliation Park	Exterior Access Route	319221	Ground surfaces are not firm, stable and slip resistant.	\$ 120	1
Chinese Reconciliation Park	Exterior Access Route	319223	Ground surfaces are not firm, stable and slip resistant.	\$ 120	1
Chinese Reconciliation Park	Exterior Access Route	319217	Ground surfaces are not firm, stable and slip resistant.	\$ 2,000	1
Chinese Reconciliation Park	Accessible Parking	319191	WASHINGTON: The standard stall slope is not compliant.	\$ 6,300	1
Chinese Reconciliation Park	Accessible Parking	319195	WASHINGTON: The standard stall markings are not compliant.	\$ 420	1
Chinese Reconciliation Park	Accessible Parking	319190	WASHINGTON: The van stall and access aisle are not compliant.	\$ 11,300	1
Chinese Reconciliation Park	Accessible Parking	319192	WASHINGTON: The van stall and access aisle markings are fading.	\$ 840	1
Chinese Reconciliation Park	Exterior Access Route	319199	The accessible route has areas of vertical level changes in excess of 1/4" that are not beveled or ramped.	\$ 35	1
Chinese Reconciliation Park	Exterior Access Route	319205	WASHINGTON: Handrails are not provided where the ramp rises more than 6".	\$ 3,260	1
Chinese Reconciliation Park	Exterior Access Route	321075	The ramp has a running slope in excess of 1:12 (8.33%) and/or cross slope in excess of 1:48 (2.08%).	\$ 19,860	1
Chinese Reconciliation Park	Exterior Access Route	319214	Handrail extensions are not compliant.	\$ 326	1
Chinese Reconciliation Park	Exterior Access Route	319215	Steps do not have uniform and compliant riser heights and/or tread depths.	\$ 4,284	1
Ruston Way Areas 2-4	Accessible Parking	331219	WASHINGTON: Compliant signage is not provided at the standard space and access aisle.	\$ 700	1
Ruston Way Areas 2-4	Accessible Parking	331222	WASHINGTON: Compliant signage is not provided at the standard space and access aisle.	\$ 700	1
Ruston Way Areas 2-4	Beach	331212	BEST PRACTICE: The beach access route is not compliant or is not provided.	\$ 3,000	1
Ruston Way Areas 2-4	Exterior Access Route	331244	BEST PRACTICE: An adjacent clear space is not provided at the bench.	\$ 120	2
Ruston Way Areas 2-4	Exterior Access Route	331172	BEST PRACTICE: An adjacent clear space is not provided at the bench.	\$ 237	2
Ruston Way Areas 2-4	Exterior Access Route	331184	BEST PRACTICE: An adjacent clear space is not provided at the bench.	\$ 237	2
Ruston Way Areas 2-4	Exterior Access Route	331205	BEST PRACTICE: An adjacent clear space is not provided at the bench.	\$ 237	2
Ruston Way Areas 2-4	Exterior Access Route	331207	BEST PRACTICE: An adjacent clear space is not provided at the bench.	\$ 59	2
Ruston Way Areas 2-4	Exterior Access Route	331146	BEST PRACTICE: An adjacent clear space is not provided at the bench.	\$ 237	2
Ruston Way Areas 2-4	Exterior Access Route	331154	BEST PRACTICE: An adjacent clear space is not provided at the bench.	\$ 237	2
Ruston Way Areas 2-4	Boating and Fishing	331241	The boarding pier has vertical changes in level between 1/4" and 1/2" that are not beveled, and/or greater than 1/2" that are not ramped.	\$ 200	1

PHASE THREE					
PARK	CATEGORY	BARRIER ID	BARRIER DESCRIPTION	ESTIMATE	PRIORITY
Ruston Way Areas 2-4	Exterior Access Route	331235	WASHINGTON: Where a detectable warning is located on a curb ramp run, the detectable warning is not compliant.	\$ 640	1
Ruston Way Areas 2-4	Exterior Access Route	331201	WASHINGTON: The slope of the curb ramp run is not compliant.	\$ 1,750	1
Ruston Way Areas 2-4	Accessible Parking	331139	A curb ramp is not provided where the accessible route crosses a curb. WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 1,750	1
Ruston Way Areas 2-4	Exterior Access Route	331226	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 1,744	1
Ruston Way Areas 2-4	Exterior Access Route	331227	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 5,272	1
Ruston Way Areas 2-4	Exterior Access Route	331228	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 3,765	1
Ruston Way Areas 2-4	Exterior Access Route	331229	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 18,829	1
Ruston Way Areas 2-4	Exterior Access Route	331230	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 5,272	1
Ruston Way Areas 2-4	Exterior Access Route	331231	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 7,531	1
Ruston Way Areas 2-4	Exterior Access Route	331232	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 28,243	1
Ruston Way Areas 2-4	Exterior Access Route	331233	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 26,360	1
Ruston Way Areas 2-4	Exterior Access Route	331234	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 1,228	1
Ruston Way Areas 2-4	Exterior Access Route	331237	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 455	1
Ruston Way Areas 2-4	Exterior Access Route	331238	ADVISORY: A marked crosswalk is not provided where the accessible route crosses a vehicular way from the accessible parking aisle to the amenity entrance. WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ -	1
Ruston Way Areas 2-4	Exterior Access Route	331246	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 5,946	1
Ruston Way Areas 2-4	Exterior Access Route	331247	The accessible route has gaps in the surface greater than 1/2" wide. WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 237	1
Ruston Way Areas 2-4	Exterior Access Route	331248	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 2,378	1
Ruston Way Areas 2-4	Historic Structure	331249	The exterior accessible route to the building is not compliant.	\$ 2,560	1
Ruston Way Areas 2-4	Exterior Access Route	331252	The accessible route has gaps in the surface greater than 1/2" wide. WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 12,248	1
Ruston Way Areas 2-4	Exterior Access Route	331173	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 5,529	1
Ruston Way Areas 2-4	Exterior Access Route	331174	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 3,964	1
Ruston Way Areas 2-4	Exterior Access Route	331175	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 13,477	1
Ruston Way Areas 2-4	Exterior Access Route	331176	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 1,600	1
Ruston Way Areas 2-4	Exterior Access Route	331177	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 5,920	1
Ruston Way Areas 2-4	Exterior Access Route	331178	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 9,600	1
Ruston Way Areas 2-4	Exterior Access Route	331179	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 7,200	1
Ruston Way Areas 2-4	Exterior Access Route	331180	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 160	1
Ruston Way Areas 2-4	Exterior Access Route	331181	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 480	1
Ruston Way Areas 2-4	Exterior Access Route	331182	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 3,964	1
Ruston Way Areas 2-4	Exterior Access Route	331183	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 3,964	1
Ruston Way Areas 2-4	Exterior Access Route	331185	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 3,964	1
Ruston Way Areas 2-4	Exterior Access Route	331186	The accessible route has gaps in the surface greater than 1/2" wide. WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 99	1
Ruston Way Areas 2-4	Exterior Access Route	331187	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 1,982	1
Ruston Way Areas 2-4	Exterior Access Route	331188	The accessible route has gaps in the surface greater than 1/2" wide.	\$ 594	1
Ruston Way Areas 2-4	Exterior Access Route	331189	The accessible route has gaps in the surface greater than 1/2" wide. WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 1,585	1
Ruston Way Areas 2-4	Exterior Access Route	331190	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 3,964	1
Ruston Way Areas 2-4	Exterior Access Route	331191	The accessible route has gaps in the surface greater than 1/2" wide.	\$ 39	1
Ruston Way Areas 2-4	Exterior Access Route	331192	The accessible route has gaps in the surface greater than 1/2" wide. WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 79	1
Ruston Way Areas 2-4	Exterior Access Route	331193	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 1,982	1
Ruston Way Areas 2-4	Exterior Access Route	331194	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 5,549	1
Ruston Way Areas 2-4	Exterior Access Route	331195	The accessible route has gaps in the surface greater than 1/2" wide.	\$ 79	1
Ruston Way Areas 2-4	Exterior Access Route	331196	The accessible route has gaps in the surface greater than 1/2" wide.	\$ 79	1
Ruston Way Areas 2-4	Exterior Access Route	331197	The accessible route has gaps in the surface greater than 1/2" wide. WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 59	1
Ruston Way Areas 2-4	Exterior Access Route	331198	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 5,549	1

PHASE THREE					
PARK	CATEGORY	BARRIER ID	BARRIER DESCRIPTION	ESTIMATE	PRIORITY
Ruston Way Areas 2-4	Exterior Access Route	331199	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 3,964	1
Ruston Way Areas 2-4	Exterior Access Route	331200	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 11,892	1
Ruston Way Areas 2-4	Exterior Access Route	331202	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 9,910	1
Ruston Way Areas 2-4	Exterior Access Route	331204	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 1,982	1
Ruston Way Areas 2-4	Exterior Access Route	331206	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 15,856	1
Ruston Way Areas 2-4	Exterior Access Route	331208	The accessible route has gaps in the surface greater than 1/2" wide.	\$ 19	1
Ruston Way Areas 2-4	Exterior Access Route	331209	The accessible route has gaps in the surface greater than 1/2" wide.	\$ 158	1
Ruston Way Areas 2-4	Exterior Access Route	331210	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 237	1
Ruston Way Areas 2-4	Exterior Access Route	331213	The accessible route has gaps in the surface greater than 1/2" wide.	\$ 11,158	1
Ruston Way Areas 2-4	Exterior Access Route	331214	The accessible route has gaps in the surface greater than 1/2" wide.	\$ 32,703	1
Ruston Way Areas 2-4	Exterior Access Route	331225	ADVISORY: A marked crosswalk is not provided where the accessible route crosses a vehicular way between the accessible parking aisle and the building entrance.	\$ -	1
Ruston Way Areas 2-4	Exterior Access Route	331236	The accessible route has gaps in the surface greater than 1/2" wide.	\$ 13,378	1
Ruston Way Areas 2-4	Exterior Access Route	363474	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 3,200	1
Ruston Way Areas 2-4	Exterior Access Route	331135	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 17,838	1
Ruston Way Areas 2-4	Exterior Access Route	331138	The accessible route has gaps in the surface greater than 1/2" wide.	\$ 4,756	1
Ruston Way Areas 2-4	Exterior Access Route	331141	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 11,892	1
Ruston Way Areas 2-4	Exterior Access Route	331142	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 77,416	1
Ruston Way Areas 2-4	Exterior Access Route	331143	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 11,059	1
Ruston Way Areas 2-4	Exterior Access Route	331145	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 59,618	1
Ruston Way Areas 2-4	Exterior Access Route	331147	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 7,452	1
Ruston Way Areas 2-4	Exterior Access Route	331148	The accessible route has gaps in the surface greater than 1/2" wide.	\$ 654	1
Ruston Way Areas 2-4	Exterior Access Route	331149	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 3,726	1
Ruston Way Areas 2-4	Exterior Access Route	331150	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 3,726	1
Ruston Way Areas 2-4	Exterior Access Route	331151	The accessible route has gaps in the surface greater than 1/2" wide.	\$ 19	1
Ruston Way Areas 2-4	Exterior Access Route	331152	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 3,726	1
Ruston Way Areas 2-4	Exterior Access Route	331153	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 1,863	1
Ruston Way Areas 2-4	Exterior Access Route	331155	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 7,373	1
Ruston Way Areas 2-4	Exterior Access Route	331156	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 3,726	1
Ruston Way Areas 2-4	Exterior Access Route	331157	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 9,949	1
Ruston Way Areas 2-4	Exterior Access Route	331158	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 14,746	1
Ruston Way Areas 2-4	Exterior Access Route	331159	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 3,309	1
Ruston Way Areas 2-4	Exterior Access Route	331160	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 2,293	1
Ruston Way Areas 2-4	Exterior Access Route	331162	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 3,726	1
Ruston Way Areas 2-4	Exterior Access Route	331163	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 2,973	1
Ruston Way Areas 2-4	Exterior Access Route	331164	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 9,216	1
Ruston Way Areas 2-4	Exterior Access Route	331166	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 9,949	1
Ruston Way Areas 2-4	Exterior Access Route	331167	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 14,746	1
Ruston Way Areas 2-4	Exterior Access Route	331168	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 11,059	1
Ruston Way Areas 2-4	Exterior Access Route	331169	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 11,792	1
Ruston Way Areas 2-4	Exterior Access Route	331170	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 9,216	1
Ruston Way Areas 2-4	Signage	331242	Signage on the accessible route is not compliant.	\$ 280	4
Ruston Way Areas 2-4	Exterior Access Route	331239	The pier or platform does not have at least 25% of the railings set at a maximum height of 34".	\$ 16,600	1
Ruston Way Areas 2-4	Exterior Access Route	331240	The pier or platform has a cross slope exceeding 2.08% when measured in the static position.	\$ 100	1

PHASE THREE						
PARK	CATEGORY	BARRIER ID	BARRIER DESCRIPTION	ESTIMATE	PRIORITY	
Ruston Way Areas 2-4	Accessible Parking	331136	The minimum number of accessible parking spaces is not provided.	\$ 420	1	
Ruston Way Areas 2-4	Accessible Parking	331221	WASHINGTON: The car stall ground surface is not compliant.	\$ 11,300	1	
Ruston Way Areas 2-4	Accessible Parking	331218	WASHINGTON: A van stall and access aisle ground surfaces are not compliant.	\$ 11,300	1	
Ruston Way Areas 2-4	Accessible Parking	331220	WASHINGTON: The van stall and access aisle are not compliant.	\$ 1,050	1	
Ruston Way Areas 2-4	Accessible Parking	363475	WASHINGTON: A van stall, access aisle, and signage are not provided and the slope and ground surface are not compliant.	\$ 11,300	1	
Ruston Way Areas 2-4	Accessible Parking	331137	WASHINGTON: A van stall, access aisle, and signage are not provided and the slope is not compliant.	\$ 11,300	1	
Ruston Way Areas 2-4	Exterior Access Route	331256	A compliant accessible route is not provided from the property line to the site facilities.	\$ 160	1	
Ruston Way Areas 2-4	Picnic Area	331171	The picnic table does not allow a clear space for forward wheelchair approach with knee and toe clearance.	\$ 1,300	2	
Ruston Way Areas 2-4	Picnic Area	331203	BEST PRACTICE: Clear ground space around the picnic table is less than 36" width.	\$ 792	2	
Ruston Way Areas 2-4	Picnic Area	331161	A compliant picnic table is not provided.	\$ 1,300	4	
Ruston Way Areas 2-4	Exterior Access Route	331144	The accessible dispensers are not at compliant heights.	\$ 280	3	
Ruston Way Areas 2-4	Exterior Access Route	331245	Signs or bulletin boards are not located within the height and viewing distance requirements for the size of visual characters.	\$ 400	2	
Ruston Way Areas 2-4	Exterior Access Route	331211	WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 640	3	
Ruston Way Areas 2-4	Site Furnishings	331255	Clear ground space is not provided at the trash receptacle with lid requiring operation.	\$ 237	2	
Metro Parks Headquarters	Restroom	324243	The wheelchair stall door is not compliant.	\$ 500	3	
Metro Parks Headquarters	Exterior Access Route	324235	WASHINGTON: The slope of the curb ramp run is not compliant.	\$ 1,750	1	
Metro Parks Headquarters	Exterior Access Route	324270	The slope of the curb ramp flare is greater than 1:10 (10%).	\$ 1,750	1	
Metro Parks Headquarters	Exterior Access Route	324271	WASHINGTON: The slope of the curb ramp run is not compliant.	\$ 1,750	1	
Metro Parks Headquarters	Exterior Access Route	324272	The slope of the curb ramp flare is greater than 1:10 (10%).	\$ 1,750	1	
Metro Parks Headquarters	Exterior Access Route	324275	WASHINGTON: The slope of the curb ramp run is not compliant.	\$ 1,750	1	
Metro Parks Headquarters	Exterior Access Route	324276	WASHINGTON: The slope of the curb ramp run is not compliant.	\$ 1,750	1	
Metro Parks Headquarters	Interior Access Route	324250	The push side of the accessible door does not have the required maneuvering clearances.	\$ 1,250	1	
Metro Parks Headquarters	Interior Access Route	324241	The minimum number of drinking fountains is not provided.	\$ 10,879	4	
Metro Parks Headquarters	Exterior Access Route	324277	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 2,973	1	
Metro Parks Headquarters	Exterior Access Route	324273	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 6,937	1	
Metro Parks Headquarters	Exterior Access Route	324274	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 2,477	1	
Metro Parks Headquarters	Accessible Parking	324263	The slope of the parking space is greater than 1:50 (2%).	\$ 6,300	1	
Metro Parks Headquarters	Accessible Parking	324267	Accessible car stall markings do not define the stall width.	\$ 1,680	1	
Metro Parks Headquarters	Accessible Parking	324268	Accessible car aisle markings do not define the aisle width.	\$ 840	1	
Metro Parks Headquarters	Accessible Parking	357509	WASHINGTON: Compliant signage is not provided at the access aisles.	\$ 700	1	
Metro Parks Headquarters	Accessible Parking	324265	WASHINGTON: The car stall slope is not compliant.	\$ 6,300	1	
Metro Parks Headquarters	Accessible Parking	324262	WASHINGTON: A van stall, access aisle, and signage are not provided.	\$ 11,860	1	
Metro Parks Headquarters	Accessible Parking	324264	WASHINGTON: The van access aisle is not compliant.	\$ 5,280	1	
Metro Parks Headquarters	Accessible Parking	324266	WASHINGTON: The slope of the van stall is not compliant.	\$ 1,050	1	
Metro Parks Headquarters	Restroom	324254	The wheelchair stall door is not compliant.	\$ 500	3	
Metro Parks Headquarters	Restroom	324242	The urinal dimensions are not compliant.	\$ 935	3	
Metro Parks Headquarters	Restroom	324244	The flush control is located on the closed side and/or is not within reach range.	\$ 313	3	
Metro Parks Headquarters	Restroom	324245	WASHINGTON: The toilet paper dispenser location is not compliant.	\$ 293	3	
Metro Parks Headquarters	Restroom	324258	The flush control is located on the closed side and/or is not within reach range.	\$ 313	3	
Metro Parks Headquarters	Restroom	324259	The rear grab bar at the water closet is not compliant.	\$ 355	3	
Metro Parks Headquarters	Trail	324279	The inaccessible trail or trail segment does not have signage with trail details.	\$ 1,120	4	
Dash Point Park and Pier	Amenity not evaluated	315302	The amenity is under construction and cannot be evaluated.	\$ -	0	
Dash Point Park and Pier	Exterior Access Route	315310	WASHINGTON: Where a detectable warning is located on a curb ramp run, the detectable warning is not compliant.	\$ 640	1	
Dash Point Park and Pier	Exterior Access Route	315311	WASHINGTON: The slope of the curb ramp run is not compliant.	\$ 1,750	1	
Dash Point Park and Pier	Exterior Access Route	315312	The slope of the curb ramp flare is greater than 1:10 (10%).	\$ -	1	
Dash Point Park and Pier	Exterior Access Route	315332	A curb ramp is not provided where the accessible route crosses a curb.	\$ 1,750	1	
Dash Point Park and Pier	Exterior Access Route	315313	The accessible route has greater than 1:20 (5%) running slope and 1:50 (2%) cross slope.	\$ 1,783	1	
Dash Point Park and Pier	Exterior Access Route	315352	WASHINGTON: An exterior accessible route is not provided.	\$ 295	1	
Dash Point Park and Pier	Exterior Access Route	315307	The accessible route has greater than 1:20 (5%) running slope and 1:50 (2%) cross slope.	\$ 1,149	1	
Dash Point Park and Pier	Exterior Access Route	315308	The accessible route has greater than 1:20 (5%) running slope and 1:50 (2%) cross slope.	\$ 5,153	1	
Dash Point Park and Pier	Exterior Access Route	315314	The accessible route has greater than 1:20 (5%) running slope and 1:50 (2%) cross slope.	\$ 10,702	1	
Dash Point Park and Pier	Exterior Access Route	315315	The accessible route has greater than 1:20 (5%) running slope and 1:50 (2%) cross slope.	\$ 3,567	1	

PHASE THREE						
PARK	CATEGORY	BARRIER ID	BARRIER DESCRIPTION	ESTIMATE	PRIORITY	
Dash Point Park and Pier	Accessible Parking	315319	The parking space slope is greater than 1:50 (2%).	\$ 6,300	1	
Dash Point Park and Pier	Accessible Parking	315321	The access aisle slope is greater than 1:50 (2%).	\$ 5,000	1	
Dash Point Park and Pier	Accessible Parking	315320	The parking space slope is greater than 1:50 (2%).	\$ 6,300	1	
Dash Point Park and Pier	Accessible Parking	315324	The parking space slope is greater than 1:50 (2%).	\$ 6,300	1	
Dash Point Park and Pier	Accessible Parking	315325	The access aisle slope is greater than 1:50 (2%).	\$ 5,000	1	
Dash Point Park and Pier	Accessible Parking	315326	The van access aisle is less than 96" wide where the van stall is less than 132" wide. BEST PRACTICE: The table does not have minimum 36" wide clear ground space on all usable sides of the table.	\$ 420	1	
Dash Point Park and Pier	Picnic Area	317664		\$ 644	4	
Dash Point Park and Pier	Playground	315330	A compliant turning space is not provided at a school-age swing.	\$ 150	2	
Dash Point Park and Pier	Playground	315331	A turning space is not provided at a preschool swing.	\$ 150	2	
Dash Point Park and Pier	Exterior Access Route	315306	WASHINGTON: Handrails are not provided where the ramp rises more than 6" or are not compliant.	\$ 3,586	1	
Dash Point Park and Pier	Restroom	315335	The door has less than 32" clear width. The door does not have 80" minimum head clearance from finish floor, excluding door closer hinged bar, which can be 78" minimum.	\$ 1,124	3	
Dash Point Park and Pier	Restroom	315336	The door has less than 32" clear width.	\$ 2,600	1	
Dash Point Park and Pier	Restroom	315343	The door does not have 80" minimum head clearance from finish floor, excluding door closer hinged bar, which can be 78" minimum.	\$ 1,124	3	
Dash Point Park and Pier	Restroom	315344	The hardware at the accessible door requires tight grasping, pinching or twisting of the wrist to operate	\$ 2,600	1	
Dash Point Park and Pier	Restroom	315345	The side grab bar at the water closet is not compliant.	\$ 293	3	
Dash Point Park and Pier	Restroom	315340	The water closet in a single user / unisex restroom does not have the required clearance.	\$ 355	3	
Dash Point Park and Pier	Restroom	315341	The side grab bar at the water closet is not compliant.	\$ 1,368	3	
Dash Point Park and Pier	Restroom	315348	The rear grab bar at the water closet is not compliant.	\$ 355	3	
Dash Point Park and Pier	Restroom	315349	The centerline of the toilet in the wheelchair stall is not 16" minimum to 18" maximum from the sidewall.	\$ 355	3	
Dash Point Park and Pier	Restroom	315350	The water closet in a single user / unisex restroom does not have the required clearance.	\$ 630	3	
Dash Point Park and Pier	Restroom	315351		\$ 1,368	3	
Dash Point Park and Pier	Exterior Access Route	315304	Handrails are not provided.	\$ 815	1	
Dash Point Park and Pier	Exterior Access Route	315305	Handrails are not provided.	\$ 1,467	1	
Dash Point Park and Pier	Playground	315327	The transfer platform connecting to elevated play elements has a non-compliant height lower than 11" or higher than 18".	\$ 5,000	2	
Franklin Park	Entrance to Building	320001	The threshold at the accessible door is greater than 1/2" in height. WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 179	1	
Franklin Park	Exterior Access Route	319968		\$ 554	1	
Franklin Park	Exterior Access Route	319981	WASHINGTON: An exterior accessible route is not provided.	\$ 985	1	
Franklin Park	Exterior Access Route	319992	WASHINGTON: An exterior accessible route is not provided.	\$ 1,317	1	
Franklin Park	Exterior Access Route	319971	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 14,904	1	
Franklin Park	Exterior Access Route	319969	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 8,126	1	
Franklin Park	Exterior Access Route	319972	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 2,081	1	
Franklin Park	Exterior Access Route	319973	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 2,061	1	
Franklin Park	Exterior Access Route	320003	The accessible route has gaps in the surface greater than 1/2" wide.	\$ 19	1	
Franklin Park	Exterior Access Route	319974	WASHINGTON: An exterior accessible route is not provided.	\$ 2,000	1	
Franklin Park	Playground	319977	The ground surface has not been inspected and maintained regularly.	\$ 1,625	2	
Franklin Park	Accessible Parking	319966	The slope of the parking space is greater than 1:50 (2%). WASHINGTON: A car stall and access aisle are not provided, and the ground surface is not compliant.	\$ 6,300	1	
Franklin Park	Accessible Parking	319991		\$ 22,600	1	
Franklin Park	Accessible Parking	319964	The parking space slope is greater than 1:50 (2%).	\$ 6,300	1	
Franklin Park	Accessible Parking	319965	The access aisle slope is greater than 1:50 (2%). WASHINGTON: A van stall, access aisle, and signage are not provided and the slope and/or ground surface is/are not compliant.	\$ 5,000	1	
Franklin Park	Accessible Parking	319990		\$ -	1	
Franklin Park	Site Furnishings	319994	The picnic table does not allow a clear space for forward wheelchair approach with knee and toe clearance.	\$ 1,300	2	
Franklin Park	Site Furnishings	319995	The picnic table surface height exceeds 34" or is lower than 28" above grade.	\$ 1,300	2	
Franklin Park	Site Furnishings	319970	The picnic table does not allow a clear space for forward wheelchair approach with knee and toe clearance.	\$ 1,300	2	
Franklin Park	Picnic Shelter	319983	The picnic table does not allow a clear space for forward wheelchair approach with knee and toe clearance.	\$ 1,300	2	
Franklin Park	Playground	319975	The turning space at a preschool swing is not compliant.	\$ 150	2	
Franklin Park	Playground	319976	A compliant turning space is not provided at a school-age swing.	\$ 150	2	
Franklin Park	Restroom	320000	The restroom circulation path is not free of objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.	\$ 200	2	
Franklin Park	Trail	319984	Segments of running slope from 1:12 (8.3%) to 1:10 (10%) exceed 30 LF and/or resting intervals are not provided at both ends of the segment.	\$ 1,748	4	
Franklin Park	Trail	325753	The accessible trail or trail segment does not have signage with trail details.	\$ 560	4	
Franklin Park	Trail	325754	The accessible trail or trail segment does not have signage with trail details.	\$ 1,120	4	

PHASE THREE						
PARK	CATEGORY	BARRIER ID	BARRIER DESCRIPTION	ESTIMATE	PRIORITY	
Franklin Park	Trail	319985	The inaccessible trail or trail segment does not have signage with trail details.	\$ 840	4	
Franklin Park	Trail	319987	Tread obstacles in concrete, asphalt or boards are more than 0.5".	\$ 600	4	
Franklin Park	Trail	319988	Tread obstacles in concrete, asphalt or boards are more than 0.5".	\$ 400	4	
Franklin Park	Trail	319989	Tread obstacles in concrete, asphalt or boards are more than 0.5".	\$ 3,980	4	
Franklin Park	Trail	319986	Tread obstacles in concrete, asphalt or boards are more than 0.5".	\$ 70	4	
Franklin Park	Playground	319978	A means of support is not provided at the transfer platform and/or transfer steps.	\$ 165	2	
Heidelberg Davis Park	Baseball/Softball Field	344483	The required number of wheelchair spaces is not provided at the bleacher seating for the ball field.	\$ 262	2	
Heidelberg Davis Park	Baseball/Softball Field	344492	The required number of wheelchair spaces is not provided at the bleacher seating for the ball field.	\$ 4,720	2	
Heidelberg Davis Park	Common Areas	344478	The sales or service counter does not have an accessible portion with maximum 36" height surface above finish floor or ground.	\$ 1,804	2	
Heidelberg Davis Park	Site Furnishings	344465	The minimum number and types of drinking fountains are not provided.	\$ 16,000	4	
Heidelberg Davis Park	Site Furnishings	344471	The spout height is higher than 36" at the lower/wheelchair level drinking fountain.	\$ 16,000	4	
Heidelberg Davis Park	Exterior Access Route	344453	The walkway does not have a compliant turning space at a change of direction.	\$ 360	1	
Heidelberg Davis Park	Exterior Access Route	344480	The walkway does not have a compliant turning space at a change of direction.	\$ 495	1	
Heidelberg Davis Park	Exterior Access Route	344468	Clear ground space is not provided at the operable part.	\$ 560	2	
Heidelberg Davis Park	Exterior Access Route	344477	The accessible route has gaps in the surface greater than 1/2" wide.	\$ 59	1	
Heidelberg Davis Park	Exterior Access Route	344484	A compliant turning space is not provided at a change of direction.	\$ 495	1	
Heidelberg Davis Park	Exterior Access Route	344485	The accessible route has cross slopes greater than 1:50 (2%).	\$ 2,400	1	
Heidelberg Davis Park	Exterior Access Route	344486	The accessible route has cross slopes greater than 1:50 (2%).	\$ 300	1	
Heidelberg Davis Park	Exterior Access Route	344488	WASHINGTON: An exterior accessible route is not provided.	\$ 448	1	
Heidelberg Davis Park	Exterior Access Route	344494	WASHINGTON: An exterior accessible route is not provided.	\$ 3,540	1	
Heidelberg Davis Park	Exterior Access Route	344439	WASHINGTON: An exterior accessible route is not provided.	\$ 1,680	1	
Heidelberg Davis Park	Exterior Access Route	344448	ADVISORY: A marked crosswalk is not provided where the accessible route crosses a vehicular way between the accessible parking aisle and the building entrance.	\$ -	1	
Heidelberg Davis Park	Exterior Access Route	344469	WASHINGTON: An exterior accessible route is not provided.	\$ 1,120	1	
Heidelberg Davis Park	Exterior Access Route	344443	The accessible route has areas of vertical level changes in excess of 1/4" that are not beveled or ramped.	\$ 1,232	1	
Heidelberg Davis Park	Exterior Access Route	344456	The gate maneuvering clearance area is not compliant.	\$ 710	1	
Heidelberg Davis Park	Exterior Access Route	344490	The gate maneuvering clearance area is not compliant.	\$ 568	1	
Heidelberg Davis Park	Exterior Access Route	344491	The gate hardware is not compliant.	\$ 250	1	
Heidelberg Davis Park	Accessible Parking	344445	WASHINGTON: Car stalls and adjacent access aisles are not provided.	\$ 56,500	1	
Heidelberg Davis Park	Accessible Parking	344452	The access aisle slope is greater than 1:50 (2%).	\$ 5,000	1	
Heidelberg Davis Park	Accessible Parking	344447	The slope of the parking space is greater than 1:50 (2%).	\$ 6,300	1	
Heidelberg Davis Park	Accessible Parking	344455	The slope of the parking space is greater than 1:50 (2%).	\$ 6,300	1	
Heidelberg Davis Park	Accessible Parking	344454	WASHINGTON: The car access aisle is not compliant.	\$ 420	1	
Heidelberg Davis Park	Accessible Parking	344441	WASHINGTON: A van stall and access aisle are not provided.	\$ 13,565	1	
Heidelberg Davis Park	Accessible Parking	344587	WASHINGTON: A van stall and access aisle are not provided.	\$ 840	1	
Heidelberg Davis Park	Picnic Area	344482	The picnic table does not allow a clear space for forward wheelchair approach with knee and toe clearance.	\$ 3,900	2	
Heidelberg Davis Park	Picnic Area	344470	A compliant picnic table is not provided.	\$ 1,300	4	
Heidelberg Davis Park	Baseball/Softball Field	344489	A wheelchair space is not provided at each team bench area at the ball field.	\$ 792	2	
Heidelberg Davis Park	Baseball/Softball Field	344493	A wheelchair space is not provided at each team bench area at the ball field.	\$ 4,720	2	
Heidelberg Davis Park	Restroom	344457	The threshold at the accessible door is greater than 1/2" in height.	\$ 3,580	3	
Heidelberg Davis Park	Restroom	344461	The hardware at the wheelchair stall door is not compliant.	\$ 586	3	
Heidelberg Davis Park	Restroom	344460	The wheelchair stall door is not self closing.	\$ 293	3	
Heidelberg Davis Park	Restroom	344472	The lavatory is mounted higher than 34" to the higher of the rim or counter.	\$ 1,440	3	
Heidelberg Davis Park	Restroom	344475	The wheelchair stall with a floor mounted water closet, in a multi-stall restroom, is less than 60" wide and 59" deep.	\$ 1,368	3	
Heidelberg Davis Park	Restroom	344462	The side grab bar is not compliant in the wheelchair stall.	\$ 710	3	
Heidelberg Davis Park	Restroom	344474	The clear floor space at the urinal is less than minimum 30" by minimum 48".	\$ 1,100	3	
Heidelberg Davis Park	Restroom	344463	The flush control is located on the closed side and/or is not within reach range.	\$ 313	3	
Heidelberg Davis Park	Restroom	363618	ANSI A117.1-: A vertical side grab bar is not located in the wheelchair stall.	\$ 887	3	
Heidelberg Davis Park	Restroom	344464	The centerline of the toilet in the wheelchair stall is not 16" minimum to 18" maximum from the sidewall.	\$ 1,575	3	
Heidelberg Davis Park	Concession Stand	344467	The service counter height is greater than 36" where a parallel approach is present.	\$ 2,165	2	
Heidelberg Davis Park	Site Furnishings	344481	A trash receptacle is not located on an accessible route and within reach range.	\$ 143	2	
Jefferson Park	Site Furnishings	320732	BEST PRACTICE: An adjacent clear space is not provided at the bench.	\$ 52	2	
Jefferson Park	Site Furnishings	320725	BEST PRACTICE: An adjacent clear space is not provided at the bench.	\$ 52	2	
Jefferson Park	Site Furnishings	320696	BEST PRACTICE: An adjacent clear space is not provided at the bench.	\$ 52	2	

PHASE THREE						
PARK	CATEGORY	BARRIER ID	BARRIER DESCRIPTION	ESTIMATE	PRIORITY	
Jefferson Park	Site Furnishings	320726	BEST PRACTICE: An adjacent clear space is not provided at the bench.	\$ 52	2	
Jefferson Park	Site Furnishings	320727	BEST PRACTICE: An adjacent clear space is not provided at the bench.	\$ 52	2	
Jefferson Park	Exterior Access Route	320708	The wheelchair space is not the minimum required dimensions at the bleacher seating for the baseball field.	\$ 430	2	
Jefferson Park	Exterior Access Route	320709	The wheelchair space is not the minimum required dimensions at the bleacher seating for the baseball field.	\$ 430	2	
Jefferson Park	Exterior Access Route	320720	WASHINGTON: Curb ramp flares are not provided where a 90 degree directional change is present.	\$ 1,750	1	
Jefferson Park	Exterior Access Route	320722	WASHINGTON: Curb ramp flares are not provided where a 90 degree directional change is present.	\$ 1,750	1	
Jefferson Park	Exterior Access Route	320721	WASHINGTON: Curb ramp flares are not provided where a 90 degree directional change is present.	\$ 1,750	1	
Jefferson Park	Exterior Access Route	320702	WASHINGTON: The slope of the curb ramp run is not compliant.	\$ 1,750	1	
Jefferson Park	Exterior Access Route	320703	Ground surfaces are not firm, stable and slip resistant.	\$ 20	1	
Jefferson Park	Exterior Access Route	320672	The existing detectable warning has truncated domes which do not have compliant dimensions.	\$ 100	1	
Jefferson Park	Exterior Access Route	320693	The accessible route has areas of vertical level changes in excess of 1/4" that are not beveled or ramped.	\$ 99	1	
Jefferson Park	Exterior Access Route	320692	WASHINGTON: The slope of the curb ramp run is not compliant.	\$ 1,750	1	
Jefferson Park	Exterior Access Route	320710	The accessible route has cross slopes greater than 1:50 (2%).	\$ 322	1	
Jefferson Park	Exterior Access Route	320711	The accessible route has areas of vertical level changes in excess of 1/4" that are not beveled or ramped.	\$ 89	1	
Jefferson Park	Exterior Access Route	320712	The accessible route has greater than 1:20 (5%) running slope and 1:50 (2%) cross slope.	\$ 179	1	
Jefferson Park	Exterior Access Route	320713	The accessible route has areas of vertical level changes in excess of 1/4" that are not beveled or ramped.	\$ 179	1	
Jefferson Park	Exterior Access Route	320730	WASHINGTON: An exterior accessible route is not provided.	\$ 134	1	
Jefferson Park	Exterior Access Route	320731	WASHINGTON: An exterior accessible route is not provided.	\$ 627	1	
Jefferson Park	Exterior Access Route	320690	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 713	1	
Jefferson Park	Exterior Access Route	320670	WASHINGTON: An exterior accessible route is not provided.	\$ 22,400	1	
Jefferson Park	Exterior Access Route	327268	WASHINGTON: An exterior accessible route is not provided.	\$ 15,680	1	
Jefferson Park	Exterior Access Route	320666	WASHINGTON: An exterior accessible route is not provided.	\$ 896	1	
Jefferson Park	Exterior Access Route	320705	WASHINGTON: An exterior accessible route is not provided.	\$ 7,392	1	
Jefferson Park	Exterior Access Route	320728	The accessible route has gaps in the surface greater than 1/2" wide.	\$ 1,146	1	
Jefferson Park	Exterior Access Route	327208	WASHINGTON: An exterior accessible route is not provided.	\$ 1,300	1	
Jefferson Park	Exterior Access Route	320699	WASHINGTON: An exterior accessible route is not provided.	\$ 537	1	
Jefferson Park	Exterior Access Route	320707	WASHINGTON: An exterior accessible route is not provided.	\$ 11,200	1	
Jefferson Park	Exterior Access Route	320686	The accessible route has gaps in the surface greater than 1/2" wide.	\$ 297	1	
Jefferson Park	Exterior Access Route	320674	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 3,567	1	
Jefferson Park	Exterior Access Route	320675	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 594	1	
Jefferson Park	Exterior Access Route	320676	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 198	1	
Jefferson Park	Exterior Access Route	320677	The accessible route has gaps in the surface greater than 1/2" wide.	\$ 99	1	
Jefferson Park	Exterior Access Route	320678	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 1,982	1	
Jefferson Park	Exterior Access Route	320679	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 224	1	
Jefferson Park	Exterior Access Route	320680	The accessible route has gaps in the surface greater than 1/2" wide.	\$ 99	1	
Jefferson Park	Exterior Access Route	320681	The accessible route has gaps in the surface greater than 1/2" wide.	\$ 39	1	
Jefferson Park	Exterior Access Route	320682	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 198	1	
Jefferson Park	Exterior Access Route	320683	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 495	1	
Jefferson Park	Exterior Access Route	320684	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 7,928	1	
Jefferson Park	Exterior Access Route	320685	The accessible route has gaps in the surface greater than 1/2" wide.	\$ 99	1	
Jefferson Park	Exterior Access Route	320671	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 396	1	
Jefferson Park	Exterior Access Route	320687	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 4,459	1	
Jefferson Park	Exterior Access Route	320695	The accessible route has gaps in the surface greater than 1/2" wide.	\$ 495	1	
Jefferson Park	Exterior Access Route	320701	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 3,805	1	
Jefferson Park	Exterior Access Route	320704	WASHINGTON: An exterior accessible route is not provided to the tennis courts.	\$ 22,400	1	
Jefferson Park	Exterior Access Route	320689	Ground surfaces are not firm, stable and slip resistant.	\$ 150	1	
Jefferson Park	Exterior Access Route	320688	Ground surfaces are not firm, stable and slip resistant.	\$ 300	1	
Jefferson Park	Picnic Area	320729	A compliant accessible route is not provided from the public access to the amenity.	\$ 716	1	
Jefferson Park	Picnic Area	320697	The picnic table does not allow a clear space for forward wheelchair approach with knee and toe clearance.	\$ 1,300	2	
Jefferson Park	Picnic Area	320698	The picnic table surface height exceeds 34" or is lower than 28" above grade.	\$ -	2	

PHASE THREE					
PARK	CATEGORY	BARRIER ID	BARRIER DESCRIPTION	ESTIMATE	PRIORITY
Jefferson Park	Picnic Area	320700	The picnic table does not allow a clear space for forward wheelchair approach with knee and toe clearance.	\$ 1,300	2
Jefferson Park	Picnic Area	320706	The picnic table does not allow a clear space for forward wheelchair approach with knee and toe clearance.	\$ 1,300	2
Jefferson Park	Portable Restroom	320715	An ADA portable restroom is not provided.	\$ 3,000	3
Jefferson Park	Exterior Access Route	320673	WASHINGTON: The slopes of the ramp are not compliant.	\$ 594	1
Jefferson Park	Restroom	320716	The lavatory is mounted higher than 34" to the rim. BEST PRACTICE: The inaccessible trail or trail segment does not have signage with trail details.	\$ -	3
Jefferson Park	Trail	320691	BEST PRACTICE: The inaccessible trail or trail segment does not have signage with trail details.	\$ 1,120	4
Jefferson Park	Trail	327271	BEST PRACTICE: The inaccessible trail segment does not have signage with trail details.	\$ 280	4
Jefferson Park	Trail	327276	BEST PRACTICE: The inaccessible trail segment does not have signage with trail details.	\$ 280	4
Jefferson Park	Trail	327272	BEST PRACTICE: The inaccessible trail segment does not have signage with trail details.	\$ 280	4
Jefferson Park	Trail	327275	BEST PRACTICE: The inaccessible trail or trail segment does not have signage with trail details.	\$ 280	4
Kandle Park & Pool	Restroom	324939	The mirror is mounted higher than 40" above finish floor to the bottom of the reflective surface, where it is installed above a lavatory or counter.	\$ 200	3
Kandle Park & Pool	Entrance to Building	324915	The maneuvering clearance at the accessible door is not level and clear.	\$ 1,250	1
Kandle Park & Pool	Exterior Access Route	324914	WASHINGTON: An exterior accessible route is not provided.	\$ 842	1
Kandle Park & Pool	Exterior Access Route	324941	WASHINGTON: An exterior accessible route is not provided. WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 2,688	1
Kandle Park & Pool	Exterior Access Route	324946	The ramp does not have a level landing at the top and/or bottom of each run.	\$ 1,189	1
Kandle Park & Pool	Exterior Access Route	324949	WASHINGTON: Handrails are not provided where the ramp rises more than 6" or are not compliant.	\$ 2,792	1
Kandle Park & Pool	Exterior Access Route	324950	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 27,710	1
Kandle Park & Pool	Exterior Access Route	324947	ADVISORY: The ramp connecting elevated components has running slopes in excess of 1:12 (8.33%).	\$ 3,567	1
Kandle Park & Pool	Playground	324923	The ramp has running slopes in excess of 1:12 (8.33%) and rises more than 12".	\$ -	1
Kandle Park & Pool	Playground	324924		\$ 9,930	1
Kandle Park & Pool	Restroom	324933	The shower does not have sidewalls or grab bars.	\$ 3,000	3
Kandle Park & Pool	Restroom	324937	The shower does not have sidewalls or grab bars.	\$ 3,000	3
Kandle Park & Pool	Restroom	324935	The wheelchair stall door is not compliant.	\$ 500	3
Kandle Park & Pool	Restroom	324929	The urinal dimensions are not compliant. The space between the grab bar and projecting objects above the grab bar is less than 12" minimum.	\$ 935	3
Kandle Park & Pool	Restroom	324940	The flush control is located on the closed side and is not within reach range.	\$ 100	3
Kandle Park & Pool	Restroom	324926	The space between the grab bar and projecting objects above the grab bar is less than 12" minimum.	\$ 313	3
Kandle Park & Pool	Restroom	324928	The space between the grab bar and projecting objects above the grab bar is less than 12" minimum.	\$ 100	3
Kandle Park & Pool	Restroom	324931	The space between the grab bar and projecting objects above the grab bar is less than 12" minimum.	\$ 100	3
Kandle Park & Pool	Restroom	324936	The space between the grab bar and projecting objects above the grab bar is less than 12" minimum.	\$ 100	3
Kandle Park & Pool	Basketball Court	324944	An accessible route does not directly connect each side of the court outside of play lines.	\$ 3,111	1
Kandle Park & Pool	Basketball Court	324945	An accessible route does not directly connect each side of the court outside of play lines.	\$ 3,111	1
Lincoln Eldridge Park	Exterior Access Route	324229	WASHINGTON: The slope of the curb ramp run is not compliant.	\$ 2,187	1
Lincoln Eldridge Park	Exterior Access Route	324230	WASHINGTON: The slope of the curb ramp run is not compliant.	\$ 2,187	1
Lincoln Eldridge Park	Exterior Access Route	323891	Gaps in the door threshold or entry are over .5" wide.	\$ 200	1
Lincoln Eldridge Park	Exterior Access Route	323894	Gaps in the door threshold or entry are over .5" wide WASHINGTON: An exterior accessible route is not provided to the amenity.	\$ 200	1
Lincoln Eldridge Park	Exterior Access Route	324228	A compliant accessible route is not provided from accessible parking to the public facility entrance.	\$ 5,376	1
Lincoln Eldridge Park	Exterior Access Route	324234	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 3,584	1
Lincoln Eldridge Park	Exterior Access Route	324233	WASHINGTON: Van stall and access aisle signage are not provided. The slope of the stall is not compliant. The measurements of the access aisle are not compliant.	\$ 14,336	1
Lincoln Eldridge Park	Accessible Parking	323896		\$ 11,860	1
Lincoln Eldridge Park	Accessible Parking	323895	WASHINGTON: The standard stall slope is not compliant.	\$ 6,300	1
Lincoln Eldridge Park	Exterior Access Route	323900	The ramp is required but not provided. An accessible route does not directly connect each side of the court outside of play lines.	\$ 3,972	1
Lincoln Eldridge Park	Basketball Court	324226		\$ 2,860	1
Wright Park and WW Seymour Botanical Conservatory	Exterior Access Route	317249	BEST PRACTICE: An adjacent clear space is not provided at the bench.	\$ 104	2
Wright Park and WW Seymour Botanical Conservatory	Exterior Access Route	317241	BEST PRACTICE: An adjacent clear space is not provided at the bench.	\$ 52	2
Wright Park and WW Seymour Botanical Conservatory	Exterior Access Route	317207	BEST PRACTICE: An adjacent clear space is not provided at the bench.	\$ 52	2
Wright Park and WW Seymour Botanical Conservatory	Exterior Access Route	317209	BEST PRACTICE: An adjacent clear space is not provided at the bench.	\$ 52	2
Wright Park and WW Seymour Botanical Conservatory	Exterior Access Route	317198	BEST PRACTICE: An adjacent clear space is not provided at the bench.	\$ 52	2

PHASE THREE					
PARK	CATEGORY	BARRIER ID	BARRIER DESCRIPTION	ESTIMATE	PRIORITY
Wright Park and WW Seymour Botanical Conservatory	Interior Access Route	317281	The non-fire, automatic accessible door requires more than 5 pounds of pressure to operate.	\$ 732	1
Wright Park and WW Seymour Botanical Conservatory	Restroom	317260	The height of controls are not compliant.	\$ 200	3
Wright Park and WW Seymour Botanical Conservatory	Restroom	317266	The dispenser opening is not within an allowable reach range.	\$ 500	3
Wright Park and WW Seymour Botanical Conservatory	Restroom	317269	The height of controls are not compliant.	\$ 200	3
Wright Park and WW Seymour Botanical Conservatory	Restroom	317549	Controls on dispensers are not compliant.	\$ 200	3
Wright Park and WW Seymour Botanical Conservatory	Restroom	317270	Items requiring an unobstructed forward reach motion are higher than 48" maximum or lower than 15" minimum height above finish floor.	\$ 100	2
Wright Park and WW Seymour Botanical Conservatory	Restroom	317277	The height of controls are not compliant.	\$ 200	3
Wright Park and WW Seymour Botanical Conservatory	Exterior Access Route	317213	WASHINGTON: The slope of the curb ramp run is not compliant.	\$ 1,750	1
Wright Park and WW Seymour Botanical Conservatory	Exterior Access Route	317214	Ground surfaces are not firm, stable and slip resistant.	\$ 300	1
Wright Park and WW Seymour Botanical Conservatory	Exterior Access Route	317171	WASHINGTON: The running slope of the curb ramp is not compliant.	\$ 1,750	1
Wright Park and WW Seymour Botanical Conservatory	Exterior Access Route	317211	The accessible route has gaps in the surface greater than 1/2" wide.	\$ 44	1
Wright Park and WW Seymour Botanical Conservatory	Exterior Access Route	317215	WASHINGTON: The slope of the curb ramp run is not compliant.	\$ 1,750	1
Wright Park and WW Seymour Botanical Conservatory	Exterior Access Route	317216	WASHINGTON: The slope of the curb ramp run is not compliant.	\$ 1,750	1
Wright Park and WW Seymour Botanical Conservatory	Exterior Access Route	317173	WASHINGTON: The slope of the curb ramp run is not compliant.	\$ 1,750	1
Wright Park and WW Seymour Botanical Conservatory	Exterior Access Route	317174	WASHINGTON: The slope of the curb ramp run is not compliant.	\$ 1,750	1
Wright Park and WW Seymour Botanical Conservatory	Exterior Access Route	317175	WASHINGTON: The slope of the curb ramp run is not compliant.	\$ 1,750	1
Wright Park and WW Seymour Botanical Conservatory	Exterior Access Route	317189	WASHINGTON: Where a detectable warning is located on a curb ramp run, the detectable warning is not compliant.	\$ 640	1
Wright Park and WW Seymour Botanical Conservatory	Exterior Access Route	317188	The curb ramp does not meet the slope requirements.	\$ 1,750	1
Wright Park and WW Seymour Botanical Conservatory	Exterior Access Route	317190	WASHINGTON: The slope of the curb ramp run is not compliant.	\$ 1,750	1
Wright Park and WW Seymour Botanical Conservatory	Exterior Access Route	317218	WASHINGTON: The slope of the curb ramp run is not compliant.	\$ 1,750	1
Wright Park and WW Seymour Botanical Conservatory	Exterior Access Route	317217	The accessible route has gaps in the surface greater than 1/2" wide. The spout and/or water flow of the lower level drinking fountain is not compliant.	\$ 716	1
Wright Park and WW Seymour Botanical Conservatory	Basketball Court	317220	A clear space is not positioned at the lower level drinking fountain for a forward approach and centered on the unit.	\$ 8,000	4
Wright Park and WW Seymour Botanical Conservatory	Interior Access Route	317506	The drinking fountains are not functioning.	\$ 36	4
Wright Park and WW Seymour Botanical Conservatory	Site Furnishings	317193	Stairs have open risers.	\$ 8,000	4
Wright Park and WW Seymour Botanical Conservatory	Playground	317200	Stairs have open risers.	\$ 840	1
Wright Park and WW Seymour Botanical Conservatory	Playground	317202	A compliant accessible route is not provided from the public access to the amenity.	\$ 840	1
Wright Park and WW Seymour Botanical Conservatory	Exterior Access Route	317247	The accessible route has gaps in the surface greater than 1/2" wide.	\$ 107	1
Wright Park and WW Seymour Botanical Conservatory	Exterior Access Route	317248	The accessible route has gaps in the surface greater than 1/2" wide.	\$ 268	1
Wright Park and WW Seymour Botanical Conservatory	Exterior Access Route	317185	The bus stop boarding and alighting area is not compliant.	\$ 792	1
Wright Park and WW Seymour Botanical Conservatory	Exterior Access Route	317186	The accessible route has gaps in the surface greater than 1/2" wide.	\$ 44	1
Wright Park and WW Seymour Botanical Conservatory	Exterior Access Route	317187	The bus stop boarding and alighting area is not compliant.	\$ 4,756	1
Wright Park and WW Seymour Botanical Conservatory	Exterior Access Route	317182	The accessible route has gaps in the surface greater than 1/2" wide.	\$ 188	1
Wright Park and WW Seymour Botanical Conservatory	Exterior Access Route	317183	The accessible route has gaps in the surface greater than 1/2" wide.	\$ 188	1
Wright Park and WW Seymour Botanical Conservatory	Exterior Access Route	317177	The accessible route has gaps in the surface greater than 1/2" wide.	\$ 161	1
Wright Park and WW Seymour Botanical Conservatory	Exterior Access Route	317178	The accessible route has gaps in the surface greater than 1/2" wide. The accessible route has areas of vertical level changes in excess of 1/4" that are not beveled or ramped.	\$ 44	1
Wright Park and WW Seymour Botanical Conservatory	Exterior Access Route	317179	The accessible route has areas of vertical level changes in excess of 1/4" that are not beveled or ramped.	\$ 53	1
Wright Park and WW Seymour Botanical Conservatory	Exterior Access Route	317181	The accessible route has areas of vertical level changes in excess of 1/4" that are not beveled or ramped.	\$ 71	1
Wright Park and WW Seymour Botanical Conservatory	Exterior Access Route	317180	The accessible route has areas of vertical level changes in excess of 1/4" that are not beveled or ramped.	\$ 85	1
Wright Park and WW Seymour Botanical Conservatory	Exterior Access Route	317176	The accessible route has gaps in the surface greater than 1/2" wide. The accessible route has areas of vertical level changes in excess of 1/4" that are not beveled or ramped.	\$ 89	1
Wright Park and WW Seymour Botanical Conservatory	Exterior Access Route	317192	The accessible route has gaps in the surface greater than 1/2" wide. A compliant accessible route is not provided from the public access to the amenity.	\$ 26	1
Wright Park and WW Seymour Botanical Conservatory	Exterior Access Route	317210	The accessible route has gaps in the surface greater than 1/2" wide. The accessible route has areas of vertical level changes in excess of 1/4" that are not beveled or ramped.	\$ 26	1
Wright Park and WW Seymour Botanical Conservatory	Exterior Access Route	317238	The accessible route has areas of vertical level changes in excess of 1/4" that are not beveled or ramped.	\$ 537	1
Wright Park and WW Seymour Botanical Conservatory	Exterior Access Route	317206	A compliant accessible route is not provided from the public access to the amenity.	\$ 107	1
Wright Park and WW Seymour Botanical Conservatory	Exterior Access Route	317284	The accessible route has areas of vertical level changes in excess of 1/4" that are not beveled or ramped.	\$ 752	1
Wright Park and WW Seymour Botanical Conservatory	Exterior Access Route	317197	The accessible route within the play area that serves ground level play components does not have minimum 80" vertical clearance.	\$ 197	1
Wright Park and WW Seymour Botanical Conservatory	Playground	317203	The accessible route has gaps in the surface greater than 1/2" wide.	\$ 5,000	2
Wright Park and WW Seymour Botanical Conservatory	Exterior Access Route	317208	The accessible route has gaps in the surface greater than 1/2" wide.	\$ 44	1
Wright Park and WW Seymour Botanical Conservatory	Exterior Access Route	317191	The accessible route has gaps in the surface greater than 1/2" wide.	\$ 44	1
Wright Park and WW Seymour Botanical Conservatory	Exterior Access Route	317246	The gate maneuvering clearance area is not compliant.	\$ 568	1
Wright Park and WW Seymour Botanical Conservatory	Exterior Access Route	317250	The gate maneuvering clearance area is not compliant.	\$ 568	1
Wright Park and WW Seymour Botanical Conservatory	Playground	317204	The ground surface has not been inspected and maintained regularly.	\$ 100	2
Wright Park and WW Seymour Botanical Conservatory	Playground	317205	The ground surface has not been inspected and maintained regularly. WASHINGTON: The historic property requires alteration to make it accessible.	\$ 150	2
Wright Park and WW Seymour Botanical Conservatory	Historic Structure	317172	An accessible passenger loading/unloading zone is not provided where a loading/unloading area is present.	\$ -	1
Wright Park and WW Seymour Botanical Conservatory	Exterior Access Route	317254	The parking space slope is greater than 1:50 (2%).	\$ 2,400	1
Wright Park and WW Seymour Botanical Conservatory	Accessible Parking	317168	An accessible parking space is not provided where an off-street parking facility is not provided.	\$ 6,300	1
Wright Park and WW Seymour Botanical Conservatory	Accessible Parking	317242		\$ 4,480	1

PHASE THREE						
PARK	CATEGORY	BARRIER ID	BARRIER DESCRIPTION	ESTIMATE	PRIORITY	
Wright Park and WW Seymour Botanical Conservatory	Accessible Parking	317243	WASHINGTON: A van stall and access aisle are not provided	\$ 840	1	
Wright Park and WW Seymour Botanical Conservatory	Exterior Access Route	317283	The picnic table does not allow a clear space for forward wheelchair approach with knee and toe clearance.	\$ 1,300	2	
Wright Park and WW Seymour Botanical Conservatory	Picnic Area	317194	The picnic table does not allow a clear space for forward wheelchair approach with knee and toe clearance.	\$ 1,300	2	
Wright Park and WW Seymour Botanical Conservatory	Picnic Area	317232	BEST PRACTICE: The total number of accessible picnic tables is less than the required 20% under ABA requirements.	\$ 3,900	4	
Wright Park and WW Seymour Botanical Conservatory	Athletic Fields	317239	A wheelchair space is not provided at the team or player seating.	\$ 52	2	
Wright Park and WW Seymour Botanical Conservatory	Restroom	317262	Items that require a forward reach motion require more than 48" height reach.	\$ 100	2	
Wright Park and WW Seymour Botanical Conservatory	Exterior Access Route	317219	Items requiring an unobstructed side reach motion are higher than 48" maximum and/or lower than 15" minimum height above finish floor.	\$ 100	2	
Wright Park and WW Seymour Botanical Conservatory	Exterior Access Route	317212	Items requiring an unobstructed side reach motion are higher than 48" maximum and/or lower than 15" minimum height above finish floor.	\$ 100	2	
Wright Park and WW Seymour Botanical Conservatory	Restroom	317274	The dispenser opening is not within an allowable reach range.	\$ 500	3	
Wright Park and WW Seymour Botanical Conservatory	Restroom	317234	The interior accessible route has non-compliant slopes.	\$ 682	1	
Wright Park and WW Seymour Botanical Conservatory	Restroom	317259	The pull side of the accessible door does not have the required maneuvering clearances.	\$ 50	3	
Wright Park and WW Seymour Botanical Conservatory	Restroom	317263	The door does not have 80" minimum head clearance from finish floor, excluding door closer hinged bar, which can be 78" minimum.	\$ 2,600	1	
Wright Park and WW Seymour Botanical Conservatory	Restroom	317258	The pull side of the accessible door does not have the required maneuvering clearances.	\$ 250	3	
Wright Park and WW Seymour Botanical Conservatory	Restroom	317271	The door does not have 80" minimum head clearance from finish floor, excluding door closer hinged bar, which can be 78" minimum.	\$ 2,600	1	
Wright Park and WW Seymour Botanical Conservatory	Restroom	317235	The interior accessible route has non-compliant slopes.	\$ 682	1	
Wright Park and WW Seymour Botanical Conservatory	Restroom	317224	The lavatory is mounted higher than 34" to the higher of the rim or counter.	\$ 720	3	
Wright Park and WW Seymour Botanical Conservatory	Restroom	317256	Signage with tactile lettering does not have 18" minimum by 18" minimum clear space centered on the tactile characters and/or beyond the arc swing of a door between the closed position and 45 degrees open.	\$ 2,200	4	
Wright Park and WW Seymour Botanical Conservatory	Restroom	317257	Signage with tactile lettering does not have 18" minimum by 18" minimum clear space centered on the tactile characters and/or beyond the arc swing of a door between the closed position and 45 degrees open.	\$ 2,200	4	
Wright Park and WW Seymour Botanical Conservatory	Restroom	317229	Toe clearance is not provided under the partitions	\$ 1,070	3	
Wright Park and WW Seymour Botanical Conservatory	Restroom	317226	Toe clearance is not provided under the partitions.	\$ 1,070	3	
Wright Park and WW Seymour Botanical Conservatory	Restroom	317265	The water closet in a single user / unisex restroom does not have the required clearance.	\$ 200	3	
Wright Park and WW Seymour Botanical Conservatory	Restroom	317267	Projecting object above the grab bar is less than 12" minimum above the top of the gripping surface of the bar.	\$ 500	3	
Wright Park and WW Seymour Botanical Conservatory	Restroom	317273	The water closet in a single user / unisex restroom does not have the required clearance.	\$ 200	3	
Wright Park and WW Seymour Botanical Conservatory	Restroom	317275	Projecting object above the grab bar is less than 12" minimum above the bar.	\$ 500	3	
Wright Park and WW Seymour Botanical Conservatory	Restroom	317230	The height of the water closet is not 17" minimum to 19" maximum above finished floor.	\$ 630	3	
Wright Park and WW Seymour Botanical Conservatory	Restroom	317233	The side grab bar at the water closet is not compliant.	\$ 355	3	
Wright Park and WW Seymour Botanical Conservatory	Restroom	317227	The height of the water closet is not 17" minimum to 19" maximum above finished floor.	\$ 630	3	
Wright Park and WW Seymour Botanical Conservatory	Restroom	317236	The side grab bar at the water closet is not compliant.	\$ 355	3	
Wright Park and WW Seymour Botanical Conservatory	Restroom	317237	The centerline of the toilet in the wheelchair stall is not 16" minimum to 18" maximum from the sidewall.	\$ 630	3	
Wright Park and WW Seymour Botanical Conservatory	Restroom	317228	The wheelchair stall door is not compliant.	\$ 500	3	
Wright Park and WW Seymour Botanical Conservatory	Restroom	317225	The wheelchair stall door is not compliant.	\$ 500	3	
Wright Park and WW Seymour Botanical Conservatory	Interior Access Route	317251	The sink rim is higher than 34", and does not have knee and toe clearance (does not apply to mop basins, utility sinks, or bar sinks).	\$ 720	2	
Wright Park and WW Seymour Botanical Conservatory	Interior Access Route	317252	Exposed pipes lack insulation and/or sharp or abrasive surfaces are present under the sink.	\$ 65	2	
Wright Park and WW Seymour Botanical Conservatory	Basketball Court	317221	The accessible route has gaps in the surface greater than 1/2" wide.	\$ 800	1	
Wright Park and WW Seymour Botanical Conservatory	Playground	317199	A means of support is not provided at the transfer platform and/or transfer steps.	\$ 3,795	2	
Wright Park and WW Seymour Botanical Conservatory	Interior Access Route	317253	A compliant turning space is not provided.	\$ 224	4	
Jefferson Park	Trail	320723	The accessible route has areas of vertical level changes in excess of 1/4" that are not beveled or ramped.	\$ 71	1	
Jefferson Park	Trail	327209	BEST PRACTICE: The inaccessible trail segment does not have signage with trail details.	\$ 280	4	
TOTAL				\$ 1,911,831		

PHASE FOUR						
PARK	CATEGORY	BARRIER ID	BARRIER DESCRIPTION	ESTIMATE	PRIORITY	
Charlotte's Blueberry Park	Site Furnishings	323305	An adjacent clear space is not provided at the bench.	\$ 52	2	
Charlotte's Blueberry Park	Site Furnishings	323298	An adjacent clear space is not provided at the bench.	\$ 52	2	
Charlotte's Blueberry Park	Exterior Access Route	324910	WASHINGTON: An exterior accessible route is not provided to site amenities.	\$ 8,960	1	
Charlotte's Blueberry Park	Exterior Access Route	323285	WASHINGTON: The cross slopes of the exterior accessible route are not compliant.	\$ 985	1	
Charlotte's Blueberry Park	Exterior Access Route	323286	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 22,382	1	
Charlotte's Blueberry Park	Exterior Access Route	323296	WASHINGTON: An exterior accessible route is not provided.	\$ 465	1	
Charlotte's Blueberry Park	Exterior Access Route	323301	WASHINGTON: An exterior accessible route is not provided.	\$ 197	1	
Charlotte's Blueberry Park	Exterior Access Route	323277	WASHINGTON: An exterior accessible route is not provided.	\$ 5,062	1	
Charlotte's Blueberry Park	Exterior Access Route	323282	WASHINGTON: An exterior accessible route is not provided.	\$ 663	1	
Charlotte's Blueberry Park	Exterior Access Route	323309	WASHINGTON: An exterior accessible route is not provided.	\$ 134	1	
Charlotte's Blueberry Park	Exterior Access Route	323306	WASHINGTON: An exterior accessible route is not provided.	\$ 134	1	
Charlotte's Blueberry Park	Exterior Access Route	323302	WASHINGTON: An exterior accessible route is not provided.	\$ 2,499	1	
Charlotte's Blueberry Park	Exterior Access Route	323308	WASHINGTON: An exterior accessible route is not provided.	\$ 197	1	
Charlotte's Blueberry Park	Exterior Access Route	323281	Walkway has areas of vertical level changes in excess of 1/4" that are not ramped.	\$ 89	1	
Charlotte's Blueberry Park	Playground	323279	The ground surface has not been inspected and maintained regularly.	\$ 1,500	2	
Charlotte's Blueberry Park	Accessible Parking	323310	WASHINGTON: A van stall, access aisle, and signage are not provided.	\$ 11,300	1	
Charlotte's Blueberry Park	Site Furnishings	323293	The picnic table does not allow a clear space for forward wheelchair approach with knee and toe clearance.	\$ 1,300	2	
Charlotte's Blueberry Park	Site Furnishings	323294	The table does not have minimum 36" wide clear ground space on all usable sides of the table.	\$ 629	4	
Charlotte's Blueberry Park	Site Furnishings	323288	The picnic table does not allow a clear space for forward wheelchair approach with knee and toe clearance.	\$ 1,300	2	
Charlotte's Blueberry Park	Site Furnishings	323304	The table does not have minimum 36" wide clear ground space on all usable sides of the table.	\$ 629	4	
Charlotte's Blueberry Park	Site Furnishings	323303	The picnic table does not allow a clear space for forward wheelchair approach with knee and toe clearance. Directional signage indicating the accessible route from accessible parking to the facility is not provided, where existing routes are both accessible and non-accessible.	\$ 1,300	2	
Charlotte's Blueberry Park	Exterior Access Route	324911	Directional signage indicating the accessible route from accessible parking to the facility is not provided, where existing routes are both accessible and non-accessible.	\$ 560	4	
Charlotte's Blueberry Park	Trail	324773	The accessible trail or trail segment does not have signage with trail details.	\$ 560	4	
Charlotte's Blueberry Park	Trail	324907	The inaccessible trail or trail segment does not have signage with trail details.	\$ 560	4	
Charlotte's Blueberry Park	Trail	323283	Cross slope of concrete, asphalt or wood surfaced trail is greater than 1:48 or 2.08%.	\$ 2,080	4	
Charlotte's Blueberry Park	Trail	323284	Tread obstacles in concrete, asphalt or boards are more than 0.5".	\$ 180	4	
Charlotte's Blueberry Park	Trail	323287	Cross slope of concrete, asphalt or wood surfaced trail is greater than 1:48 or 2.08%.	\$ 1,230	4	
Charlotte's Blueberry Park	Trail	323289	Cross slope of concrete, asphalt or wood surfaced trail is greater than 1:48 or 2.08%.	\$ 2,870	4	
Charlotte's Blueberry Park	Trail	323290	Cross slope of concrete, asphalt or wood surfaced trail is greater than 1:48 or 2.08%.	\$ 6,020	4	
Charlotte's Blueberry Park	Trail	323291	Cross slope of concrete, asphalt or wood surfaced trail is greater than 1:48 or 2.08%.	\$ 5,470	4	
Charlotte's Blueberry Park	Trail	323292	Cross slope of concrete, asphalt or wood surfaced trail is greater than 1:48 or 2.08%.	\$ 2,740	4	
Charlotte's Blueberry Park	Trail	323295	Cross slope of concrete, asphalt or wood surfaced trail is greater than 1:48 or 2.08%.	\$ 1,102	4	
Charlotte's Blueberry Park	Trail	323297	Cross slope of concrete, asphalt or wood surfaced trail is greater than 1:48 or 2.08%.	\$ 410	4	
Charlotte's Blueberry Park	Trail	323299	Cross slope of concrete, asphalt or wood surfaced trail is greater than 1:48 or 2.08%.	\$ 2,610	4	
Charlotte's Blueberry Park	Trail	323300	Cross slope of concrete, asphalt or wood surfaced trail is greater than 1:48 or 2.08%.	\$ 8,840	4	
Charlotte's Blueberry Park	Trail	323307	Cross slope of concrete, asphalt or wood surfaced trail is greater than 1:48 or 2.08%.	\$ 6,270	4	
McKinley Park	Playground	328843	The ground surface has not been inspected and maintained regularly.	\$ 2,000	2	
McKinley Park	Entrance to Building	328883	The pull side of the accessible door does not have the required maneuvering clearances. The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ 1,250	1	
McKinley Park	Entrance to Building	328878	The non-fire, automatic accessible door requires more than 5 pounds of pressure to operate.	\$ 366	1	
McKinley Park	Entrance to Building	328879	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ 366	1	
McKinley Park	Entrance to Building	328880	The non-fire, automatic accessible door requires more than 5 pounds of pressure to operate.	\$ 366	1	
McKinley Park	Entrance to Building	328881	The non-fire, automatic accessible door requires more than 5 pounds of pressure to operate.	\$ 366	1	
McKinley Park	Interior Access Route	328836	The minimum number of drinking fountains is not provided.	\$ 5,439	4	
McKinley Park	Exterior Access Route	328870	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 6,897	1	
McKinley Park	Exterior Access Route	328834	The accessible route has gaps in the surface greater than 1/2" wide.	\$ 645	1	
McKinley Park	Exterior Access Route	328832	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 6,976	1	
McKinley Park	Exterior Access Route	328871	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 1,803	1	
McKinley Park	Exterior Access Route	328884	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 5,708	1	
McKinley Park	Exterior Access Route	328899	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 2,794	1	
McKinley Park	Exterior Access Route	328885	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 70,763	1	
McKinley Park	Exterior Access Route	328897	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 16,153	1	
McKinley Park	Exterior Access Route	328898	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 54,029	1	
McKinley Park	Exterior Access Route	328896	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 7,928	1	
McKinley Park	Exterior Access Route	328894	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 991	1	
McKinley Park	Exterior Access Route	328886	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 31,712	1	
McKinley Park	Exterior Access Route	328887	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 4,598	1	
McKinley Park	Exterior Access Route	328888	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 55,496	1	
McKinley Park	Exterior Access Route	328890	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 634	1	
McKinley Park	Exterior Access Route	328838	WASHINGTON: An exterior accessible route is not provided.	\$ 331	1	
McKinley Park	Exterior Access Route	328839	WASHINGTON: An exterior accessible route is not provided.	\$ 985	1	
McKinley Park	Exterior Access Route	328847	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 634	1	
McKinley Park	Exterior Access Route	328848	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 1,268	1	
McKinley Park	Exterior Access Route	328850	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 6,421	1	
McKinley Park	Exterior Access Route	328851	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 2,616	1	
McKinley Park	Exterior Access Route	328852	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 2,219	1	
McKinley Park	Exterior Access Route	328853	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 634	1	
McKinley Park	Exterior Access Route	328846	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 3,864	1	
McKinley Park	Exterior Access Route	328840	WASHINGTON: An exterior accessible route is not provided.	\$ 1,478	1	
McKinley Park	Exterior Access Route	328855	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 654	1	
McKinley Park	Exterior Access Route	328856	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 20,632	1	
McKinley Park	Exterior Access Route	328857	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 3,884	1	

PHASE FOUR						
PARK	CATEGORY	BARRIER ID	BARRIER DESCRIPTION	ESTIMATE	PRIORITY	
McKinley Park	Exterior Access Route	328858	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 6,441	1	
McKinley Park	Exterior Access Route	328859	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 911	1	
McKinley Park	Exterior Access Route	328860	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 1,982	1	
McKinley Park	Exterior Access Route	328861	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 1,744	1	
McKinley Park	Exterior Access Route	328872	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 812	1	
McKinley Park	Exterior Access Route	328875	A compliant accessible route is not provided from the public access to the amenity.	\$ 143	1	
McKinley Park	Signage	328876	Signage with tactile lettering does not have 18" minimum by 18" minimum clear space centered on the tactile characters and/or beyond the arc swing of a door between the closed position and 45 degrees open.	\$ 280	4	
McKinley Park	Signage	328877	Signage with tactile lettering does not have 18" minimum by 18" minimum clear space centered on the tactile characters beyond the arc swing of a door between the closed position and 45 degrees open.	\$ 280	4	
McKinley Park	Playground	328874	The ground surface has not been inspected and maintained regularly.	\$ 562	2	
McKinley Park	Accessible Parking	328862	The parking space slope is greater than 1:50 (2%).	\$ 6,300	1	
McKinley Park	Accessible Parking	328863	The van stall has openings in ground surfaces greater than 1/2" wide.	\$ 750	1	
McKinley Park	Accessible Parking	328864	The access aisle slope is greater than 1:50 (2%).	\$ 5,000	1	
McKinley Park	Accessible Parking	328867	WASHINGTON: Compliant signage is not provided at the van space.	\$ 280	1	
McKinley Park	Accessible Parking	328868	WASHINGTON: Compliant signage is not provided at the access aisle.	\$ 280	1	
McKinley Park	Accessible Parking	328865	The parking space slope is greater than 1:50 (2%).	\$ 6,300	1	
McKinley Park	Accessible Parking	328866	The van stall has openings in ground surfaces greater than 1/2" wide.	\$ 750	1	
McKinley Park	Accessible Parking	328869	WASHINGTON: Compliant signage is not provided at the van space.	\$ 280	1	
McKinley Park	Accessible Parking	328895	WASHINGTON: A van stall, access aisle, and signage are not provided.	\$ 11,300	1	
McKinley Park	Site Furnishings	328837	The picnic table does not allow a clear space for forward wheelchair approach with knee and toe clearance.	\$ 1,300	2	
McKinley Park	Site Furnishings	328854	BEST PRACTISE: The table does not have minimum 36" wide clear ground space on all usable sides of the table.	\$ 629	4	
McKinley Park	Playground	328845	A compliant turning space is not provided at a school-age swing.	\$ 150	2	
McKinley Park	Exterior Access Route	328835	Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the accessible route.	\$ 728	1	
McKinley Park	Restroom	328882	WASHINGTON: The toilet paper dispenser location is not compliant.	\$ 293	3	
McKinley Park	Trail	328893	The inaccessible trail or trail segment does not have signage with trail details.	\$ 350	4	
McKinley Park	Trail	328841	BEST PRACTICE: The inaccessible trail or trail segment does not have signage with trail details.	\$ 350	4	
McKinley Park	Trail	328891	The inaccessible trail or trail segment does not have signage with trail details.	\$ 350	4	
McKinley Park	Exterior Access Route	328873	WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 140	3	
Norpoint Park	Site Furnishings	302162	An adjacent clear space is not provided at the bench.	\$ 237	2	
Norpoint Park	Site Furnishings	302150	An adjacent clear space is not provided at the bench.	\$ 52	2	
Norpoint Park	Exterior Access Route	302146	WASHINGTON: The slope of the curb ramp run is not compliant.	\$ 1,750	1	
Norpoint Park	Exterior Access Route	302143	WASHINGTON: The slope of the curb ramp run is not compliant.	\$ 1,750	1	
Norpoint Park	Exterior Access Route	302144	A landing at the top of the curb ramp is not present.	\$ 1,289	1	
Norpoint Park	Exterior Access Route	302167	WASHINGTON: The slope of the curb ramp run is not compliant.	\$ 1,750	1	
Norpoint Park	Exterior Access Route	302168	The curb ramp landing is not level. The slope of the curb ramp landing exceeds the maximum allowable 1:48 (2.08%).	\$ 1,289	1	
Norpoint Park	Exterior Access Route	302124	WASHINGTON: The slope of the curb ramp run is not compliant.	\$ 1,750	1	
Norpoint Park	Exterior Access Route	302128	The landing at the top of the curb ramp is not a compliant size.	\$ 1,289	1	
Norpoint Park	Exterior Access Route	302133	WASHINGTON: Where a detectable warning is located on a curb ramp run, the detectable warning is not compliant.	\$ 640	1	
Norpoint Park	Exterior Access Route	302134	WASHINGTON: Where a detectable warning is located on a curb ramp run, the detectable warning is not compliant.	\$ 640	1	
Norpoint Park	Exterior Access Route	302135	WASHINGTON: Where a detectable warning is located on a curb ramp run, the detectable warning is not compliant.	\$ 640	1	
Norpoint Park	Exterior Access Route	302136	WASHINGTON: Where a detectable warning is located on a curb ramp run, the detectable warning is not compliant.	\$ 640	1	
Norpoint Park	Exterior Access Route	302137	WASHINGTON: The slope of the curb ramp run is not compliant.	\$ 1,750	1	
Norpoint Park	Exterior Access Route	302138	WASHINGTON: Where a detectable warning is located on a curb ramp run, the detectable warning is not compliant.	\$ 640	1	
Norpoint Park	Exterior Access Route	302157	The curb ramp surface has vertical height changes greater than 1/4" that are not ramped.	\$ 1,750	1	
Norpoint Park	Exterior Access Route	302125	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 1,625	1	
Norpoint Park	Exterior Access Route	302126	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 8,264	1	
Norpoint Park	Exterior Access Route	302127	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 872	1	
Norpoint Park	Exterior Access Route	302149	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 7,016	1	
Norpoint Park	Exterior Access Route	302151	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 9,910	1	
Norpoint Park	Exterior Access Route	302152	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 4,955	1	
Norpoint Park	Exterior Access Route	302153	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 5,946	1	
Norpoint Park	Exterior Access Route	302154	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 6,243	1	
Norpoint Park	Exterior Access Route	302129	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 3,072	1	
Norpoint Park	Exterior Access Route	302130	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 772	1	
Norpoint Park	Exterior Access Route	302132	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 6,897	1	
Norpoint Park	Exterior Access Route	302139	The accessible route has gaps in the surface greater than 1/2" wide.	\$ 224	1	
Norpoint Park	Exterior Access Route	302156	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 15,697	1	
Norpoint Park	Exterior Access Route	302165	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 1,863	1	
Norpoint Park	Exterior Access Route	302147	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 1,744	1	
Norpoint Park	Exterior Access Route	302148	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 634	1	
Norpoint Park	Exterior Access Route	302170	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 1,466	1	
Norpoint Park	Exterior Access Route	302171	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 3,864	1	
Norpoint Park	Exterior Access Route	302145	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 11,158	1	
Norpoint Park	Exterior Access Route	302119	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 436	1	
Norpoint Park	Exterior Access Route	302120	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 872	1	
Norpoint Park	Exterior Access Route	302122	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 3,805	1	

PHASE FOUR						
PARK	CATEGORY	BARRIER ID	BARRIER DESCRIPTION	ESTIMATE	PRIORITY	
Norpoint Park	Exterior Access Route	302123	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 1,075	1	
Norpoint Park	Exterior Access Route	302178	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 2,893	1	
Norpoint Park	Exterior Access Route	302187	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 1,843	1	
Norpoint Park	Exterior Access Route	302188	The accessible route has gaps in the surface greater than 1/2" wide.	\$ 116	1	
Norpoint Park	Exterior Access Route	302189	The accessible route has gaps in the surface greater than 1/2" wide.	\$ 8	1	
Norpoint Park	Exterior Access Route	302190	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 772	1	
Norpoint Park	Exterior Access Route	302192	The accessible route has gaps in the surface greater than 1/2" wide.	\$ 8	1	
Norpoint Park	Exterior Access Route	302193	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 16,510	1	
Norpoint Park	Playground	302161	The ground surface has not been inspected and maintained regularly.	\$ 990	2	
Norpoint Park	Accessible Parking	302104	The slope of the parking space is greater than 1:50 (2%).	\$ 6,300	1	
Norpoint Park	Accessible Parking	302105	The slope of the parking space is greater than 1:50 (2%).	\$ 6,300	1	
Norpoint Park	Accessible Parking	302106	The access aisle slope is greater than 1:50 (2%).	\$ 5,000	1	
Norpoint Park	Accessible Parking	302107	The slope of the parking space is greater than 1:50 (2%).	\$ 6,300	1	
Norpoint Park	Accessible Parking	302108	The access aisle slope is greater than 1:50 (2%).	\$ 5,000	1	
Norpoint Park	Accessible Parking	302109	The slope of the parking space is greater than 1:50 (2%).	\$ 6,300	1	
Norpoint Park	Accessible Parking	302110	The slope of the parking space is greater than 1:50 (2%).	\$ 6,300	1	
Norpoint Park	Accessible Parking	302111	The access aisle slope is greater than 1:50 (2%).	\$ 5,000	1	
Norpoint Park	Accessible Parking	302112	The slope of the parking space is greater than 1:50 (2%).	\$ 6,300	1	
Norpoint Park	Accessible Parking	302113	The access aisle slope is greater than 1:50 (2%).	\$ 5,000	1	
Norpoint Park	Accessible Parking	302114	The slope of the parking space is greater than 1:50 (2%).	\$ 6,300	1	
Norpoint Park	Accessible Parking	302194	An accessible passenger loading/unloading zone is not provided where a loading/unloading area is present.	\$ 2,600	1	
Norpoint Park	Accessible Parking	302195	Accessible parking spaces are not at the nearest accessible entrance.	\$ 420	1	
Norpoint Park	Accessible Parking	302101	The parking space slope is greater than 1:50 (2%).	\$ 6,300	1	
Norpoint Park	Accessible Parking	302102	WASHINGTON: The van access aisle is not compliant.	\$ 420	1	
Norpoint Park	Accessible Parking	302103	The access aisle slope is greater than 1:50 (2%).	\$ 5,000	1	
Norpoint Park	Accessible Parking	302115	WASHINGTON: A van stall and access aisle are not marked and signage is not provided.	\$ 1,400	1	
Norpoint Park	Accessible Parking	302142	WASHINGTON: A van stall, access aisle, and signage are not provided and the slope and/or ground surface is/are not compliant.	\$ 11,300	1	
Norpoint Park	Accessible Parking	302121	WASHINGTON: A van stall, access aisle, and signage are not provided and the slope and/or ground surface is/are not compliant.	\$ 11,300	1	
Norpoint Park	Site Furnishings	302155	The picnic table does not allow a clear space for forward wheelchair approach with knee and toe clearance.	\$ 1,300	2	
Norpoint Park	Site Furnishings	302163	The picnic table does not allow a clear space for forward wheelchair approach with knee and toe clearance.	\$ 1,300	2	
Norpoint Park	Site Furnishings	302116	The picnic table does not allow a clear space for forward wheelchair approach with knee and toe clearance.	\$ 1,300	2	
Norpoint Park	Playground	302158	Clear ground space is not provided at each ground play component, and each elevated play component connected by a ramp.	\$ 24	2	
Norpoint Park	Playground	302159	A compliant turning space is not provided at a school-age swing.	\$ 750	2	
Norpoint Park	Playground	302160	A turning space is not provided at a preschool swing.	\$ 750	2	
Norpoint Park	Exterior Access Route	302164	Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the accessible route.	\$ 728	1	
Norpoint Park	Restroom	302091	The restroom circulation path is not free of objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.	\$ 200	2	
Norpoint Park	Restroom	302092	The restroom circulation path is not free of objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.	\$ 200	2	
Norpoint Park	Restroom	302097	The restroom circulation path is not free of objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.	\$ 200	2	
Norpoint Park	Restroom	302098	The restroom circulation path is not free of objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.	\$ 200	2	
Norpoint Park	Restroom	302088	The rear grab bar at the water closet is not compliant.	\$ 355	3	
Norpoint Park	Restroom	302089	The height of the water closet is not 17" minimum to 19" maximum above finished floor.	\$ 630	3	
Norpoint Park	Restroom	302090	The centerline of the toilet in the wheelchair stall is not 16" minimum to 18" maximum from the sidewall.	\$ 630	3	
Norpoint Park	Restroom	302099	The centerline of the toilet in the wheelchair stall is not 16" minimum to 18" maximum from the sidewall.	\$ 630	3	
Norpoint Park	Restroom	302100	The height of the water closet is not 17" minimum to 19" maximum above finished floor.	\$ 630	3	
Norpoint Park	Trail	302141	The inaccessible trail or trail segment does not have signage with trail details.	\$ 280	4	
Norpoint Park	Exterior Access Route	302175	Steps do not have uniform and compliant riser heights and/or tread depths.	\$ 382	1	
Northeast Tacoma Playground	Baseball/Softball Field	316655	The required number of wheelchair spaces is not provided at the bleacher seating for the ball field.	\$ 192	2	
Northeast Tacoma Playground	Baseball/Softball Field	316665	The required number of wheelchair spaces is not provided at the bleacher seating for the ball field.	\$ 96	2	
Northeast Tacoma Playground	Baseball/Softball Field	316668	The required number of wheelchair spaces is not provided at the bleacher seating for the ball field.	\$ 192	2	
Northeast Tacoma Playground	Exterior Access Route	316653	WASHINGTON: An exterior accessible route is not provided.	\$ 931	1	
Northeast Tacoma Playground	Exterior Access Route	316663	WASHINGTON: An exterior accessible route is not provided.	\$ 1,523	1	
Northeast Tacoma Playground	Exterior Access Route	316664	WASHINGTON: An exterior accessible route is not provided.	\$ 2,956	1	
Northeast Tacoma Playground	Exterior Access Route	316667	WASHINGTON: The clear width of the exterior accessible route is less than 44".	\$ 35	1	
Northeast Tacoma Playground	Exterior Access Route	316669	WASHINGTON: An exterior accessible route is not provided.	\$ 1,478	1	
Northeast Tacoma Playground	Exterior Access Route	316670	WASHINGTON: An exterior accessible route is not provided.	\$ 4,766	1	
Northeast Tacoma Playground	Exterior Access Route	316658	WASHINGTON: An exterior accessible route is not provided.	\$ 725	1	
Northeast Tacoma Playground	Site Furnishings	316659	The picnic table does not allow a clear space for forward wheelchair approach with knee and toe clearance.	\$ 1,300	2	
Northeast Tacoma Playground	Playground	316660	A compliant turning space is not provided at a school-age swing.	\$ 750	2	
Northeast Tacoma Playground	Baseball/Softball Field	316656	A wheelchair space is not provided at each team bench area at the ball field.	\$ 52	2	
Northeast Tacoma Playground	Baseball/Softball Field	316666	A wheelchair space is not provided at each team bench area at the ball field.	\$ 52	2	
Northeast Tacoma Playground	Basketball Court	316654	An accessible route does not directly connect each side of the court outside of play lines.	\$ 1,531	1	
Northeast Tacoma Playground	Exterior Access Route	316662	WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 281	3	
Northeast Tacoma Playground	Playground	316661	A means of support is not provided at the transfer platform.	\$ 165	2	

PHASE FOUR						
PARK	CATEGORY	BARRIER ID	BARRIER DESCRIPTION	ESTIMATE	PRIORITY	
Peck Field	Restroom	323619	The height of controls are not compliant. The sales or service counter does not have an accessible portion with maximum 36" height surface above finish floor or ground.	\$ 200	3	
Peck Field	Common Areas	323630		\$ 1,804	2	
Peck Field	Site Furnishings	323627	The minimum number and types of drinking fountains are not provided.	\$ 8,000	4	
Peck Field	Exterior Access Route	323613	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 9,000	1	
Peck Field	Exterior Access Route	323631	The walkway does not have a compliant turning space at a change of direction.	\$ 1,000	1	
Peck Field	Exterior Access Route	323612	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 5,400	1	
Peck Field	Exterior Access Route	323635	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 840	1	
Peck Field	Exterior Access Route	323636	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 1,200	1	
Peck Field	Exterior Access Route	323750	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 750	1	
Peck Field	Exterior Access Route	323637	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 1,200	1	
Peck Field	Exterior Access Route	323754	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 750	1	
Peck Field	Exterior Access Route	323645	WASHINGTON: An exterior accessible route is not provided. ADVISORY: A marked crosswalk is not provided where the accessible route crosses a vehicular way between the accessible parking aisle and the building entrance.	\$ 11,693	1	
Peck Field	Exterior Access Route	324498		\$ -	1	
Peck Field	Exterior Access Route	323646	WASHINGTON: An exterior accessible route is not provided.	\$ 42,613	1	
Peck Field	Exterior Access Route	323629	Ground surfaces are not firm, stable and slip resistant.	\$ 1,000	1	
Peck Field	Accessible Parking	323643	An access aisle is not provided.	\$ 420	1	
Peck Field	Accessible Parking	323644	A standard accessible stall is not provided.	\$ 960	1	
Peck Field	Accessible Parking	323651	An access aisle is not provided.	\$ 420	1	
Peck Field	Accessible Parking	323652	A standard accessible stall is not provided.	\$ 480	1	
Peck Field	Accessible Parking	323640	A van space is not provided.	\$ 420	1	
Peck Field	Accessible Parking	323641	A van access aisle is not provided.	\$ 420	1	
Peck Field	Accessible Parking	323648	A van space is not provided.	\$ 420	1	
Peck Field	Accessible Parking	323649	A van access aisle is not provided.	\$ 420	1	
Peck Field	Baseball/Softball Field	323632	A wheelchair space is not provided at each team bench area at the ball field.	\$ 104	2	
Peck Field	Baseball/Softball Field	323633	A wheelchair space is not provided at each team bench area at the ball field.	\$ 104	2	
Peck Field	Baseball/Softball Field	323634	A wheelchair space is not provided at each team bench area at the ball field.	\$ 104	2	
Peck Field	Baseball/Softball Field	323638	A wheelchair space is not provided at each team bench area at the ball field.	\$ 104	2	
Peck Field	Restroom	323620	The wheelchair stall door is not self closing.	\$ 586	3	
Peck Field	Restroom	323622	The side grab bar is not compliant in the wheelchair stall.	\$ 710	3	
Peck Field	Restroom	323623	The rear grab bar in the wheelchair stall is not compliant.	\$ 710	3	
Peck Field	Restroom	394737	ANSI A117.1-2009 : A vertical side grab bar is not present in the wheelchair stall. The wheelchair stall with a floor mounted water closet, in a multi-stall restroom, is less than 60" wide and 59" deep.	\$ 887	3	
Peck Field	Restroom	323624		\$ 1,368	3	
Peck Field	Restroom	323626	The urinal dimensions are not compliant.	\$ 935	3	
Peck Field	Restroom	323625	The height of the water closet is not 17" minimum to 19" maximum above finished floor.	\$ 630	3	
Peck Field	Concession Stand	323628	The service counter height is greater than 36" where a parallel approach is present.	\$ 1,804	2	
Portland Avenue Park	Accessible Parking	322640	WASHINGTON: Compliant signage is not provided at the standard space and access aisle.	\$ 560	1	
Portland Avenue Park	Restroom	322645	The amenity cannot be accessed and, therefore, cannot be evaluated.	\$ -	0	
Portland Avenue Park	Site Furnishings	322663	BEST PRACTICE: An adjacent clear space is not provided at the bench.	\$ 2,150	2	
Portland Avenue Park	Football Field	322668	The wheelchair space is not the minimum required dimensions at the bleacher seating for the football field.	\$ 215	2	
Portland Avenue Park	Football Field	322671	The required number of wheelchair spaces is not provided at the bleacher seating for the football field. The adjacent surfaces at transitions to adjoining walks, gutters and streets at the curb ramp are not at the same level.	\$ 215	2	
Portland Avenue Park	Exterior Access Route	322661		\$ -	1	
Portland Avenue Park	Exterior Access Route	322662	WASHINGTON: The slopes of the curb ramp run and flares are not compliant. WASHINGTON: Where a detectable warning is located on a curb ramp run, the detectable warning is not compliant.	\$ 1,750	1	
Portland Avenue Park	Exterior Access Route	322644		\$ 640	1	
Portland Avenue Park	Exterior Access Route	328640	WASHINGTON: The slope of the curb ramp flare is not compliant.	\$ 1,750	1	
Portland Avenue Park	Exterior Access Route	322696	WASHINGTON: The slope of the curb ramp flare is not compliant.	\$ 1,750	1	
Portland Avenue Park	Exterior Access Route	322699	WASHINGTON: The slopes of the curb ramp are not compliant. WASHINGTON: Where a detectable warning is located on a curb ramp run, the detectable warning is not compliant.	\$ 1,750	1	
Portland Avenue Park	Exterior Access Route	322702		\$ 640	1	
Portland Avenue Park	Exterior Access Route	322666	The curb ramp landing is not compliant.	\$ 1,750	1	
Portland Avenue Park	Exterior Access Route	322686	The accessible route has areas of vertical level changes in excess of 1/4" that are not beveled or ramped.	\$ 75	1	
Portland Avenue Park	Exterior Access Route	322687	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 297	1	
Portland Avenue Park	Exterior Access Route	322670	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 5,376	1	
Portland Avenue Park	Exterior Access Route	322688	The accessible route has areas of vertical level changes in excess of 1/4" that are not beveled or ramped.	\$ 79	1	
Portland Avenue Park	Exterior Access Route	322689	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 4,756	1	
Portland Avenue Park	Exterior Access Route	322682	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 1,526	1	
Portland Avenue Park	Exterior Access Route	322683	The accessible route has gaps in the surface greater than 1/2" wide.	\$ 78	1	
Portland Avenue Park	Exterior Access Route	322684	The accessible route has gaps in the surface greater than 1/2" wide.	\$ 34	1	
Portland Avenue Park	Exterior Access Route	322685	The accessible route has gaps in the surface greater than 1/2" wide.	\$ 39	1	
Portland Avenue Park	Exterior Access Route	322701	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 3,091	1	
Portland Avenue Park	Exterior Access Route	322698	The accessible route has gaps in the surface greater than 1/2" wide.	\$ 13,664	1	
Portland Avenue Park	Football Field	322648	WASHINGTON: An exterior accessible route is not provided to the bleachers.	\$ 7,168	1	
Portland Avenue Park	Exterior Access Route	322649	The accessible route has gaps in the surface greater than 1/2" wide.	\$ 1,048	1	
Portland Avenue Park	Exterior Access Route	322694	The surfacing of the accessible route is not compliant.	\$ 179	1	
Portland Avenue Park	Exterior Access Route	322664	The accessible route has gaps in the surface greater than 1/2" wide.	\$ 489	1	
Portland Avenue Park	Exterior Access Route	322691	The accessible route has areas of vertical level changes in excess of 1/4" that are not beveled or ramped.	\$ 75	1	
Portland Avenue Park	Exterior Access Route	322697	The accessible route has gaps in the surface greater than 1/2" wide.	\$ 16,151	1	
Portland Avenue Park	Exterior Access Route	322680	The accessible route has gaps in the surface greater than 1/2" wide.	\$ 21	1	
Portland Avenue Park	Exterior Access Route	322681	The accessible route has gaps in the surface greater than 1/2" wide.	\$ 78	1	
Portland Avenue Park	Exterior Access Route	322653	The accessible route has areas of vertical level changes in excess of 1/4" that are not beveled or ramped.	\$ 79	1	
Portland Avenue Park	Exterior Access Route	322700	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 2,576	1	
Portland Avenue Park	Exterior Access Route	322672	WASHINGTON: The clear width of the exterior accessible route is less than 44".	\$ 107	1	

PHASE FOUR						
PARK	CATEGORY	BARRIER ID	BARRIER DESCRIPTION	ESTIMATE	PRIORITY	
Portland Avenue Park	Exterior Access Route	322693	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 1,000	1	
Portland Avenue Park	Football Field	322695	A ramp is required but not provided.	\$ 6,620	1	
Portland Avenue Park	Exterior Access Route	322665	The accessible route has gaps in the surface greater than 1/2" wide.	\$ 454	1	
Portland Avenue Park	Exterior Access Route	322654	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 297	1	
Portland Avenue Park	Exterior Access Route	322655	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 3,567	1	
Portland Avenue Park	Exterior Access Route	322656	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 1,625	1	
Portland Avenue Park	Exterior Access Route	322657	The accessible route has gaps in the surface greater than 1/2" wide.	\$ 21	1	
Portland Avenue Park	Exterior Access Route	322658	The accessible route has gaps in the surface greater than 1/2" wide.	\$ 21	1	
Portland Avenue Park	Exterior Access Route	322679	The accessible route has gaps in the surface greater than 1/2" wide.	\$ 21	1	
Portland Avenue Park	Playground	322673	The ground surface has not been inspected and maintained regularly.	\$ 1,900	2	
Portland Avenue Park	Baseball/Softball Field	322646	The lawn seating areas, where fixed seating is not provided, do not connect to an accessible route.	\$ 2,185	2	
Portland Avenue Park	Exterior Access Route	322667	An accessible passenger loading/unloading zone is not provided where a loading/unloading area is present.	\$ 1,500	1	
Portland Avenue Park	Accessible Parking	322660	WASHINGTON: The standard access aisle slope is not compliant.	\$ 5,000	1	
Portland Avenue Park	Accessible Parking	322908	WASHINGTON: The car access aisle markings are not compliant.	\$ 420	1	
Portland Avenue Park	Accessible Parking	322641	WASHINGTON: The slope of the car stall and access aisle is not compliant.	\$ 11,300	1	
Portland Avenue Park	Accessible Parking	322643	WASHINGTON: The slope of the car stall is not compliant.	\$ 11,300	1	
Portland Avenue Park	Accessible Parking	328639	WASHINGTON: A van stall, access aisle, and signage are not provided.	\$ 11,300	1	
Portland Avenue Park	Basketball Court	322692	BEST PRACTICE: An adjacent clear space is not provided at the bench. The restroom circulation path is not free of objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.	\$ 215	2	
Portland Avenue Park	Restroom	328697	The restroom circulation path is not free of objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.	\$ 500	2	
Portland Avenue Park	Restroom	328704	The restroom circulation path is not free of objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.	\$ 500	2	
Portland Avenue Park	Restroom	328696	The side grab bar at the water closet is not compliant.	\$ 355	3	
Portland Avenue Park	Restroom	328698	The water closet in a single user / unisex restroom does not have the required clearance.	\$ 1,368	3	
Portland Avenue Park	Restroom	328701	The side grab bar at the water closet is not compliant.	\$ 355	3	
Portland Avenue Park	Restroom	328702	The rear grab bar at the water closet is not compliant.	\$ 355	3	
Portland Avenue Park	Restroom	328703	The water closet in a single user / unisex restroom does not have the required clearance.	\$ 1,368	3	
Portland Avenue Park	Restroom	322651	The pull side of the accessible door does not have the required maneuvering clearances, if the door has a closer.	\$ 2,500	3	
Portland Avenue Park	Basketball Court	322647	WASHINGTON: An exterior accessible route is not provided.	\$ 896	1	
Portland Avenue Park	Basketball Court	322885	WASHINGTON: An exterior accessible route is not provided.	\$ 1,529	1	
Portland Avenue Park	Playground	322650	A means of support is not provided at the transfer platform and/or transfer steps.	\$ 165	2	
Portland Avenue Park	Playground	322677	A means of support is not provided at the transfer platform and/or transfer steps.	\$ 165	2	
SERA Sports Complex	Restroom	326055	The provided signage does not have character contrast.	\$ 100	3	
SERA Sports Complex	Restroom	326061	The force required to open the interior, hinged, non-fire door is more than 5 pounds.	\$ 366	3	
SERA Sports Complex	Restroom	326065	Pipes are not insulated.	\$ 65	3	
SERA Sports Complex	Restroom	326066	Pipes are not insulated. The hardware at the accessible door (including sliding doors - both sides) requires tight grasping, pinching or twisting of the wrist to operate OR is mounted below 34" or above 48".	\$ 65	3	
SERA Sports Complex	Restroom	326067	The hardware at the accessible door (including sliding doors - both sides) requires tight grasping, pinching or twisting of the wrist to operate OR is mounted below 34" or above 48".	\$ 300	1	
SERA Sports Complex	Restroom	326075	The coat hook is not within an allowable reach range.	\$ 115	3	
SERA Sports Complex	Exterior Access Route	326099	The accessible route has greater than 1:20 (5%) running slope and 1:50 (2%) cross slope.	\$ 3,448	1	
SERA Sports Complex	Baseball/Softball Field	326101	The wheelchair space is not the minimum required dimensions at the bleacher seating for the baseball field.	\$ 237	2	
SERA Sports Complex	Exterior Access Route	326146	A curb ramp is not provided where the accessible route crosses a curb. The hardware at the accessible door (including sliding doors - both sides) requires tight grasping, pinching or twisting of the wrist to operate OR is mounted below 34" or above 48".	\$ 8,750	1	
SERA Sports Complex	Interior Access Route	326070	The hardware at the accessible door (including sliding doors - both sides) requires tight grasping, pinching or twisting of the wrist to operate OR is mounted below 34" or above 48".	\$ 300	1	
SERA Sports Complex	Common Areas	326057	The minimum number of drinking fountains is not provided. If the minimum number is provided, two levels or a hi-lo are not provided. If more than 2 are provided, less than 50% are high or less than 50% are low.	\$ 5,439	4	
SERA Sports Complex	Common Areas	326058	The minimum number and types of drinking fountains are not provided.	\$ 8,000	4	
SERA Sports Complex	Common Areas	326059	The minimum number and types of drinking fountains are not provided.	\$ 8,000	4	
SERA Sports Complex	Sports Facilities	326104	The gate hardware is not compliant.	\$ 200	1	
SERA Sports Complex	Exterior Access Route	326147	The gate maneuvering clearance area is not compliant.	\$ 568	1	
SERA Sports Complex	Exterior Access Route	326148	The gate hardware is not compliant.	\$ 200	1	
SERA Sports Complex	Exterior Access Route	326118	The gate hardware is not compliant.	\$ 200	1	
SERA Sports Complex	Accessible Parking	357216	WASHINGTON: A car stall slope is not compliant.	\$ 6,300	1	
SERA Sports Complex	Accessible Parking	326106	WASHINGTON: The car stall slope is not compliant.	\$ 6,300	1	
SERA Sports Complex	Accessible Parking	326107	WASHINGTON: A car access aisle slope is not compliant.	\$ 5,000	1	
SERA Sports Complex	Accessible Parking	357215	WASHINGTON: The car stall slope is not compliant.	\$ 6,300	1	
SERA Sports Complex	Accessible Parking	326109	WASHINGTON: A car stall slope is not compliant. The car stall signage is not compliant.	\$ 6,580	1	
SERA Sports Complex	Accessible Parking	326110	WASHINGTON: The car access aisle slope is not compliant.	\$ 5,000	1	
SERA Sports Complex	Accessible Parking	326111	WASHINGTON: The car stall slope is not compliant. Stall signage is not compliant.	\$ 6,580	1	
SERA Sports Complex	Accessible Parking	326126	WASHINGTON: The car stall slope and markings are not compliant.	\$ 6,300	1	
SERA Sports Complex	Accessible Parking	326127	WASHINGTON: The car stall slope and markings are not compliant. WASHINGTON: A car stall, access aisle, and signage are not provided and the slope and/or ground surface is/are not compliant.	\$ 6,300	1	
SERA Sports Complex	Accessible Parking	326128	WASHINGTON: A car stall, access aisle, and signage are not provided and the slope and/or ground surface is/are not compliant.	\$ -	1	
SERA Sports Complex	Accessible Parking	326129	WASHINGTON: The car stall slope and marking are not compliant.	\$ 6,300	1	
SERA Sports Complex	Accessible Parking	357211	WASHINGTON: The van stall and access aisle slopes are not compliant. WASHINGTON: A van stall, access aisle, and signage are not provided and the slope and/or ground surface is/are not compliant.	\$ 6,300	1	
SERA Sports Complex	Accessible Parking	326105	WASHINGTON: A van stall, access aisle, and signage are not provided and the slope and/or ground surface is/are not compliant.	\$ 5,000	1	
SERA Sports Complex	Accessible Parking	326124	WASHINGTON: The slope of the van stall and markings are not compliant. The stall signage is not compliant.	\$ 11,300	1	
SERA Sports Complex	Accessible Parking	326125	WASHINGTON: The van access aisle and signage are not compliant.	\$ 5,280	1	
SERA Sports Complex	Exterior Access Route	326097	The accessible route has gaps in the surface greater than 1/2" wide.	\$ 26	1	
SERA Sports Complex	Exterior Access Route	326098	The accessible route has gaps in the surface greater than 1/2" wide.	\$ 118	1	
SERA Sports Complex	Exterior Access Route	326093	The accessible route has gaps in the surface greater than 1/2" wide.	\$ 237	1	
SERA Sports Complex	Exterior Access Route	326096	The accessible route has gaps in the surface greater than 1/2" wide.	\$ 237	1	

PHASE FOUR						
PARK	CATEGORY	BARRIER ID	BARRIER DESCRIPTION	ESTIMATE	PRIORITY	
SERA Sports Complex	Picnic Area	326094	A compliant picnic table is not provided.	\$ 1,625	4	
SERA Sports Complex	Baseball/Softball Field	326052	The wheelchair space is not the minimum required dimensions at the team seating for the baseball/softball field.	\$ 237	2	
SERA Sports Complex	Restroom	326073	The restroom circulation path is not free of objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.	\$ 100	2	
SERA Sports Complex	Restroom	326087	The restroom circulation path is not free of objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.	\$ 100	2	
SERA Sports Complex	Exterior Access Route	327680	Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the accessible route.	\$ 728	1	
SERA Sports Complex	Restroom	326082	The pull side of the accessible door does not have the required maneuvering clearances.	\$ 1,250	1	
SERA Sports Complex	Restroom	326081	The pull side of the accessible door does not have the required maneuvering clearances.	\$ 1,250	1	
SERA Sports Complex	Restroom	326167	The hardware at the wheelchair stall door is not compliant.	\$ 300	3	
SERA Sports Complex	Restroom	326068	The door does not have 80" minimum head clearance from finish floor, excluding door closer hinged bar, which can be 78" minimum.	\$ 2,600	1	
SERA Sports Complex	Restroom	326072	The lavatory faucet hardware is not compliant.	\$ 555	3	
SERA Sports Complex	Restroom	326088	The lavatory faucet hardware is not compliant.	\$ 555	3	
SERA Sports Complex	Restroom	326084	The side grab bar at the water closet is not compliant.	\$ 355	3	
SERA Sports Complex	Restroom	326079	The side grab bar at the water closet is not compliant.	\$ 355	3	
SERA Sports Complex	Restroom	326171	The side grab bar at the water closet is not compliant.	\$ 355	3	
SERA Sports Complex	Restroom	326085	The height of the water closet is not 17" minimum to 19" maximum above finished floor.	\$ 630	3	
SERA Sports Complex	Restroom	326076	The height of the water closet is not 17" minimum to 19" maximum above finished floor.	\$ 630	3	
SERA Sports Complex	Restroom	326077	The centerline of the toilet in the wheelchair stall is not 16" minimum to 18" maximum from the sidewall.	\$ 630	3	
SERA Sports Complex	Restroom	326078	The flush control is located on the closed side and is within 12" above the rear grab bar.	\$ 300	3	
SERA Sports Complex	Restroom	326091	The pull side of the accessible door does not have the required maneuvering clearances.	\$ 1,250	3	
SERA Sports Complex	Restroom	326074	The hardware at the wheelchair stall door is not compliant.	\$ 300	3	
SERA Sports Complex	Restroom	326090	The pull side of the accessible door does not have the required maneuvering clearances.	\$ 1,250	3	
SERA Sports Complex	Restroom	327681	The wheelchair stall door is not self closing.	\$ 300	3	
SERA Sports Complex	Restroom	326169	The hardware at the wheelchair stall door is not compliant.	\$ 300	3	
SERA Sports Complex	Restroom	326080	The wheelchair stall with a floor mounted water closet, in a multi-stall restroom, is less than 60" wide and 59" deep.	\$ 1,710	3	
SERA Sports Complex	Restroom	326089	The urinal dimensions are not compliant.	\$ 935	3	
SERA Sports Complex	Restroom	357212	The centerline of the toilet in the wheelchair stall is not 16" minimum to 18" maximum from the sidewall. The service counter height is greater than 36" and/or the counter length is less than 36", where a parallel approach is present.	\$ 787	3	
SERA Sports Complex	Sports Facilities	326102	The service counter height is greater than 36" and/or the counter length is less than 36", where a parallel approach is present.	\$ 1,804	2	
SERA Sports Complex	Sports Facilities	326095	The service counter height is greater than 36" and/or the counter length is less than 36", where a parallel approach is present.	\$ 1,804	2	
SERA Sports Complex	Restroom	394738	ANSI A117.1-2009 : A vertical side grab bar is not present in the wheelchair stall.	\$ 443	3	
South Park	Amenity not evaluated	324358	The amenity is under construction and cannot be evaluated.	\$ -	0	
South Park	Amenity not evaluated	324336	The amenity cannot be accessed and, therefore, cannot be evaluated.	\$ -	0	
South Park	Amenity not evaluated	324335	The amenity cannot be accessed and, therefore, cannot be evaluated.	\$ -	0	
South Park	Site Furnishings	324343	BEST PRACTICE: An adjacent clear space is not provided at the bench.	\$ 237	2	
South Park	Site Furnishings	324344	BEST PRACTICE: An adjacent clear space is not provided at the bench.	\$ 237	2	
South Park	Site Furnishings	324345	BEST PRACTICE: An adjacent clear space is not provided at the bench.	\$ 237	2	
South Park	Site Furnishings	324383	BEST PRACTICE: An adjacent clear space is not provided at the bench.	\$ 52	2	
South Park	Exterior Access Route	324348	WASHINGTON: The slope of the curb ramp run is not compliant.	\$ 1,750	1	
South Park	Restroom	324337	The pull side of the accessible door does not have the required maneuvering clearance.	\$ 1,250	1	
South Park	Site Furnishings	334937	The minimum number and types of drinking fountains are not provided.	\$ 8,000	4	
South Park	Exterior Access Route	324322	The accessible route has gaps in the surface greater than 1/2" wide.	\$ 2,389	1	
South Park	Exterior Access Route	324333	WASHINGTON: An exterior accessible route is not provided.	\$ 1,344	1	
South Park	Exterior Access Route	324341	WASHINGTON: An exterior accessible route is not provided.	\$ 1,612	1	
South Park	Exterior Access Route	324379	The bus stop boarding and alighting area is not compliant.	\$ 792	1	
South Park	Exterior Access Route	342744	At least one accessible route does not connect the accessible building and accessible spaces and accessible elements that are on the same site.	\$ -	1	
South Park	Exterior Access Route	324338	WASHINGTON: The clear width of the exterior accessible route is less than 44".	\$ 237	1	
South Park	Common Area	324380	The amenity is not located on an accessible route.	\$ 1,109	3	
South Park	Exterior Access Route	324328	The accessible route has areas of vertical level changes in excess of 1/4" that are not beveled or ramped.	\$ 99	1	
South Park	Exterior Access Route	324329	The accessible route has gaps in the surface greater than 1/2" wide.	\$ 19	1	
South Park	Exterior Access Route	324330	The accessible route has gaps in the surface greater than 1/2" wide.	\$ 79	1	
South Park	Exterior Access Route	324331	The accessible route has greater than 1:20 (5%) running slope and 1:50 (2%) cross slope.	\$ 198	1	
South Park	Exterior Access Route	324378	The accessible route has gaps in the surface greater than 1/2" wide.	\$ 1,357	1	
South Park	Exterior Access Route	324377	The accessible route has cross slopes greater than 1:50 (2%).	\$ 495	1	
South Park	Exterior Access Route	324346	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 198	1	
South Park	Common Area	324382	The amenity is not located on an accessible route.	\$ 158	3	
South Park	Common Area	324385	The amenity is not located on an accessible route.	\$ 200	3	
South Park	Baseball/Softball Field	324334	The lawn seating and exterior overflow seating areas, where fixed seating is not provided, do not connect to an accessible route.	\$ 710	2	
South Park	Accessible Parking	324326	Accessible parking spaces are not located closest to the building entrance.	\$ 1,260	1	
South Park	Accessible Parking	324324	WASHINGTON: A car stall, access aisle, and signage are not compliant. The slope of the stall and access aisle is not compliant.	\$ 11,300	1	
South Park	Accessible Parking	324325	WASHINGTON: A car stall, access aisle, and signage are not compliant. The slope of the stall is not compliant.	\$ 11,300	1	
South Park	Accessible Parking	324323	WASHINGTON: A van stall, access aisle, and signage are not compliant. The slope of the stall is not compliant.	\$ 11,300	1	
South Park	Exterior Access Route	324339	Protruding objects in the 27" to 80" range above ground protrude more than 4" into the circulation path.	\$ 728	1	
South Park	Trail	324357	BEST PRACTICE: Openings and gaps in the trail surface are wider than 0.5".	\$ 60	4	
South Park	Exterior Access Route	324349	BEST PRACTICE: The accessible trail or trail segment does not have signage with trail details.	\$ 280	4	

PHASE FOUR						
PARK	CATEGORY	BARRIER ID	BARRIER DESCRIPTION	ESTIMATE	PRIORITY	
South Park	Exterior Access Route	324350	BEST PRACTICE: The accessible trail or trail segment does not have signage with trail details.	\$ 280	4	
South Park	Trail	324354	BEST PRACTICE: Openings and gaps in the trail surface are wider than 0.5".	\$ 10	4	
South Park	Trail	324365	BEST PRACTICE: Openings and gaps in the trail surface are wider than 0.5".	\$ 10	4	
South Park	Trail	324362	BEST PRACTICE: Cross slope of asphalt surfaced trail is greater than 1:48 or 2.08%.	\$ 7,135	4	
South Park	Trail	324360	BEST PRACTICE: Cross slope of asphalt surfaced trail is greater than 1:48 or 2.08%.	\$ 8,720	4	
South Park	Trail	324375	BEST PRACTICE: Cross slope of asphalt surfaced trail is greater than 1:48 or 2.08%.	\$ 5,153	4	
South Park	Trail	324366	BEST PRACTICE: Cross slope of asphalt surfaced trail is greater than 1:48 or 2.08%.	\$ 1,189	4	
South Park	Trail	324387	BEST PRACTICE: Cross slope of asphalt surfaced trail is greater than 1:48 or 2.08%.	\$ 1,585	4	
South Park	Trail	324388	BEST PRACTICE: Cross slope of asphalt surfaced trail is greater than 1:48 or 2.08%.	\$ 21,802	4	
South Park	Trail	324389	BEST PRACTICE: Cross slope of asphalt surfaced trail is greater than 1:48 or 2.08%.	\$ 9,910	4	
South Park	Trail	324390	BEST PRACTICE: Cross slope of asphalt surfaced trail is greater than 1:48 or 2.08%.	\$ 12,684	4	
South Park	Trail	324391	Cross slope of asphalt surfaced trail is greater than 1:48 or 2.08%.	\$ 10,260	4	
South Park	Trail	324392	BEST PRACTICE: Cross slope of asphalt surfaced trail is greater than 1:48 or 2.08%.	\$ 10,306	4	
South Park	Trail	324393	BEST PRACTICE: Cross slope of asphalt surfaced trail is greater than 1:48 or 2.08%.	\$ 11,892	4	
South Park	Trail	324394	BEST PRACTICE: Cross slope of asphalt surfaced trail is greater than 1:48 or 2.08%.	\$ 38,054	4	
South Park	Trail	324395	BEST PRACTICE: Cross slope of asphalt surfaced trail is greater than 1:48 or 2.08%.	\$ 10,702	4	
South Park	Trail	324396	BEST PRACTICE: Cross slope of asphalt surfaced trail is greater than 1:48 or 2.08%.	\$ 11,892	4	
South Park	Trail	324397	BEST PRACTICE: Cross slope of asphalt surfaced trail is greater than 1:48 or 2.08%.	\$ 15,856	4	
South Park	Trail	324398	BEST PRACTICE: Cross slope of asphalt surfaced trail is greater than 1:48 or 2.08%.	\$ 15,856	4	
South Park	Trail	324399	BEST PRACTICE: Cross slope of asphalt surfaced trail is greater than 1:48 or 2.08%.	\$ 396	4	
South Park	Trail	324400	BEST PRACTICE: Cross slope of asphalt surfaced trail is greater than 1:48 or 2.08%.	\$ 4,756	4	
South Park	Trail	324367	BEST PRACTICE: Cross slope of asphalt surfaced trail is greater than 1:48 or 2.08%.	\$ 6,342	4	
South Park	Trail	324369	BEST PRACTICE: Cross slope of asphalt surfaced trail is greater than 1:48 or 2.08%.	\$ 12,684	4	
South Park	Trail	324370	BEST PRACTICE: Cross slope of asphalt surfaced trail is greater than 1:48 or 2.08%.	\$ 8,720	4	
South Park	Trail	324371	BEST PRACTICE: Cross slope of asphalt surfaced trail is greater than 1:48 or 2.08%.	\$ 5,153	4	
South Park	Trail	324372	BEST PRACTICE: Cross slope of asphalt surfaced trail is greater than 1:48 or 2.08%.	\$ 5,549	4	
South Park	Trail	324373	BEST PRACTICE: Cross slope of asphalt surfaced trail is greater than 1:48 or 2.08%.	\$ 5,946	4	
South Park	Trail	324374	BEST PRACTICE: Cross slope of asphalt surfaced trail is greater than 1:48 or 2.08%.	\$ 3,171	4	
South Park	Trail	324361	BEST PRACTICE: Cross slope of asphalt surfaced trail is greater than 1:48 or 2.08%.	\$ 396	4	
South Park	Trail	324355	BEST PRACTICE: Cross slope of asphalt surfaced trail is greater than 1:48 or 2.08%.	\$ 12,684	4	
South Park	Trail	324363	BEST PRACTICE: Cross slope of asphalt surfaced trail is greater than 1:48 or 2.08%.	\$ 2,378	4	
South Park	Trail	324364	BEST PRACTICE: Cross slope of asphalt surfaced trail is greater than 1:48 or 2.08%.	\$ 1,189	4	
South Park	Trail	324352	BEST PRACTICE: Cross slope of asphalt surfaced trail is greater than 1:48 or 2.08%.	\$ 396	4	
South Park	Site Furnishings	324376	A trash receptacle is not located on an accessible route and within reach range.	\$ 115	2	
South Park	Site Furnishings	324381	A trash receptacle is not located on an accessible route and within reach range.	\$ 115	2	
Stewart Heights Park & Pool	Locker and Dressing Rooms	327409	The locker room does not have a compliant bench.	\$ 125	3	
Stewart Heights Park & Pool	Locker and Dressing Rooms	327432	The locker room does not have a compliant bench.	\$ 789	3	
Stewart Heights Park & Pool	Locker and Dressing Rooms	327449	The locker room does not have a compliant bench.	\$ 789	3	
Stewart Heights Park & Pool	Entrance to Building	327461	The threshold at the accessible door is greater than 1/2" in height.	\$ 179	1	
Stewart Heights Park & Pool	Amenity not evaluated	327487	The amenity cannot be accessed and, therefore, cannot be evaluated.	\$ -	0	
Stewart Heights Park & Pool	Site Furnishings	327402	BEST PRACTICE: An adjacent clear space is not provided at the bench.	\$ 52	2	
Stewart Heights Park & Pool	Site Furnishings	327389	BEST PRACTICE: An adjacent clear space is not provided at the bench.	\$ 52	2	
Stewart Heights Park & Pool	Site Furnishings	327367	BEST PRACTICE: An adjacent clear space is not provided at the bench.	\$ 52	2	
Stewart Heights Park & Pool	Entrance to Building	327505	The threshold at the accessible door is greater than 1/2" in height.	\$ 179	1	
Stewart Heights Park & Pool	Entrance to Building	327508	The threshold at the accessible door is greater than 1/2" in height.	\$ 179	1	
Stewart Heights Park & Pool	Entrance to Building	327458	The threshold at the accessible door is greater than 1/2" in height.	\$ 179	1	
Stewart Heights Park & Pool	Entrance to Building	327467	The threshold at the accessible door is greater than 1/2" in height.	\$ 179	1	
Stewart Heights Park & Pool	Entrance to Building	327478	The threshold at the accessible door is greater than 1/2" in height.	\$ 179	1	
Stewart Heights Park & Pool	Entrance to Building	327481	The threshold at the accessible door is greater than 1/2" in height.	\$ 179	1	
Stewart Heights Park & Pool	Entrance to Building	327484	The threshold at the accessible door is greater than 1/2" in height.	\$ 179	1	
Stewart Heights Park & Pool	Interior Access Route	327452	The height of controls throughout the common area are not compliant.	\$ 500	1	
Stewart Heights Park & Pool	Restroom	327430	The height of controls are not compliant.	\$ 200	3	
Stewart Heights Park & Pool	Interior Access Route	327477	The height of controls throughout the common area are not compliant.	\$ 500	1	
Stewart Heights Park & Pool	Interior Access Route	327448	The pull side of the accessible door does not have the required maneuvering clearances.	\$ 250	1	
Stewart Heights Park & Pool	Exterior Access Route	327497	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 4,776	1	
Stewart Heights Park & Pool	Exterior Access Route	327491	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 21,029	1	
Stewart Heights Park & Pool	Exterior Access Route	327496	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 6,540	1	
Stewart Heights Park & Pool	Exterior Access Route	327374	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 4,875	1	
Stewart Heights Park & Pool	Exterior Access Route	327396	The accessible route has gaps in the surface greater than 1/2" wide.	\$ 158	1	
Stewart Heights Park & Pool	Exterior Access Route	327397	The accessible route has gaps in the surface greater than 1/2" wide.	\$ 71	1	
Stewart Heights Park & Pool	Exterior Access Route	327401	WASHINGTON: An exterior accessible route is not provided.	\$ 1,317	1	
Stewart Heights Park & Pool	Exterior Access Route	327337	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 257	1	
Stewart Heights Park & Pool	Exterior Access Route	327338	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 2,299	1	
Stewart Heights Park & Pool	Exterior Access Route	327341	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 1,446	1	
Stewart Heights Park & Pool	Exterior Access Route	327342	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 10,841	1	
Stewart Heights Park & Pool	Exterior Access Route	327343	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 1,922	1	
Stewart Heights Park & Pool	Exterior Access Route	327339	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 832	1	
Stewart Heights Park & Pool	Exterior Access Route	327340	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 4,023	1	
Stewart Heights Park & Pool	Exterior Access Route	327377	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 2,120	1	
Stewart Heights Park & Pool	Exterior Access Route	327498	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 6,600	1	
Stewart Heights Park & Pool	Exterior Access Route	327499	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 1,882	1	
Stewart Heights Park & Pool	Exterior Access Route	327500	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 2,219	1	
Stewart Heights Park & Pool	Exterior Access Route	327379	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 3,468	1	
Stewart Heights Park & Pool	Exterior Access Route	327380	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 7,454	1	
Stewart Heights Park & Pool	Exterior Access Route	327381	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 4,855	1	
Stewart Heights Park & Pool	Exterior Access Route	327382	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 4,281	1	

PHASE FOUR						
PARK	CATEGORY	BARRIER ID	BARRIER DESCRIPTION	ESTIMATE	PRIORITY	
Stewart Heights Park & Pool	Exterior Access Route	327383	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 1,050	1	
Stewart Heights Park & Pool	Exterior Access Route	327384	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 1,664	1	
Stewart Heights Park & Pool	Exterior Access Route	327385	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 3,151	1	
Stewart Heights Park & Pool	Exterior Access Route	327387	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 4,796	1	
Stewart Heights Park & Pool	Exterior Access Route	327394	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 1,823	1	
Stewart Heights Park & Pool	Exterior Access Route	327501	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 71,352	1	
Stewart Heights Park & Pool	Exterior Access Route	327511	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 4,499	1	
Stewart Heights Park & Pool	Exterior Access Route	327512	The accessible route has gaps in the surface greater than 1/2" wide.	\$ 125	1	
Stewart Heights Park & Pool	Exterior Access Route	327515	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 1,466	1	
Stewart Heights Park & Pool	Exterior Access Route	327516	The accessible route has gaps in the surface greater than 1/2" wide.	\$ 71	1	
Stewart Heights Park & Pool	Exterior Access Route	327360	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 4,558	1	
Stewart Heights Park & Pool	Exterior Access Route	327361	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 891	1	
Stewart Heights Park & Pool	Exterior Access Route	327362	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 2,081	1	
Stewart Heights Park & Pool	Exterior Access Route	327363	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 2,873	1	
Stewart Heights Park & Pool	Exterior Access Route	327364	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 1,882	1	
Stewart Heights Park & Pool	Exterior Access Route	327365	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 2,180	1	
Stewart Heights Park & Pool	Exterior Access Route	327366	WASHINGTON: An exterior accessible route is not provided.	\$ 761	1	
Stewart Heights Park & Pool	Exterior Access Route	327370	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 14,666	1	
Stewart Heights Park & Pool	Exterior Access Route	327371	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 991	1	
Stewart Heights Park & Pool	Exterior Access Route	327494	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 23,288	1	
Stewart Heights Park & Pool	Exterior Access Route	327495	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 23,288	1	
Stewart Heights Park & Pool	Exterior Access Route	327513	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 5,212	1	
Stewart Heights Park & Pool	Exterior Access Route	327514	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 7,432	1	
Stewart Heights Park & Pool	Exterior Access Route	327517	The accessible route has gaps in the surface greater than 1/2" wide.	\$ 143	1	
Stewart Heights Park & Pool	Exterior Access Route	327492	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 20,196	1	
Stewart Heights Park & Pool	Exterior Access Route	327493	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 24,775	1	
Stewart Heights Park & Pool	Exterior Access Route	327510	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 13,041	1	
Stewart Heights Park & Pool	Playground	327392	The ground surface has not been inspected and maintained regularly.	\$ 1,875	2	
Stewart Heights Park & Pool	Interior Access Route	327431	The interior accessible route has non-compliant slopes.	\$ 750	1	
Stewart Heights Park & Pool	Locker and Dressing Rooms	327502	The locker room does not have accessible lockers.	\$ 1,320	3	
Stewart Heights Park & Pool	Locker and Dressing Rooms	327416	The locker room does not have a compliant bench.	\$ 125	3	
Stewart Heights Park & Pool	Employee Work Areas	327450	The locker rooms are not accessible.	\$ 330	1	
Stewart Heights Park & Pool	Accessible Parking	327318	The access aisle slope is greater than 1:50 (2%).	\$ 5,000	1	
Stewart Heights Park & Pool	Accessible Parking	327324	The access aisle slope is greater than 1:50 (2%).	\$ 5,000	1	
Stewart Heights Park & Pool	Accessible Parking	327317	The slope of the parking space is greater than 1:50 (2%).	\$ 6,300	1	
Stewart Heights Park & Pool	Accessible Parking	327319	The slope of the parking space is greater than 1:50 (2%).	\$ 6,300	1	
Stewart Heights Park & Pool	Accessible Parking	327321	The slope of the parking space is greater than 1:50 (2%).	\$ 6,300	1	
Stewart Heights Park & Pool	Accessible Parking	327322	The access aisle slope is greater than 1:50 (2%).	\$ 5,000	1	
Stewart Heights Park & Pool	Accessible Parking	327323	The slope of the parking space is greater than 1:50 (2%).	\$ 6,300	1	
Stewart Heights Park & Pool	Accessible Parking	327358	The slope of the parking space is greater than 1:50 (2%).	\$ 6,300	1	
Stewart Heights Park & Pool	Accessible Parking	327359	The access aisle slope is greater than 1:50 (2%).	\$ 5,000	1	
Stewart Heights Park & Pool	Accessible Parking	327327	The parking space slope is greater than 1:50 (2%).	\$ 6,300	1	
Stewart Heights Park & Pool	Accessible Parking	327328	The access aisle slope is greater than 1:50 (2%).	\$ 5,000	1	
Stewart Heights Park & Pool	Accessible Parking	327333	The van access aisle has openings in the ground surface greater than 1/2" wide.	\$ 160	1	
Stewart Heights Park & Pool	Accessible Parking	327334	The access aisle slope is greater than 1:50 (2%).	\$ 5,000	1	
Stewart Heights Park & Pool	Site Furnishings	327372	The picnic table does not allow a clear space for forward wheelchair approach with knee and toe clearance.	\$ 1,300	2	
Stewart Heights Park & Pool	Site Furnishings	327373	BEST PRACTICE: The table does not have minimum 36" wide clear ground space on all usable sides of the table.	\$ 629	4	
Stewart Heights Park & Pool	Site Furnishings	327375	The picnic table does not allow a clear space for forward wheelchair approach with knee and toe clearance.	\$ 1,300	2	
Stewart Heights Park & Pool	Site Furnishings	327376	BEST PRACTICE: The table does not have minimum 36" wide clear ground space on all usable sides of the table.	\$ 629	4	
Stewart Heights Park & Pool	Site Furnishings	327490	The picnic table does not allow a clear space for forward wheelchair approach with knee and toe clearance.	\$ 1,300	2	
Stewart Heights Park & Pool	Site Furnishings	327386	The picnic table does not allow a clear space for forward wheelchair approach with knee and toe clearance.	\$ 1,300	2	
Stewart Heights Park & Pool	Site Furnishings	327388	The picnic table does not allow a clear space for forward wheelchair approach with knee and toe clearance.	\$ 1,300	2	
Stewart Heights Park & Pool	Site Furnishings	327368	The picnic table does not allow a clear space for forward wheelchair approach with knee and toe clearance.	\$ 1,300	2	
Stewart Heights Park & Pool	Site Furnishings	327369	BEST PRACTICE: The table does not have minimum 36" wide clear ground space on all usable sides of the table.	\$ 629	4	
Stewart Heights Park & Pool	Site Furnishings	327489	The picnic table does not allow a clear space for forward wheelchair approach with knee and toe clearance.	\$ 1,300	2	
Stewart Heights Park & Pool	Site Furnishings	327398	The picnic table does not allow a clear space for forward wheelchair approach with knee and toe clearance.	\$ 1,300	2	
Stewart Heights Park & Pool	Site Furnishings	327399	BEST PRACTICE: The table does not have minimum 36" wide clear ground space on all usable sides of the table.	\$ 629	4	
Stewart Heights Park & Pool	Swimming Pools	327486	A clear deck space on the side of the seat opposite the water is not provided.	\$ 1,789	1	
Stewart Heights Park & Pool	Exterior Access Route	327330	Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the accessible route.	\$ 2,000	1	
Stewart Heights Park & Pool	Exterior Access Route	327446	Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the accessible route.	\$ 728	1	
Stewart Heights Park & Pool	Restroom	327420	The restroom circulation path is not free of objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.	\$ 500	2	
Stewart Heights Park & Pool	Exterior Access Route	327507	Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the accessible route.	\$ 250	1	

PHASE FOUR					
PARK	CATEGORY	BARRIER ID	BARRIER DESCRIPTION	ESTIMATE	PRIORITY
Stewart Heights Park & Pool	Restroom	327406	The restroom circulation path is not free of objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.	\$ 500	2
Stewart Heights Park & Pool	Interior Access Route	327447	Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the interior accessible route.	\$ 728	1
Stewart Heights Park & Pool	Interior Access Route	327462	Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the interior accessible route.	\$ 1,456	1
Stewart Heights Park & Pool	Interior Access Route	327472	Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the interior accessible route.	\$ 250	1
Stewart Heights Park & Pool	Restroom	327483	The restroom circulation path is not free of objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.	\$ 500	2
Stewart Heights Park & Pool	Restroom	327350	The restroom circulation path is not free of objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.	\$ 250	2
Stewart Heights Park & Pool	Restroom	327353	The restroom circulation path is not free of objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.	\$ 250	2
Stewart Heights Park & Pool	Restroom	327414	The restroom circulation path is not free of objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.	\$ 1,000	2
Stewart Heights Park & Pool	Restroom	327425	The push side of the door does not have the required maneuvering clearances.	\$ 1,250	3
Stewart Heights Park & Pool	Restroom	327429	WASHINGTON: The roll-in shower stall is not compliant.	\$ 4,750	3
Stewart Heights Park & Pool	Restroom	327419	The shower spray unit is not compliant.	\$ 650	3
Stewart Heights Park & Pool	Restroom	327404	The shower spray unit is not compliant.	\$ 650	3
Stewart Heights Park & Pool	Restroom	327405	The shower does not have sidewalls or grab bars.	\$ 3,000	3
Stewart Heights Park & Pool	Restroom	327427	The shower spray unit is not compliant.	\$ 650	3
Stewart Heights Park & Pool	Restroom	327428	The shower does not have sidewalls or grab bars.	\$ 3,000	3
Stewart Heights Park & Pool	Restroom	327412	The shower spray unit is not compliant.	\$ 650	3
Stewart Heights Park & Pool	Restroom	327413	The shower does not have sidewalls or grab bars.	\$ 3,000	3
Stewart Heights Park & Pool	Restroom	327408	WASHINGTON: The toilet paper dispenser location is not compliant.	\$ 293	3
Stewart Heights Park & Pool	Restroom	327426	The centerline of the toilet in the wheelchair stall is not 16" minimum to 18" maximum from the sidewall.	\$ 630	3
Stewart Heights Park & Pool	Restroom	327485	The water closet in a single user / unisex restroom does not have the required clearance.	\$ 1,368	3
Stewart Heights Park & Pool	Trail	327345	BEST PRACTICE: The trail is inaccessible but has potential to be made accessible.	\$ -	4
Stewart Heights Park & Pool	Trail	327346	BEST PRACTICE: The trail is inaccessible but has potential to be made accessible.	\$ -	4
Stewart Heights Park & Pool	Trail	327344	BEST PRACTICE: The inaccessible trail or trail segment does not have signage with trail details.	\$ 350	4
Stewart Heights Park & Pool	Trail	327347	BEST PRACTICE: The accessible trail or trail segment does not have signage with trail details.	\$ 280	4
Stewart Heights Park & Pool	Interior Access Route	327471	The sink rim is higher than 34", and does not have knee and toe clearance (does not apply to mop basins, utility sinks, or bar sinks).	\$ 720	2
Stewart Heights Park & Pool	Basketball Court	327403	An accessible route does not directly connect each side of the court outside of play lines.	\$ 1,215	1
Stewart Heights Park & Pool	Exterior Access Route	327488	ADVISORY: The stair treads and edge of top landing do not have visual contrast on the leading edge.	\$ -	1
Swan Creek Park	Trail	323145	BEST PRACTICE: The inaccessible trail or trail segment does not have signage with trail details.	\$ 280	4
Swan Creek Park	Accessible Parking	323148	Accessible car stall markings are fading.	\$ -	1
Swan Creek Park	Accessible Parking	323149	WASHINGTON: The ground surface of the car stall is not compliant.	\$ 10	1
Swan Creek Park	Picnic Shelter	323150	BEST PRACTICE: The table does not have minimum 36" wide clear ground space on all usable sides of the table.	\$ 500	4
Swan Creek Park	Accessible Parking	323151	WASHINGTON: The van access aisle slope is not compliant.	\$ 5,000	1
Swan Creek Park	Amenity not evaluated	323204	The amenity is winterized and cannot be evaluated.	\$ -	0
Swan Creek Park	Amenity not evaluated	323185	The amenity is under winterized conditions and cannot be evaluated.	\$ -	0
Swan Creek Park	Site Furnishings	323178	WASHINGTON: An exterior accessible route is not provided.	\$ 1,982	1
Swan Creek Park	Site Furnishings	323186	BEST PRACTICE: An adjacent clear space is not provided at the bench.	\$ 107	2
Swan Creek Park	Site Furnishings	323187	BEST PRACTICE: An adjacent clear space is not provided at the bench.	\$ 65	2
Swan Creek Park	Exterior Access Route	323203	2009 ANSI A117.1: Where a detectable warning is present, the detectable warning is not compliant. A clear space is not positioned at the lower level drinking fountain for a forward approach and centered on the unit.	\$ 2,560	1
Swan Creek Park	Site Furnishings	323184	WASHINGTON: An exterior accessible route is not provided.	\$ 52	4
Swan Creek Park	Exterior Access Route	323166	WASHINGTON: An exterior accessible route is not provided.	\$ 19	1
Swan Creek Park	Exterior Access Route	323194	WASHINGTON: An exterior accessible route is not provided.	\$ 120	1
Swan Creek Park	Exterior Access Route	323195	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 120	1
Swan Creek Park	Exterior Access Route	323188	The accessible route has gaps in the surface greater than 1/2" wide.	\$ 237	1
Swan Creek Park	Exterior Access Route	323190	WASHINGTON: An exterior accessible route is not provided.	\$ 317	1
Swan Creek Park	Accessible Parking	323167	WASHINGTON: An exterior accessible route is not provided.	\$ 700	1
Swan Creek Park	Exterior Access Route	323152	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 100	1
Swan Creek Park	Exterior Access Route	323153	WASHINGTON: An exterior accessible route is not provided.	\$ 300	1
Swan Creek Park	Exterior Access Route	323183	WASHINGTON: An exterior accessible route is not provided.	\$ 475	1
Swan Creek Park	Picnic Shelter	323169	WASHINGTON: An exterior accessible route is not provided.	\$ 792	1
Swan Creek Park	Exterior Access Route	323200	The accessible route has gaps in the surface greater than 1/2" wide.	\$ 832	1
Swan Creek Park	Picnic Shelter	323201	WASHINGTON: An exterior accessible route is not provided.	\$ 2,378	1
Swan Creek Park	Picnic Shelter	323211	WASHINGTON: An exterior accessible route is not provided.	\$ 262	1
Swan Creek Park	Signage	323213	WASHINGTON: An exterior accessible route is not provided.	\$ 2,378	1
Swan Creek Park	Exterior Access Route	323154	Ground surfaces are not firm, stable and slip resistant.	\$ 50	1
Swan Creek Park	Accessible Parking	323157	Accessible car stall markings do not define the stall width.	\$ -	1
Swan Creek Park	Accessible Parking	323163	WASHINGTON: The van access aisle is not compliant.	\$ 480	1
Swan Creek Park	Accessible Parking	323174	WASHINGTON: The van access aisle is not compliant.	\$ 5,480	1
Swan Creek Park	Accessible Parking	323164	WASHINGTON: The van stall and access aisle are not compliant.	\$ -	1
Swan Creek Park	Accessible Parking	323274	WASHINGTON: A van stall, access aisle, and signage are not provided.	\$ 11,300	1
Swan Creek Park	Accessible Parking	323158	WASHINGTON: The van stall is not marked and access aisle signage is not provided.	\$ 560	1
Swan Creek Park	Accessible Parking	323165	WASHINGTON: The van stall and access aisle are not compliant.	\$ -	1
Swan Creek Park	Picnic Area	323155	The picnic table does not allow a clear space for forward wheelchair approach with knee and toe clearance.	\$ 1,300	2
Swan Creek Park	Picnic Shelter	323198	BEST PRACTICE: The table does not have minimum 36" wide clear ground space on all usable sides of the table.	\$ 39	4
Swan Creek Park	Picnic Area	323199	The picnic table does not allow a clear space for forward wheelchair approach with knee and toe clearance.	\$ 1,300	2

PHASE FOUR						
PARK	CATEGORY	BARRIER ID	BARRIER DESCRIPTION	ESTIMATE	PRIORITY	
Swan Creek Park	Exterior Access Route	329547	WASHINGTON: The clear width of the ramp is less than 44".	\$ 3,972	1	
Swan Creek Park	Exterior Access Route	323182	Items requiring an unobstructed side reach motion are higher than 48" maximum and/or lower than 15" minimum height above finish floor.	\$ 100	2	
Swan Creek Park	Exterior Access Route	323189	Items requiring an obstructed side reach motion are higher than 48" maximum where the obstruction depth is 10" maximum, or higher than 46" maximum where the obstruction depth is between 10" and 24" and/or lower than 15" minimum height above finish floor.	\$ 150	2	
Swan Creek Park	Exterior Access Route	323179	Items requiring an unobstructed side reach motion are higher than 48" maximum and/or lower than 15" minimum height above finish floor.	\$ 100	2	
Swan Creek Park	Restroom	323206	Controls on dispensers are not compliant.	\$ 100	3	
Swan Creek Park	Restroom	323208	Controls on dispensers are not compliant.	\$ 100	3	
Swan Creek Park	Restroom	323210	The pull side of the accessible door does not have the required maneuvering clearances.	\$ 198	3	
Swan Creek Park	Restroom	323209	The pull side of the accessible door does not have the required maneuvering clearances.	\$ 198	3	
Swan Creek Park	Trail	323212	BEST PRACTICE: The inaccessible trail or trail segment does not have signage with trail details.	\$ 280	4	
Swan Creek Park	Trail	323275	BEST PRACTICE: The accessible trail does not have signage with trail details.	\$ 280	4	
Swan Creek Park	Picnic Shelter	323170	Handrails are not compliant or are not provided.	\$ 400	1	
Swan Creek Park	Picnic Shelter	323171	Steps do not have uniform and compliant riser heights and/or tread depths.	\$ 459	1	
Swan Creek Park	Trail	323202	BEST PRACTICE: Cross slope of concrete, asphalt, or wood surfaced trail is greater than 1:48 or 2.08%.	\$ 360	4	
Swan Creek Park	Trail	323214	BEST PRACTICE: Cross slope of concrete, asphalt or wood surfaced trail is greater than 1:48 or 2.08%.	\$ 660	4	
Swan Creek Park	Trail	323216	BEST PRACTICE: Cross slope of concrete, asphalt or wood surfaced trail is greater than 1:48 or 2.08%.	\$ 1,100	4	
Swan Creek Park	Trail	323217	BEST PRACTICE: Openings and gaps in the trail surface are wider than 0.5".	\$ 40	4	
Swan Creek Park	Trail	323218	BEST PRACTICE: Cross slope of concrete, asphalt or wood surfaced trail is greater than 1:48 or 2.08%.	\$ 720	4	
Swan Creek Park	Trail	323219	BEST PRACTICE: Openings and gaps in the trail surface are wider than 0.5".	\$ 400	4	
Swan Creek Park	Trail	323220	BEST PRACTICE: Cross slope of concrete, asphalt or wood surfaced trail is greater than 1:48 or 2.08%.	\$ 12,000	4	
Swan Creek Park	Trail	323221	BEST PRACTICE: Cross slope of concrete, asphalt or wood surfaced trail is greater than 1:48 or 2.08%.	\$ 7,000	4	
Swan Creek Park	Trail	323222	BEST PRACTICE: Openings and gaps in the trail surface are wider than 0.5".	\$ 400	4	
Swan Creek Park	Trail	323223	BEST PRACTICE: Openings and gaps in the trail surface are wider than 0.5".	\$ 180	4	
Swan Creek Park	Trail	323224	Openings and gaps in the trail surface are wider than 0.5".	\$ 40	4	
Swan Creek Park	Trail	323225	BEST PRACTICE: Cross slope of concrete, asphalt or wood surfaced trail is greater than 1:48 or 2.08%.	\$ 34,000	4	
Swan Creek Park	Trail	323226	BEST PRACTICE: Cross slope of concrete, asphalt or wood surfaced trail is greater than 1:48 or 2.08%.	\$ 4,000	4	
Swan Creek Park	Trail	323227	BEST PRACTICE: Cross slope of concrete, asphalt or wood surfaced trail is greater than 1:48 or 2.08%.	\$ 16,000	4	
Swan Creek Park	Trail	323229	BEST PRACTICE: Cross slope of concrete, asphalt or wood surfaced trail is greater than 1:48 or 2.08%.	\$ 1,200	4	
Swan Creek Park	Trail	323230	BEST PRACTICE: Openings and gaps in the trail surface are wider than 0.5".	\$ 350	4	
Swan Creek Park	Trail	323231	BEST PRACTICE: Openings and gaps in the trail surface are wider than 0.5".	\$ 400	4	
Swan Creek Park	Trail	323232	BEST PRACTICE: Openings and gaps in the trail surface are wider than 0.5".	\$ 300	4	
Swan Creek Park	Trail	323233	BEST PRACTICE: Openings and gaps in the trail surface are wider than 0.5".	\$ 400	4	
Swan Creek Park	Trail	323234	BEST PRACTICE: Openings and gaps in the trail surface are wider than 0.5".	\$ 240	4	
Swan Creek Park	Trail	323235	BEST PRACTICE: Openings and gaps in the trail surface are wider than 0.5".	\$ 240	4	
Swan Creek Park	Trail	323236	BEST PRACTICE: Openings and gaps in the trail surface are wider than 0.5".	\$ 200	4	
Swan Creek Park	Trail	323237	BEST PRACTICE: Openings and gaps in the trail surface are wider than 0.5".	\$ 250	4	
Swan Creek Park	Trail	323238	BEST PRACTICE: Openings and gaps in the trail surface are wider than 0.5".	\$ 200	4	
Swan Creek Park	Trail	323239	BEST PRACTICE: Openings and gaps in the trail surface are wider than 0.5".	\$ 200	4	
Swan Creek Park	Trail	323240	BEST PRACTICE: Openings and gaps in the trail surface are wider than 0.5".	\$ 594	4	
Swan Creek Park	Trail	323241	BEST PRACTICE: Openings and gaps in the trail surface are wider than 0.5".	\$ 574	4	
Swan Creek Park	Trail	323242	BEST PRACTICE: Openings and gaps in the trail surface are wider than 0.5".	\$ 300	4	
Swan Creek Park	Trail	323243	BEST PRACTICE: Openings and gaps in the trail surface are wider than 0.5".	\$ 240	4	
Swan Creek Park	Trail	323244	BEST PRACTICE: Openings and gaps in the trail surface are wider than 0.5".	\$ 240	4	
Swan Creek Park	Trail	323245	BEST PRACTICE: Openings and gaps in the trail surface are wider than 0.5".	\$ 300	4	
Swan Creek Park	Trail	323246	BEST PRACTICE: Openings and gaps in the trail surface are wider than 0.5".	\$ 240	4	
Swan Creek Park	Trail	323247	BEST PRACTICE: Openings and gaps in the trail surface are wider than 0.5".	\$ 600	4	
Swan Creek Park	Trail	323248	BEST PRACTICE: Openings and gaps in the trail surface are wider than 0.5".	\$ 300	4	
Swan Creek Park	Trail	323249	BEST PRACTICE: Openings and gaps in the trail surface are wider than 0.5".	\$ 1,700	4	
Swan Creek Park	Trail	323250	BEST PRACTICE: Openings and gaps in the trail surface are wider than 0.5".	\$ 400	4	
Swan Creek Park	Trail	323251	BEST PRACTICE: Openings and gaps in the trail surface are wider than 0.5".	\$ 300	4	
Swan Creek Park	Trail	323252	BEST PRACTICE: Openings and gaps in the trail surface are wider than 0.5".	\$ 300	4	
Swan Creek Park	Trail	323253	BEST PRACTICE: Openings and gaps in the trail surface are wider than 0.5".	\$ 300	4	
Swan Creek Park	Trail	323254	BEST PRACTICE: Openings and gaps in the trail surface are wider than 0.5".	\$ 200	4	
Swan Creek Park	Trail	323255	BEST PRACTICE: Openings and gaps in the trail surface are wider than 0.5".	\$ 1,200	4	
Swan Creek Park	Trail	323256	BEST PRACTICE: Openings and gaps in the trail surface are wider than 0.5".	\$ 300	4	
Swan Creek Park	Trail	323257	BEST PRACTICE: Openings and gaps in the trail surface are wider than 0.5".	\$ 400	4	
Swan Creek Park	Trail	323258	BEST PRACTICE: Openings and gaps in the trail surface are wider than 0.5".	\$ 350	4	
Swan Creek Park	Trail	323259	BEST PRACTICE: Openings and gaps in the trail surface are wider than 0.5".	\$ 400	4	
Swan Creek Park	Trail	323260	BEST PRACTICE: Openings and gaps in the trail surface are wider than 0.5".	\$ 300	4	
Swan Creek Park	Trail	323261	BEST PRACTICE: Openings and gaps in the trail surface are wider than 0.5".	\$ 300	4	
Swan Creek Park	Trail	323262	BEST PRACTICE: Openings and gaps in the trail surface are wider than 0.5".	\$ 300	4	
Swan Creek Park	Trail	323263	BEST PRACTICE: Openings and gaps in the trail surface are wider than 0.5".	\$ 300	4	
Swan Creek Park	Trail	323264	BEST PRACTICE: Openings and gaps in the trail surface are wider than 0.5".	\$ 300	4	
Swan Creek Park	Trail	323265	BEST PRACTICE: Openings and gaps in the trail surface are wider than 0.5".	\$ 300	4	
Swan Creek Park	Trail	323266	BEST PRACTICE: Openings and gaps in the trail surface are wider than 0.5".	\$ 300	4	
Swan Creek Park	Trail	323267	BEST PRACTICE: Openings and gaps in the trail surface are wider than 0.5".	\$ 200	4	
Swan Creek Park	Trail	323268	BEST PRACTICE: Openings and gaps in the trail surface are wider than 0.5".	\$ 200	4	
Swan Creek Park	Trail	323269	BEST PRACTICE: Openings and gaps in the trail surface are wider than 0.5".	\$ 300	4	
Swan Creek Park	Trail	323270	BEST PRACTICE: Openings and gaps in the trail surface are wider than 0.5".	\$ 200	4	
Swan Creek Park	Trail	323271	BEST PRACTICE: Openings and gaps in the trail surface are wider than 0.5".	\$ 1,200	4	
Swan Creek Park	Trail	323272	BEST PRACTICE: Openings and gaps in the trail surface are wider than 0.5".	\$ 200	4	
Swan Creek Park	Trail	329544	BEST PRACTICE: Cross slope of concrete, asphalt or wood surfaced trail is greater than 1:48 or 2.08%.	\$ 720	4	

TOTAL

\$2,046,476

PHASE FIVE						
PARK	CATEGORY	BARRIER ID	BARRIER DESCRIPTION	ESTIMATE	PRIORITY	
Alderwood Park	Trail	316432	The trail or trail segment can be made accessible.	\$ 700	4	
Alderwood Park	Exterior Access Route	316441	BEST PRACTICE - An adjacent clear space is not provided at the bench.	\$ 107	2	
Alderwood Park	Exterior Access Route	316442	BEST PRACTICE - An adjacent clear space is not provided at the bench.	\$ 52	2	
Alderwood Park	Exterior Access Route	316437	WASHINGTON: The slope of the curb ramp run is not compliant.	\$ 1,750	1	
Alderwood Park	Picnic Area	316439	The accessible route has gaps in the surface greater than 1/2" wide.	\$ 358	1	
Alderwood Park	Picnic Area	316440	The accessible route has gaps in the surface greater than 1/2" wide.	\$ 26	1	
Alderwood Park	Playground	316448	The accessible route has gaps in the surface greater than 1/2" wide.	\$ 1,120	1	
Alderwood Park	Signage	316469	The accessible trail or trail segment does not have signage with trail details.	\$ 280	4	
Alderwood Park	Accessible Parking	316424	WASHINGTON: Van access aisle signage is not provided.	\$ 280	1	
Alderwood Park	Accessible Parking	316429	WASHINGTON: Compliant signage is not provided at the van space.	\$ 280	1	
Alderwood Park	Accessible Parking	316426	WASHINGTON: The van stall and access aisle are not compliant.	\$ 840	1	
Alderwood Park	Accessible Parking	316636	The access aisle slope is greater than 1:50 (2%).	\$ 5,000	1	
Alderwood Park	Accessible Parking	316428	WASHINGTON: Van access aisle signage not provided.	\$ 280	1	
Alderwood Park	Accessible Parking	316427	WASHINGTON: The van stall and access aisle are not compliant.	\$ 840	1	
Alderwood Park	Picnic Area	316433	BEST PRACTICE: Clear ground space around the picnic table is less than 36" width.	\$ 100	2	
Alderwood Park	Picnic Area	316438	Clear ground space around the picnic table is less than 36" width.	\$ 500	2	
Alderwood Park	Playground	316436	One of each type of ground level component is not on an accessible route.	\$ 5,000	2	
Alderwood Park	Playground	316443	The entry points to a play component requiring transfer to entry points or seats is lower than 11" and higher than 24".	\$ 400	2	
Alderwood Park	Playground	316444	The ground level component is required to be on an accessible route but is not within a child's reach range.	\$ 5,000	2	
Alderwood Park	Signage	316425	BEST PRACTICE: The inaccessible trail or trail segment does not have signage with trail details.	\$ 280	4	
Alderwood Park	Signage	316468	The inaccessible trail or trail segment does not have signage with trail details.	\$ 280	4	
Alderwood Park	Trail	316489	The inaccessible trail or trail segment does not have signage with trail details.	\$ 280	4	
Alderwood Park	Exterior Access Route	320734	ADVISORY: The stair treads and edge of top landing do not have visual contrast on the leading edge.	\$ -	2	
Alderwood Park	Trail	316430	Openings and gaps in the trail surface are wider than 0.5".	\$ 21	4	
Alderwood Park	Trail	316431	Cross slope of concrete, asphalt or wood surfaced trail is greater than 1:48 or 2.08%.	\$ 1,254	4	
Alderwood Park	Trail	316449	Cross slope of concrete, asphalt or wood surfaced trail is greater than 1:48 or 2.08%.	\$ 1,792	4	
Alderwood Park	Trail	316450	Cross slope of concrete, asphalt or wood surfaced trail is greater than 1:48 or 2.08%.	\$ 1,433	4	
Alderwood Park	Trail	316451	Openings and gaps in the trail surface are wider than 0.5".	\$ 30	4	
Alderwood Park	Trail	316452	Openings and gaps in the trail surface are wider than 0.5".	\$ 30	4	
Alderwood Park	Trail	316453	Openings and gaps in the trail surface are wider than 0.5".	\$ 43	4	
Alderwood Park	Trail	316454	Cross slope of concrete, asphalt or wood surfaced trail is greater than 1:48 or 2.08%.	\$ 179	4	
Alderwood Park	Trail	316455	Openings and gaps in the trail surface are wider than 0.5".	\$ 2	4	
Alderwood Park	Trail	316456	Openings and gaps in the trail surface are wider than 0.5".	\$ 34	4	
Alderwood Park	Trail	316457	Openings and gaps in the trail surface are wider than 0.5".	\$ 24	4	
Alderwood Park	Trail	316458	Openings and gaps in the trail surface are wider than 0.5".	\$ 24	4	
Alderwood Park	Trail	316459	Openings and gaps in the trail surface are wider than 0.5".	\$ 24	4	
Alderwood Park	Trail	316460	Openings and gaps in the trail surface are wider than 0.5".	\$ 24	4	
Alderwood Park	Trail	316461	Openings and gaps in the trail surface are wider than 0.5".	\$ 24	4	
Alderwood Park	Trail	316462	Openings and gaps in the trail surface are wider than 0.5".	\$ 24	4	
Alderwood Park	Trail	316463	Openings and gaps in the trail surface are wider than 0.5".	\$ 24	4	
Alderwood Park	Trail	316464	Openings and gaps in the trail surface are wider than 0.5".	\$ 109	4	
Alderwood Park	Trail	316465	Openings and gaps in the trail surface are wider than 0.5".	\$ 61	4	
Alderwood Park	Trail	316466	Openings and gaps in the trail surface are wider than 0.5".	\$ 21	4	
Alderwood Park	Trail	316467	Openings and gaps in the trail surface are wider than 0.5".	\$ 21	4	
Alderwood Park	Trail	316470	Openings and gaps in the trail surface are wider than 0.5".	\$ 21	4	
Alderwood Park	Trail	316471	Openings and gaps in the trail surface are wider than 0.5".	\$ 21	4	
Alderwood Park	Trail	316472	Openings and gaps in the trail surface are wider than 0.5".	\$ 21	4	
Alderwood Park	Trail	316473	Openings and gaps in the trail surface are wider than 0.5".	\$ 21	4	
Alderwood Park	Trail	316474	Openings and gaps in the trail surface are wider than 0.5".	\$ 21	4	
Alderwood Park	Trail	316475	Openings and gaps in the trail surface are wider than 0.5".	\$ 21	4	
Alderwood Park	Trail	316476	Openings and gaps in the trail surface are wider than 0.5".	\$ 222	4	
Alderwood Park	Trail	316477	Openings and gaps in the trail surface are wider than 0.5".	\$ 21	4	
Alderwood Park	Trail	316478	Openings and gaps in the trail surface are wider than 0.5".	\$ 21	4	
Alderwood Park	Trail	316479	Openings and gaps in the trail surface are wider than 0.5".	\$ 21	4	
Alderwood Park	Trail	316480	Openings and gaps in the trail surface are wider than 0.5".	\$ 21	4	
Alderwood Park	Trail	316481	Openings and gaps in the trail surface are wider than 0.5".	\$ 21	4	
Alderwood Park	Trail	316482	Openings and gaps in the trail surface are wider than 0.5".	\$ 21	4	
Alderwood Park	Trail	316483	Openings and gaps in the trail surface are wider than 0.5".	\$ 21	4	
Alderwood Park	Trail	316484	Openings and gaps in the trail surface are wider than 0.5".	\$ 21	4	
Alderwood Park	Trail	316485	Openings and gaps in the trail surface are wider than 0.5".	\$ 21	4	
Alderwood Park	Trail	316486	Openings and gaps in the trail surface are wider than 0.5".	\$ 26	4	
Alderwood Park	Trail	316488	Cross slope of concrete, asphalt or wood surfaced trail is greater than 1:48 or 2.08%.	\$ 627	4	
Alderwood Park	Playground	316434	The transfer platform connecting to elevated play elements has a non-compliant height lower than 11" or higher than 18".	\$ 5,000	2	
Alling Park	Amenity not evaluated	322076	The amenity is not regulated by the ADA.	\$ -	0	
Alling Park	Amenity not evaluated	322073	The amenity is not regulated by the ADA.	\$ -	0	
Alling Park	Exterior Access Route	322071	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 2,477	1	
Alling Park	Exterior Access Route	322078	A compliant accessible route is not provided from the property line to the site facilities.	\$ 4,000	1	
Alling Park	Exterior Access Route	322075	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 3,171	1	
Alling Park	Exterior Access Route	322079	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 2,259	1	
Alling Park	Exterior Access Route	322082	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 4,281	1	
Alling Park	Exterior Access Route	322083	Walkway has areas of vertical level changes in excess of 1/4" that are not ramped.	\$ 26	1	
Alling Park	Exterior Access Route	322084	Walkway has areas of vertical level changes in excess of 1/4" that are not ramped.	\$ 17	1	
Alling Park	Exterior Access Route	322085	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 7,135	1	
Alling Park	Exterior Access Route	322080	Walkway has areas of vertical level changes in excess of 1/4" that are not ramped.	\$ 71	1	
Alling Park	Playground	322081	The ground surface has not been inspected and maintained regularly.	\$ 700	2	
Alling Park	Trail	322074	Resting intervals are not provided at both ends of trail segments with running slope from 1:20 (5%) to 1:12 (8.3%). Resting intervals are not provided at both ends of trail segments with running slope from 1:12 (8.3%) to 1:10 (10%).	\$ 4,981	4	
Alling Park	Trail	322077	The inaccessible trail or trail segment does not have signage with trail details.	\$ 560	4	
Alling Park	Trail	322072	The inaccessible trail or trail segment does not have signage with trail details.	\$ 560	4	
Baltimore Park	Exterior Access Route	332562	WASHINGTON: An exterior accessible route is not provided.	\$ 197	1	

PHASE FIVE						
PARK	CATEGORY	BARRIER ID	BARRIER DESCRIPTION	ESTIMATE	PRIORITY	
Baltimore Park	Exterior Access Route	360570	WASHINGTON: An exterior accessible route is not provided.	\$ 1,680	1	
Baltimore Park	Soccer Field	360715	The lawn seating and exterior overflow seating areas, where fixed seating is not provided, do not connect to an accessible route.	\$ 6,490	2	
Browns Point Playfield	Baseball/Softball Field	315727	The required number of wheelchair spaces is not provided at the bleacher seating for the ball field.	\$ 419	2	
Browns Point Playfield	Playground	315725	The elevated route connecting elevated play components accessed by a transfer system is less than 24" wide.	\$ 25,000	2	
Browns Point Playfield	Exterior Access Route	315718	WASHINGTON: An exterior accessible route is not provided to site amenities.	\$ 13,305	1	
Browns Point Playfield	Exterior Access Route	315720	WASHINGTON: An exterior accessible route is not provided to the bench.	\$ 1,648	1	
Browns Point Playfield	Soccer Field	315729	The lawn seating and exterior overflow seating areas, where fixed seating is not provided, do not connect to an accessible route.	\$ 3,605	2	
Browns Point Playfield	Exterior Access Route	315715	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 4,400	1	
Browns Point Playfield	Accessible Parking	315712	The slope of the parking space is greater than 1:50 (2%).	\$ 6,300	1	
Browns Point Playfield	Accessible Parking	315713	The access aisle slope is greater than 1:50 (2%).	\$ 5,000	1	
Browns Point Playfield	Accessible Parking	315714	The slope of the parking space is greater than 1:50 (2%).	\$ 6,300	1	
Browns Point Playfield	Accessible Parking	315709	WASHINGTON: A van stall and access aisle are not marked and signage is not provided.	\$ 1,400	1	
Browns Point Playfield	Site Furnishings	315719	The picnic table does not allow a clear space for forward wheelchair approach with knee and toe clearance.	\$ 1,300	2	
Browns Point Playfield	Trail	315728	BEST PRACTICE: The inaccessible trail does not have signage with trail details.	\$ 280	4	
Browns Point Playfield	Playground	315723	The transfer step is higher than 8".	\$ 3,255	2	
China Lake Park	Accessible Parking	324281	WASHINGTON: A van stall, access aisle, and signage are not provided and the slope and/or ground surface is/are not compliant.	\$ 560	1	
China Lake Park	Accessible Parking	332545	The access aisle slope is greater than 1:50 (2%).	\$ 5,000	1	
China Lake Park	Accessible Parking	332556	The parking space slope is greater than 1:50 (2%).	\$ 6,300	1	
Cloverdale Park	Trail	328917	BEST PRACTICE: The trail or portion of the trail can be made accessible.	\$ -	4	
Cloverdale Park	Site Furnishings	328933	BEST PRACTICE: An adjacent clear space is not provided at the bench.	\$ 52	2	
Cloverdale Park	Site Furnishings	328932	BEST PRACTICE: An adjacent clear space is not provided at the bench.	\$ 52	2	
Cloverdale Park	Exterior Access Route	328925	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 440	1	
Cloverdale Park	Exterior Access Route	328914	WASHINGTON: An exterior accessible route is not provided.	\$ 582	1	
Cloverdale Park	Exterior Access Route	328924	The accessible route has areas of vertical level changes in excess of 1/4" that are not beveled or ramped.	\$ 99	1	
Cloverdale Park	Exterior Access Route	328930	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 3,290	1	
Cloverdale Park	Exterior Access Route	328928	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 750	1	
Cloverdale Park	Exterior Access Route	328929	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 2,100	1	
Cloverdale Park	Playground	328919	The ground surface has not been inspected and maintained regularly.	\$ 1,687	2	
Cloverdale Park	Site Furnishings	328913	The picnic table does not allow a clear space for forward wheelchair approach with knee and toe clearance.	\$ 1,300	2	
Cloverdale Park	Site Furnishings	328926	The picnic table does not allow a clear space for forward wheelchair approach with knee and toe clearance.	\$ 1,300	2	
Cloverdale Park	Site Furnishings	328927	The picnic table does not allow a clear space for forward wheelchair approach with knee and toe clearance.	\$ 1,300	2	
Cloverdale Park	Site Furnishings	328918	The picnic table does not allow a clear space for forward wheelchair approach with knee and toe clearance.	\$ 1,300	2	
Cloverdale Park	Playground	328922	The number of existing ground level components is less than the required minimum.	\$ 10,000	2	
Cloverdale Park	Playground	328923	A compliant turning space is not provided at a school-age swing.	\$ 10	2	
Cloverdale Park	Exterior Access Route	328921	WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 484	3	
Cloverdale Park	Playground	328920	The transfer platform for connecting to elevated play elements has non-compliant dimensions.	\$ 5,000	2	
Cloverdale Park	Site Furnishings	328931	Clear ground space is not provided at the trash receptacle with lid requiring operation. The trash receptacle is out of reach range.	\$ 112	2	
DeLong Park	Site Furnishings	324041	BEST PRACTICE: An adjacent clear space is not provided at the bench.	\$ 8	2	
DeLong Park	Site Furnishings	324044	BEST PRACTICE: An adjacent clear space is not provided at the bench.	\$ 35	2	
DeLong Park	Site Furnishings	324047	BEST PRACTICE: An adjacent clear space is not provided at the bench.	\$ 65	2	
DeLong Park	Exterior Access Route	324024	WASHINGTON: The slope of the curb ramp run is not compliant.	\$ 1,750	1	
DeLong Park	Exterior Access Route	324025	A compliant parallel curb ramp is not provided.	\$ 2,187	1	
DeLong Park	Exterior Access Route	324223	The slope of the curb ramp flare is greater than 1:10 (10%).	\$ 1,750	1	
DeLong Park	Exterior Access Route	324026	WASHINGTON: The slope of the curb ramp run is not compliant.	\$ 1,750	1	
DeLong Park	Exterior Access Route	324224	The slope of the curb ramp flare is greater than 1:10 (10%).	\$ 1,750	1	
DeLong Park	Exterior Access Route	324225	A landing at the top of the curb ramp is not present.	\$ 1,289	1	
DeLong Park	Exterior Access Route	324038	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 594	1	
DeLong Park	Exterior Access Route	324035	The accessible route has gaps in the surface greater than 1/2" wide.	\$ 396	1	
DeLong Park	Exterior Access Route	324036	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 2,378	1	
DeLong Park	Exterior Access Route	324037	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 1,783	1	
DeLong Park	Accessible Parking	324032	The slope of the parking space is greater than 1:50 (2%).	\$ 6,300	1	
DeLong Park	Accessible Parking	324029	The access aisle slope is greater than 1:50 (2%).	\$ 5,000	1	
DeLong Park	Accessible Parking	324028	The parking space slope is greater than 1:50 (2%).	\$ 6,300	1	
DeLong Park	Trail	324039	BEST PRACTICE: The inaccessible trail or trail segment does not have signage with trail details.	\$ 350	4	
DeLong Park	Trail	324034	BEST PRACTICE: The inaccessible trail segment does not have signage with trail details.	\$ 280	4	
DeLong Park	Trail	324033	BEST PRACTICE: The inaccessible trail segment does not have signage with trail details.	\$ 280	4	
DeLong Park	Exterior Access Route	354828	Handrails extensions are not compliant.	\$ 815	1	
DeLong Park	Trail	324040	BEST PRACTICE: Openings and gaps in the trail surface are wider than 0.5".	\$ 104	4	
DeLong Park	Trail	324043	BEST PRACTICE: Openings and gaps in the trail surface are wider than 0.5".	\$ 17	4	
DeLong Park	Trail	324045	BEST PRACTICE: Cross slope of concrete, asphalt or wood surfaced trail is greater than 1:48 or 2.08%.	\$ 2,400	4	
DeLong Park	Trail	324046	BEST PRACTICE: Cross slope of concrete, asphalt or wood surfaced trail is greater than 1:48 or 2.08%.	\$ 2,400	4	
DeLong Park	Trail	324048	BEST PRACTICE: Cross slope of concrete, asphalt or wood surfaced trail is greater than 1:48 or 2.08%.	\$ 1,200	4	
DeLong Park	Trail	324050	BEST PRACTICE: Cross slope of concrete, asphalt or wood surfaced trail is greater than 1:48 or 2.08%.	\$ 3,600	4	
DeLong Park	Site Furnishings	324042	Clear ground space is not provided at the trash receptacle with lid requiring operation.	\$ 120	2	
Fern Hill Park	Exterior Access Route	323803	WASHINGTON: A curb ramp is required but is not provided.	\$ 1,750	1	
Fern Hill Park	Site Furnishings	323807	The picnic table does not allow a clear space for forward wheelchair approach with knee and toe clearance.	\$ 1,300	2	

PHASE FIVE						
PARK	CATEGORY	BARRIER ID	BARRIER DESCRIPTION	ESTIMATE	PRIORITY	
Fern Hill Park	Site Furnishings	323808	The picnic table does not allow a clear space for forward wheelchair approach with knee and toe clearance.	\$ 1,300	2	
Fern Hill Park	Picnic Shelter	331380	BEST PRACTICE: Clear ground space around the picnic table is less than 36" wide.	\$ 1,290	2	
Fern Hill Park	Picnic Shelter	331381	BEST PRACTICE: Clear ground space around the picnic table is less than 36" wide.	\$ 1,290	2	
Ferry Park	Exterior Access Route	320751	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 1,446	1	
Ferry Park	Exterior Access Route	320761	WASHINGTON: An exterior accessible route is not provided.	\$ 1,809	1	
Ferry Park	Exterior Access Route	320763	WASHINGTON: An exterior accessible route is not provided.	\$ 1,809	1	
Ferry Park	Exterior Access Route	320755	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 4,281	1	
Ferry Park	Exterior Access Route	320756	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 2,616	1	
Ferry Park	Exterior Access Route	320754	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 1,427	1	
Ferry Park	Exterior Access Route	320757	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 3,052	1	
Ferry Park	Site Furnishings	320760	The picnic table does not allow a clear space for forward wheelchair approach with knee and toe clearance.	\$ 1,300	2	
Ferry Park	Site Furnishings	320762	The picnic table does not allow a clear space for forward wheelchair approach with knee and toe clearance.	\$ 1,300	2	
Ferry Park	Site Furnishings	320764	The picnic table does not allow a clear space for forward wheelchair approach with knee and toe clearance.	\$ 1,300	2	
Ferry Park	Playground	320759	The number of existing ground level components is less than the required minimum.	\$ 5,000	2	
Ferry Park	Playground	320753	The number of existing ground level components is less than the required minimum.	\$ 5,000	2	
Ferry Park	Exterior Access Route	320765	WASHINGTON: A ramp is required but not provided.	\$ 2,648	1	
Ferry Park	Playground	320758	The elevated play structure does not have a transfer platform.	\$ 25,000	2	
Ferry Park	Playground	320752	The transfer steps are less than 24" wide and/or 14" deep.	\$ 3,255	2	
Garfield Park	Fitness Course	360788	Clear ground space is not provided at the transfer point to the exercise equipment.	\$ 708	1	
Garfield Park	Exterior Access Route	332571	WASHINGTON: An exterior accessible route is not provided.	\$ 1,254	1	
Garfield Park	Exterior Access Route	332570	WASHINGTON: An exterior accessible route is not provided.	\$ 2,240	1	
Garfield Park	Exterior Access Route	332567	WASHINGTON: An exterior accessible route is not provided to the fitness course.	\$ 35,400	1	
Garfield Park	Exterior Access Route	360719	WASHINGTON: An exterior accessible route is not provided.	\$ 5,040	1	
Garfield Park	Playground	360717	The ground surface within the use zone does not comply with ASTM F1292.	\$ 9,828	2	
Irving Park	Trail	323779	The inaccessible trail or trail segment does not have signage with trail details.	\$ 280	4	
Irving Park	Exterior Access Route	330023	WASHINGTON: An exterior accessible route is not provided.	\$ 134	1	
Irving Park	Trail	323776	BEST PRACTICE: The inaccessible trail or trail segment does not have signage with trail details.	\$ 280	4	
Irving Park	Trail	323774	BEST PRACTICE: The inaccessible trail or trail segment does not have signage with trail details.	\$ 280	4	
Irving Park	Site Furnishings	323767	BEST PRACTICE: An adjacent clear space is not provided at the bench.	\$ 120	2	
Irving Park	Exterior Access Route	323769	WASHINGTON: A curb ramp is required but not provided.	\$ 1,750	1	
Irving Park	Exterior Access Route	323766	The walkway does not have a compliant turning space at a change of direction.	\$ 360	1	
Irving Park	Exterior Access Route	323765	WASHINGTON: The running slopes of the exterior accessible route are not compliant.	\$ 180	1	
Irving Park	Playground	323771	The ground surface has not been inspected and maintained regularly.	\$ 600	2	
Irving Park	Playground	323768	The ground surface has not been inspected and maintained regularly.	\$ 50	2	
Irving Park	Playground	323772	The transfer steps are higher than 8" each.	\$ 1,000	2	
Jane Clark Park	Baseball/Softball Field	332555	The required number of wheelchair spaces is not provided at the bleacher seating for the ball field.	\$ 104	2	
Jane Clark Park	Exterior Access Route	332551	WASHINGTON: An exterior accessible route is not provided.	\$ 1,030	1	
Jane Clark Park	Exterior Access Route	332553	WASHINGTON: An exterior accessible route is not provided to the baseball field from accessible parking.	\$ 2,360	1	
Jane Clark Park	Exterior Access Route	332552	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 3,136	1	
Jane Clark Park	Baseball/Softball Field	332549	The lawn seating and exterior overflow seating areas, where fixed seating is not provided, do not connect to an accessible route.	\$ 1,770	2	
Jane Clark Park	Accessible Parking	332546	WASHINGTON: A van stall, access aisle, and signage are not provided.	\$ 11,860	1	
Jane Clark Park	Accessible Parking	332550	WASHINGTON: A van stall, access aisle, and signage are not provided and the slope and/or ground surface is/are not compliant.	\$ 11,860	1	
Jerry Meeker Memorial	Exterior Access Route	316652	WASHINGTON: An exterior accessible route is not provided.	\$ 295	1	
Jerry Meeker Memorial	Exterior Access Route	316648	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 1,486	1	
Jerry Meeker Memorial	Exterior Access Route	316649	WASHINGTON: The clear width of the exterior accessible route is less than 44".	\$ 2,732	1	
Jerry Meeker Memorial	Exterior Access Route	316651	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 6,045	1	
Jerry Meeker Memorial	Exterior Access Route	316647	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 2,873	1	
Jerry Meeker Memorial	Exterior Access Route	316641	WASHINGTON: The clear width of the exterior accessible route is less than 44".	\$ 1,823	1	
Jerry Meeker Memorial	Exterior Access Route	316642	The accessible route has areas of vertical level changes in excess of 1/4" that are not beveled or ramped.	\$ 59	1	
Jerry Meeker Memorial	Exterior Access Route	316643	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 1,823	1	
Jerry Meeker Memorial	Exterior Access Route	316644	WASHINGTON: The clear width of the exterior accessible route is less than 44".	\$ 1,843	1	
Jerry Meeker Memorial	Exterior Access Route	316645	The accessible route has areas of vertical level changes in excess of 1/4" that are not beveled or ramped.	\$ 59	1	
Jerry Meeker Memorial	Exterior Access Route	316646	The accessible route has gaps in the surface greater than 1/2" wide.	\$ 59	1	
Jerry Meeker Memorial	Exterior Access Route	316650	The accessible route has areas of vertical level changes in excess of 1/4" that are not beveled or ramped.	\$ 118	1	
Julia's Gulch	Exterior Access Route	315979	WASHINGTON: The exterior accessible route is not compliant.	\$ 1,792	1	
Julia's Gulch	Trail	326049	BEST PRACTICE: The inaccessible trail does not have signage with trail details.	\$ 280	4	
Julia's Gulch	Trail	315985	BEST PRACTICE: The inaccessible trail or trail segment does not have signage with trail details.	\$ 280	4	
Lincoln Heights Park	Exterior Access Route	342990	The slope of the curb ramp landing exceeds the maximum allowable 1:48 (2.08%).	\$ 1,611	1	
Lincoln Heights Park	Exterior Access Route	342989	The slope of the curb ramp landing exceeds the maximum allowable 1:48 (2.08%).	\$ 1,611	1	
Lincoln Heights Park	Exterior Access Route	324566	WASHINGTON: Where a detectable warning is located on a curb ramp run, the detectable warning is not compliant.	\$ 640	1	
Lincoln Heights Park	Exterior Access Route	324567	WASHINGTON: The slope of the curb ramp run is not compliant.	\$ 1,750	1	
Lincoln Heights Park	Exterior Access Route	324568	WASHINGTON: The slope of the curb ramp run is not compliant.	\$ 1,750	1	
Lincoln Heights Park	Exterior Access Route	324569	WASHINGTON: The slope of the curb ramp run is not compliant.	\$ 1,750	1	
Lincoln Heights Park	Exterior Access Route	324570	WASHINGTON: The slope of the curb ramp run is not compliant.	\$ 1,750	1	
Lincoln Heights Park	Exterior Access Route	324550	The bus stop boarding and alighting area is not compliant.	\$ 495	1	
Lincoln Heights Park	Exterior Access Route	324565	The accessible route has gaps in the surface greater than 1/2" wide.	\$ 112	1	
Lincoln Heights Park	Exterior Access Route	324571	The accessible route has gaps in the surface greater than 1/2" wide.	\$ 112	1	
Lincoln Heights Park	Exterior Access Route	324573	The accessible route has gaps in the surface greater than 1/2" wide.	\$ 106	1	
Lincoln Heights Park	Exterior Access Route	324574	The accessible route has gaps in the surface greater than 1/2" wide.	\$ 106	1	
Lincoln Heights Park	Exterior Access Route	324560	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 2,299	1	
Lincoln Heights Park	Exterior Access Route	324561	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 2,338	1	

PHASE FIVE						
PARK	CATEGORY	BARRIER ID	BARRIER DESCRIPTION	ESTIMATE	PRIORITY	
Lincoln Heights Park	Exterior Access Route	324559	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 2,299	1	
Lincoln Heights Park	Exterior Access Route	324562	The accessible route has gaps in the surface greater than 1/2" wide.	\$ 826	1	
Lincoln Heights Park	Exterior Access Route	324563	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 317	1	
Lincoln Heights Park	Basketball Court	324557	WASHINGTON: An exterior accessible route is not provided.	\$ 448	1	
Lincoln Heights Park	Basketball Court	324551	WASHINGTON: An exterior accessible route is not provided.	\$ 1,039	1	
Lincoln Heights Park	Exterior Access Route	324572	The accessible route has gaps in the surface greater than 1/2" wide.	\$ 1,150	1	
Lincoln Heights Park	Exterior Access Route	324577	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 2,378	1	
Lincoln Heights Park	Exterior Access Route	324578	WASHINGTON: The clear width of the exterior accessible route is less than 44".	\$ 1,000	1	
Lincoln Heights Park	Exterior Access Route	324579	The accessible route has gaps in the surface greater than 1/2" wide.	\$ 295	1	
Lincoln Heights Park	Exterior Access Route	324564	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 792	1	
Lincoln Heights Park	Exterior Access Route	324575	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 3,171	1	
Lincoln Heights Park	Exterior Access Route	324576	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 792	1	
Lincoln Heights Park	Playground	324552	A transfer space is not provided at the platform.	\$ 360	2	
Lincoln Heights Park	Playground	324553	A means of support is not provided at the transfer platform and/or transfer steps.	\$ 165	2	
Lots for Tots	Exterior Access Route	320740	The curb ramp does not meet the slope requirements.	\$ 1,750	1	
Lots for Tots	Exterior Access Route	320735	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 9,870	1	
Lots for Tots	Exterior Access Route	320736	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 1,248	1	
Lots for Tots	Exterior Access Route	320741	The accessible route has areas of vertical level changes in excess of 1/4" that are not beveled or ramped.	\$ -	1	
Lots for Tots	Site Furnishings	320737	The picnic table does not allow a clear space for forward wheelchair approach.	\$ 1,300	2	
Manitou Park	Amenity not evaluated	323936	The amenity cannot be accessed and, therefore, cannot be evaluated.	\$ -	0	
Manitou Park	Exterior Access Route	323935	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 6,272	1	
Manitou Park	Playground	323944	The accessible route within the play area that serves ground level play components does not have minimum 80" vertical clearance.	\$ 500	2	
Manitou Park	Playground	323939	The ground surface has not been inspected and maintained regularly.	\$ 2,860	2	
Manitou Park	Picnic Area	323938	The picnic table does not allow a clear space for forward wheelchair approach with knee and toe clearance.	\$ 1,300	2	
Manitou Park	Picnic Area	323937	The picnic table does not allow a clear space for forward wheelchair approach with knee and toe clearance.	\$ 1,300	2	
Manitou Park	Playground	323940	A transfer space is not provided at the platform.	\$ 60	2	
Manitou Park	Playground	323941	The transfer platform is not compliant.	\$ 6,250	2	
Manitou Park	Playground	323943	A means of support is not provided at the transfer platform and/or transfer steps.	\$ 1,320	2	
Manitou Park	Playground	323945	The slope of the transfer space is not compliant at the platform.	\$ 200	2	
Manitou Park	Playground	323946	A compliant transfer space is not provided at the platform.	\$ 5,000	2	
Manitou Park	Playground	323948	A means of support is not provided at the transfer steps.	\$ 1,650	2	
Manitou Park	Playground	343165	A transfer space is not provided at the platform.	\$ 5,000	2	
Neighbors Park	Site Furnishings	324521	BEST PRACTICE: An adjacent clear space is not provided at the bench. A clear space is not positioned at the lower level drinking fountain for a forward approach centered on the unit.	\$ 107	2	
Neighbors Park	Site Furnishings	324519		\$ 224	4	
Neighbors Park	Exterior Access Route	324529	WASHINGTON: An exterior accessible route is not provided.	\$ 2,000	1	
Neighbors Park	Exterior Access Route	324535	The walkway does not have a compliant turning space at a change of direction.	\$ 403	1	
Neighbors Park	Exterior Access Route	324536	The walkway does not have a compliant turning space at a change of direction.	\$ 1,982	1	
Neighbors Park	Exterior Access Route	324523	WASHINGTON: An exterior accessible route is not provided to the components.	\$ 1,680	1	
Neighbors Park	Exterior Access Route	324524	WASHINGTON: An exterior accessible route is not provided.	\$ 1,792	1	
Neighbors Park	Exterior Access Route	324537	WASHINGTON: An exterior accessible route is not provided.	\$ 1,120	1	
Neighbors Park	Exterior Access Route	324540	The walkway has areas of vertical level changes in excess of 1/4" that are not ramped.	\$ 118	1	
Neighbors Park	Exterior Access Route	324527	The accessible route has gaps in the surface greater than 1/2" wide.	\$ 297	1	
Neighbors Park	Exterior Access Route	324530	WASHINGTON: An exterior accessible route is not provided.	\$ 2,000	1	
Neighbors Park	Exterior Access Route	324522	The gate does not have a smooth surface within 10" of the ground on the push side.	\$ 800	2	
Neighbors Park	Exterior Access Route	324531	The gate maneuvering clearance area is not compliant.	\$ 2,840	1	
Neighbors Park	Exterior Access Route	324532	The gate is less than 32" in width.	\$ 568	1	
Neighbors Park	Playground	324538	The ground surface has not been inspected and maintained regularly.	\$ 1,250	2	
Neighbors Park	Playground	324528	The ground surface has not been inspected and maintained regularly.	\$ 200	2	
Neighbors Park	Site Furnishings	324525	The picnic table does not allow a clear space for forward wheelchair approach with knee and toe clearance.	\$ 1,300	2	
Neighbors Park	Site Furnishings	324526	BEST PRACTICE: The table does not have minimum 36" wide clear ground space on all usable sides of the table.	\$ 215	4	
Neighbors Park	Playground	324539	The play component which has manipulative or interactive features that require reaching is not within the child's reach range.	\$ 5,000	4	
Neighbors Park	Exterior Access Route	324518	WASHINGTON: The slopes of the ramp are not compliant.	\$ 13,240	1	
Neighbors Park	Exterior Access Route	324520	The ramp does not have a level landing at the bottom of the upper ramp run. The ramp landing is not a compliant size.	\$ 3,490	1	
Neighbors Park	Exterior Access Route	344432	Items requiring an unobstructed side reach motion are lower than 15" minimum height above ground surface.	\$ 1,000	2	
Neighbors Park	Exterior Access Route	344433	Items requiring an unobstructed side reach motion are lower than 15" minimum height above the ground surface.	\$ 1,000	2	
Neighbors Park	Exterior Access Route	324533	Handrails are not compliant or are not provided.	\$ 1,956	1	
Neighbors Park	Exterior Access Route	324534	Steps do not have uniform and compliant riser heights and/or tread depths.	\$ 1,836	1	
North Slope Historic Park	Exterior Access Route	321877	WASHINGTON: An exterior accessible route is not provided.	\$ 53	1	
North Slope Historic Park	Exterior Access Route	321876	The accessible route has gaps in the surface greater than 1/2" wide.	\$ 44	1	
North Slope Historic Park	Exterior Access Route	321875	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 2,854	1	
North Slope Historic Park	Site Furnishings	321880	The table does not have minimum 36" wide clear ground space on all usable sides of the table.	\$ 314	4	
North Slope Historic Park	Site Furnishings	321878	The picnic table does not allow a clear space for forward wheelchair approach with knee and toe clearance.	\$ 1,300	2	
Oak Tree Park	Exterior Access Route	324017	WASHINGTON: An exterior accessible route is not provided.	\$ 300	1	
Oak Tree Park	Exterior Access Route	348343	WASHINGTON: An exterior accessible route is not provided.	\$ 500	1	
Oak Tree Park	Exterior Access Route	324018	WASHINGTON: An exterior accessible route is not provided.	\$ 20	1	
Oak Tree Park	Exterior Access Route	343573	WASHINGTON: An exterior accessible route is not provided.	\$ 500	1	
Oak Tree Park	Trail	324016	BEST PRACTICE: The inaccessible trail or trail segment does not have signage with minimum required trail details.	\$ 560	4	
Oak Tree Park	Trail	343572	BEST PRACTICE: The inaccessible trail or trail segment does not have signage with minimum required trail details.	\$ 280	4	
Oak Tree Park	Trail	324020	BEST PRACTICE: The inaccessible trail or trail segment does not have signage with minimum required trail details.	\$ 280	4	
Oak Tree Park	Trail	348341	BEST PRACTICE: The inaccessible trail or trail segment does not have signage with minimum required trail details.	\$ 280	4	

PHASE FIVE						
PARK	CATEGORY	BARRIER ID	BARRIER DESCRIPTION	ESTIMATE	PRIORITY	
Oakland Madrona Park	Site Furnishings	362060	BEST PRACTICE: An adjacent clear space is not provided at the bench.	\$ 273	2	
Oakland Madrona Park	Site Furnishings	362061	BEST PRACTICE: An adjacent clear space is not provided at the bench.	\$ 1,092	2	
Oakland Madrona Park	Exterior Access Route	344165	The sidewalk does not have a compliant turning space at a change of direction.	\$ 495	1	
Oakland Madrona Park	Exterior Access Route	344171	WASHINGTON: An exterior accessible route is not provided.	\$ 1,344	1	
Oakland Madrona Park	Exterior Access Route	344176	WASHINGTON: An exterior accessible route is not provided.	\$ 448	1	
Oakland Madrona Park	Exterior Access Route	344177	WASHINGTON: An exterior accessible route is not provided.	\$ 1,792	1	
Oakland Madrona Park	Playground	344178	The ground surface has not been inspected and maintained regularly.	\$ 100	2	
Oakland Madrona Park	Playground	344172	The ground surface has not been inspected and maintained regularly.	\$ 312	2	
Oakland Madrona Park	Accessible Parking	344167	The parking space slope is greater than 1:50 (2%).	\$ 6,300	1	
Oakland Madrona Park	Accessible Parking	344181	WASHINGTON: Compliant signage is not provided at the van access aisle.	\$ 280	1	
Oakland Madrona Park	Accessible Parking	344168	The access aisle slope is greater than 1:50 (2%).	\$ 5,000	1	
Oakland Madrona Park	Playground	344173	The entry points to a play component requiring transfer to entry points or seats is lower than 11" and higher than 24".	\$ 400	2	
Oakland Madrona Park	Playground	344179	The entry points to a play component requiring transfer to entry points or seats is lower than 11" and higher than 24".	\$ 400	2	
Oakland Madrona Park	Trail	344174	The inaccessible trail or trail segment does not have signage with trail details.	\$ 840	4	
Oakland Madrona Park	Basketball Court	344175	An accessible route does not directly connect each side of the court outside of play lines.	\$ 4,470	1	
Oakland Madrona Park	Playground	344169	The transfer steps are higher than 8" each.	\$ 3,255	2	
Oakland Madrona Park	Playground	344170	The elevated play structure does not have a transfer platform.	\$ 5,000	2	
Old Town Park	Picnic Area	319638	BEST PRACTICE: Clear ground space around the picnic table is less than 36" width. Wheelchair spaces, companion seating and lawn seating/overflow seating are not on an accessible route.	\$ 500	2	
Old Town Park	Assembly Area	327295	Wheelchair spaces, companion seating and lawn seating/overflow seating are not on an accessible route.	\$ 2,980	2	
Old Town Park	Playground	319676	BEST PRACTICE: An adjacent clear space is not provided at the bench.	\$ 336	2	
Old Town Park	Playground	319677	BEST PRACTICE: An adjacent clear space is not provided at the bench.	\$ 336	2	
Old Town Park	Playground	319672	BEST PRACTICE: An adjacent clear space is not provided at the bench.	\$ 107	2	
Old Town Park	Playground	319673	BEST PRACTICE: An adjacent clear space is not provided at the bench.	\$ 107	2	
Old Town Park	Exterior Access Route	319640	WASHINGTON: An exterior accessible route is not provided.	\$ 1,433	1	
Old Town Park	Exterior Access Route	319675	The accessible route has gaps in the surface greater than 1/2" wide.	\$ 89	1	
Old Town Park	Exterior Access Route	327298	WASHINGTON: An exterior accessible route is not provided.	\$ 1,680	1	
Old Town Park	Exterior Access Route	319655	WASHINGTON: An exterior accessible route is not provided to the charging station. Clear space at the operable parts is not provided.	\$ 1,950	1	
Old Town Park	Exterior Access Route	319641	WASHINGTON: An exterior accessible route is not provided.	\$ 537	1	
Old Town Park	Exterior Access Route	319642	The accessible route has gaps in the surface greater than 1/2" wide.	\$ 44	1	
Old Town Park	Exterior Access Route	319648	The accessible route has gaps in the surface greater than 1/2" wide.	\$ 44	1	
Old Town Park	Exterior Access Route	319658	The accessible route has gaps in the surface greater than 1/2" wide.	\$ 286	1	
Old Town Park	Exterior Access Route	319656	The accessible route has gaps in the surface greater than 1/2" wide.	\$ 44	1	
Old Town Park	Exterior Access Route	319657	The accessible route has gaps in the surface greater than 1/2" wide.	\$ 44	1	
Old Town Park	Playground	319660	The ground surface has not been inspected and maintained regularly.	\$ 1,200	2	
Old Town Park	Accessible Parking	319653	Per Public Right Of Way Access Guidelines, provide one accessible parking stall where on-street, marked parking is provided.	\$ 2,590	1	
Old Town Park	Accessible Parking	319654	The electric vehicle charger at the electric vehicle charging station (EVCS) is not compliant.	\$ 500	1	
Old Town Park	Picnic Area	319647	The picnic table surface height exceeds 34" or is lower than 28" above grade.	\$ -	2	
Old Town Park	Picnic Area	319644	BEST PRACTICE: Clear ground space around the picnic table is less than 36" width.	\$ 250	2	
Old Town Park	Picnic Area	319646	BEST PRACTICE: Clear ground space around the picnic table is less than 36" width. The picnic table does not allow a clear space for forward wheelchair approach with knee and toe clearance.	\$ 250	2	
Old Town Park	Picnic Area	319643	The picnic table does not allow a clear space for forward wheelchair approach with knee and toe clearance.	\$ 1,300	2	
Old Town Park	Playground	319671	The play component which has features that require reaching is not within the child's reach range.	\$ 5,000	4	
Old Town Park	Exterior Access Route	319636	Steps do not have uniform and compliant riser heights and/or tread depths.	\$ 18,360	1	
Old Town Park	Exterior Access Route	319649	Ground surfaces are not firm, stable and slip resistant.	\$ 80	1	
Old Town Park	Exterior Access Route	319652	Steps do not have uniform and compliant riser heights and/or tread depths.	\$ -	1	
Old Town Park	Exterior Access Route	319633	Handrails are not compliant.	\$ 9,780	1	
Old Town Park	Exterior Access Route	319635	Handrails are not compliant.	\$ 163	1	
Old Town Park	Exterior Access Route	319637	Handrails are not compliant.	\$ 163	1	
Old Town Park	Playground	319659	A level transfer space is not provided at the platform.	\$ 100	2	
Old Town Park	Playground	319661	The side of the transfer platform used for transfer is obstructed.	\$ 1,000	2	
Old Town Park	Playground	319663	The side of the transfer platform used for transfer is obstructed.	\$ 1,000	2	
Old Town Park	Playground	319664	A means of support is not provided at the transfer platform and/or transfer steps. The transfer platform connecting to elevated play elements has a non-compliant height lower than 11" or higher than 18".	\$ 330	2	
Old Town Park	Playground	319666	A means of support is not provided at transfer steps.	\$ 100	2	
Old Town Park	Playground	319668	A means of support is not provided at transfer steps.	\$ 990	2	
Old Town Park	Playground	319669	The side of the transfer platform used for transfer is obstructed.	\$ 1,000	2	
Old Town Park	Playground	319670	A level transfer space is not provided at the platform.	\$ 100	2	
Optimist Park	Amenity not evaluated	349834	The amenity was not assessed.	\$ -	0	
Optimist Park	Site Furnishings	349833	An adjacent clear space is not provided at the bench.	\$ 65	2	
Optimist Park	Exterior Access Route	324904	WASHINGTON: An exterior accessible route is not provided.	\$ 800	1	
Optimist Park	Exterior Access Route	324903	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 7,150	1	
Optimist Park	Exterior Access Route	324906	WASHINGTON: An exterior accessible route is not provided.	\$ 1,200	1	
Optimist Park	Accessible Parking	324905	WASHINGTON: A van stall, access aisle, and signage are not provided. Assembly area does not provide wheelchair spaces dispersed among seating locations.	\$ 11,860	1	
People's Park	Common Areas	330035	Companion seating is not provided adjacent wheelchair spaces.	\$ 3,147	2	
People's Park	Exterior Access Route	323363	WASHINGTON: The slope of the curb ramp run is not compliant.	\$ 1,750	1	
People's Park	Exterior Access Route	323364	The slope of the curb ramp flare is greater than 1:10 (10%).	\$ -	1	
People's Park	Exterior Access Route	323360	Knee and toe clearance is not provided at the lower level fountain.	\$ 2,505	4	
People's Park	Exterior Access Route	323358	The accessible route has gaps in the surface greater than 1/2" wide.	\$ 1,440	1	
People's Park	Exterior Access Route	323359	Walkway has areas of vertical level changes in excess of 1/4" that are not ramped.	\$ 220	1	
People's Park	Exterior Access Route	330033	The accessible route has gaps in the surface greater than 1/2" wide. A compliant sidewalk is not provided from the public transportation stop to the public facility entrance.	\$ 1,500	1	
People's Park	Exterior Access Route	323365	A compliant sidewalk is not provided from the public transportation stop to the public facility entrance.	\$ 19,820	1	
People's Park	Playground	323349	The ground surface has not been inspected and maintained regularly.	\$ 150	2	
People's Park	Playground	323355	The ground surface has not been inspected and maintained regularly.	\$ 600	2	
People's Park	Playground	323353	The entry points to a play component requiring transfer to entry points or seats is lower than 11" and higher than 24".	\$ 400	2	
People's Park	Playground	323357	The play component which has manipulative or interactive features that require reaching is not within the child's reach range.	\$ -	4	

PHASE FIVE						
PARK	CATEGORY	BARRIER ID	BARRIER DESCRIPTION	ESTIMATE	PRIORITY	
People's Park	Exterior Access Route	323348	A ramp is required but not provided. The transfer platform connecting to elevated play elements has a non-compliant height lower than 11" or higher than 18".	\$ 33,100	1	
People's Park	Playground	323356		\$ 200	2	
People's Park	Site Furnishings	323362	Clear ground space is not provided at the trash receptacle with lid requiring operation.	\$ 53	2	
Proctor Community Garden	Exterior Access Route	332563	WASHINGTON: An exterior accessible route is not provided.	\$ 12,275	1	
Proctor Community Garden	Exterior Access Route	334936	WASHINGTON: An exterior accessible route is not provided.	\$ 12,275	1	
Proctor Community Garden	Accessible Parking	332564	WASHINGTON: A van stall, access aisle, and signage are not provided and the slope and/or ground surface is/are not compliant.	\$ 11,860	1	
Proctor Community Garden	Exterior Access Route	360721	Planting beds requiring an obstructed side reach motion are lower than 15" minimum height above grade. Clear space is not provided on all sides of accessible planting beds.	\$ 159,262	2	
Puget Gulch	Trail	328405	BEST PRACTICE: The inaccessible trail or trail segment does not have signage with trail details.	\$ 280	4	
Puget Gulch	Trail	328402	BEST PRACTICE: The inaccessible trail or trail segment does not have signage with trail details. The curb ramp landing is not level. The slope of the curb ramp landing exceeds the maximum allowable 1:48 (2.08%).	\$ 280	4	
Puget Park	Exterior Access Route	328409		\$ 1,289	1	
Puget Park	Exterior Access Route	328422	WASHINGTON: The slope of the curb ramp run is not compliant.	\$ 8,750	1	
Puget Park	Exterior Access Route	328415	The accessible route has running slopes greater than 1:20 (5%).	\$ 3,972	1	
Puget Park	Exterior Access Route	328427	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 3,964	1	
Puget Park	Exterior Access Route	328407	The walkway does not have a compliant turning space at a change of direction.	\$ 714	1	
Puget Park	Exterior Access Route	328408	The walkway does not have a compliant turning space at a change of direction.	\$ 713	1	
Puget Park	Exterior Access Route	328410	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 5,946	1	
Puget Park	Exterior Access Route	328414	The walkway does not have a compliant turning space at a change of direction.	\$ 896	1	
Puget Park	Exterior Access Route	356284	WASHINGTON: An exterior accessible route is not provided. The accessible route within the play area that serves ground level play components does not have minimum 80" vertical clearance.	\$ 2,240	1	
Puget Park	Playground	328424	The accessible route within the play area that serves ground level play components does not have minimum 80" vertical clearance.	\$ 5,000	2	
Puget Park	Playground	328429	The accessible route within the play area that serves ground level play components does not have minimum 80" vertical clearance.	\$ 10,000	2	
Puget Park	Playground	328430	have minimum 80" vertical clearance.	\$ 10,000	2	
Puget Park	Playground	328423	The ground surface has not been inspected and maintained regularly.	\$ 1,125	2	
Puget Park	Accessible Parking	328411	The parking space slope is greater than 1:50 (2%).	\$ 6,300	1	
Puget Park	Accessible Parking	328412	WASHINGTON: Compliant signage is not provided at the van space and access aisle.	\$ 560	1	
Puget Park	Accessible Parking	328413	The access aisle slope is greater than 1:50 (2%).	\$ 5,000	1	
Puget Park	Picnic Area	328416	A compliant picnic table is not provided.	\$ 1,300	4	
Puget Park	Picnic Area	328421	BEST PRACTICE: Clear ground space around the picnic table is less than 36" width. The ramp run has a rise greater than 6"; however, handrails are not provided on both sides of the ramp. Edge protection is not provided on the ramp.	\$ 53	2	
Puget Park	Exterior Access Route	328420		\$ 3,260	1	
Puget Park	Playground	328426	A means of support is not provided at the transfer platform and/or transfer steps.	\$ 330	2	
Puget Park	Site Furnishings	328419	Clear ground space is not provided at the trash receptacle with lid requiring operation.	\$ 237	2	
Rogers Playfield	Exterior Access Route	349475	WASHINGTON: The slope of the curb ramp run is not compliant.	\$ 13,125	1	
Rogers Playfield	Site Furnishings	349479	The minimum number and types of drinking fountains are not provided.	\$ 8,000	4	
Rogers Playfield	Exterior Access Route	349474	WASHINGTON: An exterior accessible route is not provided.	\$ 1,660	1	
Rogers Playfield	Exterior Access Route	349473	WASHINGTON: An exterior accessible route is not provided.	\$ 8,856	1	
Rogers Playfield	Exterior Access Route	349478	The walkway does not have a compliant turning space at a change of direction.	\$ 619	1	
Rogers Playfield	Exterior Access Route	349481	The accessible route has gaps in the surface greater than 1/2" wide.	\$ 297	1	
Rogers Playfield	Exterior Access Route	349483	WASHINGTON: An exterior accessible route is not provided.	\$ 3,360	1	
Rogers Playfield	Exterior Access Route	349470	The accessible route has gaps in the surface greater than 1/2" wide.	\$ 371	1	
Rogers Playfield	Exterior Access Route	349471	The gate maneuvering clearance area is not compliant.	\$ 1,136	1	
Rogers Playfield	Exterior Access Route	349484	The gate maneuvering clearance area is not compliant.	\$ 1,136	1	
Rogers Playfield	Exterior Access Route	349485	The gates do not have a smooth surface within 10" of the ground.	\$ 320	2	
Rogers Playfield	Exterior Access Route	349480	The gate does not have a smooth surface within 10" of the ground.	\$ 320	2	
Rogers Playfield	Exterior Access Route	349482	The gate maneuvering clearance area is not compliant.	\$ 1,136	1	
Rogers Playfield	Playground	349476	The ground surface has not been inspected and maintained regularly.	\$ 200	2	
Rogers Playfield	Accessible Parking	349487	WASHINGTON: The van space is not compliant.	\$ 11,300	1	
Rogers Playfield	Exterior Access Route	362151	Element that requires a reach motion are less than 15" height for a side or front approach. Dispensers requiring an unobstructed side reach motion are higher than 48" maximum and/or lower than 15" minimum height above finish floor.	\$ 1,000	2	
Rogers Playfield	Exterior Access Route	349486		\$ 250	2	
Rogers Playfield	Playground	349477	The transfer steps are higher than 8" each.	\$ 3,255	2	
Rogers Playfield	Playground	362065	The side of the transfer platform used for transfer is obstructed.	\$ 625	2	
Roosevelt Park	Site Furnishings	322946	BEST PRACTICE: An adjacent clear space is not provided at the bench.	\$ 134	2	
Roosevelt Park	Site Furnishings	322940	BEST PRACTICE: An adjacent clear space is not provided at the bench.	\$ 134	2	
Roosevelt Park	Exterior Access Route	323883	WASHINGTON: An exterior accessible route is not provided.	\$ 4,648	1	
Roosevelt Park	Baseball/Softball Field	322935	WASHINGTON: An exterior accessible route is not provided.	\$ 99	1	
Roosevelt Park	Exterior Access Route	322934	WASHINGTON: An exterior accessible route is not provided.	\$ 896	1	
Roosevelt Park	Accessible Parking	322932	WASHINGTON: A van stall and access aisle are not marked and signage is not provided.	\$ 1,400	1	
Roosevelt Park	Site Furnishings	322945	WASHINGTON: An exterior accessible route is not provided.	\$ 79	1	
Roosevelt Park	Site Furnishings	322939	WASHINGTON: An exterior accessible route is not provided.	\$ 12,000	1	
Roosevelt Park	Site Furnishings	322933	WASHINGTON: An exterior accessible route is not provided.	\$ 3,837	1	
Roosevelt Park	Site Furnishings	322938	WASHINGTON: An exterior accessible route is not provided. The picnic table does not allow a clear space for forward wheelchair approach with knee and toe clearance.	\$ 1,008	1	
Roosevelt Park	Site Furnishings	322944		\$ 1,300	2	
Ryan's Park	Exterior Access Route	323792	WASHINGTON: An exterior accessible route is not provided.	\$ 9,856	1	
Ryan's Park	Exterior Access Route	323798	The accessible route has gaps in the surface greater than 1/2" wide.	\$ 241	1	
Ryan's Park	Exterior Access Route	323799	The accessible route has gaps in the surface greater than 1/2" wide. The accessible route has areas of vertical level changes in excess of 1/4" that are not beveled or ramped.	\$ 430	1	
Ryan's Park	Exterior Access Route	323800		\$ 158	1	
Ryan's Park	Accessible Parking	323801	WASHINGTON: A van stall, access aisle, and signage are not provided. The picnic table does not allow a clear space for forward wheelchair approach with knee and toe clearance.	\$ -	1	
Ryan's Park	Site Furnishings	323796		\$ 1,300	2	
Ryan's Park	Trail	323795	BEST PRACTICE: The inaccessible trail or trail segment does not have signage with trail details.	\$ 280	4	
Sawyer Tot Lot	Exterior Access Route	325330	The accessible route has gaps in the surface greater than 1/2" wide.	\$ 295	1	
Sawyer Tot Lot	Exterior Access Route	325332	The accessible route has gaps in the surface greater than 1/2" wide.	\$ 152	1	
Sawyer Tot Lot	Exterior Access Route	325341	The accessible route has gaps in the surface greater than 1/2" wide.	\$ 860	1	
Sawyer Tot Lot	Exterior Access Route	325342	The accessible route has gaps in the surface greater than 1/2" wide.	\$ 107	1	

PHASE FIVE						
PARK	CATEGORY	BARRIER ID	BARRIER DESCRIPTION	ESTIMATE	PRIORITY	
Sawyer Tot Lot	Exterior Access Route	325343	The accessible route has gaps in the surface greater than 1/2" wide.	\$ 53	1	
Sawyer Tot Lot	Accessible Parking	325329	The accessible route has greater than 1:20 (5%) running slope and 1:50 (2%) cross slope.	\$ 8,919	1	
Sawyer Tot Lot	Exterior Access Route	325323	The accessible route has gaps in the surface greater than 1/2" wide.	\$ 645	1	
Sawyer Tot Lot	Exterior Access Route	325338	The accessible route has gaps in the surface greater than 1/2" wide.	\$ 19	1	
Sawyer Tot Lot	Exterior Access Route	325339	The accessible route has gaps in the surface greater than 1/2" wide.	\$ 118	1	
Sawyer Tot Lot	Playground	325324	The ground surface has not been inspected and maintained regularly. The picnic table does not allow a clear space for forward wheelchair approach with knee and toe clearance.	\$ 1,450	2	
Sawyer Tot Lot	Site Furnishings	325331	BEST PRACTICE: The table does not have minimum 36" wide clear ground space on all usable sides of the table.	\$ 1,300	2	
Sawyer Tot Lot	Picnic Area	325333	The transfer platform connecting to elevated play elements has a non-compliant height higher than 18".	\$ 107	4	
Sawyer Tot Lot	Playground	325325	The transfer platform connecting to elevated play elements has a non-compliant height lower than 11" or higher than 18".	\$ 400	2	
Sawyer Tot Lot	Playground	325335	The trash receptacle with lid requiring operation is out of reach range.	\$ 5,000	2	
Sawyer Tot Lot	Site Furnishings	325326	WASHINGTON: A curb ramp is required but not provided.	\$ 198	2	
Sheridan Park	Exterior Access Route	324064	The minimum number and types of drinking fountains are not provided.	\$ 2,187	1	
Sheridan Park	Site Furnishings	324056	A clear space is not positioned at the lower level drinking fountain for a forward approach and centered on the unit.	\$ 8,000	4	
Sheridan Park	Site Furnishings	324057	The accessible route has gaps in the surface greater than 1/2" wide.	\$ 237	4	
Sheridan Park	Exterior Access Route	324051	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 198	1	
Sheridan Park	Exterior Access Route	324063	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 594	1	
Sheridan Park	Exterior Access Route	324060	A compliant turning space is not provided at a change of direction.	\$ 1,189	1	
Sheridan Park	Exterior Access Route	324061	WASHINGTON: The clear width of the exterior accessible route is less than 44".	\$ 713	1	
Sheridan Park	Exterior Access Route	324062	The walkway does not have a compliant turning space at a change of direction.	\$ 495	1	
Sheridan Park	Exterior Access Route	324052	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 713	1	
Sheridan Park	Exterior Access Route	324053	The accessible route has gaps in the surface greater than 1/2" wide.	\$ 832	1	
Sheridan Park	Exterior Access Route	324068	BEST PRACTICE: An accessible 48" x 48" clear ground space is not located on all usable sides of the grill, and the clear space is not centered on the grill.	\$ 39	1	
Sheridan Park	Site Furnishings	324058	BEST PRACTICE: An accessible 48" x 48" clear ground space is not located on all usable sides of the grill, and the clear space is not centered on each usable side of the grill.	\$ 237	4	
Sheridan Park	Site Furnishings	324055	The ground surface has not been inspected and maintained regularly.	\$ 237	4	
Sheridan Park	Playground	324065	The picnic table does not allow a clear space for forward wheelchair approach with knee and toe clearance.	\$ 1,000	2	
Sheridan Park	Site Furnishings	324059	The picnic table does not allow a clear space for forward wheelchair approach with knee and toe clearance.	\$ 1,300	2	
Sheridan Park	Site Furnishings	324054	The transfer platform for connecting to elevated play elements has non-compliant dimensions.	\$ 1,300	2	
Sheridan Park	Playground	324066	The transfer steps are higher than 8" each.	\$ 2,986	2	
Sheridan Park	Playground	324067	Assembly areas do not provide wheelchair spaces.	\$ 3,255	2	
Tacoma Nature Center and Snake Lake Natural Area	Common Areas	346073	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ 1,384	2	
Tacoma Nature Center and Snake Lake Natural Area	Entrance to Building	346106	The pull side of the accessible door does not have the required maneuvering clearances.	\$ 366	1	
Tacoma Nature Center and Snake Lake Natural Area	Entrance to Building	346107	A landing at the top of the curb ramp is not present.	\$ 1,250	1	
Tacoma Nature Center and Snake Lake Natural Area	Exterior Access Route	346048	The slope of the lower landing of the parallel curb ramp is greater than 2.08%.	\$ 1,289	1	
Tacoma Nature Center and Snake Lake Natural Area	Exterior Access Route	346057	The curb ramp landing is not level. The slope of the curb ramp landing exceeds the maximum allowable 1:48 (2.08%).	\$ 2,187	1	
Tacoma Nature Center and Snake Lake Natural Area	Exterior Access Route	346058	Work Surfaces for Children between ages 5 and 12: Minimum 5% of the work surface is not between 26" minimum and 30" maximum height, with knee and toe clearance for children at 24" minimum above floor or ground level.	\$ 1,289	1	
Tacoma Nature Center and Snake Lake Natural Area	Common Areas	346109	The minimum number and types of drinking fountains are not provided.	\$ 3,658	2	
Tacoma Nature Center and Snake Lake Natural Area	Site Furnishings	346060	A clear space is not positioned at the lower level drinking fountain for a forward approach and centered on the unit.	\$ 8,000	4	
Tacoma Nature Center and Snake Lake Natural Area	Site Furnishings	346061	The minimum number of drinking fountains is not provided.	\$ 65	4	
Tacoma Nature Center and Snake Lake Natural Area	Interior Access Route	346075	A clear space is not positioned at the lower level drinking fountain for a forward approach and centered on the unit.	\$ 5,439	4	
Tacoma Nature Center and Snake Lake Natural Area	Interior Access Route	346076	The elevator car emergency communication system is not compliant.	\$ 918	4	
Tacoma Nature Center and Snake Lake Natural Area	Interior Access Route	346096	Characters or numbers are not compliant on the hoistways.	\$ 8,050	1	
Tacoma Nature Center and Snake Lake Natural Area	Interior Access Route	346097	A tactile, raised star minimum 2" high is not provided to the left of the floor designation on both jambs at the main elevator entry level.	\$ 1,100	2	
Tacoma Nature Center and Snake Lake Natural Area	Interior Access Route	346098	Visible and audible signal fixtures indicating which car is answering the call and the car's direction of travel are not compliant.	\$ 280	3	
Tacoma Nature Center and Snake Lake Natural Area	Interior Access Route	346229	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 1,375	3	
Tacoma Nature Center and Snake Lake Natural Area	Exterior Access Route	346041	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 1,783	1	
Tacoma Nature Center and Snake Lake Natural Area	Exterior Access Route	346043	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 1,783	1	
Tacoma Nature Center and Snake Lake Natural Area	Exterior Access Route	346049	WASHINGTON: An exterior accessible route is not provided.	\$ 1,120	1	
Tacoma Nature Center and Snake Lake Natural Area	Exterior Access Route	346111	WASHINGTON: An exterior accessible route is not provided.	\$ 4,032	1	
Tacoma Nature Center and Snake Lake Natural Area	Exterior Access Route	346052	WASHINGTON: An exterior accessible route is not provided.	\$ 1,344	1	
Tacoma Nature Center and Snake Lake Natural Area	Accessible Parking	346042	The slope of the parking space is greater than 1:50 (2%).	\$ 6,300	1	
Tacoma Nature Center and Snake Lake Natural Area	Accessible Parking	346055	The access aisle slope is greater than 1:50 (2%).	\$ 5,000	1	
Tacoma Nature Center and Snake Lake Natural Area	Accessible Parking	346056	The slope of the parking space is greater than 1:50 (2%).	\$ 6,300	1	
Tacoma Nature Center and Snake Lake Natural Area	Accessible Parking	346045	The access aisle slope is greater than 1:50 (2%).	\$ 5,000	1	
Tacoma Nature Center and Snake Lake Natural Area	Accessible Parking	346047	The parking space slope is greater than 1:50 (2%).	\$ 6,300	1	
Tacoma Nature Center and Snake Lake Natural Area	Picnic Shelter	346053	The picnic table does not allow a clear space for forward wheelchair approach with knee and toe clearance.	\$ 6,500	2	
Tacoma Nature Center and Snake Lake Natural Area	Interior Access Route	346072	Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path.	\$ 728	1	
Tacoma Nature Center and Snake Lake Natural Area	Interior Access Route	346068	The protruding object in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the interior accessible route and are not within reach range.	\$ 728	1	
Tacoma Nature Center and Snake Lake Natural Area	Restroom	346102	The restroom circulation path is not free of objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.	\$ 93	2	
Tacoma Nature Center and Snake Lake Natural Area	Restroom	346081	The restroom circulation path is not free of objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.	\$ 400	2	
Tacoma Nature Center and Snake Lake Natural Area	Exterior Access Route	346059	WASHINGTON: The slopes of the ramp are not compliant.	\$ 3,310	1	
Tacoma Nature Center and Snake Lake Natural Area	Exterior Access Route	346062	WASHINGTON: The slopes of the ramp are not compliant.	\$ 6,620	1	

PHASE FIVE						
PARK	CATEGORY	BARRIER ID	BARRIER DESCRIPTION	ESTIMATE	PRIORITY	
Tacoma Nature Center and Snake Lake Natural Area	Interior Access Route	346093	Items requiring an unobstructed side reach motion are higher than 48" maximum and/or lower than 15" minimum height above finish floor.	\$ 200	2	
Tacoma Nature Center and Snake Lake Natural Area	Interior Access Route	346110	Items that require a forward reach motion require more than 48" height reach.	\$ 200	2	
Tacoma Nature Center and Snake Lake Natural Area	Restroom	346091	Dispenser and/or dispenser controls are not within an allowable reach range.	\$ 100	3	
Tacoma Nature Center and Snake Lake Natural Area	Restroom	346080	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ 732	3	
Tacoma Nature Center and Snake Lake Natural Area	Restroom	346079	The push side of the door does not have the required maneuvering clearances.	\$ 1,250	3	
Tacoma Nature Center and Snake Lake Natural Area	Restroom	346082	The wheelchair stall door is not self closing.	\$ 293	3	
Tacoma Nature Center and Snake Lake Natural Area	Restroom	346101	Pipes are not insulated.	\$ 65	3	
Tacoma Nature Center and Snake Lake Natural Area	Restroom	346103	The lavatory is mounted higher than 34" to the higher of the rim or counter.	\$ 720	3	
Tacoma Nature Center and Snake Lake Natural Area	Restroom	346077	The provided signage is not on the latch side of the door and is not mounted at a compliant height.	\$ 55	3	
Tacoma Nature Center and Snake Lake Natural Area	Restroom	346089	The urinal dimensions are not compliant.	\$ 935	3	
Tacoma Nature Center and Snake Lake Natural Area	Restroom	346090	The clear floor space at the urinal is less than minimum 30" by minimum 48".	\$ 1,100	3	
Tacoma Nature Center and Snake Lake Natural Area	Restroom	346104	The flush control is located on the closed side of the toilet.	\$ 313	3	
Tacoma Nature Center and Snake Lake Natural Area	Restroom	346105	Projecting dispenser above the grab bar is less than 12" minimum from the top of the gripping surface of the grab bar.	\$ 100	3	
Tacoma Nature Center and Snake Lake Natural Area	Restroom	346108	WASHINGTON: The toilet paper dispenser location is not compliant.	\$ 293	3	
Tacoma Nature Center and Snake Lake Natural Area	Restroom	346086	The centerline of the toilet in the wheelchair stall is not 16" minimum to 18" maximum from the sidewall.	\$ 1,260	3	
Tacoma Nature Center and Snake Lake Natural Area	Restroom	346085	The flush control is located on the closed side and/or is not within reach range.	\$ 313	3	
Tacoma Nature Center and Snake Lake Natural Area	Restroom	346083	The hardware at the wheelchair stall door is not compliant.	\$ 732	3	
Tacoma Nature Center and Snake Lake Natural Area	Restroom	394769	ANSI A117.1-2009 : A vertical side grab bar is not present in the wheelchair stall.	\$ 443	3	
Tacoma Nature Center and Snake Lake Natural Area	Restroom	363280	ANSI A117.1-: A vertical side grab bar is not located in the restroom.	\$ 443	3	
Tacoma Nature Center and Snake Lake Natural Area	Restroom	363611	ANSI A117.1-: A vertical side grab bar is not located in the toilet stall.	\$ 887	3	
Tacoma Nature Center and Snake Lake Natural Area	Restroom	394770	ANSI A117.1-2009 : A vertical side grab bar is not present in the wheelchair stall.	\$ 443	3	
Tacoma Nature Center and Snake Lake Natural Area	Restroom	346087	Projecting dispenser above the grab bar is less than 12" minimum above the top of the gripping surface of the grab bar.	\$ 250	3	
Tacoma Nature Center and Snake Lake Natural Area	Restroom	363612	The space between the grab bar and projecting objects above the grab bar is less than 12" minimum.	\$ 375	3	
Tacoma Nature Center and Snake Lake Natural Area	Trail	346050	BEST PRACTICE: The inaccessible trail does not have signage with trail details.	\$ 280	4	
Tacoma Nature Center and Snake Lake Natural Area	Exterior Access Route	346228	Signage identifying a permanent outdoor space does not have Braille.	\$ 116	4	
Tacoma Nature Center and Snake Lake Natural Area	Interior Access Route	346069	The existing signage is not mounted at the latch side of the door.	\$ 55	2	
Tacoma Nature Center and Snake Lake Natural Area	Interior Access Route	346070	The existing signage is not mounted at the latch side of the door and is missing the Braille component.	\$ 55	2	
Tacoma Nature Center and Snake Lake Natural Area	Trail	346054	BEST PRACTICE: The inaccessible trail does not have signage with trail details.	\$ 280	4	
Tacoma Nature Center and Snake Lake Natural Area	Interior Access Route	346092	The sink rim is higher than 34".	\$ 720	2	
Tacoma Nature Center and Snake Lake Natural Area	Interior Access Route	346066	The sink rim is higher than 34", and does not have knee and toe clearance (does not apply to mop basins, utility sinks, or bar sinks).	\$ 720	2	
Titlow Park	Trail	324319	The inaccessible trail or trail segment does not have signage with trail details.	\$ 560	4	
Titlow Park	Entrance to Building	324753	The surface of the door within 10 inches of the finish floor or ground for the full width of the door on the push side is not smooth.	\$ 400	2	
Titlow Park	Entrance to Building	324763	The surface of the door within 10 inches of the finish floor or ground for the full width of the door on the push side is not smooth.	\$ 5,200	2	
Titlow Park	Entrance to Building	324764	The threshold at the accessible door is greater than 1/2" in height.	\$ 358	1	
Titlow Park	Entrance to Building	324771	The pull side of the accessible door does not have the required maneuvering clearances.	\$ 2,500	1	
Titlow Park	Entrance to Building	324768	The pull side of the accessible door does not have the required maneuvering clearances.	\$ 1,250	1	
Titlow Park	Entrance to Building	324769	The pull side of the accessible door does not have the required maneuvering clearances.	\$ 1,250	1	
Titlow Park	Common Areas	324767	The sales or service counter does not have an accessible portion with maximum 36" height surface above finish floor or ground.	\$ 3,609	2	
Titlow Park	Exterior Access Route	324301	The curb ramp projects into vehicular traffic lanes, parking space, or associated access aisle.	\$ 2,187	1	
Titlow Park	Exterior Access Route	324302	The curb ramp projects into vehicular traffic lanes, parking space, or associated access aisle.	\$ 1,750	1	
Titlow Park	Exterior Access Route	354616	A curb ramp is not provided where the accessible route crosses a curb.	\$ 2,187	1	
Titlow Park	Interior Access Route	324765	The door has less than 32" clear width.	\$ 2,600	1	
Titlow Park	Interior Access Route	324745	The door has less than 32" clear width.	\$ 2,600	1	
Titlow Park	Interior Access Route	324746	The pull side of the accessible door does not have the required maneuvering clearances.	\$ 1,250	1	
Titlow Park	Interior Access Route	324741	The push side of the accessible door does not have the required maneuvering clearances.	\$ 1,250	1	
Titlow Park	Interior Access Route	324742	The door has less than 32" clear width.	\$ 2,600	1	
Titlow Park	Interior Access Route	324755	The minimum number of drinking fountains is not provided. If the minimum number is provided, two levels or a hi-lo are not provided. If more than 2 are provided, less than 50% are high or less than 50% are low.	\$ 5,439	4	
Titlow Park	Interior Access Route	324761	The building does not have elevator access between stories.	\$ 80,000	1	
Titlow Park	Exterior Access Route	324296	WASHINGTON: An exterior accessible route is not provided.	\$ 3,360	1	
Titlow Park	Exterior Access Route	324297	WASHINGTON: An exterior accessible route is not provided.	\$ 3,494	1	
Titlow Park	Exterior Access Route	324580	WASHINGTON: An exterior accessible route is not provided.	\$ 2,150	1	
Titlow Park	Exterior Access Route	324303	WASHINGTON: An exterior accessible route is not provided.	\$ 6,720	1	
Titlow Park	Exterior Access Route	324283	WASHINGTON: An exterior accessible route is not provided.	\$ 13,440	1	
Titlow Park	Exterior Access Route	324582	WASHINGTON: An exterior accessible route is not provided.	\$ 860	1	
Titlow Park	Exterior Access Route	324295	WASHINGTON: An exterior accessible route is not provided.	\$ 1,003	1	
Titlow Park	Exterior Access Route	324486	WASHINGTON: An exterior accessible route is not provided.	\$ 1,684	1	
Titlow Park	Historic Structure	329911	WASHINGTON: The historic property requires alteration to make it accessible.	\$ -	1	
Titlow Park	Accessible Parking	324294	WASHINGTON: A car stall, access aisle, and signage are not provided.	\$ 11,580	1	
Titlow Park	Accessible Parking	354642	WASHINGTON: A car stall, access aisle, and signage are not provided.	\$ 11,580	1	
Titlow Park	Accessible Parking	324300	The slope of the parking space is greater than 1:50 (2%).	\$ 6,300	1	
Titlow Park	Accessible Parking	324482	The slope of the parking space is greater than 1:50 (2%).	\$ 6,300	1	
Titlow Park	Accessible Parking	324293	WASHINGTON: A van stall, access aisle, and signage are not provided.	\$ 11,580	1	
Titlow Park	Accessible Parking	354641	WASHINGTON: A van stall, access aisle, and signage are not provided.	\$ 11,580	1	
Titlow Park	Accessible Parking	324480	The parking space slope is greater than 1:50 (2%).	\$ 6,300	1	
Titlow Park	Baseball/Softball Field	324581	A wheelchair space is not provided at each team bench area at the ball field.	\$ 104	2	
Titlow Park	Exterior Access Route	324487	WASHINGTON: The slopes of the ramp are not compliant.	\$ 26,480	1	

PHASE FIVE						
PARK	CATEGORY	BARRIER ID	BARRIER DESCRIPTION	ESTIMATE	PRIORITY	
Titlow Park	Exterior Access Route	324488	Handrails are not compliant. The centerline of the toilet in the ambulatory stall is not 17" minimum to 19" maximum from the sidewalk.	\$ 163	1	
Titlow Park	Restroom	324287		\$ 200	3	
Titlow Park	Restroom	324288	The pull side of the accessible door does not have the required maneuvering clearances.	\$ 1,250	3	
Titlow Park	Restroom	324284	The pull side of the accessible door does not have the required maneuvering clearances.	\$ 1,250	3	
Titlow Park	Restroom	324290	The height of the water closet is not 17" minimum to 19" maximum above finished floor. The centerline of the toilet in the ambulatory stall is not 17" minimum to 19" maximum from the sidewalk.	\$ 630	3	
Titlow Park	Restroom	324286		\$ 630	3	
Titlow Park	Restroom	324292	The height of the water closet is not 17" minimum to 19" maximum above finished floor.	\$ 630	3	
Titlow Park	Restroom	324307	The height of the water closet is not 17" minimum to 19" maximum above finished floor.	\$ 630	3	
Titlow Park	Restroom	324309	The height of the water closet is not 17" minimum to 19" maximum above finished floor.	\$ 630	3	
Titlow Park	Restroom	324736	The flush control is located on the closed side and/or is not within reach range.	\$ 313	3	
Titlow Park	Restroom	324737	The grab bars at the water closet are not compliant.	\$ 710	3	
Titlow Park	Restroom	324738	The water closet in a single user / unisex restroom does not have the required clearance.	\$ 1,368	3	
Titlow Park	Restroom	324739	The entire restroom is not compliant due to limited room dimensions.	\$ 12,000	3	
Titlow Park	Restroom	324747	WASHINGTON: The toilet paper dispenser location is not compliant.	\$ 293	3	
Titlow Park	Restroom	324748	The flush control is located on the closed side and/or is not within reach range. The space between the grab bar and projecting objects above the grab bar is less than 12" minimum.	\$ 313	3	
Titlow Park	Restroom	324749		\$ 125	3	
Titlow Park	Trail	324318	BEST PRACTICE: The inaccessible trail or trail segment does not have signage with trail details.	\$ 280	4	
Titlow Park	Trail	324320	BEST PRACTICE: The accessible trail or trail segment does not have signage with trail details.	\$ 280	4	
Titlow Park	Interior Access Route	324757	Handrail extensions are not compliant.	\$ 326	1	
Titlow Park	Interior Access Route	324758	Handrails are not provided.	\$ 1,630	1	
Ursich Park	Exterior Access Route	319680	Signage with visual lettering is located lower than 40" from the ground surface.	\$ 280	4	
Ursich Park	Accessible Parking	319681	No marked, on-street parking is provided. No off-street parking is provided.	\$ -	1	
Ursich Park	Trail	319683	BEST PRACTICE: The trail is inaccessible and cannot be made accessible.	\$ -	4	
Ursich Park	Trail	319684	BEST PRACTICE: The trail is inaccessible and cannot be made accessible.	\$ -	4	
Ursich Park	Trail	319682	The inaccessible trail or trail segment does not have signage with trail details. The counter slopes of adjoining gutters and streets at the curb ramp are greater than 1:20 (5%).	\$ 280	4	
Vassault Park	Exterior Access Route	324952	The counter slopes of adjoining gutters and streets at the curb ramp are greater than 1:20 (5%).	\$ 1,750	1	
Vassault Park	Exterior Access Route	324971	The lawn seating and exterior overflow seating areas, where fixed seating is not provided, do not connect to an accessible route.	\$ 1,750	1	
Vassault Park	Soccer Field	324965		\$ 17,880	2	
Vassault Park	Accessible Parking	324970	The access aisle slope is greater than 1:50 (2%).	\$ 5,000	1	
Vassault Park	Accessible Parking	324956	The slope of the parking space is greater than 1:50 (2%). WASHINGTON: A car stall, access aisle, and signage are not provided and the slope and/or ground surface is/are not compliant.	\$ 6,300	1	
Vassault Park	Accessible Parking	324966		\$ 11,860	1	
Vassault Park	Accessible Parking	324967	The slope of the parking space is greater than 1:50 (2%).	\$ 6,300	1	
Vassault Park	Accessible Parking	324953	WASHINGTON: The van stall is not compliant.	\$ 6,300	1	
Vassault Park	Restroom	324960	The pull side of the accessible door does not have the required maneuvering clearance.	\$ 1,250	3	
Vassault Park	Restroom	324963	The pull side of the accessible door does not have the required maneuvering clearances.	\$ 1,250	3	
Vassault Park	Trail	325166	BEST PRACTICE: The inaccessible trail or trail segment does not have signage with trail details.	\$ 560	4	
Vassault Park	Basketball Court	324972	An accessible route does not directly connect each side of the court outside of play lines.	\$ 3,361	1	
Vassault Park	Basketball Court	324973	An accessible route does not directly connect each side of the court outside of play lines.	\$ 3,361	1	
Verlo Playfield	Site Furnishings	349837	BEST PRACTICE: An adjacent clear space is not provided at the bench. The curb ramp landing is not level. The slope of the curb ramp landing exceeds the maximum allowable 1:48 (2.08%).	\$ 134	2	
Verlo Playfield	Exterior Access Route	349835		\$ 48,337	1	
Verlo Playfield	Exterior Access Route	349848	WASHINGTON: The slope of the curb ramp run is not compliant.	\$ 13,125	1	
Verlo Playfield	Exterior Access Route	349843	Knee and toe clearance is not provided at the lower level fountain.	\$ 3,131	4	
Verlo Playfield	Site Furnishings	349844	The minimum number and types of drinking fountains are not provided. A clear space is not positioned at the lower level drinking fountain for a forward approach and centered on the unit.	\$ 8,000	4	
Verlo Playfield	Site Furnishings	349845		\$ 52	4	
Verlo Playfield	Exterior Access Route	349851	WASHINGTON: An exterior accessible route is not provided.	\$ 3,024	1	
Verlo Playfield	Exterior Access Route	349855	WASHINGTON: An exterior accessible route is not provided.	\$ 14,560	1	
Verlo Playfield	Exterior Access Route	349854	WASHINGTON: An exterior accessible route is not provided.	\$ 1,947	1	
Verlo Playfield	Exterior Access Route	349858	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 13,874	1	
Verlo Playfield	Exterior Access Route	349859	The accessible route has gaps in the surface greater than 1/2" wide. The accessible route has areas of vertical level changes in excess of 1/4" that are not beveled or ramped.	\$ 3,059	1	
Verlo Playfield	Exterior Access Route	349849		\$ 53	1	
Verlo Playfield	Playground	349838	The ground surface has not been inspected and maintained regularly. BEST PRACTICE: The table does not have minimum 36" wide clear ground space on all usable sides of the table.	\$ 100	2	
Verlo Playfield	Picnic Area	349853		\$ 728	4	
Verlo Playfield	Playground	349856	The play component requires transfer to entry points or seats, but at least one means of support is not provided. The entry points to a play component requiring transfer to entry points or seats is lower than 11" and higher than 24".	\$ 500	2	
Verlo Playfield	Playground	349857		\$ 500	2	
Verlo Playfield	Playground	349846	The entry points to a play component requiring transfer to entry points or seats is lower than 11" and higher than 24".	\$ 800	2	
Verlo Playfield	Restroom	349839	The pull side of the accessible door does not have the required maneuvering clearances.	\$ 2,500	3	
Verlo Playfield	Restroom	349847	The lavatory is mounted higher than 34" to the top of the rim.	\$ 720	3	

PHASE FIVE						
PARK	CATEGORY	BARRIER ID	BARRIER DESCRIPTION	ESTIMATE	PRIORITY	
Verlo Playfield	Restroom	349842	The height of the water closet is not 17" minimum to 19" maximum above finished floor.	\$ 630	3	
Verlo Playfield	Restroom	364228	ANSI A117.1:- A vertical side grab bar is not located in the wheelchair stall.	\$ 887	3	
Verlo Playfield	Trail	349836	BEST PRACTICE: The inaccessible trail or trail segment does not have signage with trail details.	\$ 1,400	4	
Verlo Playfield	Basketball Court	349852	An accessible route does not directly connect each side of the court outside of play lines.	\$ 5,900	1	
Wapato Hills Park	Trail	322572	BEST PRACTICE: The trail is less than 36" wide.	\$ 200	4	
Wapato Hills Park	Site Furnishings	322629	BEST PRACTICE: An adjacent clear space is not provided at the bench.	\$ 107	2	
Wapato Hills Park	Site Furnishings	322615	BEST PRACTICE: An adjacent clear space is not provided at the bench.	\$ 107	2	
Wapato Hills Park	Site Furnishings	322619	BEST PRACTICE: An adjacent clear space is not provided at the bench.	\$ 107	2	
Wapato Hills Park	Site Furnishings	322606	BEST PRACTICE: An adjacent clear space is not provided at the bench.	\$ 107	2	
Wapato Hills Park	Site Furnishings	322610	BEST PRACTICE: An adjacent clear space is not provided at the bench.	\$ 107	2	
Wapato Hills Park	Site Furnishings	322632	BEST PRACTICE: An adjacent clear space is not provided at the bench.	\$ 107	2	
Wapato Hills Park	Exterior Access Route	322584	Knee and toe clearance is not provided at the lower level fountain.	\$ 2,505	4	
Wapato Hills Park	Exterior Access Route	322600	WASHINGTON: The cross slopes of the exterior accessible route are not compliant.	\$ 1,982	1	
Wapato Hills Park	Exterior Access Route	322591	The accessible route has gaps in the surface greater than 1/2" wide.	\$ 158	1	
Wapato Hills Park	Exterior Access Route	322594	The accessible route has gaps in the surface greater than 1/2" wide.	\$ 158	1	
Wapato Hills Park	Exterior Access Route	322613	WASHINGTON: The cross slopes of the exterior accessible route are not compliant.	\$ 3,964	1	
Wapato Hills Park	Exterior Access Route	322628	Walkway has areas of vertical level changes in excess of 1/4" that are not ramped.	\$ 99	1	
Wapato Hills Park	Exterior Access Route	322625	WASHINGTON: An exterior accessible route is not provided.	\$ 922	1	
Wapato Hills Park	Exterior Access Route	322616	WASHINGTON: The cross slopes of the exterior accessible route are not compliant.	\$ 3,964	1	
Wapato Hills Park	Exterior Access Route	322617	Walkway has areas of vertical level changes in excess of 1/4" that are not ramped.	\$ 99	1	
Wapato Hills Park	Exterior Access Route	322618	WASHINGTON: The cross slopes of the exterior accessible route are not compliant.	\$ 3,964	1	
Wapato Hills Park	Exterior Access Route	322620	WASHINGTON: The cross slopes of the exterior accessible route are not compliant.	\$ 1,982	1	
Wapato Hills Park	Exterior Access Route	322621	WASHINGTON: The cross slopes of the exterior accessible route are not compliant.	\$ 2,973	1	
Wapato Hills Park	Exterior Access Route	322622	WASHINGTON: The cross slopes of the exterior accessible route are not compliant.	\$ 2,973	1	
Wapato Hills Park	Exterior Access Route	322623	WASHINGTON: The cross slopes of the exterior accessible route are not compliant.	\$ 991	1	
Wapato Hills Park	Exterior Access Route	322624	WASHINGTON: The cross slopes of the exterior accessible route are not compliant.	\$ 991	1	
Wapato Hills Park	Exterior Access Route	322609	The accessible route has gaps in the surface greater than 1/2" wide.	\$ 198	1	
Wapato Hills Park	Exterior Access Route	322611	WASHINGTON: The cross slopes of the exterior accessible route are not compliant.	\$ 5,946	1	
Wapato Hills Park	Exterior Access Route	322637	WASHINGTON: The cross slopes of the exterior accessible route are not compliant.	\$ 5,946	1	
Wapato Hills Park	Exterior Access Route	322636	WASHINGTON: The cross slopes of the exterior accessible route are not compliant.	\$ 1,982	1	
Wapato Hills Park	Playground	322633	The ground surface has not been inspected and maintained regularly.	\$ 3,890	2	
Wapato Hills Park	Accessible Parking	322597	The access aisle is less than 60" wide.	\$ 420	1	
Wapato Hills Park	Accessible Parking	322598	The slope of the parking space is greater than 1:50 (2%).	\$ 6,300	1	
Wapato Hills Park	Accessible Parking	322595	WASHINGTON: A van stall, access aisle, and signage are not provided and the slope and/or ground surface is/are not compliant.	\$ 11,300	1	
Wapato Hills Park	Site Furnishings	322630	The picnic table does not allow a clear space for forward wheelchair approach with knee and toe clearance.	\$ 1,300	2	
Wapato Hills Park	Site Furnishings	322626	The picnic table does not allow a clear space for forward wheelchair approach with knee and toe clearance.	\$ 1,300	2	
Wapato Hills Park	Site Furnishings	322627	BEST PRACTICE: The table does not have minimum 36" wide clear ground space on all usable sides of the table.	\$ 1,290	4	
Wapato Hills Park	Site Furnishings	322585	The picnic table does not allow a clear space for forward wheelchair approach with knee and toe clearance.	\$ 1,300	2	
Wapato Hills Park	Site Furnishings	322586	BEST PRACTICE: The table does not have minimum 36" wide clear ground space on all usable sides of the table.	\$ 645	4	
Wapato Hills Park	Site Furnishings	322587	The picnic table does not allow a clear space for forward wheelchair approach with knee and toe clearance.	\$ 1,300	2	
Wapato Hills Park	Restroom	322575	The restroom circulation path is not free of objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.	\$ 750	2	
Wapato Hills Park	Restroom	322583	The restroom circulation path is not free of objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.	\$ 500	2	
Wapato Hills Park	Restroom	322576	The hardware at the accessible door requires tight grasping, pinching and twisting of the wrist to operate.	\$ 293	3	
Wapato Hills Park	Restroom	322573	The centerline of the toilet in the wheelchair stall is not 16" minimum to 18" maximum from the sidewall.	\$ 630	3	
Wapato Hills Park	Restroom	322574	The rear grab bar at the water closet is not compliant.	\$ 355	3	
Wapato Hills Park	Trail	322570	BEST PRACTICE: The inaccessible trail does not have signage with trail details.	\$ 280	4	
Wapato Hills Park	Trail	322568	BEST PRACTICE: The inaccessible trail does not have signage with trail details.	\$ 280	4	
Wapato Hills Park	Trail	322569	BEST PRACTICE: The inaccessible trail or trail segment does not have signage with trail details.	\$ 1,120	4	
Wapato Hills Park	Trail	322571	BEST PRACTICE: The inaccessible trail or trail segment does not have signage with trail details.	\$ 280	4	
Wapato Hills Park	Exterior Access Route	322588	WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 140	3	
Wapato Hills Park	Exterior Access Route	322589	Handrails are not compliant.	\$ 1,304	1	
Wapato Hills Park	Exterior Access Route	322590	Handrail extensions are not compliant.	\$ 163	1	
Wapato Hills Park	Exterior Access Route	322592	WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 176	3	
Wapato Hills Park	Exterior Access Route	322593	Handrails are not compliant.	\$ 1,304	1	
Wapato Hills Park	Playground	322634	The transfer steps are less than 24" wide and/or 14" deep.	\$ 1,000	2	
Wapato Park & Pavilion	Interior Access Route	301529	The existing signage is not mounted at the latch side of the door or at a compliant height.	\$ 55	2	
Wapato Park & Pavilion	Beach	301588	The beach access route is not compliant or is not provided.	\$ 430	1	
Wapato Park & Pavilion	Site Furnishings	301449	An adjacent clear space is not provided at the bench.	\$ 237	2	
Wapato Park & Pavilion	Site Furnishings	301448	An adjacent clear space is not provided at the bench.	\$ 107	2	
Wapato Park & Pavilion	Site Furnishings	301486	An adjacent clear space is not provided at the bench.	\$ 107	2	
Wapato Park & Pavilion	Entrance to Building	301548	The threshold at the accessible door is greater than 1/2" in height.	\$ 179	1	
Wapato Park & Pavilion	Entrance to Building	301565	The push side of the accessible door does not have the required maneuvering clearances.	\$ 1,250	1	
Wapato Park & Pavilion	Common Areas	301590	Controls and/or dispensers are not within an allowable reach range.	\$ 200	4	
Wapato Park & Pavilion	Common Areas	301433	Controls and/or dispensers are not within an allowable reach range.	\$ 200	4	
Wapato Park & Pavilion	Restroom	301558	The height of controls are not compliant.	\$ 200	3	
Wapato Park & Pavilion	Common Areas	301614	Controls and/or dispensers are not within an allowable reach range.	\$ 200	4	

PHASE FIVE						
PARK	CATEGORY	BARRIER ID	BARRIER DESCRIPTION	ESTIMATE	PRIORITY	
Wapato Park & Pavilion	Exterior Access Route	301634	The curb ramp landing is not level. The slope of the curb ramp landing exceeds the maximum allowable 1:48 (2.08%).	\$ 1,289	1	
Wapato Park & Pavilion	Exterior Access Route	301572	The curb ramp landing is not level. The slope of the curb ramp landing exceeds the maximum allowable 1:48 (2.08%).	\$ 1,289	1	
Wapato Park & Pavilion	Exterior Access Route	301573	The curb ramp landing is not level. The slope of the curb ramp landing exceeds the maximum allowable 1:48 (2.08%).	\$ 1,289	1	
Wapato Park & Pavilion	Interior Access Route	301497	Double-leaf doors are used and neither side is compliant.	\$ 5,200	1	
Wapato Park & Pavilion	Interior Access Route	301504	Double-leaf doors are used and neither side is compliant.	\$ 5,200	1	
Wapato Park & Pavilion	Interior Access Route	301506	The pull side of the accessible door does not have the required maneuvering clearances.	\$ 1,250	1	
Wapato Park & Pavilion	Interior Access Route	301507	The pull side of the accessible door does not have the required maneuvering clearances.	\$ 1,250	1	
Wapato Park & Pavilion	Exterior Access Route	301542	Knee and toe clearance is not provided at the lower level fountain.	\$ 2,505	4	
Wapato Park & Pavilion	Exterior Access Route	301446	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 896	1	
Wapato Park & Pavilion	Exterior Access Route	301566	WASHINGTON: An exterior accessible route is not provided.	\$ 1,648	1	
Wapato Park & Pavilion	Exterior Access Route	301591	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 1,486	1	
Wapato Park & Pavilion	Exterior Access Route	301475	WASHINGTON: An exterior accessible route is not provided.	\$ 6,899	1	
Wapato Park & Pavilion	Exterior Access Route	301452	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 3,567	1	
Wapato Park & Pavilion	Exterior Access Route	301586	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 11,773	1	
Wapato Park & Pavilion	Exterior Access Route	301587	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 19,502	1	
Wapato Park & Pavilion	Exterior Access Route	301474	WASHINGTON: An exterior accessible route is not provided.	\$ 2,795	1	
Wapato Park & Pavilion	Exterior Access Route	301547	The accessible route has gaps in the surface greater than 1/2" wide.	\$ 1,250	1	
Wapato Park & Pavilion	Exterior Access Route	301441	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 1,486	1	
Wapato Park & Pavilion	Exterior Access Route	301596	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 3,072	1	
Wapato Park & Pavilion	Exterior Access Route	301597	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 4,994	1	
Wapato Park & Pavilion	Exterior Access Route	301612	WASHINGTON: An exterior accessible route is not provided.	\$ 1,971	1	
Wapato Park & Pavilion	Exterior Access Route	301589	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 11,455	1	
Wapato Park & Pavilion	Exterior Access Route	301601	WASHINGTON: An exterior accessible route is not provided.	\$ 465	1	
Wapato Park & Pavilion	Exterior Access Route	301635	WASHINGTON: An exterior accessible route is not provided.	\$ 8,216	1	
Wapato Park & Pavilion	Exterior Access Route	301426	WASHINGTON: An exterior accessible route is not provided.	\$ 8,216	1	
Wapato Park & Pavilion	Exterior Access Route	301569	WASHINGTON: The clear width of the exterior accessible route is less than 44".	\$ 62	1	
Wapato Park & Pavilion	Exterior Access Route	301570	WASHINGTON: The clear width of the exterior accessible route is less than 44".	\$ 62	1	
Wapato Park & Pavilion	Exterior Access Route	301571	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 4,994	1	
Wapato Park & Pavilion	Exterior Access Route	301575	WASHINGTON: The slopes of the exterior accessible route are not compliant.	\$ 1,427	1	
Wapato Park & Pavilion	Exterior Access Route	301576	WASHINGTON: An exterior accessible route is not provided.	\$ 824	1	
Wapato Park & Pavilion	Exterior Access Route	301476	WASHINGTON: An exterior accessible route is not provided.	\$ 3,288	1	
Wapato Park & Pavilion	Exterior Access Route	301434	In areas along the route there are level changes of 1/2" or greater that are not ramped.	\$ 237	1	
Wapato Park & Pavilion	Exterior Access Route	301440	WASHINGTON: An exterior accessible route is not provided.	\$ 2,140	1	
Wapato Park & Pavilion	Exterior Access Route	301584	WASHINGTON: The clear width of the exterior accessible route is less than 44".	\$ 71	1	
Wapato Park & Pavilion	Exterior Access Route	301487	WASHINGTON: An exterior accessible route is not provided.	\$ 11,827	1	
Wapato Park & Pavilion	Exterior Access Route	301480	The gate maneuvering clearance area is not compliant.	\$ 4,544	1	
Wapato Park & Pavilion	Exterior Access Route	301482	The gate maneuvering clearance area is not compliant.	\$ 1,136	1	
Wapato Park & Pavilion	Exterior Access Route	301484	The gate maneuvering clearance area is not compliant.	\$ 568	1	
Wapato Park & Pavilion	Kitchen	301561	The height of the counter is greater than 34".	\$ 1,986	2	
Wapato Park & Pavilion	Kitchen	301560	The location of the controls requires reaching across burners.	\$ 759	4	
Wapato Park & Pavilion	Accessible Parking	301462	WASHINGTON: A car stall, access aisle, and signage are not provided and the slope and/or ground surface is/are not compliant.	\$ 11,300	1	
Wapato Park & Pavilion	Accessible Parking	301454	WASHINGTON: The car access aisle signage is not compliant or not provided.	\$ 280	1	
Wapato Park & Pavilion	Accessible Parking	301465	The access aisle slope is greater than 1:50 (2%).	\$ 5,000	1	
Wapato Park & Pavilion	Accessible Parking	301466	Accessible car aisle markings do not define the aisle width.	\$ 840	1	
Wapato Park & Pavilion	Accessible Parking	301463	WASHINGTON: A car stall, access aisle, and signage are not provided and the slope and/or ground surface is/are not compliant.	\$ 11,300	1	
Wapato Park & Pavilion	Accessible Parking	301460	WASHINGTON: A car stall, access aisle, and signage are not provided and the slope and/or ground surface is/are not compliant.	\$ 11,300	1	
Wapato Park & Pavilion	Accessible Parking	301455	WASHINGTON: The car access aisle signage is not compliant or not provided.	\$ 280	1	
Wapato Park & Pavilion	Accessible Parking	301464	The access aisle slope is greater than 1:50 (2%).	\$ 5,000	1	
Wapato Park & Pavilion	Accessible Parking	301467	Accessible car aisle markings do not define the aisle width.	\$ 840	1	
Wapato Park & Pavilion	Accessible Parking	301461	WASHINGTON: A car stall, access aisle, and signage are not provided and the slope and/or ground surface is/are not compliant.	\$ 11,300	1	
Wapato Park & Pavilion	Accessible Parking	301468	Accessible car stall markings do not define the stall width.	\$ 420	1	
Wapato Park & Pavilion	Accessible Parking	301471	The slope of the parking space is greater than 1:50 (2%).	\$ 6,300	1	
Wapato Park & Pavilion	Accessible Parking	301473	The slope of the parking space is greater than 1:50 (2%).	\$ 6,300	1	
Wapato Park & Pavilion	Accessible Parking	301545	WASHINGTON: A van stall, access aisle, and signage are not provided and the slope and/or ground surface is/are not compliant.	\$ 11,300	5	
Wapato Park & Pavilion	Accessible Parking	301445	WASHINGTON: A van stall, access aisle, and signage are not provided and the slope and/or ground surface is/are not compliant.	\$ 11,300	1	
Wapato Park & Pavilion	Accessible Parking	301453	WASHINGTON: A van stall, access aisle, and signage are not provided and the slope and/or ground surface is/are not compliant.	\$ 11,300	1	
Wapato Park & Pavilion	Accessible Parking	301425	The access aisle slope is greater than 1:50 (2%).	\$ 5,000	1	
Wapato Park & Pavilion	Site Furnishings	301599	The picnic table does not allow a clear space for forward wheelchair approach with knee and toe clearance.	\$ 2,600	2	
Wapato Park & Pavilion	Site Furnishings	301432	The picnic table does not allow a clear space for forward wheelchair approach with knee and toe clearance.	\$ 3,900	2	
Wapato Park & Pavilion	Site Furnishings	301447	The picnic table does not allow a clear space for forward wheelchair approach with knee and toe clearance.	\$ 3,900	2	
Wapato Park & Pavilion	Site Furnishings	301477	The picnic table does not allow a clear space for forward wheelchair approach with knee and toe clearance.	\$ 1,300	2	
Wapato Park & Pavilion	Site Furnishings	301450	The picnic table does not allow a clear space for forward wheelchair approach with knee and toe clearance.	\$ 1,300	2	
Wapato Park & Pavilion	Site Furnishings	301451	The table does not have minimum 36" wide clear ground space on all usable sides of the table.	\$ 297	4	
Wapato Park & Pavilion	Site Furnishings	301613	The picnic table does not allow a clear space for forward wheelchair approach with knee and toe clearance.	\$ 6,500	2	
Wapato Park & Pavilion	Site Furnishings	301600	The table does not have minimum 36" wide clear ground space on all usable sides of the table.	\$ 313	4	
Wapato Park & Pavilion	Site Furnishings	301602	The picnic table does not allow a clear space for forward wheelchair approach with knee and toe clearance.	\$ 1,300	2	

PHASE FIVE						
PARK	CATEGORY	BARRIER ID	BARRIER DESCRIPTION	ESTIMATE	PRIORITY	
Wapato Park & Pavilion	Site Furnishings	301478	The picnic table does not allow a clear space for forward wheelchair approach with knee and toe clearance.	\$ 1,300	2	
Wapato Park & Pavilion	Interior Access Route	301495	The platform lift is not compliant.	\$ 22,525	1	
Wapato Park & Pavilion	Playground	301608	The number of existing ground level components is less than the required minimum.	\$ 5,000	2	
Wapato Park & Pavilion	Playground	301605	The number of existing ground level components is less than the required minimum.	\$ 10,000	2	
Wapato Park & Pavilion	Playground	301607	A turning space is not provided at a preschool swing.	\$ -	2	
Wapato Park & Pavilion	Playground	301606	A compliant turning space is not provided at a school-age swing.	\$ -	2	
Wapato Park & Pavilion	Exterior Access Route	301483	Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the accessible route.	\$ 200	1	
Wapato Park & Pavilion	Exterior Access Route	301543	Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the accessible route.	\$ 728	1	
Wapato Park & Pavilion	Interior Access Route	301562	Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the interior accessible route.	\$ 1,000	1	
Wapato Park & Pavilion	Interior Access Route	301508	Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the interior accessible route.	\$ 728	1	
Wapato Park & Pavilion	Exterior Access Route	301595	WASHINGTON: Handrails are not provided where the ramp rises more than 6" or are not compliant.	\$ 7,661	1	
Wapato Park & Pavilion	Restroom	301636	The entire restroom is not compliant due to limited room dimensions.	\$ 24,000	3	
Wapato Park & Pavilion	Restroom	301427	The push side of the door does not have the required maneuvering clearances.	\$ 1,250	3	
Wapato Park & Pavilion	Restroom	301429	The door does not have 80" minimum head clearance from finish floor, excluding door closer hinged bar, which can be 78" minimum.	\$ 2,600	1	
Wapato Park & Pavilion	Restroom	301438	The door does not have 80" minimum head clearance from finish floor, excluding door closer hinged bar, which can be 78" minimum.	\$ 2,600	1	
Wapato Park & Pavilion	Restroom	301439	The push side of the door does not have the required maneuvering clearances.	\$ 1,250	3	
Wapato Park & Pavilion	Restroom	301552	The pull side of the accessible door does not have the required maneuvering clearances.	\$ 100	3	
Wapato Park & Pavilion	Restroom	301518	The required turning space within the restroom is not provided.	\$ 9,250	3	
Wapato Park & Pavilion	Restroom	301521	The required turning space within the restroom is not provided.	\$ 9,250	3	
Wapato Park & Pavilion	Restroom	301556	The lavatory is mounted higher than 34" to the higher of the rim or counter.	\$ 720	3	
Wapato Park & Pavilion	Restroom	301559	The lavatory does not have the required knee clearance.	\$ 100	3	
Wapato Park & Pavilion	Restroom	301430	The urinal dimensions are not compliant.	\$ 935	3	
Wapato Park & Pavilion	Restroom	301437	The urinal dimensions are not compliant.	\$ 935	3	
Wapato Park & Pavilion	Restroom	301431	The height of the water closet is not 17" minimum to 19" maximum above finished floor.	\$ 630	3	
Wapato Park & Pavilion	Restroom	301436	The height of the water closet is not 17" minimum to 19" maximum above finished floor.	\$ 630	3	
Wapato Park & Pavilion	Restroom	301530	The side grab bar at the water closet is not compliant.	\$ 355	3	
Wapato Park & Pavilion	Restroom	301531	The rear grab bar at the water closet is not compliant.	\$ 355	3	
Wapato Park & Pavilion	Restroom	301533	The height of the water closet is not 17" minimum to 19" maximum above finished floor.	\$ 630	3	
Wapato Park & Pavilion	Restroom	301534	The required turning space within the restroom is not provided.	\$ 9,250	3	
Wapato Park & Pavilion	Restroom	301538	The height of the water closet is not 17" minimum to 19" maximum above finished floor.	\$ 630	3	
Wapato Park & Pavilion	Restroom	301540	The side grab bar at the water closet is not compliant.	\$ 355	3	
Wapato Park & Pavilion	Restroom	301541	The rear grab bar at the water closet is not compliant.	\$ 355	3	
Wapato Park & Pavilion	Restroom	301522	The height of the water closet is not 17" minimum to 19" maximum above finished floor.	\$ 630	3	
Wapato Park & Pavilion	Restroom	301525	The rear grab bar at the water closet is not compliant.	\$ 355	3	
Wapato Park & Pavilion	Restroom	301526	The side grab bar at the water closet is not compliant.	\$ 355	3	
Wapato Park & Pavilion	Restroom	301513	The side grab bar at the water closet is not compliant.	\$ 355	3	
Wapato Park & Pavilion	Restroom	301514	The rear grab bar at the water closet is not compliant.	\$ 355	3	
Wapato Park & Pavilion	Restroom	301517	The height of the water closet is not 17" minimum to 19" maximum above finished floor.	\$ 630	3	
Wapato Park & Pavilion	Restroom	301553	The side grab bar at the water closet is not compliant.	\$ 355	3	
Wapato Park & Pavilion	Restroom	301554	The rear grab bar at the water closet is not compliant.	\$ 355	3	
Wapato Park & Pavilion	Restroom	301555	The height of the water closet is not 17" minimum to 19" maximum above finished floor.	\$ 630	3	
Wapato Park & Pavilion	Restroom	305025	ANSI A117.1-: A vertical side grab bar is not located in the wheelchair stall.	\$ 443	3	
Wapato Park & Pavilion	Trail	301544	The accessible trail or trail segment does not have signage with trail details.	\$ 280	4	
Wapato Park & Pavilion	Trail	301567	The accessible trail or trail segment does not have signage with trail details.	\$ 280	4	
Wapato Park & Pavilion	Trail	301568	The inaccessible trail or trail segment does not have signage with trail details.	\$ 280	4	
Wapato Park & Pavilion	Restroom	301637	Restroom is not accessible, and directional signs to the nearest accessible restroom is not provided.	\$ 165	3	
Wapato Park & Pavilion	Trail	301577	The inaccessible trail or trail segment does not have signage with trail details.	\$ 280	4	
Wapato Park & Pavilion	Trail	301578	The inaccessible trail or trail segment does not have signage with trail details.	\$ 280	4	
Wapato Park & Pavilion	Trail	301581	The inaccessible trail or trail segment does not have signage with trail details.	\$ 280	4	
Wapato Park & Pavilion	Trail	301582	The inaccessible trail or trail segment does not have signage with trail details.	\$ 280	4	
Wapato Park & Pavilion	Trail	301583	The accessible trail or trail segment does not have signage with trail details.	\$ 280	4	
Wapato Park & Pavilion	Trail	301585	The accessible trail or trail segment does not have signage with trail details.	\$ 280	4	
Wapato Park & Pavilion	Trail	301598	The accessible trail or trail segment does not have signage with trail details.	\$ 280	4	
Wapato Park & Pavilion	Trail	301616	The inaccessible trail or trail segment does not have signage with trail details.	\$ 280	4	
Wapato Park & Pavilion	Trail	301632	The accessible trail or trail segment does not have signage with trail details.	\$ 280	4	
Wapato Park & Pavilion	Trail	301574	The inaccessible trail or trail segment does not have signage with trail details.	\$ 280	4	
Wapato Park & Pavilion	Kitchen	301563	Sinks do not have knee and/or toe clearance.	\$ 1,986	2	
Wapato Park & Pavilion	Interior Access Route	301493	The sink rim is higher than 34", and does not have knee and toe clearance (does not apply to mop basins, utility sinks, or bar sinks).	\$ 720	2	
Wapato Park & Pavilion	Exterior Access Route	301594	Handrails are not compliant.	\$ 1,304	1	
Wapato Park & Pavilion	Interior Access Route	301511	Steps do not have uniform and compliant riser heights and/or tread depths.	\$ 1,147	1	
Wapato Park & Pavilion	Interior Access Route	301510	Steps do not have uniform and compliant riser heights and/or tread depths.	\$ 1,147	1	
Wapato Park & Pavilion	Trail	301580	Tread obstacles in concrete, asphalt or boards are more than 0.5".	\$ 20	4	
Wapato Park & Pavilion	Trail	301579	Tread obstacles in concrete, asphalt or boards are more than 0.5".	\$ 90	4	
Wapato Park & Pavilion	Trail	301611	Cross slope of concrete, asphalt or wood surfaced trail is greater than 1:48 or 2.08%.	\$ 1,962	4	
Wapato Park & Pavilion	Trail	301615	Tread obstacles in concrete, asphalt or boards are more than 0.5".	\$ 178	4	
Wapato Park & Pavilion	Trail	301617	Tread obstacles in concrete, asphalt or boards are more than 0.5".	\$ 198	4	
Wapato Park & Pavilion	Trail	301618	Tread obstacles in concrete, asphalt or boards are more than 0.5".	\$ 99	4	
Wapato Park & Pavilion	Trail	301619	Tread obstacles in concrete, asphalt or boards are more than 0.5".	\$ 99	4	
Wapato Park & Pavilion	Trail	301620	Tread obstacles in concrete, asphalt or boards are more than 0.5".	\$ 198	4	

PHASE FIVE						
PARK	CATEGORY	BARRIER ID	BARRIER DESCRIPTION	ESTIMATE	PRIORITY	
Wapato Park & Pavilion	Trail	301621	Tread obstacles in concrete, asphalt or boards are more than 0.5".	\$ 118	4	
Wapato Park & Pavilion	Trail	301622	Tread obstacles in concrete, asphalt or boards are more than 0.5".	\$ 118	4	
Wapato Park & Pavilion	Trail	301623	Tread obstacles in concrete, asphalt or boards are more than 0.5".	\$ 198	4	
Wapato Park & Pavilion	Trail	301624	Tread obstacles in concrete, asphalt or boards are more than 0.5".	\$ 79	4	
Wapato Park & Pavilion	Trail	301625	Tread obstacles in concrete, asphalt or boards are more than 0.5".	\$ 79	4	
Wapato Park & Pavilion	Trail	301626	Cross slope of concrete, asphalt or wood surfaced trail is greater than 1:48 or 2.08%.	\$ 594	4	
Wapato Park & Pavilion	Trail	301627	Tread obstacles in concrete, asphalt or boards are more than 0.5".	\$ 1,189	4	
Wapato Park & Pavilion	Trail	301628	Tread obstacles in concrete, asphalt or boards are more than 0.5".	\$ 198	4	
Wapato Park & Pavilion	Trail	301629	Tread obstacles in concrete, asphalt or boards are more than 0.5".	\$ 198	4	
Wapato Park & Pavilion	Trail	301630	Tread obstacles in concrete, asphalt or boards are more than 0.5".	\$ 198	4	
Wapato Park & Pavilion	Trail	301631	Tread obstacles in concrete, asphalt or boards are more than 0.5".	\$ 198	4	
Wapato Park & Pavilion	Trail	301633	Tread obstacles in concrete, asphalt or boards are more than 0.5".	\$ 198	4	
Wapato Park & Pavilion	Playground	301609	The transfer platform for connecting to elevated play elements has non-compliant dimensions.	\$ 23,909	2	
Wapato Park & Pavilion	Playground	301610	A transfer space is not provided at the platform. The transfer platform for connecting to elevated play elements has non-compliant dimensions.	\$ -	2	
Wapato Park & Pavilion	Playground	301603	A transfer space is not provided at the platform.	\$ 23,909	2	
Wapato Park & Pavilion	Playground	301604	A transfer space is not provided at the platform.	\$ -	2	
Wapato Park & Pavilion	Common Areas	301535	The work surface height is not compliant. Knee and toe clearances are not provided.	\$ 200	2	
Wapato Park & Pavilion	Common Areas	301519	The work surface height is not compliant. Knee and toe clearances are not provided.	\$ 200	2	
Wapato Park & Pavilion	Common Areas	301520	The work surface height is not compliant. Knee and toe clearances are not provided.	\$ 200	2	
TOTAL				\$ 2,231,223		

PHASE EASILY REMOVABLE BARRIERS (ERBs)						
PARK	CATEGORY	BARRIER ID	BARRIER DESCRIPTION	ESTIMATE	PRIORITY	
Alderwood Park	Common Areas	316423	Dispensers are not within an allowable reach range.	\$ 1,098	4	
Alderwood Park	Exterior Access Route	316638	Signage identifying a permanent outdoor space does not have raised lettering and Braille.	\$ 500	4	
Alderwood Park	Playground	316435	The ground surface has not been inspected and maintained regularly.	\$ 1,075	2	
Alling Park	Playground	322087	The ground surface has not been inspected and maintained regularly. WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 1,749	2	
Alling Park	Exterior Access Route	322086		\$ 352	3	
Baltimore Park	Trail	332560	BEST PRACTICE: The inaccessible trail or trail segment does not have signage with trail details.	\$ 280	4	
Baltimore Park	Playground	332561	The ground surface has not been inspected and maintained regularly.	\$ 1,000	2	
Browns Point Lighthouse Park	Exterior Access Route	315358	Items requiring an unobstructed side reach motion are higher than 48" above finish floor.	\$ 200	2	
Browns Point Lighthouse Park	Accessible Parking	315359	WASHINGTON: The van access aisle signage is not provided.	\$ 280	1	
Browns Point Lighthouse Park	Portable Restroom	315386	An ADA portable restroom is not provided. The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ 3,000	3	
Browns Point Lighthouse Park	Portable Restroom	315385		\$ -	3	
Browns Point Lighthouse Park	Accessible Parking	315710	WASHINGTON: Access aisle signage is not provided.	\$ 280	1	
Browns Point Playfield	Accessible Parking	315711	WASHINGTON: Signage is not located at the required height for the standard accessible space.	\$ 560	1	
Browns Point Playfield	Exterior Access Route	315716	The gate hardware is not compliant.	\$ 200	1	
Browns Point Playfield	Exterior Access Route	315717	The gate does not have a smooth surface within 10" of the ground. ADVISORY: The stair treads and edge of top landing do not have visual contrast on the leading edge.	\$ 320	2	
Browns Point Playfield	Exterior Access Route	315726	Tactile means of egress signage is not provided. (Applies to designated egress stairways, exit doors, areas of refuge) The surface of the swinging door within 10 inches of the finish floor or ground for the full width of the door on the push side is not smooth.	\$ -	1	
Center at Norpoint	Interior Access Route	349860		\$ 660	2	
Center at Norpoint	Interior Access Route	349863	The hardware at the accessible door requires tight grasping, pinching or twisting of the wrist to operate.	\$ 7,200	2	
Center at Norpoint	Interior Access Route	349864	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ 293	1	
Center at Norpoint	Interior Access Route	349865		\$ 366	1	
Center at Norpoint	Restroom	349866	Pipes are not insulated.	\$ 130	3	
Center at Norpoint	Restroom	349868	The coat hook is not within an allowable reach range. The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ 143	3	
Center at Norpoint	Entrance to Building	349871	The restroom does not have compliant signage at the door with the International Symbol of Accessibility, raised characters, and Braille.	\$ 366	1	
Center at Norpoint	Restroom	349876		\$ 110	3	
Center at Norpoint	Restroom	349880	Pipes are not insulated.	\$ 130	3	
Center at Norpoint	Restroom	349883	The coat hook is not within an allowable reach range. The restroom does not have compliant signage at the door with the International Symbol of Accessibility, raised characters, and Braille.	\$ 143	3	
Center at Norpoint	Restroom	349885		\$ 110	3	
Center at Norpoint	Restroom	349888	Pipes are not insulated.	\$ 130	3	
Center at Norpoint	Interior Access Route	349900	The existing signage is not mounted at the latch side of the door or at a compliant height. The hardware at the accessible door (including sliding doors - both sides) requires tight grasping, pinching or twisting of the wrist to operate OR is mounted below 34" or above 48".	\$ 110	2	
Center at Norpoint	Interior Access Route	349901		\$ 293	1	
Center at Norpoint	Kitchen	349917	Exposed pipes lack insulation under the sink.	\$ 130	2	
Center at Norpoint	Playground	349918	The ground surface has not been inspected and maintained regularly. WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 500	2	
Charlotte's Blueberry Park	Exterior Access Route	323280		\$ 246	3	
Charlotte's Blueberry Park	Exterior Access Route	323278	The gate does not have a smooth surface within 10" of the ground.	\$ 160	2	
China Lake Park	Trail	324282	BEST PRACTICE: The inaccessible trail or trail segment does not have signage with trail details.	\$ 280	4	
Chinese Reconciliation Park	Accessible Parking	319193	WASHINGTON: Van access aisle signage is not provided.	\$ 280	1	
Chinese Reconciliation Park	Accessible Parking	319194	WASHINGTON: Compliant signage is not provided at the van space. Signage directing pedestrians to the nearest accessible building entrance on an accessible route is not present.	\$ 280	1	
Chinese Reconciliation Park	Signage	323025	Directional signage indicating the accessible route is not provided, where existing routes are both accessible and non-accessible.	\$ 280	4	
Chinese Reconciliation Park	Exterior Access Route	322567	Directional signage indicating the accessible route from accessible parking to the facility is not provided, where existing routes are both accessible and non-accessible.	\$ 560	4	
Chinese Reconciliation Park	Exterior Access Route	322566	WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 280	4	
Chinese Reconciliation Park	Exterior Access Route	319212		\$ 1,760	3	
Cloverdale Park	Trail	328915	BEST PRACTICE: The inaccessible trail or trail segment does not have signage with trail details.	\$ 350	4	
Cloverdale Park	Trail	328916		\$ 350	4	
Cummings Park	Accessible Parking	327016	WASHINGTON: Compliant signage is not provided at the standard space.	\$ 280	1	
Cummings Park	Accessible Parking	327017	WASHINGTON: The car access aisle signage is not compliant.	\$ 280	1	
Cummings Park	Accessible Parking	327021	WASHINGTON: Compliant signage is not provided at the van space.	\$ 280	1	
Cummings Park	Accessible Parking	327025	WASHINGTON: Compliant signage is not provided at the van access aisle. WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 280	1	
Dash Point Park and Pier / Exterior	Exterior Access Route	315301		\$ 105	3	
Dash Point Park and Pier / Exterior	Exterior Access Route	315303	WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 176	3	
Dash Point Park and Pier / Exterior	Accessible Parking	315316	WASHINGTON: Signage is not located at the required height for the van accessible space or access aisle. WASHINGTON: Signage is not located at the required height for the standard accessible space or access aisle.	\$ 280	1	
Dash Point Park and Pier / Exterior	Accessible Parking	315317		\$ 280	1	
Dash Point Park and Pier / Exterior	Accessible Parking	315318	WASHINGTON: The van access aisle signage is not compliant or not provided. WASHINGTON: Signage is not located at the required height for the van accessible space or access aisle.	\$ 280	1	
Dash Point Park and Pier / Exterior	Accessible Parking	315322		\$ 280	1	
Dash Point Park and Pier / Exterior	Accessible Parking	315323	WASHINGTON: Van access aisle signage is not provided.	\$ 280	1	
Dash Point Park and Pier / Exterior	Playground	315329	The ground surface within the use zone does not comply with ASTM F 1292.	\$ 12,000	2	
Dash Point Park and Pier / Interior	Restroom	315333	The provided signage is not mounted at the latch side of the door or at a compliant height.	\$ 55	3	
Dash Point Park and Pier / Interior	Restroom	315334	The provided signage is not mounted at the latch side of the door or at a compliant height. The hardware at the accessible door requires tight grasping, pinching or twisting of the wrist to operate	\$ 55	3	
Dash Point Park and Pier / Interior	Restroom	315337		\$ 293	3	

PHASE EASILY REMOVABLE BARRIERS (ERBs)						
PARK	CATEGORY	BARRIER ID	BARRIER DESCRIPTION	ESTIMATE	PRIORITY	
Dash Point Park and Pier / Interior	Restroom	315338	Pipes are not insulated.	\$ 65	3	
Dash Point Park and Pier / Interior	Restroom	315339	WASHINGTON: The toilet paper dispenser location is not compliant.	\$ 293	3	
Dash Point Park and Pier / Interior	Restroom	315342	The force required to open the interior, hinged, non-fire door is more than 5 pounds.	\$ 366	3	
Dash Point Park and Pier / Interior	Restroom	315346	Pipes are not insulated.	\$ 65	3	
Dash Point Park and Pier / Interior	Restroom	315347	WASHINGTON: The toilet paper dispenser location is not compliant.	\$ 293	3	
DeLong Park	Accessible Parking	324027	WASHINGTON: Compliant signage is not provided at the van space.	\$ 280	1	
DeLong Park	Accessible Parking	324030	WASHINGTON: Van access aisle signage is not provided.	\$ 280	1	
DeLong Park	Accessible Parking	324031	WASHINGTON: Compliant signage is not provided at the standard space.	\$ 280	1	
Dickman Mill Park	Restroom	326865	The provided signage is not mounted at the latch side of the door or at a compliant height. The swinging door does not have a smooth surface within 10" of the ground measured vertically on the push side extending the full width of the door.	\$ 220	3	
Dickman Mill Park	Restroom	326866	The mirror is mounted higher than 40" above finish floor to the bottom of the reflective surface, where it is installed above a lavatory or counter.	\$ 100	2	
Dickman Mill Park	Restroom	326870	WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 200	3	
Dune Peninsula at Point Defiance Park	Exterior Access Route	324977	The opening force of the fire door is more than the minimum allowable by the appropriate administrative authority.	\$ 352	3	
Dune Peninsula at Point Defiance Park	Entrance to Building	324980	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ 457	1	
Dune Peninsula at Point Defiance Park	Entrance to Building	324981	The surface of the door within 10 inches of the finish floor or ground for the full width of the door on the push side is not smooth.	\$ -	1	
Dune Peninsula at Point Defiance Park	Entrance to Building	324982	The opening force of the fire door is more than the minimum allowable by the appropriate administrative authority.	\$ 400	2	
Dune Peninsula at Point Defiance Park	Entrance to Building	324985	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ 457	1	
Dune Peninsula at Point Defiance Park	Entrance to Building	324986	WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ -	1	
Dune Peninsula at Point Defiance Park	Exterior Access Route	324991	WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 422	3	
Dune Peninsula at Point Defiance Park	Exterior Access Route	324995	The surface of the door within 10 inches of the finish floor or ground for the full width of the door on the push side is not smooth.	\$ 457	3	
Dune Peninsula at Point Defiance Park	Entrance to Building	325008	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ 400	2	
Dune Peninsula at Point Defiance Park	Entrance to Building	325007	The opening force of the fire door is more than the minimum allowable by the appropriate administrative authority.	\$ -	1	
Dune Peninsula at Point Defiance Park	Entrance to Building	325006	The surface of the door within 10 inches of the finish floor or ground for the full width of the door on the push side is not smooth.	\$ 457	1	
Dune Peninsula at Point Defiance Park	Entrance to Building	325005	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ 400	2	
Dune Peninsula at Point Defiance Park	Entrance to Building	325004	The opening force of the fire door is more than the minimum allowable by the appropriate administrative authority.	\$ -	1	
Dune Peninsula at Point Defiance Park	Entrance to Building	325003	The opening force of the fire door is more than the minimum allowable by the appropriate administrative authority.	\$ 457	1	
Eastside Community Center	Accessible Parking	326422	WASHINGTON: Compliant signage is not provided at the standard space and access aisle.	\$ 350	1	
Eastside Community Center	Accessible Parking	326420	WASHINGTON: The car stall and access aisle signage is not compliant. The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ 560	1	
Eastside Community Center	Restroom	326419	WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 366	3	
Eastside Community Center	Signage	326411	WASHINGTON: The van stall and access aisle signage is not compliant.	\$ 844	3	
Eastside Community Center	Accessible Parking	326406	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ 560	1	
Eastside Community Center	Interior Access Route	326890	The surface of the swinging door within 10 inches of the finish floor or ground for the full width of the door on the push side is not smooth.	\$ 366	1	
Eastside Community Center	Interior Access Route	326891	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ 100	2	
Eastside Community Center	Interior Access Route	326892	The interior signage does not have compliant visual and tactile characters, with raised or indented characters or symbols.	\$ 366	1	
Eastside Community Center	Signage	326893	The surface of the swinging door within 10 inches of the finish floor or ground for the full width of the door on the push side is not smooth.	\$ 55	2	
Eastside Community Center	Interior Access Route	326896	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ 103	2	
Eastside Community Center	Interior Access Route	326897	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ 366	1	
Eastside Community Center	Entrance to Building	326898	Tactile means of egress signage is not provided at the latch side of the door. (Applies to designated egress stairways, exit doors, areas of refuge)	\$ 366	1	
Eastside Community Center	Interior Access Route	326899	Tactile means of egress signage is not provided at the latch side of the door. (Applies to designated egress stairways, exit doors, areas of refuge)	\$ 55	2	
Eastside Community Center	Interior Access Route	326900	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ 55	2	
Eastside Community Center	Interior Access Route	326901	The surface of the swinging door within 10 inches of the finish floor or ground for the full width of the door on the push side is not smooth.	\$ 366	1	
Eastside Community Center	Interior Access Route	326902	The surface of the swinging door within 10 inches of the finish floor or ground for the full width of the door on the push side is not smooth.	\$ 100	2	
Eastside Community Center	Interior Access Route	326903	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ 100	2	
Eastside Community Center	Interior Access Route	326904	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ 366	1	
Eastside Community Center	Interior Access Route	326905	The existing signage is not mounted at the latch side of the door or at a compliant height.	\$ 55	2	
Eastside Community Center	Interior Access Route	326906	The existing signage is not mounted at the latch side of the door or at a compliant height.	\$ 55	2	
Eastside Community Center	Interior Access Route	326907	The existing signage is not mounted at the latch side of the door or at a compliant height.	\$ 55	2	
Eastside Community Center	Interior Access Route	326909	The existing signage is not mounted at the latch side of the door or at a compliant height. The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ 55	2	
Eastside Community Center	Interior Access Route	326910	The mirror is mounted higher than 40" above finish floor to the bottom of the reflective surface, where it is installed above a lavatory or counter.	\$ 366	1	
Eastside Community Center	Restroom	326913	The surface of the swinging door within 10 inches of the finish floor or ground for the full width of the door on the push side is not smooth.	\$ 200	3	
Eastside Community Center	Interior Access Route	326912	The surface of the swinging door within 10 inches of the finish floor or ground for the full width of the door on the push side is not smooth.	\$ 100	2	

PHASE EASILY REMOVABLE BARRIERS (ERBs)						
PARK	CATEGORY	BARRIER ID	BARRIER DESCRIPTION	ESTIMATE	PRIORITY	
Eastside Community Center	Interior Access Route	326966	The opening force required to open the accessible, hinged, non-fire door is more than 5 pounds.	\$ 366	1	
Eastside Community Center	Restroom	326973	The coat hook is not within an allowable reach range.	\$ 115	3	
Eastside Community Center	Restroom	326977	The coat hook is not within an allowable reach range.	\$ 115	3	
Eastside Community Center	Interior Access Route	326981	The surface of the swinging door within 10 inches of the finish floor or ground for the full width of the door on the push side is not smooth.	\$ 100	2	
Eastside Community Center	Interior Access Route	326982	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ 366	1	
Eastside Community Center	Interior Access Route	326983	The opening force required to open the accessible, hinged, non-fire door is more than 5 pounds.	\$ 366	1	
Eastside Community Center	Interior Access Route	326984	The surface of the swinging door within 10 inches of the finish floor or ground for the full width of the door on the push side is not smooth.	\$ 100	2	
Eastside Community Center	Interior Access Route	326985	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ 366	1	
Eastside Community Center	Interior Access Route	326986	The opening force required to open the accessible, hinged, non-fire door is more than 5 pounds.	\$ 366	1	
Eastside Community Center	Interior Access Route	326987	The surface of the swinging door within 10 inches of the finish floor or ground for the full width of the door on the push side is not smooth.	\$ 100	2	
Eastside Community Center	Interior Access Route	326988	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ 366	1	
Eastside Community Center	Interior Access Route	326989	The opening force required to open the accessible, hinged, non-fire door is more than 5 pounds.	\$ 366	1	
Eastside Community Center	Restroom	326991	The coat hook is not within an allowable reach range.	\$ 115	3	
Eastside Community Center	Interior Access Route	326994	The surface of the swinging door within 10 inches of the finish floor or ground for the full width of the door on the push side is not smooth.	\$ 100	2	
Eastside Community Center	Interior Access Route	326998	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ 732	1	
Eastside Community Center	Interior Access Route	326999	The opening force required to open the accessible, hinged, non-fire door is more than 5 pounds.	\$ 732	1	
Eastside Community Center	Interior Access Route	327000	The surface of the swinging door within 10 inches of the finish floor or ground for the full width of the door on the push side is not smooth.	\$ 200	2	
Eastside Community Center	Interior Access Route	327001	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ 732	1	
Eastside Community Center	Interior Access Route	327002	The opening force required to open the accessible, hinged, non-fire door is more than 5 pounds.	\$ 732	1	
Eastside Community Center	Interior Access Route	327003	The existing signage is not mounted at the latch side of the door or at a compliant height.	\$ 55	2	
Eastside Community Center	Interior Access Route	327004	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ 366	1	
Eastside Community Center	Interior Access Route	327005	The opening force required to open the accessible, hinged, non-fire door is more than 5 pounds.	\$ 366	1	
Eastside Community Center	Restroom	327008	The coat hook is not within an allowable reach range.	\$ 115	3	
Eastside Community Center	Entrance to Building	327012	The opening force of the fire door is more than the minimum allowable by the appropriate administrative authority.	\$ 366	1	
Eastside Community Center	Entrance to Building	327013	The non-fire, automatic accessible door requires more than 5 pounds of pressure to operate.	\$ 366	1	
Eastside Community Center	Interior Access Route	328805	The opening force required to open the accessible, hinged, non-fire door is more than 5 pounds.	\$ 366	1	
Eastside Community Center	Interior Access Route	328806	The opening force required to open the accessible, hinged, non-fire door is more than 5 pounds.	\$ 366	1	
Eastside Community Center	Interior Access Route	328807	The opening force required to open the accessible, hinged, non-fire door is more than 5 pounds.	\$ 366	1	
Eastside Community Center	Interior Access Route	328808	The opening force required to open the accessible, hinged, non-fire door is more than 5 pounds.	\$ 366	1	
Eastside Community Center	Interior Access Route	328809	The opening force required to open the accessible, hinged, non-fire door is more than 5 pounds.	\$ 366	1	
Eastside Community Center	Restroom	328810	The force required to open the interior, hinged, non-fire door is more than 5 pounds.	\$ 366	3	
Eastside Community Center	Common Areas	326429	An assistive listening system is required, but not provided.	\$ 3,000	2	
Eastside Community Center	Restroom	326894	The mirror is mounted higher than 40" above finish floor to the bottom of the reflective surface, where it is installed above a lavatory or counter.	\$ 200	3	
Eastside Community Center	Interior Access Route	326997	The surface of the swinging door within 10 inches of the finish floor or ground for the full width of the door on the push side is not smooth.	\$ 200	2	
Fern Hill Park	Playground	323804	The ground surface has not been inspected and maintained regularly.	\$ 2,450	2	
Fern Hill Park	Playground	323805	The ground surface has not been inspected and maintained regularly.	\$ 1,190	2	
Fern Hill Park	Exterior Access Route	323806	WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 528	3	
Fern Hill Park	Exterior Access Route	323810	WASHINGTON: An exterior accessible route is not provided.	\$ 8,960	1	
Fern Hill Park	Trail	323811	The inaccessible trail does not have signage with trail details.	\$ 560	4	
Fern Hill Park	Exterior Access Route	323812	WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 105	3	
Ferry Park	Exterior Access Route	320766	WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 246	3	
Ferry Park	Exterior Access Route	320767	WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 281	3	
Fort Nisqually Living History Museum	Accessible Parking	325169	WASHINGTON: Compliant signage is not provided at the van space.	\$ 280	1	
Fort Nisqually Living History Museum	Accessible Parking	325171	WASHINGTON: The car access aisle signage is not compliant or not provided.	\$ 280	1	
Fort Nisqually Living History Museum	Entrance to Building	325175	The opening force of the fire door is more than the minimum allowable by the appropriate administrative authority.	\$ 457	1	
Fort Nisqually Living History Museum	Entrance to Building	325176	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ -	1	
Fort Nisqually Living History Museum	Entrance to Building	325178	The opening force of the fire door is more than the minimum allowable by the appropriate administrative authority.	\$ 457	1	
Fort Nisqually Living History Museum	Restroom	325180	The restroom does not have compliant signage at the door with the International Symbol of Accessibility, raised characters, and Braille.	\$ 55	3	
Fort Nisqually Living History Museum	Restroom	325181	Pipes are not insulated.	\$ 65	3	
Fort Nisqually Living History Museum	Restroom	325184	The coat hook is not within an allowable reach range.	\$ 115	3	
Fort Nisqually Living History Museum	Restroom	325183	The wheelchair stall door is not compliant.	\$ 500	3	
Fort Nisqually Living History Museum	Restroom	325187	WASHINGTON: The toilet paper dispenser location is not compliant.	\$ 293	3	
Fort Nisqually Living History Museum	Restroom	325189	The restroom does not have compliant signage at the door with the International Symbol of Accessibility, raised characters, and Braille.	\$ 55	3	
Fort Nisqually Living History Museum	Restroom	325190	Pipes are not insulated.	\$ 65	3	

PHASE EASILY REMOVABLE BARRIERS (ERBs)						
PARK	CATEGORY	BARRIER ID	BARRIER DESCRIPTION	ESTIMATE	PRIORITY	
Fort Nisqually Living History Museum	Restroom	325191	The wheelchair stall door is not compliant.	\$ 500	3	
Fort Nisqually Living History Museum	Restroom	325192	The coat hook is not within an allowable reach range.	\$ 115	3	
Fort Nisqually Living History Museum	Restroom	325194	WASHINGTON: The toilet paper dispenser location is not compliant.	\$ 293	3	
Fort Nisqually Living History Museum	Entrance to Building	325201	The opening force of the fire door is more than the minimum allowable by the appropriate administrative authority. The restroom does not have compliant signage at the door with the International Symbol of Accessibility, raised characters, and Braille.	\$ 457	1	
Fort Nisqually Living History Museum	Restroom	325203	WASHINGTON: The toilet paper dispenser location is not compliant.	\$ 110	3	
Fort Nisqually Living History Museum	Restroom	325204	The height of controls are not compliant.	\$ 293	3	
Fort Nisqually Living History Museum	Restroom	325205	The mirror is mounted higher than 40" above finish floor to the bottom of the reflective surface, where it is installed above a lavatory or counter.	\$ 200	3	
Fort Nisqually Living History Museum	Restroom	325206	The coat hook is not within an allowable reach range.	\$ 115	3	
Fort Nisqually Living History Museum	Restroom	325207	WASHINGTON: The toilet paper dispenser location is not compliant.	\$ 293	3	
Fort Nisqually Living History Museum	Restroom	325208	The height of the opening of the dispenser is not compliant.	\$ 200	3	
Fort Nisqually Living History Museum	Restroom	325209	The mirror is mounted higher than 40" above finish floor to the bottom of the reflective surface, where it is installed above a lavatory or counter.	\$ 200	3	
Fort Nisqually Living History Museum	Restroom	325210	The coat hook is not within an allowable reach range.	\$ 115	3	
Fort Nisqually Living History Museum	Restroom	325211	WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 105	3	
Fort Nisqually Living History Museum	Exterior Access Route	325218	WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 105	3	
Fort Nisqually Living History Museum	Exterior Access Route	325219	The opening force of the fire door is more than the minimum allowable by the appropriate administrative authority.	\$ 457	1	
Fort Nisqually Living History Museum	Entrance to Building	325220	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ -	1	
Fort Nisqually Living History Museum	Entrance to Building	325221	WASHINGTON: The car access aisle signage is not provided.	\$ 280	1	
Franklin Park	Accessible Parking	319967	WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 352	3	
Franklin Park	Exterior Access Route	319982	The gate does not have a smooth surface within 10" of the ground.	\$ 160	2	
Franklin Park	Exterior Access Route	319993	Dispensers are not within an allowable reach range.	\$ 2,196	4	
Franklin Park	Common Areas	319996	The restroom does not have compliant signage at the door with the International Symbol of Accessibility, raised characters, and Braille.	\$ 55	3	
Franklin Park	Restroom	319998	The non-fire, automatic accessible door requires more than 5 pounds of pressure to operate.	\$ 366	1	
Franklin Park	Entrance to Building	319999	The hardware at the accessible door (including sliding doors - both sides) requires tight grasping, pinching or twisting of the wrist to operate OR is mounted below 34" or above 48".	\$ 676	1	
Franklin Park	Entrance to Building	320002	WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 774	3	
Garfield Park	Exterior Access Route	332566	WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 668	3	
Garfield Park	Exterior Access Route	332568	The ground surface has not been inspected and maintained regularly.	\$ 3,900	2	
Garfield Park	Playground	332569	WASHINGTON: Compliant signage is not provided at the van space and access aisle.	\$ 560	1	
Heidelberg Davis Park	Accessible Parking	344440	WASHINGTON: Compliant signage is not provided at the standard space or access aisle.	\$ 1,400	1	
Heidelberg Davis Park	Accessible Parking	344444	WASHINGTON: Signage is not located at the required height for the standard accessible space or access aisle.	\$ 280	1	
Heidelberg Davis Park	Accessible Parking	344449	WASHINGTON: Compliant signage is not provided at the standard space or access aisle.	\$ 280	1	
Heidelberg Davis Park	Accessible Parking	344450	WASHINGTON: Compliant signage is not provided at the access aisle.	\$ 280	1	
Heidelberg Davis Park	Restroom	344451	The provided signage is not mounted at the latch side of the door or at a compliant height.	\$ 55	3	
Heidelberg Davis Park	Restroom	344458	The coat hook is not within an allowable reach range.	\$ 115	3	
Heidelberg Davis Park	Restroom	344476	The gate does not have a smooth surface within 10" of the ground.	\$ 480	2	
Heidelberg Davis Park	Exterior Access Route	344487	Signage indicating the accessible route to the amenity is not provided.	\$ 250	1	
Jack Hyde Park	Exterior Access Route	319563	WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 492	3	
Jane Clark Park	Exterior Access Route	332543	WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 492	3	
Jane Clark Park	Exterior Access Route	332547	The ground surface has not been inspected and maintained regularly.	\$ 4,375	2	
Jane Clark Park	Playground	332548	Directional signage indicating the accessible route from a park entry is not provided, where not all existing routes are accessible.	\$ 280	4	
Jefferson Park	Exterior Access Route	320694	The ground surface has not been inspected and maintained regularly.	\$ 750	2	
Jefferson Park	Playground	320714	The ground surface has not been inspected and maintained regularly.	\$ 1,440	2	
Jefferson Park	Playground	320717	Signage with tactile lettering is located lower than 48" measured to the baseline of the lowest tactile character, or higher than 60" measured to the baseline of the highest tactile character.	\$ 280	4	
Jefferson Park	Signage	320718	The ground surface has not been inspected and maintained regularly.	\$ 325	2	
Jefferson Park	Playground	320719	Directional signage indicating the accessible route from accessible parking to the facility is not provided, where existing routes are both accessible and non-accessible.	\$ 280	4	
Jefferson Park	Exterior Access Route	320724	Directional signage indicating the accessible route to an accessible park entry is not provided, where existing routes are both accessible and non-accessible.	\$ 280	4	
Jefferson Park	Exterior Access Route	327270	Directional signage indicating the accessible route to an accessible park entry is not provided, where existing routes are both accessible and non-accessible.	\$ 280	4	
Jefferson Park	Exterior Access Route	327271	Directional signage indicating the accessible route to an accessible park entry is not provided, where existing routes are both accessible and non-accessible.	\$ 280	4	
Jefferson Park	Exterior Access Route	327272	Directional signage indicating the accessible route to an accessible park entry is not provided, where existing routes are both accessible and non-accessible.	\$ 280	4	
Jefferson Park	Exterior Access Route	327273	Directional signage indicating the accessible route to an accessible park entry is not provided, where existing routes are both accessible and non-accessible.	\$ 280	4	
Jefferson Park	Exterior Access Route	327274	Directional signage indicating the accessible route to an accessible park entry is not provided, where existing routes are both accessible and non-accessible.	\$ 280	4	
Jefferson Park	Exterior Access Route	327277	Directional signage indicating the accessible route to an accessible park entry is not provided, where existing routes are both accessible and non-accessible.	\$ 280	4	
Judge Jack Tanner Park	Accessible Parking	327060	WASHINGTON: Compliant signage is not provided at the van space or access aisle.	\$ 560	1	
Kandle Park & Pool	Entrance to Building	324916	The non-fire, automatic accessible door requires more than 5 pounds of pressure to operate.	\$ 366	1	
Kandle Park & Pool	Entrance to Building	324917	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ -	1	
Kandle Park & Pool	Entrance to Building	324918	The surface of the door within 10 inches of the finish floor or ground for the full width of the door on the push side is not smooth.	\$ 400	2	
Kandle Park & Pool	Entrance to Building	324919	The non-fire, automatic accessible door requires more than 5 pounds of pressure to operate.	\$ 366	1	
Kandle Park & Pool	Entrance to Building	324920	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ -	1	
Kandle Park & Pool	Entrance to Building	324921	The surface of the door within 10 inches of the finish floor or ground for the full width of the door on the push side is not smooth.	\$ 400	2	
Kandle Park & Pool	Restroom	324922	Pipes are not insulated.	\$ 65	3	

PHASE EASILY REMOVABLE BARRIERS (ERBs)						
PARK	CATEGORY	BARRIER ID	BARRIER DESCRIPTION	ESTIMATE	PRIORITY	
Kandle Park & Pool	Entrance to Building	324925	The non-fire, automatic accessible door requires more than 5 pounds of pressure to operate. The mirror is mounted higher than 40" above finish floor to the bottom of the reflective surface, where it is installed above a lavatory or counter.	\$ 366	1	
Kandle Park & Pool	Restroom	324927		\$ 200	3	
Kandle Park & Pool	Restroom	324930	The wheelchair stall door is not compliant. The mirror is mounted higher than 40" above finish floor to the bottom of the reflective surface, where it is installed above a lavatory or counter.	\$ 500	3	
Kandle Park & Pool	Restroom	324932		\$ 200	3	
Kandle Park & Pool	Restroom	324934	The mirror is mounted higher than 35" above finish floor to the bottom of the reflective surface, where it is not installed above a lavatory or counter.	\$ 200	3	
Kandle Park & Pool	Entrance to Building	324938	The non-fire, automatic accessible door requires more than 5 pounds of pressure to operate.	\$ 366	1	
Kandle Park & Pool	Exterior Access Route	324942	WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 211	3	
Kandle Park & Pool	Exterior Access Route	324943	WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 211	3	
Les Davis Pier	Exterior Access Route	328340	WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 35	3	
Les Davis Pier	Exterior Access Route	328345	WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 35	3	
Les Davis Pier	Exterior Access Route	328352	WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 35	3	
Les Davis Pier	Exterior Access Route	328355	WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 35	3	
Les Davis Pier	Exterior Access Route	328356	WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 35	3	
Les Davis Pier	Kitchen	328371	Exposed pipes lack insulation and/or sharp or abrasive surfaces are present under the sink.	\$ 65	2	
Les Davis Pier	Restroom	328383	Pipes are not insulated.	\$ 130	3	
Les Davis Pier	Restroom	328384	The wheelchair stall door is not self closing.	\$ 586	3	
Les Davis Pier	Restroom	328385	The hardware at the wheelchair stall door is not compliant.	\$ 586	3	
Les Davis Pier	Accessible Parking	328393	WASHINGTON: Compliant signage is not provided at the van space.	\$ 280	1	
Les Davis Pier	Accessible Parking	328395	WASHINGTON: Compliant signage is not provided at the standard space. The swinging door does not have a smooth surface within 10" of the ground measured vertically on the push side extending the full width of the door.	\$ 280	1	
Les Davis Pier	Restroom	328382	The opening force of the fire door is more than 15#s at the latch, more than 30#s to set door in motion, and more than #15 to move door to fully open.	\$ 200	2	
Lincoln Eldridge Park	Restroom	323887		\$ 457	1	
Lincoln Eldridge Park	Restroom	323888	WASHINGTON: The toilet paper dispenser location is not compliant.	\$ 293	3	
Lincoln Eldridge Park	Restroom	323890	WASHINGTON: The toilet paper dispenser location is not compliant. The opening force of the fire door is more than 15#s at the latch, more than 30#s to set door in motion, and more than #15 to move door to fully open.	\$ 293	3	
Lincoln Eldridge Park	Restroom	323892		\$ 457	1	
Lincoln Eldridge Park	Playground	324231	The ground surface has not been inspected and maintained regularly.	\$ 3,150	2	
Lincoln Eldridge Park	Playground	324232	The ground surface has not been inspected and maintained regularly.	\$ 1,500	2	
Lincoln Eldridge Park	Accessible Parking	346557	WASHINGTON: Compliant signage is not provided at the standard space.	\$ 560	1	
Lincoln Heights Park	Playground	324555	The ground surface has not been inspected and maintained regularly.	\$ 900	2	
Lincoln Heights Park	Playground	324554	WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 316	3	
Lots for Tots	Playground	320738	A means of support is not provided at the transfer platform and/or transfer steps. ADVISORY: The stair treads and edge of top landing do not have visual contrast on the leading edge.	\$ 165	2	
Lots for Tots	Exterior Access Route	320739		\$ 211	1	
Lots for Tots	Playground	320742	The ground surface has not been inspected and maintained regularly. WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 600	2	
Manitou Park	Exterior Access Route	323942	WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 387	3	
Manitou Park	Exterior Access Route	323947	WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface. Directional signage indicating the accessible entrance is not provided at the non-accessible entrance, where existing entrances are both accessible and non-accessible.	\$ 211	3	
Meadow Park Golf Course	Exterior Access Route	324122		\$ 560	4	
Meadow Park Golf Course	Accessible Parking	324125	WASHINGTON: Compliant signage is not provided at the van access aisle.	\$ 280	1	
Meadow Park Golf Course	Accessible Parking	324126	WASHINGTON: The car stall signage is worn. Access aisle signage is not provided.	\$ 560	1	
Meadow Park Golf Course	Accessible Parking	324127	WASHINGTON: Compliant signage is not provided at the standard access aisle.	\$ 280	1	
Meadow Park Golf Course	Accessible Parking	324128	WASHINGTON: Compliant signage is not provided at the standard space and access aisle. WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 280	1	
Meadow Park Golf Course	Entrance to Building	324145		\$ 105	3	
Meadow Park Golf Course	Signage	324146	Signage on the accessible route is not compliant. The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ 280	4	
Meadow Park Golf Course	Entrance to Building	324170		\$ 366	1	
Meadow Park Golf Course	Interior Access Route	324172	Means of egress signage is not provided.	\$ 110	3	
Meadow Park Golf Course	Restroom	324177	Pipes are not insulated.	\$ 65	3	
Meadow Park Golf Course	Restroom	324178	Pipes are not insulated. The surface of the swinging door within 10 inches of the finish floor for the full width of the door on the push side is not smooth.	\$ 65	3	
Meadow Park Golf Course	Restroom	324179		\$ 100	2	
Meadow Park Golf Course	Restroom	324180	The surface of the swinging door within 10 inches of the finish floor for the full width of the door on the push side is not smooth.	\$ 100	2	
Meadow Park Golf Course	Restroom	324181	The opening force required to open the accessible, hinged, non-fire door is more than 5 pounds.	\$ 366	1	
Meadow Park Golf Course	Restroom	324182	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ 366	3	
Meadow Park Golf Course	Restroom	324186	The hardware at the wheelchair stall door is not compliant.	\$ 300	3	
Meadow Park Golf Course	Restroom	324193	WASHINGTON: The toilet paper dispenser location is not compliant.	\$ 300	3	
Meadow Park Golf Course	Restroom	324194	WASHINGTON: The toilet paper dispenser location is not compliant. The surface of the swinging door within 10 inches of the finish floor or ground for the full width of the door on the push side is not smooth.	\$ 300	3	
Meadow Park Golf Course	Restroom	324196		\$ 100	2	
Meadow Park Golf Course	Restroom	324197	The opening force required to open the accessible, hinged, non-fire door is more than 5 pounds. The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ 366	1	
Meadow Park Golf Course	Restroom	324198		\$ 366	3	
Meadow Park Golf Course	Restroom	324202	ADVISORY: The top of the reflective surface of the mirror is less than 74" high.	\$ -	3	
Meadow Park Golf Course	Restroom	324215	The hardware at the wheelchair stall door is not compliant. The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ 300	3	
Meadow Park Golf Course	Restroom	324214		\$ 366	3	
Meadow Park Golf Course	Restroom	324216	The coat hook is not within an allowable reach range.	\$ 115	3	

PHASE EASILY REMOVABLE BARRIERS (ERBs)						
PARK	CATEGORY	BARRIER ID	BARRIER DESCRIPTION	ESTIMATE	PRIORITY	
Meadow Park Golf Course	Entrance to Building	324217	Means of egress signage is not provided.	\$ 55	3	
Meadow Park Golf Course	Entrance to Building	324218	Means of egress signage is not provided.	\$ 165	3	
Meadow Park Golf Course	Entrance to Building	324219	WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 70	3	
Meadow Park Golf Course	Restroom	324220	The opening force required to open the accessible, hinged, non-fire door is more than 5 pounds.	\$ 366	1	
Meadow Park Golf Course	Restroom	324221	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ 366	3	
Meadow Park Golf Course	Signage	324509	Signage with tactile lettering is located higher than 60" measured to the baseline of the highest tactile character.	\$ 280	4	
Meadow Park Golf Course	Signage	324510	Signage on the accessible route is not compliant.	\$ 280	4	
Metro Parks Headquarters	Restroom	324236	Pipes are not insulated.	\$ 65	3	
Metro Parks Headquarters	Interior Access Route	324237	The opening force required to open the accessible, hinged, non-fire door is more than 5 pounds.	\$ 366	1	
Metro Parks Headquarters	Interior Access Route	324238	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ -	1	
Metro Parks Headquarters	Interior Access Route	324239	The opening force required to open the accessible, hinged, non-fire door is more than 5 pounds.	\$ 366	1	
Metro Parks Headquarters	Interior Access Route	324240	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ -	1	
Metro Parks Headquarters	Restroom	324246	Pipes are not insulated.	\$ 65	3	
Metro Parks Headquarters	Exterior Access Route	324248	WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 774	3	
Metro Parks Headquarters	Interior Access Route	324249	The opening force required to open the accessible, hinged, non-fire door is more than 5 pounds.	\$ 366	1	
Metro Parks Headquarters	Interior Access Route	324251	The opening force required to open the accessible, hinged, non-fire door is more than 5 pounds.	\$ 366	1	
Metro Parks Headquarters	Interior Access Route	324252	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ 366	1	
Metro Parks Headquarters	Restroom	324253	Pipes are not insulated.	\$ 65	3	
Metro Parks Headquarters	Restroom	324256	Pipes are not insulated.	\$ 65	3	
Metro Parks Headquarters	Interior Access Route	324261	The opening force required to open the accessible, hinged, non-fire door is more than 5 pounds.	\$ 366	1	
Metro Parks Headquarters	Restroom	324247	The wheelchair stall door is not compliant.	\$ 500	3	
Metro Parks Headquarters	Restroom	324257	The wheelchair stall door is not compliant.	\$ 500	3	
Metro Parks Headquarters	Restroom	324255	The rear grab bar at the water closet is not compliant.	\$ 355	3	
Norpoint Park	Restroom	302093	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ 366	3	
Norpoint Park	Restroom	302094	The provided signage is not mounted at the latch side of the door or at a compliant height.	\$ 55	3	
Norpoint Park	Restroom	302095	The provided signage is not mounted at the latch side of the door or at a compliant height.	\$ 55	3	
Norpoint Park	Restroom	302096	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ 366	3	
Norpoint Park	Signage	302117	Signage directing pedestrians to the nearest accessible entrance on an accessible route is not present.	\$ 280	4	
Norpoint Park	Exterior Access Route	302118	WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 140	3	
Norpoint Park	Exterior Access Route	302172	WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 70	3	
Norpoint Park	Exterior Access Route	302173	WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 70	3	
Norpoint Park	Exterior Access Route	302174	WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 176	3	
Norpoint Park	Exterior Access Route	302176	WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 140	3	
Norpoint Park	Exterior Access Route	302184	WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 70	3	
North Slope Historic Park	Exterior Access Route	321879	WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 246	3	
Northeast Tacoma Playground	Playground	316657	The ground surface has not been inspected and maintained regularly.	\$ 1,200	2	
NW Trek Wildlife Park	Exterior Access Route	342380	WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 492	3	
NW Trek Wildlife Park	Exterior Access Route	342295	WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 704	3	
NW Trek Wildlife Park	Exterior Access Route	342340	WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 457	3	
NW Trek Wildlife Park	Exterior Access Route	342339	WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 457	3	
NW Trek Wildlife Park	Exterior Access Route	342137	WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 105	3	
NW Trek Wildlife Park	Exterior Access Route	342136	WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 105	3	
NW Trek Wildlife Park	Exterior Access Route	342306	WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 176	3	
NW Trek Wildlife Park	Entrance to Building	342275	The opening force of the fire door is more than the minimum allowable by the appropriate administrative authority.	\$ 457	1	
NW Trek Wildlife Park	Entrance to Building	342396	The opening force of the fire door is more than the minimum allowable by the appropriate administrative authority.	\$ 457	1	
NW Trek Wildlife Park	Entrance to Building	342391	The opening force of the fire door is more than the minimum allowable by the appropriate administrative authority.	\$ 457	1	
NW Trek Wildlife Park	Entrance to Building	342452	The opening force of the fire door is more than the minimum allowable by the appropriate administrative authority.	\$ 457	1	
NW Trek Wildlife Park	Entrance to Building	342196	The opening force of the fire door is more than the minimum allowable by the appropriate administrative authority.	\$ 457	1	
NW Trek Wildlife Park	Entrance to Building	342546	The opening force of the fire door is more than the minimum allowable by the appropriate administrative authority.	\$ 457	1	
NW Trek Wildlife Park	Entrance to Building	342436	The opening force of the fire door is more than the minimum allowable by the appropriate administrative authority.	\$ 915	1	
NW Trek Wildlife Park	Entrance to Building	342435	The opening force of the fire door is more than the minimum allowable by the appropriate administrative authority.	\$ 457	1	

PHASE EASILY REMOVABLE BARRIERS (ERBs)						
PARK	CATEGORY	BARRIER ID	BARRIER DESCRIPTION	ESTIMATE	PRIORITY	
NW Trek Wildlife Park	Entrance to Building	342506	The opening force of the fire door is more than the minimum allowable by the appropriate administrative authority.	\$ 915	1	
NW Trek Wildlife Park	Entrance to Building	342505	The opening force of the fire door is more than the minimum allowable by the appropriate administrative authority.	\$ 915	1	
NW Trek Wildlife Park	Entrance to Building	342182	The opening force of the fire door is more than the minimum allowable by the appropriate administrative authority.	\$ 457	1	
NW Trek Wildlife Park	Entrance to Building	342524	The opening force of the fire door is more than the minimum allowable by the appropriate administrative authority.	\$ 457	1	
NW Trek Wildlife Park	Entrance to Building	342521	The opening force of the fire door is more than the minimum allowable by the appropriate administrative authority.	\$ 457	1	
NW Trek Wildlife Park	Entrance to Building	342520	The opening force of the fire door is more than the minimum allowable by the appropriate administrative authority.	\$ 457	1	
NW Trek Wildlife Park	Entrance to Building	342518	The opening force of the fire door is more than the minimum allowable by the appropriate administrative authority.	\$ 457	1	
NW Trek Wildlife Park	Entrance to Building	342106	The non-fire, automatic accessible door requires more than 5 pounds of pressure to operate.	\$ 366	1	
NW Trek Wildlife Park	Accessible Parking	342210	WASHINGTON: The car access aisle signage is not compliant or not provided.	\$ 1,960	1	
NW Trek Wildlife Park	Accessible Parking	342221	WASHINGTON: Signage is not located at the required height for the van accessible space or access aisle.	\$ 280	1	
NW Trek Wildlife Park	Accessible Parking	342238	WASHINGTON: Signage is not located at the required height for the standard accessible space or access aisle.	\$ 280	1	
NW Trek Wildlife Park	Accessible Parking	342235	WASHINGTON: Signage is not located at the required height for the standard accessible space or access aisle.	\$ 280	1	
NW Trek Wildlife Park	Accessible Parking	342233	WASHINGTON: Signage is not located at the required height for the standard accessible space or access aisle.	\$ 280	1	
NW Trek Wildlife Park	Accessible Parking	342230	WASHINGTON: Signage is not located at the required height for the standard accessible space or access aisle.	\$ 280	1	
NW Trek Wildlife Park	Accessible Parking	342227	WASHINGTON: Signage is not located at the required height for the standard accessible space or access aisle.	\$ 280	1	
NW Trek Wildlife Park	Accessible Parking	342223	WASHINGTON: Signage is not located at the required height for the standard accessible space or access aisle.	\$ 280	1	
NW Trek Wildlife Park	Interior Access Route	342449	The surface of the swinging door within 10 inches of the finish floor or ground for the full width of the door on the push side is not smooth.	\$ 400	2	
NW Trek Wildlife Park	Entrance to Building	342276	The surface of the door within 10 inches of the finish floor or ground for the full width of the door on the push side is not smooth.	\$ 400	2	
NW Trek Wildlife Park	Entrance to Building	342397	The surface of the door within 10 inches of the finish floor or ground for the full width of the door on the push side is not smooth.	\$ 400	2	
NW Trek Wildlife Park	Entrance to Building	342107	The surface of the door within 10 inches of the finish floor or ground for the full width of the door on the push side is not smooth.	\$ 400	2	
NW Trek Wildlife Park	Entrance to Building	342392	The surface of the door within 10 inches of the finish floor or ground for the full width of the door on the push side is not smooth.	\$ 400	2	
NW Trek Wildlife Park	Entrance to Building	342450	The surface of the door within 10 inches of the finish floor or ground for the full width of the door on the push side is not smooth.	\$ 400	2	
NW Trek Wildlife Park	Entrance to Building	342445	The surface of the door within 10 inches of the finish floor or ground for the full width of the door on the push side is not smooth.	\$ 800	2	
NW Trek Wildlife Park	Entrance to Building	342301	The surface of the door within 10 inches of the finish floor or ground for the full width of the door on the push side is not smooth.	\$ 400	2	
NW Trek Wildlife Park	Entrance to Building	342197	The surface of the door within 10 inches of the finish floor or ground for the full width of the door on the push side is not smooth.	\$ 400	2	
NW Trek Wildlife Park	Entrance to Building	342526	The surface of the door within 10 inches of the finish floor or ground for the full width of the door on the push side is not smooth.	\$ 400	2	
NW Trek Wildlife Park	Entrance to Building	342431	The surface of the door within 10 inches of the finish floor or ground for the full width of the door on the push side is not smooth.	\$ 1,600	2	
NW Trek Wildlife Park	Entrance to Building	342427	The surface of the door within 10 inches of the finish floor or ground for the full width of the door on the push side is not smooth.	\$ 400	2	
NW Trek Wildlife Park	Entrance to Building	342423	The surface of the door within 10 inches of the finish floor or ground for the full width of the door on the push side is not smooth.	\$ 400	2	
NW Trek Wildlife Park	Entrance to Building	342183	The surface of the door within 10 inches of the finish floor or ground for the full width of the door on the push side is not smooth.	\$ 400	2	
NW Trek Wildlife Park	Entrance to Building	342519	The surface of the door within 10 inches of the finish floor or ground for the full width of the door on the push side is not smooth.	\$ 400	2	
NW Trek Wildlife Park	Entrance to Building	342517	The surface of the door within 10 inches of the finish floor or ground for the full width of the door on the push side is not smooth.	\$ 400	2	
NW Trek Wildlife Park	Restroom	342535	The restroom does not have compliant signage at the door with the International Symbol of Accessibility, raised characters, and Braille.	\$ 55	3	
NW Trek Wildlife Park	Entrance to Building	342508	The non-fire, automatic accessible door requires more than 5 pounds of pressure to operate.	\$ 732	1	
NW Trek Wildlife Park	Entrance to Building	342105	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ 366	1	
NW Trek Wildlife Park	Restroom	342108	The mirror is mounted higher than 40" above finish floor to the bottom of the reflective surface, where it is installed above a lavatory or counter.	\$ 200	3	
NW Trek Wildlife Park	Entrance to Building	342181	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ -	1	
NW Trek Wildlife Park	Entrance to Building	342247	The hardware at the accessible door requires tight grasping and twisting of the wrist to operate.	\$ 1,352	1	
NW Trek Wildlife Park	Interior Access Route	342251	Items requiring an unobstructed side reach motion are higher than 48" maximum and/or lower than 15" minimum height above finish floor.	\$ 200	2	
NW Trek Wildlife Park	Interior Access Route	342259	The hardware at the accessible door requires tight grasping and twisting of the wrist to operate.	\$ 293	5	
NW Trek Wildlife Park	Exterior Access Route	342263	The gate hardware is not compliant.	\$ 200	1	
NW Trek Wildlife Park	Exterior Access Route	342264	The gate does not have a smooth surface within 10" of the ground.	\$ 160	2	
NW Trek Wildlife Park	Exterior Access Route	342265	Means of egress signage is not provided.	\$ 55	3	
NW Trek Wildlife Park	Exterior Access Route	342266	The gate has a closure that does not meet the requirements.	\$ 275	1	
NW Trek Wildlife Park	Interior Access Route	342268	The hardware at the accessible door requires tight grasping and twisting of the wrist to operate.	\$ 293	1	
NW Trek Wildlife Park	Interior Access Route	342274	The hardware at the accessible door requires tight grasping and twisting of the wrist to operate.	\$ 293	1	
NW Trek Wildlife Park	Entrance to Building	342300	The hardware at the accessible door requires tight grasping and twisting of the wrist to operate.	\$ 676	1	
NW Trek Wildlife Park	Interior Access Route	342302	The hardware at the accessible door requires tight grasping and twisting of the wrist to operate.	\$ 1,465	1	

PHASE EASILY REMOVABLE BARRIERS (ERBs)						
PARK	CATEGORY	BARRIER ID	BARRIER DESCRIPTION	ESTIMATE	PRIORITY	
NW Trek Wildlife Park	Entrance to Building	342317	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ 366	1	
NW Trek Wildlife Park	Entrance to Building	342364	The hardware at the accessible door requires tight grasping and twisting of the wrist to operate.	\$ 676	5	
NW Trek Wildlife Park	Interior Access Route	342366	Tactile means of egress signage is not provided at the latch side of the door. (Applies to designated egress stairways, exit doors, areas of refuge)	\$ 137	5	
NW Trek Wildlife Park	Restroom	342368	Restroom is not accessible, and directional signs to the nearest accessible restroom is not provided.	\$ 55	5	
NW Trek Wildlife Park	Restroom	342370	The mirror is mounted higher than 40" above finish floor to the bottom of the reflective surface, where it is installed above a lavatory or counter.	\$ 200	5	
NW Trek Wildlife Park	Entrance to Building	342376	The hardware at the accessible door requires tight grasping and twisting of the wrist to operate.	\$ 676	5	
NW Trek Wildlife Park	Interior Access Route	342377	The hardware at the accessible door requires tight grasping and twisting of the wrist to operate.	\$ 293	5	
NW Trek Wildlife Park	Entrance to Building	342379	The hardware at the accessible door requires tight grasping and twisting of the wrist to operate.	\$ 676	5	
NW Trek Wildlife Park	Entrance to Building	342390	The hardware at the accessible door requires tight grasping and twisting of the wrist to operate.	\$ 676	5	
NW Trek Wildlife Park	Restroom	342393	The mirror is mounted higher than 40" above finish floor to the bottom of the reflective surface, where it is installed above a lavatory or counter.	\$ 200	3	
NW Trek Wildlife Park	Entrance to Building	342395	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ -	1	
NW Trek Wildlife Park	Restroom	342398	The mirror is mounted higher than 40" above finish floor to the bottom of the reflective surface, where it is installed above a lavatory or counter.	\$ 200	3	
NW Trek Wildlife Park	Interior Access Route	342420	Tactile means of egress signage is not provided at the latch side of the door. (Applies to designated egress stairways, exit doors, areas of refuge)	\$ 68	2	
NW Trek Wildlife Park	Entrance to Building	342424	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ 366	1	
NW Trek Wildlife Park	Entrance to Building	342425	The hardware at the accessible door is mounted above 48".	\$ 676	1	
NW Trek Wildlife Park	Entrance to Building	342428	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ 366	1	
NW Trek Wildlife Park	Entrance to Building	342429	The hardware at the accessible door is mounted above 48".	\$ 676	1	
NW Trek Wildlife Park	Entrance to Building	342432	The hardware at the accessible door is mounted above 48".	\$ 1,352	1	
NW Trek Wildlife Park	Entrance to Building	342433	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ -	1	
NW Trek Wildlife Park	Entrance to Building	342434	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ -	1	
NW Trek Wildlife Park	Interior Access Route	342437	The hardware at the accessible door requires tight grasping and twisting of the wrist to operate.	\$ 293	1	
NW Trek Wildlife Park	Entrance to Building	342444	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ 732	1	
NW Trek Wildlife Park	Interior Access Route	342447	Tactile means of egress signage is not provided at the latch side of the door. (Applies to designated egress stairways, exit doors, areas of refuge)	\$ 137	2	
NW Trek Wildlife Park	Interior Access Route	342448	The hardware at the accessible door requires tight grasping and twisting of the wrist to operate.	\$ 293	1	
NW Trek Wildlife Park	Entrance to Building	342451	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ -	1	
NW Trek Wildlife Park	Interior Access Route	342504	Tactile means of egress signage is not provided at the latch side of the door. (Applies to designated egress stairways, exit doors, areas of refuge)	\$ 68	2	
NW Trek Wildlife Park	Entrance to Building	342507	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ 366	1	
NW Trek Wildlife Park	Interior Access Route	342513	Tactile means of egress signage is not provided at the latch side of the door. (Applies to designated egress stairways, exit doors, areas of refuge)	\$ 275	2	
NW Trek Wildlife Park	Entrance to Building	342527	The hardware at the accessible door is mounted above 48".	\$ 676	1	
NW Trek Wildlife Park	Restroom	342542	The mirror is mounted higher than 40" above finish floor to the bottom of the reflective surface, where it is installed above a lavatory or counter.	\$ 200	3	
NW Trek Wildlife Park	Entrance to Building	342545	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ 366	1	
NW Trek Wildlife Park	Entrance to Building	342560	The hardware at the accessible door requires tight grasping and twisting of the wrist to operate.	\$ 676	1	
NW Trek Wildlife Park	Interior Access Route	342566	The hardware at the accessible door requires tight grasping and twisting of the wrist to operate.	\$ 1,465	1	
NW Trek Wildlife Park	Restroom	342576	The mirror is mounted higher than 40" above finish floor to the bottom of the reflective surface, where it is installed above a lavatory or counter.	\$ 200	3	
Oakland Madrona Park	Accessible Parking	344166	WASHINGTON: Compliant signage is not provided at the van space.	\$ 280	1	
Old Town Dock	Restroom	326037	The swinging door does not have a smooth surface within 10" of the ground measured vertically on the push side extending the full width of the door.	\$ 200	2	
Old Town Park	Exterior Access Route	319631	Directional signage indicating the accessible route from accessible parking to the facility is not provided, where existing routes are both accessible and non-accessible.	\$ 560	4	
Old Town Park	Exterior Access Route	319632	WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 690	3	
Optimist Park	Accessible Parking	324901	WASHINGTON: Compliant signage is not provided at the van space.	\$ 280	1	
Optimist Park	Accessible Parking	324902	WASHINGTON: Compliant signage is not provided at the van space or access aisle.	\$ 280	1	
Peck Field	Restroom	323614	The restroom does not have compliant signage at the door with the International Symbol of Accessibility, raised characters, and Braille.	\$ 110	3	
Peck Field	Restroom	323615	The hardware at the door is not compliant.	\$ 586	3	
Peck Field	Restroom	323617	Pipes are not insulated.	\$ 130	3	
Peck Field	Restroom	323618	The mirror is mounted higher than 40" above finish floor to the bottom of the reflective surface, where it is installed above a lavatory or counter.	\$ 400	3	
Peck Field	Restroom	323621	The coat hook is not within an allowable reach range.	\$ 230	3	
Peck Field	Restroom	323877	The hardware at the wheelchair stall door is not compliant.	\$ 586	3	
Peck Field	Accessible Parking	323650	WASHINGTON: Compliant signage is not provided at the standard space or access aisle.	\$ 560	1	
Peck Field	Accessible Parking	323647	WASHINGTON: Compliant signage is not provided at the van space or access aisle.	\$ 560	1	
Peck Field	Accessible Parking	323642	WASHINGTON: Compliant signage is not provided at the standard space or access aisle.	\$ 840	1	
Peck Field	Accessible Parking	323639	WASHINGTON: Compliant signage is not provided at the van space or access aisle.	\$ 560	1	
People's Community Center	Restroom	319378	The hardware at the wheelchair stall door is not compliant.	\$ 293	3	
People's Community Center	Restroom	319383	The swinging door does not have a smooth surface within 10" of the finish floor measured vertically on the push side extending the full width of the door.	\$ 93	2	
People's Community Center	Restroom	319394	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ 366	3	

PHASE EASILY REMOVABLE BARRIERS (ERBs)						
PARK	CATEGORY	BARRIER ID	BARRIER DESCRIPTION	ESTIMATE	PRIORITY	
People's Community Center	Restroom	319403	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ 366	3	
People's Community Center	Interior Access Route	319415	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ 366	1	
People's Community Center	Interior Access Route	319423	The surface of the swinging door within 10 inches of the finish floor for the full width of the door on the push side is not smooth.	\$ 93	2	
People's Community Center	Interior Access Route	319427	The surface of the swinging door within 10 inches of the finish floor for the full width of the door on the push side is not smooth.	\$ 93	2	
People's Community Center	Interior Access Route	319432	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ 366	1	
People's Community Center	Interior Access Route	319436	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ 366	1	
People's Community Center	Entrance to Building	319442	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ 732	1	
People's Community Center	Interior Access Route	319449	The surface of the swinging door within 10 inches of the finish floor for the full width of the door on the push side is not smooth.	\$ 186	2	
People's Community Center	Interior Access Route	319450	The hardware at the accessible door (including sliding doors - both sides) is mounted below 34" or above 48".	\$ 586	1	
People's Community Center	Interior Access Route	319454	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ 366	1	
People's Community Center	Interior Access Route	319460	The surface of the swinging door within 10 inches of the finish floor for the full width of the door on the push side is not smooth.	\$ 186	2	
People's Community Center	Interior Access Route	319459	The interior signage does not have compliant visual and tactile characters, with raised or indented characters or symbols.	\$ 110	2	
People's Community Center	Interior Access Route	319470	The surface of the swinging door within 10 inches of the finish floor for the full width of the door on the push side is not smooth.	\$ 186	2	
People's Community Center	Interior Access Route	319480	Means of egress signage is not provided.	\$ 110	3	
People's Community Center	Interior Access Route	319481	The surface of the swinging door within 10 inches of the finish floor for the full width of the door on the push side is not smooth.	\$ 93	2	
People's Community Center	Interior Access Route	319484	The opening force required to open the accessible, hinged, non-fire door is more than 5 pounds.	\$ 366	1	
People's Community Center	Interior Access Route	319488	Means of egress signage is not provided.	\$ 55	3	
People's Community Center	Entrance to Building	319489	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ 732	1	
People's Community Center	Entrance to Building	319494	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ 366	1	
People's Community Center	Interior Access Route	319500	The surface of the swinging door within 10 inches of the finish floor for the full width of the door on the push side is not smooth.	\$ 93	2	
People's Community Center	Interior Access Route	319502	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ 732	1	
People's Community Center	Interior Access Route	319505	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ 366	1	
People's Community Center	Interior Access Route	319511	The surface of the swinging door within 10 inches of the finish floor for the full width of the door on the push side is not smooth.	\$ 93	2	
People's Community Center	Interior Access Route	319514	Means of egress signage is not provided.	\$ 55	3	
People's Community Center	Interior Access Route	319519	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ 366	1	
People's Community Center	Interior Access Route	319525	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ 366	1	
People's Community Center	Interior Access Route	319526	The opening force required to open the accessible, hinged, non-fire door is more than 5 pounds.	\$ 366	1	
People's Community Center	Interior Access Route	319529	Means of egress signage is not provided.	\$ 55	3	
People's Community Center	Interior Access Route	319530	The opening force required to open the accessible, hinged, non-fire door is more than 5 pounds.	\$ 366	1	
People's Community Center	Entrance to Building	319536	The non-fire, automatic accessible door requires more than 5 pounds of pressure to operate.	\$ 732	1	
People's Community Center	Accessible Parking	319559	WASHINGTON: The car access aisle signage is not compliant or not provided.	\$ 280	1	
People's Community Center	Restroom	319369	The swinging door does not have a smooth surface within 10" of the finish floor measured vertically on the push side extending the full width of the door.	\$ 93	2	
People's Community Center	Restroom	319370	The swinging door does not have a smooth surface within 10" of the finish floor measured vertically on the push side extending the full width of the door.	\$ 93	2	
People's Community Center	Restroom	319379	The hardware at the wheelchair stall door is not compliant.	\$ 293	3	
People's Community Center	Restroom	319382	The swinging door does not have a smooth surface within 10" of the finish floor measured vertically on the push side extending the full width of the door.	\$ 93	2	
People's Community Center	Restroom	319389	The hardware at the wheelchair stall door is not compliant.	\$ 293	3	
People's Community Center	Restroom	319392	The provided signage is not mounted at the latch side of the door.	\$ 55	3	
People's Community Center	Locker and Dressing Rooms	319396	The locker room does not have a compliant bench.	\$ 789	3	
People's Community Center	Restroom	319399	The hardware at the wheelchair stall door is not compliant.	\$ 293	3	
People's Community Center	Restroom	319404	The provided signage is not mounted at the latch side of the door.	\$ 55	3	
People's Community Center	Interior Access Route	319413	The surface of the swinging door within 10 inches of the finish floor for the full width of the door on the push side is not smooth.	\$ 93	2	
People's Community Center	Interior Access Route	319416	The opening force required to open the accessible, hinged, non-fire door is more than 5 pounds.	\$ 366	1	
People's Community Center	Entrance to Building	319418	The non-fire, accessible door requires more than 5 pounds of pressure to operate.	\$ 366	1	
People's Community Center	Exterior Access Route	319421	WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 211	3	
People's Community Center	Interior Access Route	319425	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ 732	1	
People's Community Center	Interior Access Route	319428	Means of egress signage is not provided.	\$ 165	3	
People's Community Center	Interior Access Route	319430	The interior signage does not have compliant visual and tactile characters, with raised or indented characters or symbols.	\$ 55	2	
People's Community Center	Interior Access Route	319433	The surface of the swinging door within 10 inches of the finish floor for the full width of the door on the push side is not smooth.	\$ 93	2	
People's Community Center	Interior Access Route	319434	The surface of the swinging door within 10 inches of the finish floor for the full width of the door on the push side is not smooth.	\$ 372	2	
People's Community Center	Interior Access Route	319439	The surface of the swinging door within 10 inches of the finish floor for the full width of the door on the push side is not smooth.	\$ 93	2	
People's Community Center	Interior Access Route	319440	The hardware at the accessible door (including sliding doors - both sides) requires tight grasping, pinching or twisting of the wrist to operate.	\$ 293	1	
People's Community Center	Entrance to Building	319443	The non-fire, automatic accessible door requires more than 5 pounds of pressure to operate.	\$ 732	1	

PHASE EASILY REMOVABLE BARRIERS (ERBs)						
PARK	CATEGORY	BARRIER ID	BARRIER DESCRIPTION	ESTIMATE	PRIORITY	
People's Community Center	Interior Access Route	319446	The surface of the swinging door within 10 inches of the finish floor for the full width of the door on the push side is not smooth.	\$ 93	2	
People's Community Center	Interior Access Route	319452	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ 366	1	
People's Community Center	Interior Access Route	319453	Means of egress signage is not provided.	\$ 165	3	
People's Community Center	Interior Access Route	319455	The opening force required to open the accessible, hinged, non-fire door is more than 5 pounds.	\$ 366	1	
People's Community Center	Entrance to Building	319457	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ 366	1	
People's Community Center	Interior Access Route	319463	The existing signage is not mounted at a compliant height.	\$ 55	2	
People's Community Center	Interior Access Route	319465	The surface of the swinging door within 10 inches of the finish floor for the full width of the door on the push side is not smooth.	\$ 93	2	
People's Community Center	Interior Access Route	319475	The surface of the swinging door within 10 inches of the finish floor for the full width of the door on the push side is not smooth.	\$ 93	2	
People's Community Center	Interior Access Route	319476	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ 732	1	
People's Community Center	Interior Access Route	319482	The hardware at the accessible door (including sliding doors - both sides) requires tight grasping, pinching or twisting of the wrist to operate.	\$ 293	1	
People's Community Center	Interior Access Route	319483	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ 366	1	
People's Community Center	Interior Access Route	319485	The interior signage does not have compliant visual and tactile characters, with raised or indented characters or symbols.	\$ 110	2	
People's Community Center	Interior Access Route	319487	The hardware at the accessible door (including sliding doors - both sides) requires tight grasping, pinching or twisting of the wrist to operate.	\$ 293	1	
People's Community Center	Entrance to Building	319490	The non-fire, automatic accessible door requires more than 5 pounds of pressure to operate.	\$ 732	1	
People's Community Center	Interior Access Route	319493	Means of egress signage is not provided.	\$ 275	3	
People's Community Center	Interior Access Route	319497	The surface of the swinging door within 10 inches of the finish floor for the full width of the door on the push side is not smooth.	\$ 186	2	
People's Community Center	Interior Access Route	319499	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ 366	1	
People's Community Center	Interior Access Route	319503	The existing signage is not mounted at the latch side of the door or at a compliant height.	\$ 55	2	
People's Community Center	Interior Access Route	319504	The surface of the swinging door within 10 inches of the finish floor for the full width of the door on the push side is not smooth.	\$ 93	2	
People's Community Center	Interior Access Route	319506	The surface of the swinging door within 10 inches of the finish floor for the full width of the door on the push side is not smooth.	\$ 93	2	
People's Community Center	Interior Access Route	319510	The surface of the swinging door within 10 inches of the finish floor for the full width of the door on the push side is not smooth.	\$ 93	2	
People's Community Center	Interior Access Route	319515	Means of egress signage is not provided.	\$ 55	3	
People's Community Center	Entrance to Building	319517	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ 732	1	
People's Community Center	Interior Access Route	319521	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ 366	1	
People's Community Center	Interior Access Route	319523	Means of egress signage is not provided.	\$ 55	3	
People's Community Center	Interior Access Route	319527	Means of egress signage is not provided.	\$ 55	3	
People's Community Center	Interior Access Route	319528	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ 366	1	
People's Community Center	Interior Access Route	319531	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ 366	1	
People's Community Center	Interior Access Route	319535	Means of egress signage is not provided.	\$ 55	3	
People's Community Center	Entrance to Building	319537	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ 366	1	
People's Community Center	Exterior Access Route	319546	The gate does not have a smooth surface within 10" of the ground.	\$ 160	2	
People's Community Center	Accessible Parking	319560	WASHINGTON: Compliant signage is not provided at the van space or access aisle.	\$ 280	1	
People's Community Center / Interior Accessible Routes	Entrance to Building	319417	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ 366	1	
Point Defiance Marina	Restroom	332075	The hardware at the wheelchair stall door is not compliant.	\$ 366	3	
Point Defiance Marina	Restroom	332077	The coat hook is not within an allowable reach range.	\$ 115	3	
Point Defiance Marina	Interior Access Route	332082	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ -	1	
Point Defiance Marina	Entrance to Building	332081	The opening force of the fire door is more than the minimum allowable by the appropriate administrative authority.	\$ 457	1	
Point Defiance Marina	Entrance to Building	332084	The opening force of the fire door is more than the minimum allowable by the appropriate administrative authority.	\$ 457	1	
Point Defiance Marina	Interior Access Route	332086	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ -	1	
Point Defiance Marina	Entrance to Building	332088	The opening force of the fire door is more than the minimum allowable by the appropriate administrative authority.	\$ 457	1	
Point Defiance Marina	Entrance to Building	332089	The surface of the door within 10 inches of the finish floor or ground for the full width of the door on the push side is not smooth.	\$ 400	2	
Point Defiance Marina	Entrance to Building	332091	The surface of the door within 10 inches of the finish floor or ground for the full width of the door on the push side is not smooth.	\$ 400	2	
Point Defiance Marina	Entrance to Building	332093	The surface of the door within 10 inches of the finish floor or ground for the full width of the door on the push side is not smooth.	\$ 400	2	
Point Defiance Marina	Restroom	332095	The hardware at the wheelchair stall door is not compliant.	\$ 366	3	
Point Defiance Marina	Restroom	332097	The coat hook is not within an allowable reach range.	\$ 115	3	
Point Defiance Marina	Restroom	332099	WASHINGTON: The toilet paper dispenser location is not compliant.	\$ 293	3	
Point Defiance Marina	Restroom	332100	Controls on dispensers are not compliant.	\$ 200	3	
Point Defiance Marina	Accessible Parking	332106	WASHINGTON: Compliant signage is not provided at the van space or access aisle.	\$ 700	1	
Point Defiance Marina	Accessible Parking	332108	WASHINGTON: The van access aisle signage is not compliant or not provided.	\$ 560	1	
Point Defiance Marina	Accessible Parking	332113	WASHINGTON: Compliant signage is not provided at the standard space or access aisle.	\$ 560	1	
Point Defiance Marina	Accessible Parking	332114	WASHINGTON: Compliant signage is not provided at the van space or access aisle.	\$ 560	1	
Point Defiance Marina	Common Areas	336552	WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 281	3	
Point Defiance Marina	Restroom	332079	WASHINGTON: The toilet paper dispenser location is not compliant.	\$ 293	3	
Point Defiance Park	Exterior Access Route	325226	WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 105	3	
Point Defiance Park	Accessible Parking	325227	WASHINGTON: Compliant signage is not provided at the van space or access aisle.	\$ 280	1	
Point Defiance Park	Exterior Access Route	325230	WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 668	3	

PHASE EASILY REMOVABLE BARRIERS (ERBs)						
PARK	CATEGORY	BARRIER ID	BARRIER DESCRIPTION	ESTIMATE	PRIORITY	
Point Defiance Park	Exterior Access Route	325232	WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 809	3	
Point Defiance Park	Exterior Access Route	325233	WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 809	3	
Point Defiance Park	Entrance to Building	325239	The opening force of the fire door is more than the minimum allowable by the appropriate administrative authority.	\$ 915	1	
Point Defiance Park	Entrance to Building	325240	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ -	1	
Point Defiance Park	Entrance to Building	325241	The surface of the door within 10 inches of the finish floor or ground for the full width of the door on the push side is not smooth.	\$ 800	2	
Point Defiance Park	Entrance to Building	325242	The opening force of the fire door is more than the minimum allowable by the appropriate administrative authority.	\$ 457	1	
Point Defiance Park	Entrance to Building	325244	The surface of the door within 10 inches of the finish floor or ground for the full width of the door on the push side is not smooth.	\$ 400	2	
Point Defiance Park	Restroom	325245	The force required to open the interior, hinged, non-fire door is more than 5 pounds.	\$ 366	3	
Point Defiance Park	Restroom	325246	The restroom does not have compliant signage at the door with the International Symbol of Accessibility, raised characters, and Braille.	\$ 55	3	
Point Defiance Park	Interior Access Route	325248	WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 35	3	
Point Defiance Park	Interior Access Route	325249	WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 774	3	
Point Defiance Park	Restroom	325250	The restroom does not have compliant signage at the door with the International Symbol of Accessibility, raised characters, and Braille.	\$ 110	3	
Point Defiance Park	Restroom	325251	The force required to open the interior, hinged, non-fire door is more than 5 pounds.	\$ 732	3	
Point Defiance Park	Entrance to Building	325252	The opening force of the fire door is more than the minimum allowable by the appropriate administrative authority.	\$ 457	1	
Point Defiance Park	Restroom	325253	The restroom does not have compliant signage at the door with the International Symbol of Accessibility, raised characters, and Braille.	\$ 55	3	
Point Defiance Park	Restroom	325254	The force required to open the interior, hinged, non-fire door is more than 5 pounds.	\$ 366	3	
Point Defiance Park	Restroom	325255	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ 366	3	
Point Defiance Park	Restroom	325257	The restroom does not have compliant signage at the door with the International Symbol of Accessibility, raised characters, and Braille.	\$ 55	3	
Point Defiance Park	Restroom	325258	The force required to open the interior, hinged, non-fire door is more than 5 pounds.	\$ 366	3	
Point Defiance Park	Restroom	325259	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ 366	3	
Point Defiance Park	Common Areas	325260	The opening force required to open the accessible, hinged, non-fire door is more than 5 pounds.	\$ 732	1	
Point Defiance Park	Common Areas	325261	The surface of the swinging door within 10 inches of the finish floor or ground for the full width of the door on the push side is not smooth.	\$ 400	2	
Point Defiance Park	Common Areas	325264	The opening force required to open the accessible, hinged, non-fire door is more than 5 pounds.	\$ 366	1	
Point Defiance Park	Entrance to Building	325263	The non-fire, automatic accessible door requires more than 5 pounds of pressure to operate.	\$ 366	1	
Point Defiance Park	Entrance to Building	325265	The opening force of the fire door is more than the minimum allowable by the appropriate administrative authority.	\$ 457	1	
Point Defiance Park	Entrance to Building	325266	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ -	1	
Point Defiance Park	Interior Access Route	325267	Tactile means of egress signage is not provided at the latch side of the door. (Applies to designated egress stairways, exit doors, areas of refuge)	\$ 165	2	
Point Defiance Park	Common Areas	325268	Exposed pipes lack insulation and/or sharp or abrasive surfaces are present under the sink.	\$ 65	2	
Point Defiance Park	Interior Access Route	325270	Tactile means of egress signage is not provided at the latch side of the door. (Applies to designated egress stairways, exit doors, areas of refuge)	\$ 55	2	
Point Defiance Park	Accessible Parking	332119	WASHINGTON: Signage is not located at the required height for the standard accessible space or access aisle.	\$ 280	1	
Point Defiance Park	Accessible Parking	332121	WASHINGTON: Compliant signage is not provided at the van access aisle.	\$ 350	1	
Point Defiance Park	Accessible Parking	332122	WASHINGTON: The car access aisle signage is not compliant or not provided.	\$ 560	5	
Point Defiance Park	Accessible Parking	332127	WASHINGTON: Compliant signage is not provided at the van space or access aisle.	\$ 560	1	
Point Defiance Park	Accessible Parking	332128	WASHINGTON: The car access aisle signage is not compliant or not provided.	\$ 560	1	
Point Defiance Park	Restroom	332129	Pipes are not insulated.	\$ 65	3	
Point Defiance Park	Restroom	332130	WASHINGTON: The toilet paper dispenser location is not compliant.	\$ 293	3	
Point Defiance Park	Exterior Access Route	332154	The gate does not have a smooth surface within 10" of the ground.	\$ 1,440	2	
Point Defiance Park	Accessible Parking	332159	WASHINGTON: Van access aisle signage is not provided.	\$ 840	1	
Point Defiance Park	Restroom	332162	The restroom does not have compliant signage at the door with the International Symbol of Accessibility, raised characters, and Braille.	\$ 55	3	
Point Defiance Park	Restroom	332163	The restroom does not have compliant signage at the door with the International Symbol of Accessibility, raised characters, and Braille.	\$ 55	3	
Point Defiance Park	Accessible Parking	332171	WASHINGTON: Compliant signage is not provided at the van space or access aisle.	\$ 280	1	
Point Defiance Park	Accessible Parking	332172	WASHINGTON: Compliant signage is not provided at the van space or access aisle.	\$ 280	1	
Point Defiance Park	Restroom	332179	The restroom does not have compliant signage at the door with the International Symbol of Accessibility, raised characters, and Braille.	\$ 55	3	
Point Defiance Park	Restroom	332187	The restroom does not have compliant signage at the door with the International Symbol of Accessibility, raised characters, and Braille.	\$ 55	3	
Point Defiance Park	Accessible Parking	332208	WASHINGTON: The car access aisle signage is not compliant or not provided.	\$ 1,680	1	
Point Defiance Park	Accessible Parking	332209	WASHINGTON: The van access aisle signage is not provided.	\$ 560	1	
Point Defiance Park	Accessible Parking	332573	WASHINGTON: The van access aisle signage is not compliant or not provided.	\$ 280	1	
Point Defiance Park	Restroom	334526	The restroom does not have compliant signage at the door with the International Symbol of Accessibility, raised characters, and Braille.	\$ 55	3	
Point Defiance Park	Restroom	334531	The restroom does not have compliant signage at the door with the International Symbol of Accessibility, raised characters, and Braille.	\$ 55	3	
Point Defiance Park	Restroom	332134	The coat hook is not within an allowable reach range.	\$ 115	3	
Point Defiance Park	Entrance to Building	332139	The opening force of the fire door is more than the minimum allowable by the appropriate administrative authority.	\$ 457	1	
Point Defiance Park	Interior Access Route	332140	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ -	1	
Point Defiance Park	Restroom	332141	Pipes are not insulated.	\$ 65	3	
Point Defiance Park	Restroom	332145	The coat hook is not within an allowable reach range.	\$ 115	3	
Point Defiance Park	Playground	332166	The ground surface has not been inspected and maintained regularly.	\$ 625	2	
Point Defiance Park	Playground	332167	The ground surface has not been inspected and maintained regularly.	\$ 2,700	2	
Point Defiance Park	Restroom	332181	Pipes are not insulated.	\$ 65	3	

PHASE EASILY REMOVABLE BARRIERS (ERBs)						
PARK	CATEGORY	BARRIER ID	BARRIER DESCRIPTION	ESTIMATE	PRIORITY	
Point Defiance Park	Restroom	332185	WASHINGTON: The toilet paper dispenser location is not compliant.	\$ 366	3	
Point Defiance Park	Restroom	332188	Pipes are not insulated.	\$ 65	3	
Point Defiance Park	Restroom	332191	WASHINGTON: The toilet paper dispenser location is not compliant.	\$ 366	3	
Point Defiance Park	Restroom	332193	The coat hook is not within an allowable reach range.	\$ 115	3	
Point Defiance Park	Entrance to Building	332210	The opening force of the fire door is more than the minimum allowable by the appropriate administrative authority.	\$ 457	1	
Point Defiance Park	Interior Access Route	332211	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ -	1	
Point Defiance Park	Entrance to Building	332214	The opening force of the fire door is more than the minimum allowable by the appropriate administrative authority.	\$ 457	1	
Point Defiance Park	Interior Access Route	332215	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ -	1	
Point Defiance Park	Entrance to Building	332216	The opening force of the fire door is more than the minimum allowable by the appropriate administrative authority.	\$ 457	1	
Point Defiance Park	Interior Access Route	332217	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ -	1	
Point Defiance Park	Entrance to Building	332220	The opening force of the fire door is more than the minimum allowable by the appropriate administrative authority.	\$ 457	1	
Point Defiance Park	Interior Access Route	332221	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ -	1	
Point Defiance Park	Exterior Access Route	332222	WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 211	3	
Point Defiance Park	Exterior Access Route	332223	WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 352	3	
Point Defiance Park	Exterior Access Route	332224	WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 352	3	
Point Defiance Park	Kitchen	332229	Exposed pipes lack insulation and/or sharp or abrasive surfaces are present under the sink.	\$ 65	2	
Point Defiance Park	Exterior Access Route	332230	WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 176	3	
Point Defiance Park	Exterior Access Route	332231	WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 176	3	
Point Defiance Park	Exterior Access Route	332574	WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 352	3	
Point Defiance Park	Exterior Access Route	332577	WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 246	3	
Point Defiance Park	Entrance to Building	334519	The opening force of the fire door is more than the minimum allowable by the appropriate administrative authority.	\$ 457	1	
Point Defiance Park	Interior Access Route	334520	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ -	1	
Point Defiance Park	Common Areas	334523	All exposed pipes at accessible lavatories lack insulation and/or sharp or abrasive surfaces are present under the lavatory.	\$ 65	2	
Point Defiance Park	Entrance to Building	334525	The opening force of the fire door is more than the minimum allowable by the appropriate administrative authority.	\$ 457	1	
Point Defiance Park	Interior Access Route	334527	The opening force required to open the accessible, hinged, non-fire door is more than 5 pounds.	\$ 366	1	
Point Defiance Park	Interior Access Route	334528	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ -	1	
Point Defiance Park	Entrance to Building	334529	The opening force of the fire door is more than the minimum allowable by the appropriate administrative authority.	\$ 457	1	
Point Defiance Park	Interior Access Route	334530	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ -	1	
Point Defiance Park	Restroom	334533	Pipes are not insulated.	\$ 65	3	
Point Defiance Park	Restroom	334535	The coat hook is not within an allowable reach range.	\$ 115	3	
Point Defiance Park	Restroom	334538	Pipes are not insulated.	\$ 65	3	
Point Defiance Zoo & Aquarium	Accessible Parking	332585	WASHINGTON: Compliant signage is not provided at the van space or access aisle.	\$ 560	1	
Point Defiance Zoo & Aquarium	Accessible Parking	332587	WASHINGTON: The car access aisle signage is not compliant or not provided.	\$ 4,200	1	
Point Defiance Zoo & Aquarium	Accessible Parking	332599	WASHINGTON: Compliant signage is not provided at the standard space or access aisle.	\$ 280	1	
Point Defiance Zoo & Aquarium	Accessible Parking	332613	WASHINGTON: Compliant signage is not provided at the van space or access aisle.	\$ 560	1	
Point Defiance Zoo & Aquarium	Accessible Parking	332616	WASHINGTON: Compliant signage is not provided at the van space or access aisle.	\$ 560	1	
Point Defiance Zoo & Aquarium	Exterior Access Route	332629	WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 809	3	
Point Defiance Zoo & Aquarium	Exterior Access Route	332630	WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 492	3	
Point Defiance Zoo & Aquarium	Restroom	332987	The mirror is mounted higher than 40" above finish floor to the bottom of the reflective surface, where it is installed above a lavatory or counter.	\$ 200	3	
Point Defiance Zoo & Aquarium	Restroom	332988	The restroom does not have compliant signage at the door with the International Symbol of Accessibility, raised characters, and Braille.	\$ 55	3	
Point Defiance Zoo & Aquarium	Entrance to Building	332989	The opening force of the fire door is more than the minimum allowable by the appropriate administrative authority.	\$ 457	1	
Point Defiance Zoo & Aquarium	Interior Access Route	332990	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ -	1	
Point Defiance Zoo & Aquarium	Restroom	332993	The restroom does not have compliant signage at the door with the International Symbol of Accessibility, raised characters, and Braille.	\$ 55	3	
Point Defiance Zoo & Aquarium	Restroom	332994	The mirror is mounted higher than 40" above finish floor to the bottom of the reflective surface, where it is installed above a lavatory or counter.	\$ 200	3	
Point Defiance Zoo & Aquarium	Restroom	332996	The coat hook is not within an allowable reach range.	\$ 115	3	
Point Defiance Zoo & Aquarium	Restroom	333001	The mirror is mounted higher than 40" above finish floor to the bottom of the reflective surface, where it is installed above a lavatory or counter.	\$ 200	3	
Point Defiance Zoo & Aquarium	Restroom	333003	The coat hook is not within an allowable reach range.	\$ 115	3	
Point Defiance Zoo & Aquarium	Entrance to Building	333004	The opening force of the fire door is more than the minimum allowable by the appropriate administrative authority.	\$ 457	1	
Point Defiance Zoo & Aquarium	Interior Access Route	333005	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ -	1	
Point Defiance Zoo & Aquarium	Entrance to Building	333006	The opening force of the fire door is more than the minimum allowable by the appropriate administrative authority.	\$ 457	1	
Point Defiance Zoo & Aquarium	Restroom	333008	The coat hook is not within an allowable reach range.	\$ 115	3	
Point Defiance Zoo & Aquarium	Entrance to Building	333010	The opening force of the fire door is more than the minimum allowable by the appropriate administrative authority.	\$ 457	1	
Point Defiance Zoo & Aquarium	Restroom	333011	The restroom does not have compliant signage at the door with the International Symbol of Accessibility, raised characters, and Braille.	\$ 55	3	

PHASE EASILY REMOVABLE BARRIERS (ERBs)						
PARK	CATEGORY	BARRIER ID	BARRIER DESCRIPTION	ESTIMATE	PRIORITY	
Point Defiance Zoo & Aquarium	Entrance to Building	333014	The opening force of the fire door is more than the minimum allowable by the appropriate administrative authority.	\$ 457	1	
Point Defiance Zoo & Aquarium	Restroom	333017	The coat hook is not within an allowable reach range.	\$ 115	3	
Point Defiance Zoo & Aquarium	Restroom	333019	The restroom does not have compliant signage at the door with the International Symbol of Accessibility, raised characters, and Braille.	\$ 55	3	
Point Defiance Zoo & Aquarium	Restroom	333020	The restroom does not have compliant signage at the door with the International Symbol of Accessibility, raised characters, and Braille.	\$ 55	3	
Point Defiance Zoo & Aquarium	Interior Access Route	333021	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ -	1	
Point Defiance Zoo & Aquarium	Entrance to Building	333022	The opening force of the fire door is more than the minimum allowable by the appropriate administrative authority.	\$ 457	1	
Point Defiance Zoo & Aquarium	Restroom	333027	The space between the grab bar and projecting objects above the grab bar is less than 12" minimum.	\$ 100	3	
Point Defiance Zoo & Aquarium	Exterior Access Route	333030	WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 633	3	
Point Defiance Zoo & Aquarium	Exterior Access Route	333031	WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 633	3	
Point Defiance Zoo & Aquarium	Exterior Access Route	333032	WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 492	3	
Point Defiance Zoo & Aquarium	Exterior Access Route	333033	WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 316	3	
Point Defiance Zoo & Aquarium	Exterior Access Route	333034	WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 246	3	
Point Defiance Zoo & Aquarium	Exterior Access Route	333035	WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 633	3	
Point Defiance Zoo & Aquarium	Entrance to Building	333044	The opening force of the fire door is more than the minimum allowable by the appropriate administrative authority.	\$ 457	1	
Point Defiance Zoo & Aquarium	Interior Access Route	333045	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ -	1	
Point Defiance Zoo & Aquarium	Entrance to Building	333048	The opening force of the fire door is more than the minimum allowable by the appropriate administrative authority.	\$ 457	1	
Point Defiance Zoo & Aquarium	Interior Access Route	333049	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ -	1	
Point Defiance Zoo & Aquarium	Entrance to Building	333050	The opening force of the fire door is more than the minimum allowable by the appropriate administrative authority.	\$ 457	1	
Point Defiance Zoo & Aquarium	Entrance to Building	333051	The opening force of the fire door is more than the minimum allowable by the appropriate administrative authority.	\$ 457	1	
Point Defiance Zoo & Aquarium	Restroom	333054	The mirror is mounted higher than 40" above finish floor to the bottom of the reflective surface, where it is installed above a lavatory or counter.	\$ 200	3	
Point Defiance Zoo & Aquarium	Interior Access Route	333056	The opening force required to open the accessible, hinged, non-fire door is more than 5 pounds.	\$ 366	1	
Point Defiance Zoo & Aquarium	Interior Access Route	333057	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ -	1	
Point Defiance Zoo & Aquarium	Entrance to Building	333058	The opening force of the fire door is more than the minimum allowable by the appropriate administrative authority.	\$ 457	1	
Point Defiance Zoo & Aquarium	Entrance to Building	333060	The opening force of the fire door is more than the minimum allowable by the appropriate administrative authority.	\$ 915	1	
Point Defiance Zoo & Aquarium	Interior Access Route	333061	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ -	1	
Point Defiance Zoo & Aquarium	Entrance to Building	333062	The opening force of the fire door is more than the minimum allowable by the appropriate administrative authority.	\$ 915	1	
Point Defiance Zoo & Aquarium	Entrance to Building	333063	The opening force of the fire door is more than the minimum allowable by the appropriate administrative authority.	\$ 915	1	
Point Defiance Zoo & Aquarium	Exterior Access Route	334549	The gate does not have a smooth surface within 10" of the ground.	\$ 160	2	
Point Defiance Zoo & Aquarium	Exterior Access Route	334552	WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 316	3	
Point Defiance Zoo & Aquarium	Exterior Access Route	334553	WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 492	3	
Point Defiance Zoo & Aquarium	Exterior Access Route	334556	WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 844	3	
Point Defiance Zoo & Aquarium	Exterior Access Route	334558	WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 704	3	
Point Defiance Zoo & Aquarium	Exterior Access Route	334559	WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 704	3	
Point Defiance Zoo & Aquarium	Exterior Access Route	334560	WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 704	3	
Point Defiance Zoo & Aquarium	Exterior Access Route	334561	WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 704	3	
Point Defiance Zoo & Aquarium	Exterior Access Route	334563	WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 528	3	
Point Defiance Zoo & Aquarium	Entrance to Building	334565	The opening force of the fire door is more than the minimum allowable by the appropriate administrative authority.	\$ 457	1	
Point Defiance Zoo & Aquarium	Interior Access Route	334566	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ -	1	
Point Defiance Zoo & Aquarium	Entrance to Building	334567	The opening force of the fire door is more than the minimum allowable by the appropriate administrative authority.	\$ 457	1	
Point Defiance Zoo & Aquarium	Interior Access Route	334570	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ -	1	
Point Defiance Zoo & Aquarium	Restroom	334571	The restroom does not have compliant signage at the door with the International Symbol of Accessibility, raised characters, and Braille.	\$ 55	3	
Point Defiance Zoo & Aquarium	Restroom	334573	WASHINGTON: The toilet paper dispenser location is not compliant.	\$ 293	3	
Point Defiance Zoo & Aquarium	Restroom	334575	The mirror is mounted higher than 40" above finish floor to the bottom of the reflective surface, where it is installed above a lavatory or counter.	\$ 200	3	
Point Defiance Zoo & Aquarium	Restroom	334576	The height of controls are not compliant.	\$ 200	3	
Point Defiance Zoo & Aquarium	Restroom	334577	The height of controls are not compliant.	\$ 200	3	
Point Defiance Zoo & Aquarium	Interior Access Route	334578	The opening force required to open the accessible, hinged, non-fire door is more than 5 pounds.	\$ 366	1	
Point Defiance Zoo & Aquarium	Interior Access Route	334583	WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 281	3	
Point Defiance Zoo & Aquarium	Interior Access Route	334584	WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 70	3	

PHASE EASILY REMOVABLE BARRIERS (ERBs)						
PARK	CATEGORY	BARRIER ID	BARRIER DESCRIPTION	ESTIMATE	PRIORITY	
Point Defiance Zoo & Aquarium	Interior Access Route	334585	WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 281	3	
Point Defiance Zoo & Aquarium	Interior Access Route	334586	WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 140	3	
Point Defiance Zoo & Aquarium	Interior Access Route	334588	A tactile, raised star minimum 2" high is not provided to the left of the floor designation on both jambs at the main elevator entry level.	\$ 560	3	
Point Defiance Zoo & Aquarium	Entrance to Building	334590	The opening force required to open the accessible, hinged, non-fire door is more than 5 pounds.	\$ 366	1	
Point Defiance Zoo & Aquarium	Restroom	334592	The mirror is mounted higher than 40" above finish floor to the bottom of the reflective surface, where it is installed above a lavatory or counter.	\$ 200	3	
Point Defiance Zoo & Aquarium	Interior Access Route	334600	WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 211	3	
Point Defiance Zoo & Aquarium	Exterior Access Route	334616	WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 105	3	
Point Defiance Zoo & Aquarium	Exterior Access Route	334618	WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 105	3	
Point Defiance Zoo & Aquarium	Exterior Access Route	334620	WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 352	3	
Point Defiance Zoo & Aquarium	Exterior Access Route	334621	WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 281	3	
Portland Avenue Community Center	Interior Access Route	328706	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ 366	1	
Portland Avenue Community Center	Interior Access Route	328707	The opening force required to open the accessible, hinged, non-fire door is more than 5 pounds.	\$ -	1	
Portland Avenue Community Center	Interior Access Route	328714	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ 366	1	
Portland Avenue Community Center	Interior Access Route	328715	The opening force required to open the accessible, hinged, non-fire door is more than 5 pounds.	\$ -	1	
Portland Avenue Community Center	Interior Access Route	328716	The hardware at the accessible door (including sliding doors - both sides) requires tight grasping, pinching or twisting of the wrist to operate OR is mounted below 34" or above 48". Signage with tactile lettering does not have 18" minimum by 18" minimum clear space centered on the tactile characters and/or beyond the arc swing of a door between the closed	\$ 293	1	
Portland Avenue Community Center	Interior Access Route	328717	position and 45 degrees open.	\$ 280	4	
Portland Avenue Community Center	Interior Access Route	328718	Means of egress signage is not provided.	\$ 330	3	
Portland Avenue Community Center	Entrance to Building	328719	The non-fire, automatic accessible door requires more than 5 pounds of pressure to operate. The swinging door does not have a smooth surface within 10" of the ground measured vertically on the push side extending the full width of the door.	\$ 366	1	
Portland Avenue Community Center	Restroom	328721	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ 200	2	
Portland Avenue Community Center	Restroom	328722	The force required to open the interior, hinged, non-fire door is more than 5 pounds.	\$ 366	3	
Portland Avenue Community Center	Restroom	328723	The hardware at the wheelchair stall door is not compliant.	\$ -	3	
Portland Avenue Community Center	Restroom	328728	The coat hook is not within an allowable reach range.	\$ 293	3	
Portland Avenue Community Center	Restroom	328729	The coat hook is not within an allowable reach range.	\$ 115	3	
Portland Avenue Community Center	Restroom	328731	WASHINGTON: The toilet paper dispenser location is not compliant.	\$ 293	3	
Portland Avenue Community Center	Restroom	328732	The swinging door does not have a smooth surface within 10" of the ground measured vertically on the push side extending the full width of the door.	\$ 200	2	
Portland Avenue Community Center	Restroom	328733	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ 366	3	
Portland Avenue Community Center	Restroom	328734	The force required to open the interior, hinged, non-fire door is more than 5 pounds.	\$ -	3	
Portland Avenue Community Center	Interior Access Route	328742	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ 366	1	
Portland Avenue Community Center	Interior Access Route	328743	The opening force required to open the accessible, hinged, non-fire door is more than 5 pounds.	\$ -	1	
Portland Avenue Community Center	Interior Access Route	328745	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ 366	1	
Portland Avenue Community Center	Interior Access Route	328746	The opening force required to open the accessible, hinged, non-fire door is more than 5 pounds.	\$ -	1	
Portland Avenue Community Center	Entrance to Building	328754	The non-fire, automatic accessible door requires more than 5 pounds of pressure to operate. The surface of the swinging door within 10 inches of the finish floor or ground for the full width of the door on the push side is not smooth.	\$ 366	1	
Portland Avenue Community Center	Interior Access Route	328756	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ 200	2	
Portland Avenue Community Center	Interior Access Route	328758	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ 366	1	
Portland Avenue Community Center	Interior Access Route	328759	The opening force required to open the accessible, hinged, non-fire door is more than 5 pounds.	\$ -	1	
Portland Avenue Community Center	Entrance to Building	328762	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ 366	1	
Portland Avenue Community Center	Entrance to Building	328763	The non-fire, automatic accessible door requires more than 5 pounds of pressure to operate. The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ -	1	
Portland Avenue Community Center	Entrance to Building	328764	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ 366	1	
Portland Avenue Community Center	Entrance to Building	328765	The non-fire, automatic accessible door requires more than 5 pounds of pressure to operate. Signage with tactile lettering does not have 18" minimum by 18" minimum clear space centered on the tactile characters and/or beyond the arc swing of a door between the closed	\$ -	1	
Portland Avenue Community Center	Restroom	328768	position and 45 degrees open. Signage with tactile lettering does not have 18" minimum by 18" minimum clear space centered on the tactile characters and/or beyond the arc swing of a door between the closed	\$ 280	4	
Portland Avenue Community Center	Restroom	328769	position and 45 degrees open. The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ 280	4	
Portland Avenue Community Center	Interior Access Route	328773	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ 366	1	
Portland Avenue Community Center	Interior Access Route	328778	The surface of the swinging door within 10 inches of the finish floor or ground for the full width of the door on the push side is not smooth.	\$ 200	2	
Portland Avenue Community Center	Interior Access Route	328780	The surface of the swinging door within 10 inches of the finish floor or ground for the full width of the door on the push side is not smooth.	\$ 200	2	
Portland Avenue Community Center	Interior Access Route	328782	The opening force required to open the accessible, hinged, non-fire door is more than 5 pounds.	\$ 366	1	
Portland Avenue Community Center	Interior Access Route	328782	The surface of the swinging door within 10 inches of the finish floor or ground for the full width of the door on the push side is not smooth.	\$ 366	1	
Portland Avenue Community Center	Interior Access Route	328784	The surface of the swinging door within 10 inches of the finish floor or ground for the full width of the door on the push side is not smooth.	\$ 200	2	

PHASE EASILY REMOVABLE BARRIERS (ERBs)						
PARK	CATEGORY	BARRIER ID	BARRIER DESCRIPTION	ESTIMATE	PRIORITY	
Portland Avenue Community Center	Interior Access Route	328786	The opening force required to open the accessible, hinged, non-fire door is more than 5 pounds.	\$ 366	1	
Portland Avenue Community Center	Interior Access Route	328787	The hardware at the accessible door (including sliding doors - both sides) requires tight grasping, pinching or twisting of the wrist to operate OR is mounted below 34" or above 48".	\$ 293	1	
Portland Avenue Community Center	Interior Access Route	328788	The surface of the swinging door within 10 inches of the finish floor or ground for the full width of the door on the push side is not smooth.	\$ 200	2	
Portland Avenue Community Center	Interior Access Route	328789	The surface of the swinging door within 10 inches of the finish floor or ground for the full width of the door on the push side is not smooth.	\$ 200	2	
Portland Avenue Community Center	Interior Access Route	328790	The opening force required to open the accessible, hinged, non-fire door is more than 5 pounds.	\$ 366	1	
Portland Avenue Community Center	Interior Access Route	328791	The surface of the swinging door within 10 inches of the finish floor or ground for the full width of the door on the push side is not smooth.	\$ 200	2	
Portland Avenue Community Center	Interior Access Route	328792	The surface of the swinging door within 10 inches of the finish floor or ground for the full width of the door on the push side is not smooth.	\$ 200	2	
Portland Avenue Community Center	Interior Access Route	328794	The surface of the swinging door within 10 inches of the finish floor or ground for the full width of the door on the push side is not smooth.	\$ 200	2	
Portland Avenue Community Center	Interior Access Route	328795	The surface of the swinging door within 10 inches of the finish floor or ground for the full width of the door on the push side is not smooth.	\$ 200	2	
Portland Avenue Community Center	Interior Access Route	328796	The surface of the swinging door within 10 inches of the finish floor or ground for the full width of the door on the push side is not smooth.	\$ 200	2	
Portland Avenue Community Center	Interior Access Route	328802	The surface of the swinging door within 10 inches of the finish floor or ground for the full width of the door on the push side is not smooth.	\$ 200	2	
Portland Avenue Community Center	Interior Access Route	328803	The surface of the swinging door within 10 inches of the finish floor or ground for the full width of the door on the push side is not smooth.	\$ 200	2	
Portland Avenue Community Center	Interior Access Route	328804	The surface of the swinging door within 10 inches of the finish floor or ground for the full width of the door on the push side is not smooth.	\$ 200	2	
Portland Avenue Community Center	Restroom	328741	WASHINGTON: The toilet paper dispenser location is not compliant.	\$ 293	3	
Portland Avenue Park	Accessible Parking	322642	WASHINGTON: Signage is not readable.	\$ 280	1	
Portland Avenue Park	Restroom	322652	The restroom does not have compliant signage at the door with the International Symbol of Accessibility, raised characters, and Braille.	\$ 55	3	
Portland Avenue Park	Exterior Access Route	322659	WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 70	3	
Portland Avenue Park	Restroom	322690	The restroom does not have compliant signage at the door with the International Symbol of Accessibility, raised characters, and Braille.	\$ 55	3	
Portland Avenue Park	Restroom	322886	The provided signage is not at a compliant height.	\$ 220	3	
Portland Avenue Park	Entrance to Building	328699	The non-fire, automatic accessible door requires more than 5 pounds of pressure to operate.	\$ 366	1	
Portland Avenue Park	Entrance to Building	328700	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ -	1	
Portland Avenue Park	Entrance to Building	328695	The non-fire, automatic accessible door requires more than 5 pounds of pressure to operate.	\$ 366	1	
Proctor Community Garden	Exterior Access Route	332565	The gate does not have a smooth surface within 10" of the ground.	\$ 320	2	
Rogers Playground	Exterior Access Route	349472	The gate does not have a smooth surface within 10" of the ground.	\$ 160	2	
Sawyer Tot Lot	Signage	325340	Signs or bulletin boards are not located within the height and viewing distance requirements for the size of visual characters.	\$ 100	2	
SERA Sports Complex	Accessible Parking	326050	WASHINGTON: The van stall and access aisle signage are not compliant.	\$ 560	1	
SERA Sports Complex	Restroom	326060	The swinging door does not have a smooth surface within 10" of the ground measured vertically on the push side extending the full width of the door.	\$ 100	2	
SERA Sports Complex	Restroom	326063	The swinging door does not have a smooth surface within 10" of the ground measured vertically on the push side extending the full width of the door.	\$ 100	2	
SERA Sports Complex	Accessible Parking	326051	WASHINGTON: The car stall signage is not compliant.	\$ 280	1	
SERA Sports Complex	Sports Facilities	326103	The gate does not have a smooth surface within 10" of the ground.	\$ 160	2	
SERA Sports Complex	Accessible Parking	326108	WASHINGTON: The car stall signage is not compliant.	\$ 280	1	
SERA Sports Complex	Exterior Access Route	326117	The gate at the tennis courts does not have a smooth surface within 10" of the ground.	\$ 160	2	
SERA Sports Complex	Exterior Access Route	328086	The gate does not have a smooth surface within 10" of the ground.	\$ 200	2	
SERA Sports Complex	Accessible Parking	357213	WASHINGTON: A car access aisle sign is not compliant.	\$ 280	1	
SERA Sports Complex	Accessible Parking	357214	WASHINGTON: The car stall sign is not compliant.	\$ 280	1	
SERA Sports Complex	Accessible Parking	357218	WASHINGTON: The car access aisle sign is not compliant.	\$ 280	1	
South Park	Playground	324342	The ground surface has not been inspected and maintained regularly.	\$ 1,280	2	
STAR Center	Signage	326131	Tactile means of egress signage is not provided at the latch side of the door. (Applies to designated egress stairways, exit doors, areas of refuge)	\$ 220	2	
STAR Center	Common Areas	326134	Assistive listening signage is not compliant or is not provided.	\$ 440	3	
STAR Center	Interior Access Route	326135	The existing signage is not mounted at the latch side of the door or at a compliant height.	\$ 55	2	
STAR Center	Interior Access Route	326136	The existing signage is not mounted at the latch side of the door or at a compliant height.	\$ 110	2	
STAR Center	Interior Access Route	326137	The surface of the swinging door within 10 inches of the finish floor or ground for the full width of the door on the push side is not smooth.	\$ 400	2	
STAR Center	Interior Access Route	326138	The opening force required to open the accessible, hinged, non-fire door is more than 5 pounds.	\$ 732	1	
STAR Center	Interior Access Route	326139	The opening force required to open the accessible, hinged, non-fire door is more than 5 pounds.	\$ 732	1	
STAR Center	Entrance to Building	326141	The opening force of the fire door is more than the minimum allowable by the appropriate administrative authority.	\$ 366	1	
STAR Center	Entrance to Building	326142	The opening force of the fire door is more than the minimum allowable by the appropriate administrative authority.	\$ 366	1	
STAR Center	Interior Access Route	326143	The opening force required to open the accessible, hinged, non-fire door is more than 5 pounds.	\$ 366	1	
STAR Center	Interior Access Route	326149	The surface of the swinging door within 10 inches of the finish floor or ground for the full width of the door on the push side is not smooth.	\$ 200	2	
STAR Center	Interior Access Route	326150	The opening force required to open the accessible, hinged, non-fire door is more than 5 pounds.	\$ 732	1	
STAR Center	Entrance to Building	326151	The opening force of the fire door is more than the minimum allowable by the appropriate administrative authority.	\$ 732	1	
STAR Center	Signage	326152	Tactile means of egress signage is not provided at the latch side of the door. (Applies to designated egress stairways, exit doors, areas of refuge)	\$ 220	2	
STAR Center	Signage	326153	Tactile means of egress signage is not provided at the latch side of the door. (Applies to designated egress stairways, exit doors, areas of refuge)	\$ 55	2	
STAR Center	Signage	326154	Tactile means of egress signage is not provided at the latch side of the door. (Applies to designated egress stairways, exit doors, areas of refuge)	\$ 55	2	

PHASE EASILY REMOVABLE BARRIERS (ERBs)						
PARK	CATEGORY	BARRIER ID	BARRIER DESCRIPTION	ESTIMATE	PRIORITY	
STAR Center	Interior Access Route	326155	The non-fire, automatic accessible door requires more than 5 pounds of pressure to operate.	\$ 732	1	
STAR Center	Interior Access Route	326156	The non-fire, automatic accessible door requires more than 5 pounds of pressure to operate.	\$ 366	1	
STAR Center	Signage	326157	Tactile means of egress signage is not provided at the latch side of the door. (Applies to designated egress stairways, exit doors, areas of refuge)	\$ 55	2	
STAR Center	Signage	326158	Tactile means of egress signage is not provided at the latch side of the door. (Applies to designated egress stairways, exit doors, areas of refuge)	\$ 110	2	
STAR Center	Signage	326159	Tactile means of egress signage is not provided at the latch side of the door. (Applies to designated egress stairways, exit doors, areas of refuge)	\$ 55	2	
STAR Center	Interior Access Route	326160	The non-fire, automatic accessible door requires more than 5 pounds of pressure to operate.	\$ 366	1	
STAR Center	Interior Access Route	326161	The existing signage is not mounted at the latch side of the door or at a compliant height. The opening force required to open the accessible, hinged, non-fire door is more than 5 pounds.	\$ 110	2	
STAR Center	Interior Access Route	326162	The coat hook is not within an allowable reach range.	\$ 366	1	
STAR Center	Restroom	326178	The opening force required to open the accessible, hinged, non-fire door is more than 5 pounds.	\$ 115	3	
STAR Center	Interior Access Route	326184	The hardware at the wheelchair stall door is not compliant.	\$ 366	1	
STAR Center	Restroom	326186	Controls on dispensers are not compliant.	\$ 300	3	
STAR Center	Restroom	326187	The surface of the swinging door within 10 inches of the finish floor or ground for the full width of the door on the push side is not smooth.	\$ 225	3	
STAR Center	Interior Access Route	326189	The opening force required to open the accessible, hinged, non-fire door is more than 5 pounds.	\$ 100	2	
STAR Center	Interior Access Route	326192	The opening force required to open the accessible, hinged, non-fire door is more than 5 pounds.	\$ 366	1	
STAR Center	Interior Access Route	326190	The opening force required to open the accessible, hinged, non-fire door is more than 5 pounds.	\$ 366	1	
STAR Center	Interior Access Route	326191	The hardware at the wheelchair stall door is not compliant.	\$ 366	1	
STAR Center	Restroom	326193	The hardware at the wheelchair stall door is not compliant.	\$ 300	3	
STAR Center	Restroom	326194	The mirror is mounted higher than 40" above finish floor to the bottom of the reflective surface, where it is installed above a lavatory or counter.	\$ 300	3	
STAR Center	Restroom	326196	The surface of the swinging door within 10 inches of the finish floor or ground for the full width of the door on the push side is not smooth.	\$ 200	3	
STAR Center	Interior Access Route	326200	The existing signage is not mounted at the latch side of the door or at a compliant height.	\$ 100	2	
STAR Center	Interior Access Route	326201	The existing signage is not mounted at the latch side of the door or at a compliant height.	\$ 55	2	
STAR Center	Interior Access Route	326202	The surface of the swinging door within 10 inches of the finish floor or ground for the full width of the door on the push side is not smooth.	\$ 55	2	
STAR Center	Interior Access Route	326203	The opening force required to open the accessible, hinged, non-fire door is more than 5 pounds.	\$ 100	2	
STAR Center	Interior Access Route	326204	The mirror is mounted higher than 40" above finish floor to the bottom of the reflective surface, where it is installed above a lavatory or counter.	\$ 366	1	
STAR Center	Restroom	326205	The opening force of the fire door is more than the minimum allowable by the appropriate administrative authority.	\$ 200	3	
STAR Center	Entrance to Building	326207	The gate does not have a smooth surface within 10" of the ground.	\$ 366	1	
STAR Center	Exterior Access Route	326211	The gate does not have a smooth surface within 10" of the ground.	\$ 160	2	
STAR Center	Exterior Access Route	326212	The gate does not have a smooth surface within 10" of the ground.	\$ 160	2	
STAR Center	Interior Access Route	326214	The existing signage is not mounted at the latch side of the door or at a compliant height.	\$ 55	2	
STAR Center	Interior Access Route	326215	The surface of the swinging door within 10 inches of the finish floor or ground for the full width of the door on the push side is not smooth.	\$ 100	2	
STAR Center	Interior Access Route	326216	The opening force required to open the accessible, hinged, non-fire door is more than 5 pounds.	\$ 366	1	
STAR Center	Interior Access Route	326217	The opening force required to open the accessible, hinged, non-fire door is more than 5 pounds.	\$ 366	5	
STAR Center	Interior Access Route	326218	The surface of the swinging door within 10 inches of the finish floor or ground for the full width of the door on the push side is not smooth.	\$ 100	5	
STAR Center	Interior Access Route	326223	The opening force required to open the accessible, hinged, non-fire door is more than 5 pounds.	\$ 366	1	
STAR Center	Interior Access Route	326224	The existing signage is not mounted at the latch side of the door or at a compliant height.	\$ 55	2	
STAR Center	Interior Access Route	327691	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ 732	1	
STAR Center	Interior Access Route	327817	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ 732	1	
STAR Center	Entrance to Building	327818	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ 366	1	
STAR Center	Entrance to Building	327819	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ 457	1	
STAR Center	Interior Access Route	328087	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ 732	1	
STAR Center	Entrance to Building	328088	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ 915	1	
STAR Center	Entrance to Building	328111	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ 366	1	
STAR Center	Entrance to Building	328112	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ 457	1	
STAR Center	Restroom	328204	The coat hook is not within an allowable reach range.	\$ 115	3	
STAR Center	Restroom	328205	The coat hook is not within an allowable reach range.	\$ 115	3	
STAR Center	Interior Access Route	328206	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ 366	1	
STAR Center	Interior Access Route	328329	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ 366	1	
STAR Center	Interior Access Route	328330	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ 366	1	
STAR Center	Interior Access Route	328331	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ 366	1	
STAR Center	Interior Access Route	328332	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ 366	1	

PHASE EASILY REMOVABLE BARRIERS (ERBs)						
PARK	CATEGORY	BARRIER ID	BARRIER DESCRIPTION	ESTIMATE	PRIORITY	
STAR Center	Entrance to Building	328333	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ 366	1	
STAR Center	Interior Access Route	328336	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ 366	1	
STAR Center	Entrance to Building	328337	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ 457	1	
Stewart Heights Park & Pool	Restroom	327407	The hardware at the wheelchair stall door is not compliant.	\$ 293	3	
Stewart Heights Park & Pool	Interior Access Route	327410	Means of egress signage is not provided.	\$ 165	3	
Stewart Heights Park & Pool	Restroom	327417	The swinging door does not have a smooth surface within 10" of the ground measured vertically on the push side extending the full width of the door.	\$ 100	2	
Stewart Heights Park & Pool	Restroom	327418	The force required to open the interior, hinged, non-fire door is more than 5 pounds.	\$ 366	3	
Stewart Heights Park & Pool	Restroom	327415	The hardware at the wheelchair stall door is not compliant.	\$ 293	3	
Stewart Heights Park & Pool	Restroom	327423	The force required to open the interior, hinged, non-fire door is more than 5 pounds.	\$ 366	3	
Stewart Heights Park & Pool	Restroom	327424	The swinging door does not have a smooth surface within 10" of the ground measured vertically on the push side extending the full width of the door.	\$ 100	2	
Stewart Heights Park & Pool	Restroom	327422	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ 366	3	
Stewart Heights Park & Pool	Restroom	327421	The provided signage is not mounted at the latch side of the door.	\$ 55	3	
Stewart Heights Park & Pool	Entrance to Building	327434	The non-fire, automatic accessible door requires more than 5 pounds of pressure to operate.	\$ 732	1	
Stewart Heights Park & Pool	Entrance to Building	327435	The surface of the door within 10 inches of the finish floor or ground for the full width of the door on the push side is not smooth.	\$ 100	2	
Stewart Heights Park & Pool	Entrance to Building	327433	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ 732	1	
Stewart Heights Park & Pool	Entrance to Building	327437	The non-fire, automatic accessible door requires more than 5 pounds of pressure to operate.	\$ 366	1	
Stewart Heights Park & Pool	Entrance to Building	327438	The surface of the door within 10 inches of the finish floor or ground for the full width of the door on the push side is not smooth.	\$ 100	2	
Stewart Heights Park & Pool	Entrance to Building	327436	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ 366	1	
Stewart Heights Park & Pool	Entrance to Building	327439	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ 366	1	
Stewart Heights Park & Pool	Entrance to Building	327440	The non-fire, automatic accessible door requires more than 5 pounds of pressure to operate.	\$ 366	1	
Stewart Heights Park & Pool	Signage	327441	Signage with tactile lettering is located lower than 48" measured to the baseline of the lowest tactile character, or higher than 60" measured to the baseline of the highest tactile character.	\$ 280	4	
Stewart Heights Park & Pool	Signage	327442	Signage with tactile lettering is located lower than 48" measured to the baseline of the lowest tactile character, or higher than 60" measured to the baseline of the highest tactile character.	\$ 280	4	
Stewart Heights Park & Pool	Signage	327443	Signage with tactile lettering is located lower than 48" measured to the baseline of the lowest tactile character, or higher than 60" measured to the baseline of the highest tactile character.	\$ 280	4	
Stewart Heights Park & Pool	Restroom	327444	The restroom does not have compliant signage at the door with the International Symbol of Accessibility.	\$ 55	3	
Stewart Heights Park & Pool	Restroom	327445	The restroom does not have compliant signage at the door with the International Symbol of Accessibility.	\$ 55	3	
Stewart Heights Park & Pool	Restroom	327451	The coat hook is not within an allowable reach range.	\$ 115	3	
Stewart Heights Park & Pool	Interior Access Route	327453	Means of egress signage is not provided.	\$ 55	3	
Stewart Heights Park & Pool	Entrance to Building	327454	The surface of the door within 10 inches of the finish floor or ground for the full width of the door on the push side is not smooth.	\$ 100	2	
Stewart Heights Park & Pool	Entrance to Building	327455	The non-fire, automatic accessible door requires more than 5 pounds of pressure to operate.	\$ 366	1	
Stewart Heights Park & Pool	Signage	327456	Signage with tactile lettering is located lower than 48" measured to the baseline of the lowest tactile character, or higher than 60" measured to the baseline of the highest tactile character.	\$ 280	4	
Stewart Heights Park & Pool	Entrance to Building	327457	The surface of the door within 10 inches of the finish floor or ground for the full width of the door on the push side is not smooth.	\$ 100	2	
Stewart Heights Park & Pool	Entrance to Building	327459	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ 366	1	
Stewart Heights Park & Pool	Entrance to Building	327460	The non-fire, automatic accessible door requires more than 5 pounds of pressure to operate.	\$ 366	1	
Stewart Heights Park & Pool	Interior Access Route	327463	Means of egress signage is not provided.	\$ 55	3	
Stewart Heights Park & Pool	Signage	327464	Signage with tactile lettering is located lower than 48" measured to the baseline of the lowest tactile character, or higher than 60" measured to the baseline of the highest tactile character.	\$ 280	4	
Stewart Heights Park & Pool	Signage	327465	Signage with tactile lettering does not have 18" minimum by 18" minimum clear space centered on the tactile characters and/or beyond the arc swing of a door between the closed position and 45 degrees open.	\$ 100	4	
Stewart Heights Park & Pool	Signage	327466	Signage with tactile lettering is located lower than 48" measured to the baseline of the lowest tactile character, or higher than 60" measured to the baseline of the highest tactile character.	\$ 280	4	
Stewart Heights Park & Pool	Entrance to Building	327468	The surface of the door within 10 inches of the finish floor or ground for the full width of the door on the push side is not smooth.	\$ 100	2	
Stewart Heights Park & Pool	Entrance to Building	327469	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ 366	1	
Stewart Heights Park & Pool	Entrance to Building	327470	The non-fire, automatic accessible door requires more than 5 pounds of pressure to operate.	\$ 366	1	
Stewart Heights Park & Pool	Interior Access Route	327473	Means of egress signage is not provided.	\$ 165	3	
Stewart Heights Park & Pool	Signage	327474	Signage with tactile lettering is located lower than 48" measured to the baseline of the lowest tactile character, or higher than 60" measured to the baseline of the highest tactile character.	\$ 280	4	
Stewart Heights Park & Pool	Entrance to Building	327475	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ 366	1	
Stewart Heights Park & Pool	Entrance to Building	327476	The non-fire, automatic accessible door requires more than 5 pounds of pressure to operate.	\$ 366	1	
Stewart Heights Park & Pool	Entrance to Building	327479	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ 366	1	
Stewart Heights Park & Pool	Entrance to Building	327480	The non-fire, automatic accessible door requires more than 5 pounds of pressure to operate.	\$ 366	1	

PHASE EASILY REMOVABLE BARRIERS (ERBs)						
PARK	CATEGORY	BARRIER ID	BARRIER DESCRIPTION	ESTIMATE	PRIORITY	
Stewart Heights Park & Pool	Restroom	327482	The provided signage is not mounted at the latch side of the door or at a compliant height.	\$ 55	3	
Stewart Heights Park & Pool	Accessible Parking	327314	WASHINGTON: Signage is not located at the required height for the standard accessible space.	\$ 280	1	
Stewart Heights Park & Pool	Accessible Parking	327315	WASHINGTON: Signage is not located at the required height for the standard accessible space.	\$ 280	1	
Stewart Heights Park & Pool	Accessible Parking	327316	WASHINGTON: The car access aisle signage is not provided.	\$ 280	1	
Stewart Heights Park & Pool	Accessible Parking	327325	WASHINGTON: The car access aisle signage is not provided.	\$ 280	1	
Stewart Heights Park & Pool	Accessible Parking	327326	WASHINGTON: Compliant signage is not provided at the standard space.	\$ 280	1	
Stewart Heights Park & Pool	Accessible Parking	327329	WASHINGTON: The van access aisle signage is not provided.	\$ 280	1	
Stewart Heights Park & Pool	Accessible Parking	327332	WASHINGTON: Compliant signage is not provided at the van space.	\$ 280	1	
Stewart Heights Park & Pool	Accessible Parking	327331	WASHINGTON: Compliant signage is not provided at the van space or access aisle.	\$ 560	1	
Stewart Heights Park & Pool	Accessible Parking	327335	WASHINGTON: Compliant signage is not provided at the van space.	\$ 560	1	
Stewart Heights Park & Pool	Accessible Parking	327336	WASHINGTON: Compliant signage is not provided at the van space.	\$ 280	1	
Stewart Heights Park & Pool	Entrance to Building	327348	The non-fire, automatic accessible door requires more than 5 pounds of pressure to operate. Signage with tactile lettering does not have 18" minimum by 18" minimum clear space centered on the tactile characters and/or beyond the arc swing of a door between the closed position and 45 degrees open.	\$ 366	1	
Stewart Heights Park & Pool	Signage	327349	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ 280	4	
Stewart Heights Park & Pool	Entrance to Building	327351	The non-fire, automatic accessible door requires more than 5 pounds of pressure to operate. Signage with tactile lettering does not have 18" minimum by 18" minimum clear space centered on the tactile characters and/or beyond the arc swing of a door between the closed position and 45 degrees open.	\$ 366	1	
Stewart Heights Park & Pool	Entrance to Building	327352	The non-fire, automatic accessible door requires more than 5 pounds of pressure to operate. Signage with tactile lettering does not have 18" minimum by 18" minimum clear space centered on the tactile characters and/or beyond the arc swing of a door between the closed position and 45 degrees open.	\$ 366	1	
Stewart Heights Park & Pool	Signage	327354	Signage with tactile lettering is located lower than 48" measured to the baseline of the lowest tactile character, or higher than 60" measured to the baseline of the highest tactile character.	\$ 280	4	
Stewart Heights Park & Pool	Accessible Parking	327355	Signage is not located at the required height for the standard accessible space.	\$ 280	1	
Stewart Heights Park & Pool	Accessible Parking	327356	WASHINGTON: The car access aisle signage is not provided.	\$ 280	1	
Stewart Heights Park & Pool	Accessible Parking	327357	WASHINGTON: A van stall, access aisle, and signage is not provided.	\$ 11,300	1	
Stewart Heights Park & Pool	Playground	327390	The ground surface has not been inspected and maintained regularly.	\$ 2,700	2	
Stewart Heights Park & Pool	Playground	327391	The ground surface has not been inspected and maintained regularly.	\$ 312	2	
Stewart Heights Park & Pool	Exterior Access Route	327400	The gate does not have a smooth surface within 10" of the ground. The surface of the door within 10 inches of the finish floor or ground for the full width of the door on the push side is not smooth.	\$ 160	2	
Stewart Heights Park & Pool	Entrance to Building	327411	Signage with tactile lettering is located lower than 48" measured to the baseline of the lowest tactile character, or higher than 60" measured to the baseline of the highest tactile character.	\$ 100	2	
Stewart Heights Park & Pool	Signage	327503	Signage with tactile lettering is located lower than 48" measured to the baseline of the lowest tactile character, or higher than 60" measured to the baseline of the highest tactile character.	\$ 280	4	
Stewart Heights Park & Pool	Signage	327504	Signage with tactile lettering is located lower than 48" measured to the baseline of the lowest tactile character, or higher than 60" measured to the baseline of the highest tactile character. The surface of the door within 10 inches of the finish floor or ground for the full width of the door on the push side is not smooth.	\$ 280	4	
Stewart Heights Park & Pool	Entrance to Building	327506	The surface of the door within 10 inches of the finish floor or ground for the full width of the door on the push side is not smooth.	\$ 100	2	
Stewart Heights Park & Pool	Entrance to Building	327509	The surface of the door within 10 inches of the finish floor or ground for the full width of the door on the push side is not smooth.	\$ 100	2	
Swan Creek Park	Accessible Parking	323156	WASHINGTON: Van access aisle signage is not provided.	\$ 280	1	
Swan Creek Park	Accessible Parking	323146	WASHINGTON: The van access aisle signage is not provided.	\$ 280	1	
Swan Creek Park	Accessible Parking	323147	WASHINGTON: Compliant signage is not provided at the van stall and access aisle.	\$ 560	1	
Swan Creek Park	Accessible Parking	323162	WASHINGTON: Compliant signage is not provided at the van space or access aisle.	\$ 280	1	
Swan Creek Park	Accessible Parking	323159	WASHINGTON: Compliant signage is not provided at the van space or access aisle.	\$ 280	1	
Swan Creek Park	Exterior Access Route	323168	The gate does not have a smooth surface within 10" of the ground.	\$ 160	2	
Swan Creek Park	Exterior Access Route	323176	The gate does not have a smooth surface within 10" of the ground.	\$ 160	2	
Swan Creek Park	Exterior Access Route	323177	The gate does not have a smooth surface within 10" of the ground.	\$ 160	2	
Swan Creek Park	Exterior Access Route	323180	The gate does not have a smooth surface within 10" of the ground.	\$ 160	2	
Swan Creek Park	Exterior Access Route	323181	The gate does not have a smooth surface within 10" of the ground.	\$ 160	2	
Swan Creek Park	Exterior Access Route	323191	The gate does not have a smooth surface within 10" of the ground.	\$ 160	2	
Swan Creek Park	Exterior Access Route	323192	The gate does not have a smooth surface within 10" of the ground.	\$ 160	2	
Swan Creek Park	Exterior Access Route	323193	The gate does not have a smooth surface within 10" of the ground.	\$ 160	2	
Swan Creek Park	Exterior Access Route	323196	The gate does not have a smooth surface within 10" of the ground.	\$ 160	2	
Swan Creek Park	Exterior Access Route	323197	The gate does not have a smooth surface within 10" of the ground.	\$ 160	2	
Swan Creek Park	Entrance to Building	323205	The non-fire, automatic accessible door requires more than 5 pounds of pressure to operate.	\$ 366	1	
Swan Creek Park	Entrance to Building	323207	The non-fire, automatic accessible door requires more than 5 pounds of pressure to operate.	\$ 366	1	
Tacoma Nature Center and Snake Lake Natural Area	Interior Access Route	346063	The bottom of the door vision light is higher than 43" and less than 66".	\$ 2,600	2	
Tacoma Nature Center and Snake Lake Natural Area	Accessible Parking	346044	WASHINGTON: Compliant signage is not provided at the van access aisle.	\$ 280	1	
Tacoma Nature Center and Snake Lake Natural Area	Accessible Parking	346046	WASHINGTON: Compliant signage is not provided at the van space. The surface of the swinging door within 10 inches of the finish floor or ground for the full width of the door on the push side is not smooth.	\$ 280	1	
Tacoma Nature Center and Snake Lake Natural Area	Interior Access Route	346064	Items that require a forward reach motion require more than 48" height reach.	\$ 200	2	
Tacoma Nature Center and Snake Lake Natural Area	Interior Access Route	346067	The bottom of the door vision light is higher than 43" and less than 66".	\$ 200	2	
Tacoma Nature Center and Snake Lake Natural Area	Interior Access Route	346071	Tactile means of egress signage is not provided at the latch side of the door. (Applies to designated egress stairways, exit doors, areas of refuge)	\$ 2,600	2	
Tacoma Nature Center and Snake Lake Natural Area	Interior Access Route	346074	The swinging door does not have a smooth surface within 10" of the ground measured vertically on the push side extending the full width of the door.	\$ 220	2	
Tacoma Nature Center and Snake Lake Natural Area	Restroom	346078	The interior signage indicating a permanent space does not have compliant visual and tactile characters, with raised or indented characters or symbols. The swinging door does not have a smooth surface within 10" of the ground measured vertically on the push side extending the full width of the door.	\$ 400	2	
Tacoma Nature Center and Snake Lake Natural Area	Interior Access Route	346095	The restroom does not have compliant signage at the door with the International Symbol of Accessibility, raised characters, and Braille.	\$ 55	2	
Tacoma Nature Center and Snake Lake Natural Area	Restroom	346099	The restroom does not have compliant signage at the door with the International Symbol of Accessibility, raised characters, and Braille.	\$ 200	2	
Tacoma Nature Center and Snake Lake Natural Area	Restroom	346100	Signage identifying the name of a permanent indoor space lack Braille.	\$ 55	3	
Tacoma Nature Center and Snake Lake Natural Area	Site Furnishings	362608	Signage identifying the name of a permanent indoor space lack Braille.	\$ 350	4	
Thea's Park	Accessible Parking	319000	WASHINGTON: Signage is not located at the required height for the van accessible space.	\$ 280	1	
Titlow Park	Exterior Access Route	324485	WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 352	3	
Titlow Park	Exterior Access Route	324483	WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 316	3	
Titlow Park	Entrance to Building	324762	The opening force of the fire door is more than the minimum allowable by the appropriate administrative authority.	\$ 2,287	1	
Titlow Park	Exterior Access Route	324484	WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 352	3	

PHASE EASILY REMOVABLE BARRIERS (ERBs)						
PARK	CATEGORY	BARRIER ID	BARRIER DESCRIPTION	ESTIMATE	PRIORITY	
Titlow Park	Entrance to Building	324752	The non-fire, automatic accessible door requires more than 5 pounds of pressure to operate. WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 366	1	
Titlow Park	Exterior Access Route	324479		\$ 316	3	
Titlow Park	Restroom	324285	Pipes are not insulated.	\$ 65	3	
Titlow Park	Restroom	324289	Pipes are not insulated.	\$ 65	3	
Titlow Park	Restroom	324291	The wheelchair stall door is not compliant.	\$ 500	3	
Titlow Park	Common Areas	324304	Pipes are not insulated	\$ 65	3	
Titlow Park	Restroom	324306	The wheelchair stall door is not compliant.	\$ 500	3	
Titlow Park	Restroom	324308	The wheelchair stall door is not compliant.	\$ 500	3	
Titlow Park	Restroom	324735	WASHINGTON: The toilet paper dispenser location is not compliant.	\$ 293	3	
Titlow Park	Restroom	324740	The height of controls are not compliant. The opening force required to open the accessible, hinged, non-fire door is more than 5 pounds.	\$ 200	3	
Titlow Park	Interior Access Route	324743		\$ 366	1	
Titlow Park	Interior Access Route	324744	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ -	1	
Titlow Park	Common Areas	324750	Exposed pipes lack insulation and/or sharp or abrasive surfaces are present under the sink. The storage does not have at least 50% of cabinet shelf space within reach ranges (15"-48"; 46" max when shelving is 10" deep)	\$ 65	2	
Titlow Park	Common Areas	324751		\$ 2,026	4	
Titlow Park	Common Areas	324754	The coat hook is not within an allowable reach range.	\$ 115	3	
Titlow Park	Exterior Access Route	324756	WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface. ADVISORY: The stair treads and edge of top landing do not have visual contrast on the leading edge.	\$ 308	3	
Titlow Park	Interior Access Route	324759		\$ 672	2	
Titlow Park	Exterior Access Route	324314	WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 176	3	
Titlow Park	Exterior Access Route	324317	WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 140	3	
Titlow Park	Exterior Access Route	324313	WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 176	3	
Titlow Park	Accessible Parking	324299	WASHINGTON: Compliant signage is not provided at the van space or access aisle. ADVISORY: The stair treads and edge of top landing do not have visual contrast on the leading edge.	\$ 280	1	
Titlow Park	Interior Access Route	324760		\$ 354	2	
Titlow Park	Accessible Parking	324298	WASHINGTON: Compliant signage is not provided at the standard space and access aisle.	\$ 840	1	
Titlow Park	Exterior Access Route	324310	WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 352	3	
Titlow Park	Playground	324311	The ground surface has not been inspected and maintained regularly.	\$ 2,000	2	
Titlow Park	Exterior Access Route	324312	WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 492	3	
Titlow Park	Playground	324315	The ground surface has not been inspected and maintained regularly.	\$ 2,000	2	
Titlow Park	Playground	324316	The ground surface has not been inspected and maintained regularly.	\$ 1,200	2	
Titlow Park	Accessible Parking	324481	WASHINGTON: Compliant signage is not provided at the van access aisle.	\$ 280	1	
Titlow Park	Interior Access Route	324766	The hardware at the accessible door (including sliding doors - both sides) requires tight grasping, pinching or twisting of the wrist to operate OR is mounted below 34" or above 48".	\$ 586	1	
Titlow Park	Beach	354640	BEST PRACTICE: The beach access route is not compliant or is not provided.	\$ 2,240	1	
Vassault Park	Accessible Parking	324954	WASHINGTON: Compliant signage is not provided at a van space.	\$ 280	1	
Vassault Park	Accessible Parking	324955	WASHINGTON: Compliant signage is not provided at the van access aisle. The opening force of the fire door is more than the minimum allowable by the appropriate administrative authority.	\$ 280	1	
Vassault Park	Entrance to Building	324957		\$ 457	1	
Vassault Park	Restroom	324958	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ 366	3	
Vassault Park	Restroom	324959	The swinging door does not have a smooth surface within 10" of the ground measured vertically on the push side extending the full width of the door.	\$ 200	2	
Vassault Park	Entrance to Building	324961	The opening force of the fire door is more than the minimum allowable by the appropriate administrative authority.	\$ 457	1	
Vassault Park	Restroom	324962	The swinging door does not have a smooth surface within 10" of the ground measured vertically on the push side extending the full width of the door.	\$ 200	2	
Vassault Park	Restroom	324964	WASHINGTON: The toilet paper dispenser location is not compliant.	\$ 293	3	
Vassault Park	Accessible Parking	324968	WASHINGTON: Compliant signage is not provided at the standard space.	\$ 280	1	
Vassault Park	Accessible Parking	324969	WASHINGTON: Compliant signage is not provided at the access aisle.	\$ 280	1	
Vassault Park	Playground	324974	The ground surface has not been inspected and maintained regularly.	\$ 2,050	2	
Vassault Park	Playground	324975	The ground surface has not been inspected and maintained regularly.	\$ 1,600	2	
Vassault Park	Exterior Access Route	324976	The gate does not have a smooth surface within 10" of the ground. The restroom does not have compliant signage at the door with the International Symbol of Accessibility, raised characters, and Braille.	\$ 160	2	
Verlo Playfield	Restroom	349840		\$ 110	3	
Verlo Playfield	Restroom	349841	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ 366	3	
Verlo Playfield	Playground	349850	The ground surface has not been inspected and maintained regularly.	\$ 400	2	
Wapato Hills Park	Accessible Parking	322596	WASHINGTON: The car access aisle signage is not compliant or not provided.	\$ 280	1	
Wapato Hills Park	Restroom	322579	The restroom does not have compliant signage at the door with raised characters and Braille. The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ 55	3	
Wapato Hills Park	Restroom	322581		\$ 366	3	
Wapato Hills Park	Restroom	322578	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ 366	3	
Wapato Hills Park	Restroom	322580	The restroom does not have compliant signage at the door with raised characters and Braille.	\$ 55	3	
Wapato Hills Park	Trail	322614	BEST PRACTICE: The trail is less than 36" wide at the trailhead.	\$ 200	4	
Wapato Park & Pavilion	Exterior Access Route	301479	The gate does not have a smooth surface within 10" of the ground.	\$ 1,120	2	
Wapato Park & Pavilion	Interior Access Route	301489	Means of egress signage is not provided.	\$ 55	3	
Wapato Park & Pavilion	Interior Access Route	301499	The existing signage is not mounted at the latch side of the door or at a compliant height. Tactile means of egress signage is not provided at the latch side of the door. (Applies to designated egress stairways, exit doors, areas of refuge)	\$ 110	2	
Wapato Park & Pavilion	Interior Access Route	301503		\$ 55	2	
Wapato Park & Pavilion	Restroom	301428	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ 366	3	
Wapato Park & Pavilion	Exterior Access Route	301512	WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 704	3	

PHASE EASILY REMOVABLE BARRIERS (ERBs)						
PARK	CATEGORY	BARRIER ID	BARRIER DESCRIPTION	ESTIMATE	PRIORITY	
Wapato Park & Pavilion	Restroom	301527	Pipes are not insulated.	\$ 65	3	
Wapato Park & Pavilion	Entrance to Building	301537	The surface of the door within 10 inches of the finish floor or ground for the full width of the door on the push side is not smooth.	\$ 400	2	
Wapato Park & Pavilion	Restroom	301550	The restroom does not have compliant signage at the door with the International Symbol of Accessibility, raised characters, and Braille.	\$ 55	3	
Wapato Park & Pavilion	Exterior Access Route	301592	WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 176	3	
Wapato Park & Pavilion	Restroom	365017	WASHINGTON: The toilet paper dispenser location is not compliant.	\$ 366	3	
Wapato Park & Pavilion	Restroom	365016	The space between the grab bar and projecting objects above the grab bar is less than 12" minimum.	\$ -	3	
Wapato Park & Pavilion	Restroom	301435	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ 366	3	
Wapato Park & Pavilion	Exterior Access Route	301481	The gate does not have a smooth surface within 10" of the ground.	\$ 480	2	
Wapato Park & Pavilion	Exterior Access Route	301485	The gate does not have a smooth surface within 10" of the ground.	\$ 160	2	
Wapato Park & Pavilion	Interior Access Route	301488	Means of egress signage is not provided.	\$ 55	3	
Wapato Park & Pavilion	Entrance to Building	301491	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ 732	1	
Wapato Park & Pavilion	Entrance to Building	301492	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ 732	1	
Wapato Park & Pavilion	Interior Access Route	301498	Tactile means of egress signage is not provided at the latch side of the door. (Applies to designated egress stairways, exit doors, areas of refuge)	\$ 55	2	
Wapato Park & Pavilion	Interior Access Route	301500	The opening force required to open the accessible, hinged, non-fire door is more than 5 pounds.	\$ 366	1	
Wapato Park & Pavilion	Interior Access Route	301501	The opening force required to open the accessible, hinged, non-fire door is more than 5 pounds.	\$ 366	1	
Wapato Park & Pavilion	Interior Access Route	301502	The existing signage is not mounted at the latch side of the door or at a compliant height.	\$ 110	2	
Wapato Park & Pavilion	Interior Access Route	301505	The surface of the swinging door within 10 inches of the finish floor or ground for the full width of the door on the push side is not smooth.	\$ 186	2	
Wapato Park & Pavilion	Accessible Parking	301423	WASHINGTON: The car access aisle signage is not compliant or not provided.	\$ 280	1	
Wapato Park & Pavilion	Accessible Parking	301424	WASHINGTON: The car access aisle signage is not compliant or not provided.	\$ 280	1	
Wapato Park & Pavilion	Kitchen	301494	Exposed pipes lack insulation and/or sharp or abrasive surfaces are present under the sink.	\$ 65	2	
Wapato Park & Pavilion	Interior Access Route	301496	The surface of the swinging door within 10 inches of the finish floor or ground for the full width of the door on the push side is not smooth.	\$ 186	2	
Wapato Park & Pavilion	Exterior Access Route	301509	WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 704	3	
Wapato Park & Pavilion	Restroom	301515	WASHINGTON: The toilet paper dispenser location is not compliant.	\$ 293	3	
Wapato Park & Pavilion	Restroom	301516	The space between the grab bar and projecting objects above the grab bar is less than 12" minimum.	\$ -	3	
Wapato Park & Pavilion	Restroom	301524	WASHINGTON: The toilet paper dispenser location is not compliant.	\$ 293	3	
Wapato Park & Pavilion	Restroom	301528	Pipes are not insulated.	\$ 65	3	
Wapato Park & Pavilion	Restroom	301532	Pipes are not insulated.	\$ 65	3	
Wapato Park & Pavilion	Entrance to Building	301536	The surface of the door within 10 inches of the finish floor or ground for the full width of the door on the push side is not smooth.	\$ 400	2	
Wapato Park & Pavilion	Restroom	301539	Pipes are not insulated.	\$ 65	3	
Wapato Park & Pavilion	Entrance to Building	301546	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ 366	1	
Wapato Park & Pavilion	Interior Access Route	301549	The surface of the swinging door within 10 inches of the finish floor or ground for the full width of the door on the push side is not smooth.	\$ 186	2	
Wapato Park & Pavilion	Restroom	301551	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$ 366	3	
Wapato Park & Pavilion	Restroom	301557	The mirror is mounted higher than 40" above finish floor to the bottom of the reflective surface, where it is installed above a lavatory or counter.	\$ 200	3	
Wapato Park & Pavilion	Entrance to Building	301564	The edges of the carpet are not securely attached.	\$ 270	1	
Wapato Park & Pavilion	Exterior Access Route	301593	WASHINGTON: The stair treads do not have visual contrast of dark-on-light or light-on-dark on the leading 2" of the tread from the remaining portion of the tread surface.	\$ 176	3	
Wapato Park & Pavilion	Playground	303551	The ground surface has not been inspected and maintained regularly.	\$ 600	2	
Wapato Park & Pavilion	Playground	303552	The ground surface has not been inspected and maintained regularly.	\$ 600	2	
Wapato Park & Pavilion	Restroom	365018	WASHINGTON: The toilet paper dispenser location is not compliant.	\$ 366	3	
Wapato Park & Pavilion	Restroom	365015	The space between the grab bar and projecting objects above the grab bar is less than 12" minimum.	\$ -	3	
Wapato Park & Pavilion	Restroom	365019	The space between the grab bar and projecting objects above the grab bar is less than 12" minimum.	\$ -	3	
Wapato Park & Pavilion	Restroom	301523	The space between the grab bar and projecting objects above the grab bar is less than 12" minimum.	\$ 100	3	
Wright Park and WW Seymour Botanical Conservatory	Restroom	317272	The mirror is mounted higher than 40" above finish floor to the bottom of the reflective surface, where it is installed above a lavatory or counter.	\$ 200	3	
Wright Park and WW Seymour Botanical Conservatory	Interior Access Route	317279	The opening force required to open the accessible, hinged, non-fire door is more than 5 pounds.	\$ 366	1	
Wright Park and WW Seymour Botanical Conservatory	Interior Access Route	317282	Accessible entries are not identified with the International Symbol of Accessibility, where not all entrances are accessible.	\$ 120	1	
Wright Park and WW Seymour Botanical Conservatory	Restroom	317264	The mirror is mounted higher than 40" above finish floor to the bottom of the reflective surface, where it is installed above a lavatory or counter.	\$ 200	3	
Wright Park and WW Seymour Botanical Conservatory	Interior Access Route	317261	The opening force required to open the accessible, hinged, non-fire door is more than 5 pounds.	\$ 366	1	
Wright Park and WW Seymour Botanical Conservatory	Interior Access Route	317255	Tactile means of egress signage is not provided at the latch side of the door. (Applies to designated egress stairways, exit doors, areas of refuge)	\$ 250	2	
Wright Park and WW Seymour Botanical Conservatory	Exterior Access Route	317245	The gate hardware is not compliant.	\$ 200	1	
Wright Park and WW Seymour Botanical Conservatory	Restroom	317231	The surface of the door within 10 inches of the finish floor or ground for the full width of the door on the push side is not smooth.	\$ 400	2	
Wright Park and WW Seymour Botanical Conservatory	Restroom	317223	The restroom does not have compliant signage at the door with the International Symbol of Accessibility, raised characters, and Braille.	\$ 240	3	
Wright Park and WW Seymour Botanical Conservatory	Restroom	317222	The restroom does not have compliant signage at the door with the International Symbol of Accessibility, raised characters, and Braille.	\$ 240	3	
TOTAL				\$ 430,514		

APPENDIX E: EASILY REMOVABLE BARRIERS (ERB)



Park	Barrier ID	Category	Estimate	Priority
Alderwood Park	316435	Playground	\$ 1,075	2
Alderwood Park	316638	Exterior Access Route	\$ 500	4
Alderwood Park	316423	Common Areas	\$ 1,098	4
Alling Park	322087	Playground	\$ 1,749	2
Alling Park	322086	Exterior Access Route	\$ 352	3
Baltimore Park	332560	Trail	\$ 280	4
Baltimore Park	332561	Playground	\$ 1,000	2
Browns Point Lighthouse Park	315358	Exterior Access Route	\$ 200	2
Browns Point Lighthouse Park	315359	Accessible Parking	\$ 280	1
Browns Point Lighthouse Park	315386	Portable Restroom	\$ 3,000	3
Browns Point Lighthouse Park	315385	Portable Restroom	\$ -	3
Browns Point Playfield	315726	Exterior Access Route	\$ -	1
Browns Point Playfield	315710	Accessible Parking	\$ 280	1
Browns Point Playfield	315711	Accessible Parking	\$ 560	1
Browns Point Playfield	315716	Exterior Access Route	\$ 200	1
Browns Point Playfield	315717	Exterior Access Route	\$ 320	2
Center at Norpoint	349860	Interior Access Route	\$ 660	2
Center at Norpoint	349863	Interior Access Route	\$ 7,200	2
Center at Norpoint	349864	Interior Access Route	\$ 293	1
Center at Norpoint	349865	Interior Access Route	\$ 366	1
Center at Norpoint	349866	Restroom	\$ 130	3
Center at Norpoint	349868	Restroom	\$ 143	3
Center at Norpoint	349871	Entrance to Building	\$ 366	1
Center at Norpoint	349876	Restroom	\$ 110	3
Center at Norpoint	349880	Restroom	\$ 130	3
Center at Norpoint	349883	Restroom	\$ 143	3
Center at Norpoint	349885	Restroom	\$ 110	3
Center at Norpoint	349888	Restroom	\$ 130	3
Center at Norpoint	349900	Interior Access Route	\$ 110	2
Center at Norpoint	349901	Interior Access Route	\$ 293	1
Center at Norpoint	349917	Kitchen	\$ 130	2
Center at Norpoint	349918	Playground	\$ 500	2
Charlotte's Blueberry Park	323280	Exterior Access Route	\$ 246	3
Charlotte's Blueberry Park	323278	Exterior Access Route	\$ 160	2
China Lake Park	324282	Trail	\$ 280	4
Chinese Reconciliation Park	319193	Accessible Parking	\$ 280	1
Chinese Reconciliation Park	319194	Accessible Parking	\$ 280	1
Chinese Reconciliation Park	323025	Signage	\$ 280	4
Chinese Reconciliation Park	322567	Exterior Access Route	\$ 560	4
Chinese Reconciliation Park	322566	Exterior Access Route	\$ 280	4
Chinese Reconciliation Park	319212	Exterior Access Route	\$ 1,760	3
Cloverdale Park	328915	Trail	\$ 350	4
Cloverdale Park	328916	Trail	\$ 350	4
Cummings Park	327016	Accessible Parking	\$ 280	1
Cummings Park	327017	Accessible Parking	\$ 280	1
Cummings Park	327021	Accessible Parking	\$ 280	1
Cummings Park	327025	Accessible Parking	\$ 280	1

Park	Barrier ID	Category	Estimate	Priority
Dash Point Park and Pier	315347	Restroom	\$ 293	3
Dash Point Park and Pier	315301	Exterior Access Route	\$ 105	3
Dash Point Park and Pier	315303	Exterior Access Route	\$ 176	3
Dash Point Park and Pier	315316	Accessible Parking	\$ 280	1
Dash Point Park and Pier	315317	Accessible Parking	\$ 280	1
Dash Point Park and Pier	315318	Accessible Parking	\$ 280	1
Dash Point Park and Pier	315322	Accessible Parking	\$ 280	1
Dash Point Park and Pier	315323	Accessible Parking	\$ 280	1
Dash Point Park and Pier	315329	Playground	\$ 12,000	2
Dash Point Park and Pier	315333	Restroom	\$ 55	3
Dash Point Park and Pier	315334	Restroom	\$ 55	3
Dash Point Park and Pier	315337	Restroom	\$ 293	3
Dash Point Park and Pier	315338	Restroom	\$ 65	3
Dash Point Park and Pier	315339	Restroom	\$ 293	3
Dash Point Park and Pier	315342	Restroom	\$ 366	3
Dash Point Park and Pier	315346	Restroom	\$ 65	3
DeLong Park	324027	Accessible Parking	\$ 280	1
DeLong Park	324030	Accessible Parking	\$ 280	1
DeLong Park	324031	Accessible Parking	\$ 280	1
Dickman Mill Park	326865	Restroom	\$ 220	3
Dickman Mill Park	326866	Restroom	\$ 100	2
Dickman Mill Park	326870	Restroom	\$ 200	3
Dune Peninsula at Point Defiance Park	324977	Exterior Access Route	\$ 352	3
Dune Peninsula at Point Defiance Park	324980	Entrance to Building	\$ 457	1
Dune Peninsula at Point Defiance Park	324981	Entrance to Building	\$ -	1
Dune Peninsula at Point Defiance Park	324982	Entrance to Building	\$ 400	2
Dune Peninsula at Point Defiance Park	324985	Entrance to Building	\$ 457	1
Dune Peninsula at Point Defiance Park	324986	Entrance to Building	\$ -	1
Dune Peninsula at Point Defiance Park	324991	Exterior Access Route	\$ 422	3
Dune Peninsula at Point Defiance Park	324995	Exterior Access Route	\$ 457	3
Dune Peninsula at Point Defiance Park	325008	Entrance to Building	\$ 400	2
Dune Peninsula at Point Defiance Park	325007	Entrance to Building	\$ -	1
Dune Peninsula at Point Defiance Park	325006	Entrance to Building	\$ 457	1
Dune Peninsula at Point Defiance Park	325005	Entrance to Building	\$ 400	2
Dune Peninsula at Point Defiance Park	325004	Entrance to Building	\$ -	1
Dune Peninsula at Point Defiance Park	325003	Entrance to Building	\$ 457	1
Eastside Community Center	326422	Accessible Parking	\$ 350	1
Eastside Community Center	326420	Accessible Parking	\$ 560	1
Eastside Community Center	326419	Restroom	\$ 366	3
Eastside Community Center	326411	Signage	\$ 844	3
Eastside Community Center	326406	Accessible Parking	\$ 560	1
Eastside Community Center	326890	Interior Access Route	\$ 366	1
Eastside Community Center	326891	Interior Access Route	\$ 100	2
Eastside Community Center	326892	Interior Access Route	\$ 366	1
Eastside Community Center	326893	Signage	\$ 55	2
Eastside Community Center	326896	Interior Access Route	\$ 103	2
Eastside Community Center	326897	Interior Access Route	\$ 366	1

Park	Barrier ID	Category	Estimate	Priority
Eastside Community Center	326898	Entrance to Building	\$ 366	1
Eastside Community Center	326899	Interior Access Route	\$ 55	2
Eastside Community Center	326900	Interior Access Route	\$ 55	2
Eastside Community Center	326901	Interior Access Route	\$ 366	1
Eastside Community Center	326902	Interior Access Route	\$ 100	2
Eastside Community Center	326903	Interior Access Route	\$ 100	2
Eastside Community Center	326904	Interior Access Route	\$ 366	1
Eastside Community Center	326905	Interior Access Route	\$ 55	2
Eastside Community Center	326906	Interior Access Route	\$ 55	2
Eastside Community Center	326907	Interior Access Route	\$ 55	2
Eastside Community Center	326909	Interior Access Route	\$ 55	2
Eastside Community Center	326910	Interior Access Route	\$ 366	1
Eastside Community Center	326913	Restroom	\$ 200	3
Eastside Community Center	326912	Interior Access Route	\$ 100	2
Eastside Community Center	326915	Restroom	\$ 200	3
Eastside Community Center	326917	Restroom	\$ 200	3
Eastside Community Center	326919	Restroom	\$ 200	3
Eastside Community Center	326921	Interior Access Route	\$ 55	2
Eastside Community Center	326922	Interior Access Route	\$ 55	2
Eastside Community Center	326923	Interior Access Route	\$ 55	2
Eastside Community Center	326924	Interior Access Route	\$ 55	2
Eastside Community Center	326925	Signage	\$ 110	2
Eastside Community Center	326926	Interior Access Route	\$ 55	2
Eastside Community Center	326927	Interior Access Route	\$ 55	2
Eastside Community Center	326928	Interior Access Route	\$ 55	2
Eastside Community Center	326929	Interior Access Route	\$ 55	2
Eastside Community Center	326930	Interior Access Route	\$ 55	2
Eastside Community Center	326931	Interior Access Route	\$ 55	2
Eastside Community Center	326932	Interior Access Route	\$ 220	2
Eastside Community Center	326933	Interior Access Route	\$ 165	2
Eastside Community Center	326934	Interior Access Route	\$ 110	2
Eastside Community Center	326935	Interior Access Route	\$ 110	2
Eastside Community Center	326936	Interior Access Route	\$ 100	2
Eastside Community Center	326937	Interior Access Route	\$ 366	1
Eastside Community Center	326938	Interior Access Route	\$ 366	1
Eastside Community Center	326939	Interior Access Route	\$ 366	1
Eastside Community Center	326940	Interior Access Route	\$ 732	1
Eastside Community Center	326941	Interior Access Route	\$ 1,464	1
Eastside Community Center	326942	Interior Access Route	\$ 732	1
Eastside Community Center	326943	Interior Access Route	\$ 366	1
Eastside Community Center	326944	Interior Access Route	\$ 366	1
Eastside Community Center	326945	Interior Access Route	\$ 366	1
Eastside Community Center	326946	Interior Access Route	\$ 366	1
Eastside Community Center	326948	Interior Access Route	\$ 366	1
Eastside Community Center	326949	Interior Access Route	\$ 366	1
Eastside Community Center	326950	Interior Access Route	\$ 366	1
Eastside Community Center	326951	Interior Access Route	\$ 366	1

Park	Barrier ID	Category	Estimate	Priority
Eastside Community Center	326952	Interior Access Route	\$ 366	1
Eastside Community Center	326953	Interior Access Route	\$ 366	1
Eastside Community Center	326954	Interior Access Route	\$ 100	2
Eastside Community Center	326955	Interior Access Route	\$ 366	1
Eastside Community Center	326956	Interior Access Route	\$ 366	1
Eastside Community Center	326957	Interior Access Route	\$ 100	2
Eastside Community Center	326959	Interior Access Route	\$ 732	1
Eastside Community Center	326960	Interior Access Route	\$ 200	2
Eastside Community Center	326961	Interior Access Route	\$ 732	1
Eastside Community Center	326962	Interior Access Route	\$ 732	1
Eastside Community Center	326963	Interior Access Route	\$ 732	1
Eastside Community Center	326964	Interior Access Route	\$ 732	1
Eastside Community Center	326966	Interior Access Route	\$ 366	1
Eastside Community Center	326973	Restroom	\$ 115	3
Eastside Community Center	326977	Restroom	\$ 115	3
Eastside Community Center	326981	Interior Access Route	\$ 100	2
Eastside Community Center	326982	Interior Access Route	\$ 366	1
Eastside Community Center	326983	Interior Access Route	\$ 366	1
Eastside Community Center	326984	Interior Access Route	\$ 100	2
Eastside Community Center	326985	Interior Access Route	\$ 366	1
Eastside Community Center	326986	Interior Access Route	\$ 366	1
Eastside Community Center	326987	Interior Access Route	\$ 100	2
Eastside Community Center	326988	Interior Access Route	\$ 366	1
Eastside Community Center	326989	Interior Access Route	\$ 366	1
Eastside Community Center	326991	Restroom	\$ 115	3
Eastside Community Center	326994	Interior Access Route	\$ 100	2
Eastside Community Center	326998	Interior Access Route	\$ 732	1
Eastside Community Center	326999	Interior Access Route	\$ 732	1
Eastside Community Center	327000	Interior Access Route	\$ 200	2
Eastside Community Center	327001	Interior Access Route	\$ 732	1
Eastside Community Center	327002	Interior Access Route	\$ 732	1
Eastside Community Center	327003	Interior Access Route	\$ 55	2
Eastside Community Center	327004	Interior Access Route	\$ 366	1
Eastside Community Center	327005	Interior Access Route	\$ 366	1
Eastside Community Center	327008	Restroom	\$ 115	3
Eastside Community Center	327012	Entrance to Building	\$ 366	1
Eastside Community Center	327013	Entrance to Building	\$ 366	1
Eastside Community Center	328805	Interior Access Route	\$ 366	1
Eastside Community Center	328806	Interior Access Route	\$ 366	1
Eastside Community Center	328807	Interior Access Route	\$ 366	1
Eastside Community Center	328808	Interior Access Route	\$ 366	1
Eastside Community Center	328809	Interior Access Route	\$ 366	1
Eastside Community Center	328810	Restroom	\$ 366	3
Eastside Community Center	326429	Common Areas	\$ 3,000	2
Eastside Community Center	326894	Restroom	\$ 200	3
Eastside Community Center	326997	Interior Access Route	\$ 200	2
Fern Hill Park	323804	Playground	\$ 2,450	2

Park	Barrier ID	Category	Estimate	Priority
Fern Hill Park	323805	Playground	\$ 1,190	2
Fern Hill Park	323806	Exterior Access Route	\$ 528	3
Fern Hill Park	323810	Exterior Access Route	\$ 8,960	1
Fern Hill Park	323811	Trail	\$ 560	4
Fern Hill Park	323812	Exterior Access Route	\$ 105	3
Ferry Park	320766	Exterior Access Route	\$ 246	3
Ferry Park	320767	Exterior Access Route	\$ 281	3
Fort Nisqually Living History Museum	325169	Accessible Parking	\$ 280	1
Fort Nisqually Living History Museum	325171	Accessible Parking	\$ 280	1
Fort Nisqually Living History Museum	325175	Entrance to Building	\$ 457	1
Fort Nisqually Living History Museum	325176	Entrance to Building	\$ -	1
Fort Nisqually Living History Museum	325178	Entrance to Building	\$ 457	1
Fort Nisqually Living History Museum	325180	Restroom	\$ 55	3
Fort Nisqually Living History Museum	325181	Restroom	\$ 65	3
Fort Nisqually Living History Museum	325184	Restroom	\$ 115	3
Fort Nisqually Living History Museum	325183	Restroom	\$ 500	3
Fort Nisqually Living History Museum	325187	Restroom	\$ 293	3
Fort Nisqually Living History Museum	325189	Restroom	\$ 55	3
Fort Nisqually Living History Museum	325190	Restroom	\$ 65	3
Fort Nisqually Living History Museum	325191	Restroom	\$ 500	3
Fort Nisqually Living History Museum	325192	Restroom	\$ 115	3
Fort Nisqually Living History Museum	325194	Restroom	\$ 293	3
Fort Nisqually Living History Museum	325201	Entrance to Building	\$ 457	1
Fort Nisqually Living History Museum	325203	Restroom	\$ 110	3
Fort Nisqually Living History Museum	325204	Restroom	\$ 293	3
Fort Nisqually Living History Museum	325205	Restroom	\$ 200	3
Fort Nisqually Living History Museum	325206	Restroom	\$ 200	3
Fort Nisqually Living History Museum	325207	Restroom	\$ 115	3
Fort Nisqually Living History Museum	325208	Restroom	\$ 293	3
Fort Nisqually Living History Museum	325209	Restroom	\$ 200	3
Fort Nisqually Living History Museum	325210	Restroom	\$ 200	3
Fort Nisqually Living History Museum	325211	Restroom	\$ 115	3
Fort Nisqually Living History Museum	325218	Exterior Access Route	\$ 105	3
Fort Nisqually Living History Museum	325219	Exterior Access Route	\$ 105	3
Fort Nisqually Living History Museum	325220	Entrance to Building	\$ 457	1
Fort Nisqually Living History Museum	325221	Entrance to Building	\$ -	1
Franklin Park	319967	Accessible Parking	\$ 280	1
Franklin Park	319982	Exterior Access Route	\$ 352	3
Franklin Park	319993	Exterior Access Route	\$ 160	2
Franklin Park	319996	Common Areas	\$ 2,196	4
Franklin Park	319998	Restroom	\$ 55	3
Franklin Park	319999	Entrance to Building	\$ 366	1
Franklin Park	320002	Entrance to Building	\$ 676	1
Garfield Park	332566	Exterior Access Route	\$ 774	3
Garfield Park	332568	Exterior Access Route	\$ 668	3
Garfield Park	332569	Playground	\$ 3,900	2
Heidelberg Davis Park	344440	Accessible Parking	\$ 560	1

Park	Barrier ID	Category	Estimate	Priority
Heidelberg Davis Park	344444	Accessible Parking	\$ 1,400	1
Heidelberg Davis Park	344449	Accessible Parking	\$ 280	1
Heidelberg Davis Park	344450	Accessible Parking	\$ 280	1
Heidelberg Davis Park	344451	Accessible Parking	\$ 280	1
Heidelberg Davis Park	344458	Restroom	\$ 55	3
Heidelberg Davis Park	344476	Restroom	\$ 115	3
Heidelberg Davis Park	344487	Exterior Access Route	\$ 480	2
Jack Hyde Park	319563	Exterior Access Route	\$ 250	1
Jane Clark Park	332543	Exterior Access Route	\$ 492	3
Jane Clark Park	332547	Exterior Access Route	\$ 492	3
Jane Clark Park	332548	Playground	\$ 4,375	2
Jefferson Park	320694	Exterior Access Route	\$ 280	4
Jefferson Park	320714	Playground	\$ 750	2
Jefferson Park	320717	Playground	\$ 1,440	2
Jefferson Park	320718	Signage	\$ 280	4
Jefferson Park	320719	Playground	\$ 325	2
Jefferson Park	320724	Exterior Access Route	\$ 280	4
Jefferson Park	327270	Exterior Access Route	\$ 280	4
Jefferson Park	327273	Exterior Access Route	\$ 280	4
Jefferson Park	327274	Exterior Access Route	\$ 280	4
Jefferson Park	327277	Exterior Access Route	\$ 280	4
Judge Jack Tanner Park	327060	Accessible Parking	\$ 560	1
Kandle Park & Pool	324916	Entrance to Building	\$ 366	1
Kandle Park & Pool	324917	Entrance to Building	\$ -	1
Kandle Park & Pool	324918	Entrance to Building	\$ 400	2
Kandle Park & Pool	324919	Entrance to Building	\$ 366	1
Kandle Park & Pool	324920	Entrance to Building	\$ -	1
Kandle Park & Pool	324921	Entrance to Building	\$ 400	2
Kandle Park & Pool	324922	Restroom	\$ 65	3
Kandle Park & Pool	324925	Entrance to Building	\$ 366	1
Kandle Park & Pool	324927	Restroom	\$ 200	3
Kandle Park & Pool	324930	Restroom	\$ 500	3
Kandle Park & Pool	324932	Restroom	\$ 200	3
Kandle Park & Pool	324934	Restroom	\$ 200	3
Kandle Park & Pool	324938	Entrance to Building	\$ 366	1
Kandle Park & Pool	324942	Exterior Access Route	\$ 211	3
Kandle Park & Pool	324943	Exterior Access Route	\$ 211	3
Les Davis Pier	328340	Exterior Access Route	\$ 35	3
Les Davis Pier	328345	Exterior Access Route	\$ 35	3
Les Davis Pier	328352	Exterior Access Route	\$ 35	3
Les Davis Pier	328355	Exterior Access Route	\$ 35	3
Les Davis Pier	328356	Exterior Access Route	\$ 35	3
Les Davis Pier	328371	Kitchen	\$ 65	2
Les Davis Pier	328383	Restroom	\$ 130	3
Les Davis Pier	328384	Restroom	\$ 586	3
Les Davis Pier	328385	Restroom	\$ 586	3
Les Davis Pier	328393	Accessible Parking	\$ 280	1

Park	Barrier ID	Category	Estimate	Priority
Les Davis Pier	328395	Accessible Parking	\$ 280	1
Les Davis Pier	328382	Restroom	\$ 200	2
Lincoln Eldridge Park	323887	Restroom	\$ 457	1
Lincoln Eldridge Park	323888	Restroom	\$ 293	3
Lincoln Eldridge Park	323890	Restroom	\$ 293	3
Lincoln Eldridge Park	323892	Restroom	\$ 457	1
Lincoln Eldridge Park	324231	Playground	\$ 3,150	2
Lincoln Eldridge Park	324232	Playground	\$ 1,500	2
Lincoln Eldridge Park	346557	Accessible Parking	\$ 560	1
Lincoln Heights Park	324555	Playground	\$ 900	2
Lincoln Heights Park	324554	Playground	\$ 316	3
Lots for Tots	320738	Playground	\$ 165	2
Lots for Tots	320739	Exterior Access Route	\$ 211	1
Lots for Tots	320742	Playground	\$ 600	2
Manitou Park	323942	Exterior Access Route	\$ 387	3
Manitou Park	323947	Exterior Access Route	\$ 211	3
Meadow Park Golf Course	324122	Exterior Access Route	\$ 560	4
Meadow Park Golf Course	324125	Accessible Parking	\$ 280	1
Meadow Park Golf Course	324126	Accessible Parking	\$ 560	1
Meadow Park Golf Course	324127	Accessible Parking	\$ 280	1
Meadow Park Golf Course	324128	Accessible Parking	\$ 280	1
Meadow Park Golf Course	324145	Entrance to Building	\$ 105	3
Meadow Park Golf Course	324146	Signage	\$ 280	4
Meadow Park Golf Course	324170	Entrance to Building	\$ 366	1
Meadow Park Golf Course	324172	Interior Access Route	\$ 110	3
Meadow Park Golf Course	324177	Restroom	\$ 65	3
Meadow Park Golf Course	324178	Restroom	\$ 65	3
Meadow Park Golf Course	324179	Restroom	\$ 100	2
Meadow Park Golf Course	324180	Restroom	\$ 100	2
Meadow Park Golf Course	324181	Restroom	\$ 366	1
Meadow Park Golf Course	324182	Restroom	\$ 366	3
Meadow Park Golf Course	324186	Restroom	\$ 300	3
Meadow Park Golf Course	324193	Restroom	\$ 300	3
Meadow Park Golf Course	324194	Restroom	\$ 300	3
Meadow Park Golf Course	324196	Restroom	\$ 100	2
Meadow Park Golf Course	324197	Restroom	\$ 366	1
Meadow Park Golf Course	324198	Restroom	\$ 366	3
Meadow Park Golf Course	324202	Restroom	\$ -	3
Meadow Park Golf Course	324215	Restroom	\$ 300	3
Meadow Park Golf Course	324214	Restroom	\$ 366	3
Meadow Park Golf Course	324216	Restroom	\$ 115	3
Meadow Park Golf Course	324217	Entrance to Building	\$ 55	3
Meadow Park Golf Course	324218	Entrance to Building	\$ 165	3
Meadow Park Golf Course	324219	Entrance to Building	\$ 70	3
Meadow Park Golf Course	324220	Restroom	\$ 366	1
Meadow Park Golf Course	324221	Restroom	\$ 366	3
Meadow Park Golf Course	324509	Signage	\$ 280	4

Park	Barrier ID	Category	Estimate	Priority
Meadow Park Golf Course	324510	Signage	\$ 280	4
Metro Parks Headquarters	324236	Restroom	\$ 65	3
Metro Parks Headquarters	324237	Interior Access Route	\$ 366	1
Metro Parks Headquarters	324238	Interior Access Route	\$ -	1
Metro Parks Headquarters	324239	Interior Access Route	\$ 366	1
Metro Parks Headquarters	324240	Interior Access Route	\$ -	1
Metro Parks Headquarters	324246	Restroom	\$ 65	3
Metro Parks Headquarters	324248	Exterior Access Route	\$ 774	3
Metro Parks Headquarters	324249	Interior Access Route	\$ 366	1
Metro Parks Headquarters	324251	Interior Access Route	\$ 366	1
Metro Parks Headquarters	324252	Interior Access Route	\$ 366	1
Metro Parks Headquarters	324253	Restroom	\$ 65	3
Metro Parks Headquarters	324256	Restroom	\$ 65	3
Metro Parks Headquarters	324261	Interior Access Route	\$ 366	1
Metro Parks Headquarters	324247	Restroom	\$ 500	3
Metro Parks Headquarters	324257	Restroom	\$ 500	3
Metro Parks Headquarters	324255	Restroom	\$ 355	3
Norpoint Park	302093	Restroom	\$ 366	3
Norpoint Park	302096	Restroom	\$ 366	3
Norpoint Park	302176	Exterior Access Route	\$ 140	3
Norpoint Park	302094	Restroom	\$ 55	3
Norpoint Park	302095	Restroom	\$ 55	3
Norpoint Park	302117	Signage	\$ 280	4
Norpoint Park	302118	Exterior Access Route	\$ 140	3
Norpoint Park	302172	Exterior Access Route	\$ 70	3
Norpoint Park	302173	Exterior Access Route	\$ 70	3
Norpoint Park	302174	Exterior Access Route	\$ 176	3
Norpoint Park	302184	Exterior Access Route	\$ 70	3
North Slope Historic Park	321879	Exterior Access Route	\$ 246	3
Northeast Tacoma Playground	316657	Playground	\$ 1,200	2
NW Trek Wildlife Park	342380	Exterior Access Route	\$ 492	3
NW Trek Wildlife Park	342295	Exterior Access Route	\$ 704	3
NW Trek Wildlife Park	342340	Exterior Access Route	\$ 457	3
NW Trek Wildlife Park	342339	Exterior Access Route	\$ 457	3
NW Trek Wildlife Park	342137	Exterior Access Route	\$ 105	3
NW Trek Wildlife Park	342136	Exterior Access Route	\$ 105	3
NW Trek Wildlife Park	342306	Exterior Access Route	\$ 176	3
NW Trek Wildlife Park	342275	Entrance to Building	\$ 457	1
NW Trek Wildlife Park	342396	Entrance to Building	\$ 457	1
NW Trek Wildlife Park	342391	Entrance to Building	\$ 457	1
NW Trek Wildlife Park	342452	Entrance to Building	\$ 457	1
NW Trek Wildlife Park	342196	Entrance to Building	\$ 457	1
NW Trek Wildlife Park	342546	Entrance to Building	\$ 457	1
NW Trek Wildlife Park	342436	Entrance to Building	\$ 915	1
NW Trek Wildlife Park	342435	Entrance to Building	\$ 457	1
NW Trek Wildlife Park	342506	Entrance to Building	\$ 915	1
NW Trek Wildlife Park	342505	Entrance to Building	\$ 915	1

Park	Barrier ID	Category	Estimate	Priority
NW Trek Wildlife Park	342182	Entrance to Building	\$ 457	1
NW Trek Wildlife Park	342524	Entrance to Building	\$ 457	1
NW Trek Wildlife Park	342521	Entrance to Building	\$ 457	1
NW Trek Wildlife Park	342520	Entrance to Building	\$ 457	1
NW Trek Wildlife Park	342518	Entrance to Building	\$ 457	1
NW Trek Wildlife Park	342106	Entrance to Building	\$ 366	1
NW Trek Wildlife Park	342210	Accessible Parking	\$ 1,960	1
NW Trek Wildlife Park	342221	Accessible Parking	\$ 280	1
NW Trek Wildlife Park	342238	Accessible Parking	\$ 280	1
NW Trek Wildlife Park	342235	Accessible Parking	\$ 280	1
NW Trek Wildlife Park	342233	Accessible Parking	\$ 280	1
NW Trek Wildlife Park	342230	Accessible Parking	\$ 280	1
NW Trek Wildlife Park	342227	Accessible Parking	\$ 280	1
NW Trek Wildlife Park	342223	Accessible Parking	\$ 280	1
NW Trek Wildlife Park	342449	Interior Access Route	\$ 400	2
NW Trek Wildlife Park	342276	Entrance to Building	\$ 400	2
NW Trek Wildlife Park	342397	Entrance to Building	\$ 400	2
NW Trek Wildlife Park	342107	Entrance to Building	\$ 400	2
NW Trek Wildlife Park	342392	Entrance to Building	\$ 400	2
NW Trek Wildlife Park	342450	Entrance to Building	\$ 400	2
NW Trek Wildlife Park	342445	Entrance to Building	\$ 800	2
NW Trek Wildlife Park	342301	Entrance to Building	\$ 400	2
NW Trek Wildlife Park	342197	Entrance to Building	\$ 400	2
NW Trek Wildlife Park	342526	Entrance to Building	\$ 400	2
NW Trek Wildlife Park	342431	Entrance to Building	\$ 1,600	2
NW Trek Wildlife Park	342427	Entrance to Building	\$ 400	2
NW Trek Wildlife Park	342423	Entrance to Building	\$ 400	2
NW Trek Wildlife Park	342183	Entrance to Building	\$ 400	2
NW Trek Wildlife Park	342519	Entrance to Building	\$ 400	2
NW Trek Wildlife Park	342517	Entrance to Building	\$ 400	2
NW Trek Wildlife Park	342535	Restroom	\$ 55	3
NW Trek Wildlife Park	342508	Entrance to Building	\$ 732	1
NW Trek Wildlife Park	342105	Entrance to Building	\$ 366	1
NW Trek Wildlife Park	342108	Restroom	\$ 200	3
NW Trek Wildlife Park	342181	Entrance to Building	\$ -	1
NW Trek Wildlife Park	342247	Entrance to Building	\$ 1,352	1
NW Trek Wildlife Park	342251	Interior Access Route	\$ 200	2
NW Trek Wildlife Park	342259	Interior Access Route	\$ 293	5
NW Trek Wildlife Park	342263	Exterior Access Route	\$ 200	1
NW Trek Wildlife Park	342264	Exterior Access Route	\$ 160	2
NW Trek Wildlife Park	342265	Exterior Access Route	\$ 55	3
NW Trek Wildlife Park	342266	Exterior Access Route	\$ 275	1
NW Trek Wildlife Park	342268	Interior Access Route	\$ 293	1
NW Trek Wildlife Park	342274	Interior Access Route	\$ 293	1
NW Trek Wildlife Park	342300	Entrance to Building	\$ 676	1
NW Trek Wildlife Park	342302	Interior Access Route	\$ 1,465	1
NW Trek Wildlife Park	342317	Entrance to Building	\$ 366	1

Park	Barrier ID	Category	Estimate	Priority
NW Trek Wildlife Park	342364	Entrance to Building	\$ 676	5
NW Trek Wildlife Park	342366	Interior Access Route	\$ 137	5
NW Trek Wildlife Park	342368	Restroom	\$ 55	5
NW Trek Wildlife Park	342370	Restroom	\$ 200	5
NW Trek Wildlife Park	342376	Entrance to Building	\$ 676	5
NW Trek Wildlife Park	342377	Interior Access Route	\$ 293	5
NW Trek Wildlife Park	342379	Entrance to Building	\$ 676	5
NW Trek Wildlife Park	342390	Entrance to Building	\$ 676	5
NW Trek Wildlife Park	342393	Restroom	\$ 200	3
NW Trek Wildlife Park	342395	Entrance to Building	\$ -	1
NW Trek Wildlife Park	342398	Restroom	\$ 200	3
NW Trek Wildlife Park	342420	Interior Access Route	\$ 68	2
NW Trek Wildlife Park	342424	Entrance to Building	\$ 366	1
NW Trek Wildlife Park	342425	Entrance to Building	\$ 676	1
NW Trek Wildlife Park	342428	Entrance to Building	\$ 366	1
NW Trek Wildlife Park	342429	Entrance to Building	\$ 676	1
NW Trek Wildlife Park	342432	Entrance to Building	\$ 1,352	1
NW Trek Wildlife Park	342433	Entrance to Building	\$ -	1
NW Trek Wildlife Park	342434	Entrance to Building	\$ -	1
NW Trek Wildlife Park	342437	Interior Access Route	\$ 293	1
NW Trek Wildlife Park	342444	Entrance to Building	\$ 732	1
NW Trek Wildlife Park	342447	Interior Access Route	\$ 137	2
NW Trek Wildlife Park	342448	Interior Access Route	\$ 293	1
NW Trek Wildlife Park	342451	Entrance to Building	\$ -	1
NW Trek Wildlife Park	342504	Interior Access Route	\$ 68	2
NW Trek Wildlife Park	342507	Entrance to Building	\$ 366	1
NW Trek Wildlife Park	342513	Interior Access Route	\$ 275	2
NW Trek Wildlife Park	342527	Entrance to Building	\$ 676	1
NW Trek Wildlife Park	342542	Restroom	\$ 200	3
NW Trek Wildlife Park	342545	Entrance to Building	\$ 366	1
NW Trek Wildlife Park	342560	Entrance to Building	\$ 676	1
NW Trek Wildlife Park	342566	Interior Access Route	\$ 1,465	1
NW Trek Wildlife Park	342576	Restroom	\$ 200	3
Oakland Madrona Park	344166	Accessible Parking	\$ 280	1
Old Town Dock	326037	Restroom	\$ 200	2
Old Town Park	319631	Exterior Access Route	\$ 560	4
Old Town Park	319632	Exterior Access Route	\$ 690	3
Optimist Park	324901	Accessible Parking	\$ 280	1
Optimist Park	324902	Accessible Parking	\$ 280	1
Peck Field	323614	Restroom	\$ 110	3
Peck Field	323615	Restroom	\$ 586	3
Peck Field	323617	Restroom	\$ 130	3
Peck Field	323618	Restroom	\$ 400	3
Peck Field	323621	Restroom	\$ 230	3
Peck Field	323877	Restroom	\$ 586	3
Peck Field	323650	Accessible Parking	\$ 560	1
Peck Field	323647	Accessible Parking	\$ 560	1

Park	Barrier ID	Category	Estimate	Priority
Peck Field	323642	Accessible Parking	\$ 840	1
Peck Field	323639	Accessible Parking	\$ 560	1
People's Community Center	319370	Restroom	\$ 93	2
People's Community Center	319382	Restroom	\$ 93	2
People's Community Center	319392	Restroom	\$ 55	3
People's Community Center	319399	Restroom	\$ 293	3
People's Community Center	319413	Interior Access Route	\$ 93	2
People's Community Center	319418	Entrance to Building	\$ 366	1
People's Community Center	319425	Interior Access Route	\$ 732	1
People's Community Center	319430	Interior Access Route	\$ 55	2
People's Community Center	319434	Interior Access Route	\$ 372	2
People's Community Center	319440	Interior Access Route	\$ 293	1
People's Community Center	319446	Interior Access Route	\$ 93	2
People's Community Center	319452	Interior Access Route	\$ 366	1
People's Community Center	319455	Interior Access Route	\$ 366	1
People's Community Center	319459	Interior Access Route	\$ 110	2
People's Community Center	319470	Interior Access Route	\$ 186	2
People's Community Center	319480	Interior Access Route	\$ 110	3
People's Community Center	319483	Interior Access Route	\$ 366	1
People's Community Center	319487	Interior Access Route	\$ 293	1
People's Community Center	319490	Entrance to Building	\$ 732	1
People's Community Center	319497	Interior Access Route	\$ 186	2
People's Community Center	319502	Interior Access Route	\$ 732	1
People's Community Center	319505	Interior Access Route	\$ 366	1
People's Community Center	319511	Interior Access Route	\$ 93	2
People's Community Center	319517	Entrance to Building	\$ 732	1
People's Community Center	319523	Interior Access Route	\$ 55	3
People's Community Center	319527	Interior Access Route	\$ 55	3
People's Community Center	319530	Interior Access Route	\$ 366	1
People's Community Center	319536	Entrance to Building	\$ 732	1
People's Community Center	319559	Accessible Parking	\$ 280	1
People's Community Center	319369	Restroom	\$ 93	2
People's Community Center	319378	Restroom	\$ 293	3
People's Community Center	319379	Restroom	\$ 293	3
People's Community Center	319383	Restroom	\$ 93	2
People's Community Center	319389	Restroom	\$ 293	3
People's Community Center	319394	Restroom	\$ 366	3
People's Community Center	319396	Locker and Dressing Rooms	\$ 789	3
People's Community Center	319403	Restroom	\$ 366	3
People's Community Center	319404	Restroom	\$ 55	3
People's Community Center	319415	Interior Access Route	\$ 366	1
People's Community Center	319416	Interior Access Route	\$ 366	1
People's Community Center	319423	Interior Access Route	\$ 93	2
People's Community Center	319421	Exterior Access Route	\$ 211	3
People's Community Center	319427	Interior Access Route	\$ 93	2
People's Community Center	319428	Interior Access Route	\$ 165	3
People's Community Center	319432	Interior Access Route	\$ 366	1

Park	Barrier ID	Category	Estimate	Priority
People's Community Center	319433	Interior Access Route	\$ 93	2
People's Community Center	319436	Interior Access Route	\$ 366	1
People's Community Center	319439	Interior Access Route	\$ 93	2
People's Community Center	319442	Entrance to Building	\$ 732	1
People's Community Center	319443	Entrance to Building	\$ 732	1
People's Community Center	319449	Interior Access Route	\$ 186	2
People's Community Center	319450	Interior Access Route	\$ 586	1
People's Community Center	319453	Interior Access Route	\$ 165	3
People's Community Center	319454	Interior Access Route	\$ 366	1
People's Community Center	319457	Entrance to Building	\$ 366	1
People's Community Center	319460	Interior Access Route	\$ 186	2
People's Community Center	319463	Interior Access Route	\$ 55	2
People's Community Center	319465	Interior Access Route	\$ 93	2
People's Community Center	319475	Interior Access Route	\$ 93	2
People's Community Center	319476	Interior Access Route	\$ 732	1
People's Community Center	319481	Interior Access Route	\$ 93	2
People's Community Center	319482	Interior Access Route	\$ 293	1
People's Community Center	319484	Interior Access Route	\$ 366	1
People's Community Center	319485	Interior Access Route	\$ 110	2
People's Community Center	319488	Interior Access Route	\$ 55	3
People's Community Center	319489	Entrance to Building	\$ 732	1
People's Community Center	319493	Interior Access Route	\$ 275	3
People's Community Center	319494	Entrance to Building	\$ 366	1
People's Community Center	319499	Interior Access Route	\$ 366	1
People's Community Center	319500	Interior Access Route	\$ 93	2
People's Community Center	319503	Interior Access Route	\$ 55	2
People's Community Center	319504	Interior Access Route	\$ 93	2
People's Community Center	319506	Interior Access Route	\$ 93	2
People's Community Center	319510	Interior Access Route	\$ 93	2
People's Community Center	319514	Interior Access Route	\$ 55	3
People's Community Center	319515	Interior Access Route	\$ 55	3
People's Community Center	319519	Interior Access Route	\$ 366	1
People's Community Center	319521	Interior Access Route	\$ 366	1
People's Community Center	319525	Interior Access Route	\$ 366	1
People's Community Center	319526	Interior Access Route	\$ 366	1
People's Community Center	319528	Interior Access Route	\$ 366	1
People's Community Center	319529	Interior Access Route	\$ 55	3
People's Community Center	319531	Interior Access Route	\$ 366	1
People's Community Center	319535	Interior Access Route	\$ 55	3
People's Community Center	319537	Entrance to Building	\$ 366	1
People's Community Center	319546	Exterior Access Route	\$ 160	2
People's Community Center	319560	Accessible Parking	\$ 280	1
People's Community Center	319417	Entrance to Building	\$ 366	1
Point Defiance Marina	332075	Restroom	\$ 366	3
Point Defiance Marina	332077	Restroom	\$ 115	3
Point Defiance Marina	332082	Interior Access Route	\$ -	1
Point Defiance Marina	332081	Entrance to Building	\$ 457	1

Park	Barrier ID	Category	Estimate	Priority
Point Defiance Marina	332084	Entrance to Building	\$ 457	1
Point Defiance Marina	332086	Interior Access Route	\$ -	1
Point Defiance Marina	332088	Entrance to Building	\$ 457	1
Point Defiance Marina	332089	Entrance to Building	\$ 400	2
Point Defiance Marina	332091	Entrance to Building	\$ 400	2
Point Defiance Marina	332093	Entrance to Building	\$ 400	2
Point Defiance Marina	332095	Restroom	\$ 366	3
Point Defiance Marina	332097	Restroom	\$ 115	3
Point Defiance Marina	332099	Restroom	\$ 293	3
Point Defiance Marina	332100	Restroom	\$ 200	3
Point Defiance Marina	332106	Accessible Parking	\$ 700	1
Point Defiance Marina	332108	Accessible Parking	\$ 560	1
Point Defiance Marina	332113	Accessible Parking	\$ 560	1
Point Defiance Marina	332114	Accessible Parking	\$ 560	1
Point Defiance Marina	336552	Common Areas	\$ 281	3
Point Defiance Marina	332079	Restroom	\$ 293	3
Point Defiance Park	325226	Exterior Access Route	\$ 105	3
Point Defiance Park	325227	Accessible Parking	\$ 280	1
Point Defiance Park	325230	Exterior Access Route	\$ 668	3
Point Defiance Park	325232	Exterior Access Route	\$ 809	3
Point Defiance Park	325233	Exterior Access Route	\$ 809	3
Point Defiance Park	325239	Entrance to Building	\$ 915	1
Point Defiance Park	325240	Entrance to Building	\$ -	1
Point Defiance Park	325241	Entrance to Building	\$ 800	2
Point Defiance Park	325242	Entrance to Building	\$ 457	1
Point Defiance Park	325244	Entrance to Building	\$ 400	2
Point Defiance Park	325245	Restroom	\$ 366	3
Point Defiance Park	325246	Restroom	\$ 55	3
Point Defiance Park	325248	Interior Access Route	\$ 35	3
Point Defiance Park	325249	Interior Access Route	\$ 774	3
Point Defiance Park	325250	Restroom	\$ 110	3
Point Defiance Park	325251	Restroom	\$ 732	3
Point Defiance Park	325252	Entrance to Building	\$ 457	1
Point Defiance Park	325253	Restroom	\$ 55	3
Point Defiance Park	325254	Restroom	\$ 366	3
Point Defiance Park	325255	Restroom	\$ 366	3
Point Defiance Park	325257	Restroom	\$ 55	3
Point Defiance Park	325258	Restroom	\$ 366	3
Point Defiance Park	325259	Restroom	\$ 366	3
Point Defiance Park	325260	Common Areas	\$ 732	1
Point Defiance Park	325261	Common Areas	\$ 400	2
Point Defiance Park	325264	Common Areas	\$ 366	1
Point Defiance Park	325263	Entrance to Building	\$ 366	1
Point Defiance Park	325265	Entrance to Building	\$ 457	1
Point Defiance Park	325266	Entrance to Building	\$ -	1
Point Defiance Park	325267	Interior Access Route	\$ 165	2
Point Defiance Park	325268	Common Areas	\$ 65	2

Park	Barrier ID	Category	Estimate	Priority
Point Defiance Park	325270	Interior Access Route	\$ 55	2
Point Defiance Park	332119	Accessible Parking	\$ 280	1
Point Defiance Park	332121	Accessible Parking	\$ 350	1
Point Defiance Park	332122	Accessible Parking	\$ 560	5
Point Defiance Park	332127	Accessible Parking	\$ 560	1
Point Defiance Park	332128	Accessible Parking	\$ 560	1
Point Defiance Park	332129	Restroom	\$ 65	3
Point Defiance Park	332130	Restroom	\$ 293	3
Point Defiance Park	332154	Exterior Access Route	\$ 1,440	2
Point Defiance Park	332159	Accessible Parking	\$ 840	1
Point Defiance Park	332162	Restroom	\$ 55	3
Point Defiance Park	332163	Restroom	\$ 55	3
Point Defiance Park	332171	Accessible Parking	\$ 280	1
Point Defiance Park	332172	Accessible Parking	\$ 280	1
Point Defiance Park	332179	Restroom	\$ 55	3
Point Defiance Park	332187	Restroom	\$ 55	3
Point Defiance Park	332208	Accessible Parking	\$ 1,680	1
Point Defiance Park	332209	Accessible Parking	\$ 560	1
Point Defiance Park	332573	Accessible Parking	\$ 280	1
Point Defiance Park	334526	Restroom	\$ 55	3
Point Defiance Park	334531	Restroom	\$ 55	3
Point Defiance Park	332134	Restroom	\$ 115	3
Point Defiance Park	332139	Entrance to Building	\$ 457	1
Point Defiance Park	332140	Interior Access Route	\$ -	1
Point Defiance Park	332141	Restroom	\$ 65	3
Point Defiance Park	332145	Restroom	\$ 115	3
Point Defiance Park	332166	Playground	\$ 625	2
Point Defiance Park	332167	Playground	\$ 2,700	2
Point Defiance Park	332181	Restroom	\$ 65	3
Point Defiance Park	332185	Restroom	\$ 366	3
Point Defiance Park	332188	Restroom	\$ 65	3
Point Defiance Park	332191	Restroom	\$ 366	3
Point Defiance Park	332193	Restroom	\$ 115	3
Point Defiance Park	332210	Entrance to Building	\$ 457	1
Point Defiance Park	332211	Interior Access Route	\$ -	1
Point Defiance Park	332214	Entrance to Building	\$ 457	1
Point Defiance Park	332215	Interior Access Route	\$ -	1
Point Defiance Park	332216	Entrance to Building	\$ 457	1
Point Defiance Park	332217	Interior Access Route	\$ -	1
Point Defiance Park	332220	Entrance to Building	\$ 457	1
Point Defiance Park	332221	Interior Access Route	\$ -	1
Point Defiance Park	332222	Exterior Access Route	\$ 211	3
Point Defiance Park	332223	Exterior Access Route	\$ 352	3
Point Defiance Park	332224	Exterior Access Route	\$ 352	3
Point Defiance Park	332229	Kitchen	\$ 65	2
Point Defiance Park	332230	Exterior Access Route	\$ 176	3
Point Defiance Park	332231	Exterior Access Route	\$ 176	3

Park	Barrier ID	Category	Estimate	Priority
Point Defiance Park	332574	Exterior Access Route	\$ 352	3
Point Defiance Park	332577	Exterior Access Route	\$ 246	3
Point Defiance Park	334519	Entrance to Building	\$ 457	1
Point Defiance Park	334520	Interior Access Route	\$ -	1
Point Defiance Park	334523	Common Areas	\$ 65	2
Point Defiance Park	334525	Entrance to Building	\$ 457	1
Point Defiance Park	334527	Interior Access Route	\$ 366	1
Point Defiance Park	334528	Interior Access Route	\$ -	1
Point Defiance Park	334529	Entrance to Building	\$ 457	1
Point Defiance Park	334530	Interior Access Route	\$ -	1
Point Defiance Park	334533	Restroom	\$ 65	3
Point Defiance Park	334535	Restroom	\$ 115	3
Point Defiance Park	334538	Restroom	\$ 65	3
Point Defiance Zoo & Aquarium	332585	Accessible Parking	\$ 560	1
Point Defiance Zoo & Aquarium	332587	Accessible Parking	\$ 4,200	1
Point Defiance Zoo & Aquarium	332599	Accessible Parking	\$ 280	1
Point Defiance Zoo & Aquarium	332613	Accessible Parking	\$ 560	1
Point Defiance Zoo & Aquarium	332616	Accessible Parking	\$ 560	1
Point Defiance Zoo & Aquarium	332629	Exterior Access Route	\$ 809	3
Point Defiance Zoo & Aquarium	332630	Exterior Access Route	\$ 492	3
Point Defiance Zoo & Aquarium	332987	Restroom	\$ 200	3
Point Defiance Zoo & Aquarium	332988	Restroom	\$ 55	3
Point Defiance Zoo & Aquarium	332989	Entrance to Building	\$ 457	1
Point Defiance Zoo & Aquarium	332990	Interior Access Route	\$ -	1
Point Defiance Zoo & Aquarium	332993	Restroom	\$ 55	3
Point Defiance Zoo & Aquarium	332994	Restroom	\$ 200	3
Point Defiance Zoo & Aquarium	332996	Restroom	\$ 115	3
Point Defiance Zoo & Aquarium	333001	Restroom	\$ 200	3
Point Defiance Zoo & Aquarium	333003	Restroom	\$ 115	3
Point Defiance Zoo & Aquarium	333004	Entrance to Building	\$ 457	1
Point Defiance Zoo & Aquarium	333005	Interior Access Route	\$ -	1
Point Defiance Zoo & Aquarium	333006	Entrance to Building	\$ 457	1
Point Defiance Zoo & Aquarium	333008	Restroom	\$ 115	3
Point Defiance Zoo & Aquarium	333010	Entrance to Building	\$ 457	1
Point Defiance Zoo & Aquarium	333011	Restroom	\$ 55	3
Point Defiance Zoo & Aquarium	333014	Entrance to Building	\$ 457	1
Point Defiance Zoo & Aquarium	333017	Restroom	\$ 115	3
Point Defiance Zoo & Aquarium	333019	Restroom	\$ 55	3
Point Defiance Zoo & Aquarium	333020	Restroom	\$ 55	3
Point Defiance Zoo & Aquarium	333021	Interior Access Route	\$ -	1
Point Defiance Zoo & Aquarium	333022	Entrance to Building	\$ 457	1
Point Defiance Zoo & Aquarium	333027	Restroom	\$ 100	3
Point Defiance Zoo & Aquarium	333030	Exterior Access Route	\$ 633	3
Point Defiance Zoo & Aquarium	333031	Exterior Access Route	\$ 633	3
Point Defiance Zoo & Aquarium	333032	Exterior Access Route	\$ 492	3
Point Defiance Zoo & Aquarium	333033	Exterior Access Route	\$ 316	3
Point Defiance Zoo & Aquarium	333034	Exterior Access Route	\$ 246	3

Park	Barrier ID	Category	Estimate	Priority
Point Defiance Zoo & Aquarium	333035	Exterior Access Route	\$ 633	3
Point Defiance Zoo & Aquarium	333044	Entrance to Building	\$ 457	1
Point Defiance Zoo & Aquarium	333045	Interior Access Route	\$ -	1
Point Defiance Zoo & Aquarium	333048	Entrance to Building	\$ 457	1
Point Defiance Zoo & Aquarium	333049	Interior Access Route	\$ -	1
Point Defiance Zoo & Aquarium	333050	Entrance to Building	\$ 457	1
Point Defiance Zoo & Aquarium	333051	Entrance to Building	\$ 457	1
Point Defiance Zoo & Aquarium	333054	Restroom	\$ 200	3
Point Defiance Zoo & Aquarium	333056	Interior Access Route	\$ 366	1
Point Defiance Zoo & Aquarium	333057	Interior Access Route	\$ -	1
Point Defiance Zoo & Aquarium	333058	Entrance to Building	\$ 457	1
Point Defiance Zoo & Aquarium	333060	Entrance to Building	\$ 915	1
Point Defiance Zoo & Aquarium	333061	Interior Access Route	\$ -	1
Point Defiance Zoo & Aquarium	333062	Entrance to Building	\$ 915	1
Point Defiance Zoo & Aquarium	333063	Entrance to Building	\$ 915	1
Point Defiance Zoo & Aquarium	334549	Exterior Access Route	\$ 160	2
Point Defiance Zoo & Aquarium	334552	Exterior Access Route	\$ 316	3
Point Defiance Zoo & Aquarium	334553	Exterior Access Route	\$ 492	3
Point Defiance Zoo & Aquarium	334556	Exterior Access Route	\$ 844	3
Point Defiance Zoo & Aquarium	334558	Exterior Access Route	\$ 704	3
Point Defiance Zoo & Aquarium	334559	Exterior Access Route	\$ 704	3
Point Defiance Zoo & Aquarium	334560	Exterior Access Route	\$ 704	3
Point Defiance Zoo & Aquarium	334561	Exterior Access Route	\$ 704	3
Point Defiance Zoo & Aquarium	334563	Exterior Access Route	\$ 528	3
Point Defiance Zoo & Aquarium	334565	Entrance to Building	\$ 457	1
Point Defiance Zoo & Aquarium	334566	Interior Access Route	\$ -	1
Point Defiance Zoo & Aquarium	334567	Entrance to Building	\$ 457	1
Point Defiance Zoo & Aquarium	334570	Interior Access Route	\$ -	1
Point Defiance Zoo & Aquarium	334571	Restroom	\$ 55	3
Point Defiance Zoo & Aquarium	334573	Restroom	\$ 293	3
Point Defiance Zoo & Aquarium	334575	Restroom	\$ 200	3
Point Defiance Zoo & Aquarium	334576	Restroom	\$ 200	3
Point Defiance Zoo & Aquarium	334577	Restroom	\$ 200	3
Point Defiance Zoo & Aquarium	334578	Interior Access Route	\$ 366	1
Point Defiance Zoo & Aquarium	334583	Interior Access Route	\$ 281	3
Point Defiance Zoo & Aquarium	334584	Interior Access Route	\$ 70	3
Point Defiance Zoo & Aquarium	334585	Interior Access Route	\$ 281	3
Point Defiance Zoo & Aquarium	334586	Interior Access Route	\$ 140	3
Point Defiance Zoo & Aquarium	334588	Interior Access Route	\$ 560	3
Point Defiance Zoo & Aquarium	334590	Entrance to Building	\$ 366	1
Point Defiance Zoo & Aquarium	334592	Restroom	\$ 200	3
Point Defiance Zoo & Aquarium	334600	Interior Access Route	\$ 211	3
Point Defiance Zoo & Aquarium	334616	Exterior Access Route	\$ 105	3
Point Defiance Zoo & Aquarium	334618	Exterior Access Route	\$ 105	3
Point Defiance Zoo & Aquarium	334620	Exterior Access Route	\$ 352	3
Point Defiance Zoo & Aquarium	334621	Exterior Access Route	\$ 281	3
Portland Avenue Community Center	328706	Interior Access Route	\$ 366	1

Park	Barrier ID	Category	Estimate	Priority
Portland Avenue Community Center	328707	Interior Access Route	\$ -	1
Portland Avenue Community Center	328714	Interior Access Route	\$ 366	1
Portland Avenue Community Center	328715	Interior Access Route	\$ -	1
Portland Avenue Community Center	328716	Interior Access Route	\$ 293	1
Portland Avenue Community Center	328717	Interior Access Route	\$ 280	4
Portland Avenue Community Center	328718	Interior Access Route	\$ 330	3
Portland Avenue Community Center	328719	Entrance to Building	\$ 366	1
Portland Avenue Community Center	328721	Restroom	\$ 200	2
Portland Avenue Community Center	328722	Restroom	\$ 366	3
Portland Avenue Community Center	328723	Restroom	\$ -	3
Portland Avenue Community Center	328728	Restroom	\$ 293	3
Portland Avenue Community Center	328729	Restroom	\$ 115	3
Portland Avenue Community Center	328731	Restroom	\$ 293	3
Portland Avenue Community Center	328732	Restroom	\$ 200	2
Portland Avenue Community Center	328733	Restroom	\$ 366	3
Portland Avenue Community Center	328734	Restroom	\$ -	3
Portland Avenue Community Center	328742	Interior Access Route	\$ 366	1
Portland Avenue Community Center	328743	Interior Access Route	\$ -	1
Portland Avenue Community Center	328745	Interior Access Route	\$ 366	1
Portland Avenue Community Center	328746	Interior Access Route	\$ -	1
Portland Avenue Community Center	328754	Entrance to Building	\$ 366	1
Portland Avenue Community Center	328756	Interior Access Route	\$ 200	2
Portland Avenue Community Center	328758	Interior Access Route	\$ 366	1
Portland Avenue Community Center	328759	Interior Access Route	\$ -	1
Portland Avenue Community Center	328762	Entrance to Building	\$ 366	1
Portland Avenue Community Center	328763	Entrance to Building	\$ -	1
Portland Avenue Community Center	328764	Entrance to Building	\$ 366	1
Portland Avenue Community Center	328765	Entrance to Building	\$ -	1
Portland Avenue Community Center	328768	Restroom	\$ 280	4
Portland Avenue Community Center	328769	Restroom	\$ 280	4
Portland Avenue Community Center	328773	Interior Access Route	\$ 366	1
Portland Avenue Community Center	328778	Interior Access Route	\$ 200	2
Portland Avenue Community Center	328780	Interior Access Route	\$ 200	2
Portland Avenue Community Center	328782	Interior Access Route	\$ 366	1
Portland Avenue Community Center	328784	Interior Access Route	\$ 200	2
Portland Avenue Community Center	328786	Interior Access Route	\$ 366	1
Portland Avenue Community Center	328787	Interior Access Route	\$ 293	1
Portland Avenue Community Center	328788	Interior Access Route	\$ 200	2
Portland Avenue Community Center	328789	Interior Access Route	\$ 200	2
Portland Avenue Community Center	328790	Interior Access Route	\$ 366	1
Portland Avenue Community Center	328791	Interior Access Route	\$ 200	2
Portland Avenue Community Center	328792	Interior Access Route	\$ 200	2
Portland Avenue Community Center	328794	Interior Access Route	\$ 200	2
Portland Avenue Community Center	328795	Interior Access Route	\$ 200	2
Portland Avenue Community Center	328796	Interior Access Route	\$ 200	2
Portland Avenue Community Center	328802	Interior Access Route	\$ 200	2
Portland Avenue Community Center	328803	Interior Access Route	\$ 200	2

Park	Barrier ID	Category	Estimate	Priority
Portland Avenue Community Center	328804	Interior Access Route	\$ 200	2
Portland Avenue Community Center	328741	Restroom	\$ 293	3
Portland Avenue Park	322642	Accessible Parking	\$ 280	1
Portland Avenue Park	322652	Restroom	\$ 55	3
Portland Avenue Park	322659	Exterior Access Route	\$ 70	3
Portland Avenue Park	322690	Restroom	\$ 55	3
Portland Avenue Park	322886	Restroom	\$ 220	3
Portland Avenue Park	328699	Entrance to Building	\$ 366	1
Portland Avenue Park	328700	Entrance to Building	\$ -	1
Portland Avenue Park	328695	Entrance to Building	\$ 366	1
Proctor Community Garden	332565	Exterior Access Route	\$ 320	2
Rogers Playfield	349472	Exterior Access Route	\$ 160	2
Sawyer Tot Lot	325340	Signage	\$ 100	2
SERA Sports Complex	326050	Accessible Parking	\$ 560	1
SERA Sports Complex	326060	Restroom	\$ 100	2
SERA Sports Complex	326063	Restroom	\$ 100	2
SERA Sports Complex	326051	Accessible Parking	\$ 280	1
SERA Sports Complex	326103	Sports Facilities	\$ 160	2
SERA Sports Complex	326108	Accessible Parking	\$ 280	1
SERA Sports Complex	326117	Exterior Access Route	\$ 160	2
SERA Sports Complex	328086	Exterior Access Route	\$ 200	2
SERA Sports Complex	357213	Accessible Parking	\$ 280	1
SERA Sports Complex	357214	Accessible Parking	\$ 280	1
SERA Sports Complex	357218	Accessible Parking	\$ 280	1
South Park	324342	Playground	\$ 1,280	2
STAR Center	326131	Signage	\$ 220	2
STAR Center	326134	Common Areas	\$ 440	3
STAR Center	326135	Interior Access Route	\$ 55	2
STAR Center	326136	Interior Access Route	\$ 110	2
STAR Center	326137	Interior Access Route	\$ 400	2
STAR Center	326138	Interior Access Route	\$ 732	1
STAR Center	326139	Interior Access Route	\$ 732	1
STAR Center	326141	Entrance to Building	\$ 366	1
STAR Center	326142	Entrance to Building	\$ 366	1
STAR Center	326143	Interior Access Route	\$ 366	1
STAR Center	326149	Interior Access Route	\$ 200	2
STAR Center	326150	Interior Access Route	\$ 732	1
STAR Center	326151	Entrance to Building	\$ 732	1
STAR Center	326152	Signage	\$ 220	2
STAR Center	326153	Signage	\$ 55	2
STAR Center	326154	Signage	\$ 55	2
STAR Center	326155	Interior Access Route	\$ 732	1
STAR Center	326156	Interior Access Route	\$ 366	1
STAR Center	326157	Signage	\$ 55	2
STAR Center	326158	Signage	\$ 110	2
STAR Center	326159	Signage	\$ 55	2
STAR Center	326160	Interior Access Route	\$ 366	1

Park	Barrier ID	Category	Estimate	Priority
STAR Center	326161	Interior Access Route	\$ 110	2
STAR Center	326162	Interior Access Route	\$ 366	1
STAR Center	326178	Restroom	\$ 115	3
STAR Center	326184	Interior Access Route	\$ 366	1
STAR Center	326186	Restroom	\$ 300	3
STAR Center	326187	Restroom	\$ 225	3
STAR Center	326189	Interior Access Route	\$ 100	2
STAR Center	326192	Interior Access Route	\$ 366	1
STAR Center	326190	Interior Access Route	\$ 366	1
STAR Center	326191	Interior Access Route	\$ 366	1
STAR Center	326193	Restroom	\$ 300	3
STAR Center	326194	Restroom	\$ 300	3
STAR Center	326196	Restroom	\$ 200	3
STAR Center	326200	Interior Access Route	\$ 100	2
STAR Center	326201	Interior Access Route	\$ 55	2
STAR Center	326202	Interior Access Route	\$ 55	2
STAR Center	326203	Interior Access Route	\$ 100	2
STAR Center	326204	Interior Access Route	\$ 366	1
STAR Center	326205	Restroom	\$ 200	3
STAR Center	326207	Entrance to Building	\$ 366	1
STAR Center	326211	Exterior Access Route	\$ 160	2
STAR Center	326212	Exterior Access Route	\$ 160	2
STAR Center	326214	Interior Access Route	\$ 55	2
STAR Center	326215	Interior Access Route	\$ 100	2
STAR Center	326216	Interior Access Route	\$ 366	1
STAR Center	326217	Interior Access Route	\$ 366	5
STAR Center	326218	Interior Access Route	\$ 100	5
STAR Center	326223	Interior Access Route	\$ 366	1
STAR Center	326224	Interior Access Route	\$ 55	2
STAR Center	327691	Interior Access Route	\$ 732	1
STAR Center	327817	Interior Access Route	\$ 732	1
STAR Center	327818	Entrance to Building	\$ 366	1
STAR Center	327819	Entrance to Building	\$ 457	1
STAR Center	328087	Interior Access Route	\$ 732	1
STAR Center	328088	Entrance to Building	\$ 915	1
STAR Center	328111	Entrance to Building	\$ 366	1
STAR Center	328112	Entrance to Building	\$ 457	1
STAR Center	328204	Restroom	\$ 115	3
STAR Center	328205	Restroom	\$ 115	3
STAR Center	328206	Interior Access Route	\$ 366	1
STAR Center	328329	Interior Access Route	\$ 366	1
STAR Center	328330	Interior Access Route	\$ 366	1
STAR Center	328331	Interior Access Route	\$ 366	1
STAR Center	328332	Interior Access Route	\$ 366	1
STAR Center	328333	Entrance to Building	\$ 366	1
STAR Center	328336	Interior Access Route	\$ 366	1
STAR Center	328337	Entrance to Building	\$ 457	1

Park	Barrier ID	Category	Estimate	Priority
Stewart Heights Park & Pool	327407	Restroom	\$ 293	3
Stewart Heights Park & Pool	327410	Interior Access Route	\$ 165	3
Stewart Heights Park & Pool	327417	Restroom	\$ 100	2
Stewart Heights Park & Pool	327418	Restroom	\$ 366	3
Stewart Heights Park & Pool	327415	Restroom	\$ 293	3
Stewart Heights Park & Pool	327423	Restroom	\$ 366	3
Stewart Heights Park & Pool	327424	Restroom	\$ 100	2
Stewart Heights Park & Pool	327422	Restroom	\$ 366	3
Stewart Heights Park & Pool	327421	Restroom	\$ 55	3
Stewart Heights Park & Pool	327434	Entrance to Building	\$ 732	1
Stewart Heights Park & Pool	327435	Entrance to Building	\$ 100	2
Stewart Heights Park & Pool	327433	Entrance to Building	\$ 732	1
Stewart Heights Park & Pool	327437	Entrance to Building	\$ 366	1
Stewart Heights Park & Pool	327438	Entrance to Building	\$ 100	2
Stewart Heights Park & Pool	327436	Entrance to Building	\$ 366	1
Stewart Heights Park & Pool	327439	Entrance to Building	\$ 366	1
Stewart Heights Park & Pool	327440	Entrance to Building	\$ 366	1
Stewart Heights Park & Pool	327441	Signage	\$ 280	4
Stewart Heights Park & Pool	327442	Signage	\$ 280	4
Stewart Heights Park & Pool	327443	Signage	\$ 280	4
Stewart Heights Park & Pool	327444	Restroom	\$ 55	3
Stewart Heights Park & Pool	327445	Restroom	\$ 55	3
Stewart Heights Park & Pool	327451	Restroom	\$ 115	3
Stewart Heights Park & Pool	327453	Interior Access Route	\$ 55	3
Stewart Heights Park & Pool	327454	Entrance to Building	\$ 100	2
Stewart Heights Park & Pool	327455	Entrance to Building	\$ 366	1
Stewart Heights Park & Pool	327456	Signage	\$ 280	4
Stewart Heights Park & Pool	327457	Entrance to Building	\$ 100	2
Stewart Heights Park & Pool	327459	Entrance to Building	\$ 366	1
Stewart Heights Park & Pool	327460	Entrance to Building	\$ 366	1
Stewart Heights Park & Pool	327463	Interior Access Route	\$ 55	3
Stewart Heights Park & Pool	327464	Signage	\$ 280	4
Stewart Heights Park & Pool	327465	Signage	\$ 100	4
Stewart Heights Park & Pool	327466	Signage	\$ 280	4
Stewart Heights Park & Pool	327468	Entrance to Building	\$ 100	2
Stewart Heights Park & Pool	327469	Entrance to Building	\$ 366	1
Stewart Heights Park & Pool	327470	Entrance to Building	\$ 366	1
Stewart Heights Park & Pool	327473	Interior Access Route	\$ 165	3
Stewart Heights Park & Pool	327474	Signage	\$ 280	4
Stewart Heights Park & Pool	327475	Entrance to Building	\$ 366	1
Stewart Heights Park & Pool	327476	Entrance to Building	\$ 366	1
Stewart Heights Park & Pool	327479	Entrance to Building	\$ 366	1
Stewart Heights Park & Pool	327480	Entrance to Building	\$ 366	1
Stewart Heights Park & Pool	327482	Restroom	\$ 55	3
Stewart Heights Park & Pool	327314	Accessible Parking	\$ 280	1
Stewart Heights Park & Pool	327315	Accessible Parking	\$ 280	1
Stewart Heights Park & Pool	327316	Accessible Parking	\$ 280	1

Park	Barrier ID	Category	Estimate	Priority
Stewart Heights Park & Pool	327325	Accessible Parking	\$ 280	1
Stewart Heights Park & Pool	327326	Accessible Parking	\$ 280	1
Stewart Heights Park & Pool	327329	Accessible Parking	\$ 280	1
Stewart Heights Park & Pool	327332	Accessible Parking	\$ 280	1
Stewart Heights Park & Pool	327331	Accessible Parking	\$ 560	1
Stewart Heights Park & Pool	327335	Accessible Parking	\$ 560	1
Stewart Heights Park & Pool	327336	Accessible Parking	\$ 280	1
Stewart Heights Park & Pool	327348	Entrance to Building	\$ 366	1
Stewart Heights Park & Pool	327349	Signage	\$ 280	4
Stewart Heights Park & Pool	327351	Entrance to Building	\$ 366	1
Stewart Heights Park & Pool	327352	Entrance to Building	\$ 366	1
Stewart Heights Park & Pool	327354	Signage	\$ 280	4
Stewart Heights Park & Pool	327355	Accessible Parking	\$ 280	1
Stewart Heights Park & Pool	327356	Accessible Parking	\$ 280	1
Stewart Heights Park & Pool	327357	Accessible Parking	\$ 11,300	1
Stewart Heights Park & Pool	327390	Playground	\$ 2,700	2
Stewart Heights Park & Pool	327391	Playground	\$ 312	2
Stewart Heights Park & Pool	327400	Exterior Access Route	\$ 160	2
Stewart Heights Park & Pool	327411	Entrance to Building	\$ 100	2
Stewart Heights Park & Pool	327503	Signage	\$ 280	4
Stewart Heights Park & Pool	327504	Signage	\$ 280	4
Stewart Heights Park & Pool	327506	Entrance to Building	\$ 100	2
Stewart Heights Park & Pool	327509	Entrance to Building	\$ 100	2
Swan Creek Park	323156	Accessible Parking	\$ 280	1
Swan Creek Park	323146	Accessible Parking	\$ 280	1
Swan Creek Park	323147	Accessible Parking	\$ 560	1
Swan Creek Park	323162	Accessible Parking	\$ 280	1
Swan Creek Park	323159	Accessible Parking	\$ 280	1
Swan Creek Park	323168	Exterior Access Route	\$ 160	2
Swan Creek Park	323176	Exterior Access Route	\$ 160	2
Swan Creek Park	323177	Exterior Access Route	\$ 160	2
Swan Creek Park	323180	Exterior Access Route	\$ 160	2
Swan Creek Park	323181	Exterior Access Route	\$ 160	2
Swan Creek Park	323191	Exterior Access Route	\$ 160	2
Swan Creek Park	323192	Exterior Access Route	\$ 160	2
Swan Creek Park	323193	Exterior Access Route	\$ 160	2
Swan Creek Park	323196	Exterior Access Route	\$ 160	2
Swan Creek Park	323197	Exterior Access Route	\$ 160	2
Swan Creek Park	323205	Entrance to Building	\$ 366	1
Swan Creek Park	323207	Entrance to Building	\$ 366	1
Tacoma Nature Center and Snake Lake Natural Area	346063	Interior Access Route	\$ 2,600	2
Tacoma Nature Center and Snake Lake Natural Area	346044	Accessible Parking	\$ 280	1
Tacoma Nature Center and Snake Lake Natural Area	346046	Accessible Parking	\$ 280	1
Tacoma Nature Center and Snake Lake Natural Area	346064	Interior Access Route	\$ 200	2
Tacoma Nature Center and Snake Lake Natural Area	346067	Interior Access Route	\$ 200	2
Tacoma Nature Center and Snake Lake Natural Area	346071	Interior Access Route	\$ 2,600	2
Tacoma Nature Center and Snake Lake Natural Area	346074	Interior Access Route	\$ 220	2

Park	Barrier ID	Category	Estimate	Priority
Tacoma Nature Center and Snake Lake Natural Area	346078	Restroom	\$ 400	2
Tacoma Nature Center and Snake Lake Natural Area	346095	Interior Access Route	\$ 55	2
Tacoma Nature Center and Snake Lake Natural Area	346099	Restroom	\$ 200	2
Tacoma Nature Center and Snake Lake Natural Area	346100	Restroom	\$ 55	3
Tacoma Nature Center and Snake Lake Natural Area	362608	Site Furnishings	\$ 350	4
Thea's Park	319000	Accessible Parking	\$ 280	1
Titlow Park	324485	Exterior Access Route	\$ 352	3
Titlow Park	324483	Exterior Access Route	\$ 316	3
Titlow Park	324762	Entrance to Building	\$ 2,287	1
Titlow Park	324484	Exterior Access Route	\$ 352	3
Titlow Park	324752	Entrance to Building	\$ 366	1
Titlow Park	324479	Exterior Access Route	\$ 316	3
Titlow Park	324285	Restroom	\$ 65	3
Titlow Park	324289	Restroom	\$ 65	3
Titlow Park	324291	Restroom	\$ 500	3
Titlow Park	324304	Common Areas	\$ 65	3
Titlow Park	324306	Restroom	\$ 500	3
Titlow Park	324308	Restroom	\$ 500	3
Titlow Park	324735	Restroom	\$ 293	3
Titlow Park	324740	Restroom	\$ 200	3
Titlow Park	324743	Interior Access Route	\$ 366	1
Titlow Park	324744	Interior Access Route	\$ -	1
Titlow Park	324750	Common Areas	\$ 65	2
Titlow Park	324751	Common Areas	\$ 2,026	4
Titlow Park	324754	Common Areas	\$ 115	3
Titlow Park	324756	Exterior Access Route	\$ 308	3
Titlow Park	324759	Interior Access Route	\$ 672	2
Titlow Park	324314	Exterior Access Route	\$ 176	3
Titlow Park	324317	Exterior Access Route	\$ 140	3
Titlow Park	324313	Exterior Access Route	\$ 176	3
Titlow Park	324299	Accessible Parking	\$ 280	1
Titlow Park	324760	Interior Access Route	\$ 354	2
Titlow Park	324298	Accessible Parking	\$ 840	1
Titlow Park	324310	Exterior Access Route	\$ 352	3
Titlow Park	324311	Playground	\$ 2,000	2
Titlow Park	324312	Exterior Access Route	\$ 492	3
Titlow Park	324315	Playground	\$ 2,000	2
Titlow Park	324316	Playground	\$ 1,200	2
Titlow Park	324481	Accessible Parking	\$ 280	1
Titlow Park	324766	Interior Access Route	\$ 586	1
Titlow Park	354640	Beach	\$ 2,240	1
Vassault Park	324954	Accessible Parking	\$ 280	1
Vassault Park	324955	Accessible Parking	\$ 280	1
Vassault Park	324957	Entrance to Building	\$ 457	1
Vassault Park	324958	Restroom	\$ 366	3
Vassault Park	324959	Restroom	\$ 200	2
Vassault Park	324961	Entrance to Building	\$ 457	1

Park	Barrier ID	Category	Estimate	Priority
Vassault Park	324962	Restroom	\$ 200	2
Vassault Park	324964	Restroom	\$ 293	3
Vassault Park	324968	Accessible Parking	\$ 280	1
Vassault Park	324969	Accessible Parking	\$ 280	1
Vassault Park	324974	Playground	\$ 2,050	2
Vassault Park	324975	Playground	\$ 1,600	2
Vassault Park	324976	Exterior Access Route	\$ 160	2
Verlo Playfield	349840	Restroom	\$ 110	3
Verlo Playfield	349841	Restroom	\$ 366	3
Verlo Playfield	349850	Playground	\$ 400	2
Wapato Hills Park	322596	Accessible Parking	\$ 280	1
Wapato Hills Park	322579	Restroom	\$ 55	3
Wapato Hills Park	322581	Restroom	\$ 366	3
Wapato Hills Park	322578	Restroom	\$ 366	3
Wapato Hills Park	322580	Restroom	\$ 55	3
Wapato Hills Park	322614	Trail	\$ 200	4
Wapato Park & Pavilion	301479	Exterior Access Route	\$ 1,120	2
Wapato Park & Pavilion	301537	Entrance to Building	\$ 400	2
Wapato Park & Pavilion	301549	Interior Access Route	\$ 186	2
Wapato Park & Pavilion	301435	Restroom	\$ 366	3
Wapato Park & Pavilion	301481	Exterior Access Route	\$ 480	2
Wapato Park & Pavilion	301485	Exterior Access Route	\$ 160	2
Wapato Park & Pavilion	301488	Interior Access Route	\$ 55	3
Wapato Park & Pavilion	301489	Interior Access Route	\$ 55	3
Wapato Park & Pavilion	301491	Entrance to Building	\$ 732	1
Wapato Park & Pavilion	301492	Entrance to Building	\$ 732	1
Wapato Park & Pavilion	301498	Interior Access Route	\$ 55	2
Wapato Park & Pavilion	301499	Interior Access Route	\$ 110	2
Wapato Park & Pavilion	301500	Interior Access Route	\$ 366	1
Wapato Park & Pavilion	301501	Interior Access Route	\$ 366	1
Wapato Park & Pavilion	301502	Interior Access Route	\$ 110	2
Wapato Park & Pavilion	301503	Interior Access Route	\$ 55	2
Wapato Park & Pavilion	301505	Interior Access Route	\$ 186	2
Wapato Park & Pavilion	301423	Accessible Parking	\$ 280	1
Wapato Park & Pavilion	301424	Accessible Parking	\$ 280	1
Wapato Park & Pavilion	301428	Restroom	\$ 366	3
Wapato Park & Pavilion	301494	Kitchen	\$ 65	2
Wapato Park & Pavilion	301496	Interior Access Route	\$ 186	2
Wapato Park & Pavilion	301509	Exterior Access Route	\$ 704	3
Wapato Park & Pavilion	301512	Exterior Access Route	\$ 704	3
Wapato Park & Pavilion	301515	Restroom	\$ 293	3
Wapato Park & Pavilion	301516	Restroom	\$ -	3
Wapato Park & Pavilion	301524	Restroom	\$ 293	3
Wapato Park & Pavilion	301527	Restroom	\$ 65	3
Wapato Park & Pavilion	301528	Restroom	\$ 65	3
Wapato Park & Pavilion	301532	Restroom	\$ 65	3
Wapato Park & Pavilion	301536	Entrance to Building	\$ 400	2

Park	Barrier ID	Category	Estimate	Priority
Wapato Park & Pavilion	301539	Restroom	\$ 65	3
Wapato Park & Pavilion	301546	Entrance to Building	\$ 366	1
Wapato Park & Pavilion	301550	Restroom	\$ 55	3
Wapato Park & Pavilion	301551	Restroom	\$ 366	3
Wapato Park & Pavilion	301557	Restroom	\$ 200	3
Wapato Park & Pavilion	301564	Entrance to Building	\$ 270	1
Wapato Park & Pavilion	301592	Exterior Access Route	\$ 176	3
Wapato Park & Pavilion	301593	Exterior Access Route	\$ 176	3
Wapato Park & Pavilion	303551	Playground	\$ 600	2
Wapato Park & Pavilion	303552	Playground	\$ 600	2
Wapato Park & Pavilion	365017	Restroom	\$ 366	3
Wapato Park & Pavilion	365018	Restroom	\$ 366	3
Wapato Park & Pavilion	365015	Restroom	\$ -	3
Wapato Park & Pavilion	365016	Restroom	\$ -	3
Wapato Park & Pavilion	365019	Restroom	\$ -	3
Wapato Park & Pavilion	301523	Restroom	\$ 100	3
Wright Park and WW Seymour Botanical Conservatory	317272	Restroom	\$ 200	3
Wright Park and WW Seymour Botanical Conservatory	317279	Interior Access Route	\$ 366	1
Wright Park and WW Seymour Botanical Conservatory	317282	Interior Access Route	\$ 120	1
Wright Park and WW Seymour Botanical Conservatory	317264	Restroom	\$ 200	3
Wright Park and WW Seymour Botanical Conservatory	317261	Interior Access Route	\$ 366	1
Wright Park and WW Seymour Botanical Conservatory	317255	Interior Access Route	\$ 250	2
Wright Park and WW Seymour Botanical Conservatory	317245	Exterior Access Route	\$ 200	1
Wright Park and WW Seymour Botanical Conservatory	317231	Restroom	\$ 400	2
Wright Park and WW Seymour Botanical Conservatory	317223	Restroom	\$ 240	3
Wright Park and WW Seymour Botanical Conservatory	317222	Restroom	\$ 240	3
Total			\$ 430,514	

APPENDIX F: SAFETY AND TRIPPING HAZARDS



Id	Park	Location Description	Barrier Priority	Detail	Total
328934	Cloverdale Park	Park Entrance at E 59th Street	1	Sidewalk has areas of vertical level changes in excess of 1/4" that are not ramped.	\$31
315309	Dash Point Park and Pier	To Park from Public Right-Of-Way	1	Sidewalk has areas of vertical level changes in excess of 1/4" that are not ramped.	\$59
323777	Irving Park	Accessible Route from Street Parking	1	Sidewalk has areas of vertical level changes in excess of 1/4" that are not ramped.	\$119
302131	Norpoint Park	Parking Lot P1	1	Sidewalk has areas of vertical level changes in excess of 1/4" that are not ramped.	\$99
302140	Norpoint Park	Parking Lot P1	1	Sidewalk has areas of vertical level changes in excess of 1/4" that are not ramped.	\$18
302169	Norpoint Park	Sidewalk	1	Sidewalk has areas of vertical level changes in excess of 1/4" that are not ramped.	\$99
302179	Norpoint Park	Walkway - North side of Center at Norpoint	1	Sidewalk has areas of vertical level changes in excess of 1/4" that are not ramped.	\$59
302180	Norpoint Park	Walkway - North side of Center at Norpoint	1	Sidewalk has areas of vertical level changes in excess of 1/4" that are not ramped.	\$178
302181	Norpoint Park	Walkway - North side of Center at Norpoint	1	Sidewalk has areas of vertical level changes in excess of 1/4" that are not ramped.	\$40
302183	Norpoint Park	Walkway - North side of Center at Norpoint	1	Sidewalk has areas of vertical level changes in excess of 1/4" that are not ramped.	\$40
302185	Norpoint Park	Walkway - North side of Center at Norpoint	1	Sidewalk has areas of vertical level changes in excess of 1/4" that are not ramped.	\$119
302191	Norpoint Park	Walkway - North side of Center at Norpoint	1	Sidewalk has areas of vertical level changes in excess of 1/4" that are not ramped.	\$20
328849	McKinley Park	Playground Loop	1	Sidewalk has areas of vertical level changes in excess of 1/4" that are not ramped.	\$79
328889	McKinley Park	Park Pathway Parallel Upper Park Street near McKinley Ave	1	Sidewalk has areas of vertical level changes in excess of 1/4" that are not ramped.	\$99
342296	NW Trek Wildlife Park	Stair ST-8	1	Stairs have open risers.	\$15,120
342530	NW Trek Wildlife Park	Stair ST-11	1	Stairs have open risers.	\$10,920
342557	NW Trek Wildlife Park	Stair ST-12	1	Stairs have open risers.	\$2,520
326032	Old Town Dock	Ruston Way East of Dock - from Jack Hyde Park	1	Sidewalk has areas of vertical level changes in excess of 1/4" that are not ramped.	\$119
326035	Old Town Dock	Picnic Area	1	Sidewalk has areas of vertical level changes in excess of 1/4" that are not ramped.	\$357
326036	Old Town Dock	Ruston Way East of Dock - from Jack Hyde Park	1	Sidewalk has areas of vertical level changes in excess of 1/4" that are not ramped.	\$198
326040	Old Town Dock	Accessible Route to Restroom Building	1	Sidewalk has areas of vertical level changes in excess of 1/4" that are not ramped.	\$79
332575	Point Defiance Park	Point Defiance Lodge Stair ST-1	1	Stairs have open risers.	\$8,400
331165	Ruston Way Areas 2-4	Accessible Route at Ruston Way Area 4	1	Sidewalk has areas of vertical level changes in excess of 1/4" that are not ramped.	\$198
331243	Ruston Way Areas 2-4	Accessible Route at Ruston Way Area 2	1	Sidewalk has areas of vertical level changes in excess of 1/4" that are not ramped.	\$198
331250	Ruston Way Areas 2-4	Accessible Route at Ruston Way Area 2	1	Sidewalk has areas of vertical level changes in excess of 1/4" that are not ramped.	\$198
331251	Ruston Way Areas 2-4	Accessible Route at Ruston Way Area 2	1	Sidewalk has areas of vertical level changes in excess of 1/4" that are not ramped.	\$198
331253	Ruston Way Areas 2-4	Accessible Route at Ruston Way Area 2	1	Sidewalk has areas of vertical level changes in excess of 1/4" that are not ramped.	\$198
331254	Ruston Way Areas 2-4	Accessible Route at Ruston Way Area 2	1	Sidewalk has areas of vertical level changes in excess of 1/4" that are not ramped.	\$198
327378	Stewart Heights Park & Pool	Park Loop	1	Sidewalk has areas of vertical level changes in excess of 1/4" that are not ramped.	\$119
327395	Stewart Heights Park & Pool	Playground to Basketball	1	Sidewalk has areas of vertical level changes in excess of 1/4" that are not ramped.	\$36
324770	Titlow Park	Titlow Lodge Side Entrance	1	Sidewalk has areas of vertical level changes in excess of 1/4" that are not ramped.	\$45
322599	Wapato Hills Park	E Side of Restrooms	1	Sidewalk has areas of vertical level changes in excess of 1/4" that are not ramped.	\$119
322601	Wapato Hills Park	Restrooms and Baseball	1	Sidewalk has areas of vertical level changes in excess of 1/4" that are not ramped.	\$198
322602	Wapato Hills Park	Playground Loop parallel S Wapato St.	1	Sidewalk has areas of vertical level changes in excess of 1/4" that are not ramped.	\$198
322603	Wapato Hills Park	Playground Loop parallel S Wapato St	1	Sidewalk has areas of vertical level changes in excess of 1/4" that are not ramped.	\$99
322604	Wapato Hills Park	Playground Loop parallel S Wapato St	1	Sidewalk has areas of vertical level changes in excess of 1/4" that are not ramped.	\$198
322605	Wapato Hills Park	Playground Loop parallel S Wapato St.	1	Sidewalk has areas of vertical level changes in excess of 1/4" that are not ramped.	\$198
322607	Wapato Hills Park	Playground Loop parallel S Wapato St.	1	Sidewalk has areas of vertical level changes in excess of 1/4" that are not ramped.	\$198
322608	Wapato Hills Park	Playground Loop parallel S Wapato St.	1	Sidewalk has areas of vertical level changes in excess of 1/4" that are not ramped.	\$198
322612	Wapato Hills Park	Playground Loop parallel S Wapato St.	1	Sidewalk has areas of vertical level changes in excess of 1/4" that are not ramped.	\$198
322631	Wapato Hills Park	NW Side of Playground	1	Sidewalk has areas of vertical level changes in excess of 1/4" that are not ramped.	\$99
322638	Wapato Hills Park	SW Park Entrance parallel S Wapato St	1	Sidewalk has areas of vertical level changes in excess of 1/4" that are not ramped.	\$199
322639	Wapato Hills Park	Restroom	1	Sidewalk has areas of vertical level changes in excess of 1/4" that are not ramped.	\$198
301490	Wapato Park & Pavilion	East Entrance	1	The edges of the carpet are not securely attached.	\$270
317184	Wright Park and WW Seymour Botanical Conservatory	Curb Ramp CR-2 at 6th Avenue at the end of Yakima Avenue	1	Water accumulates on surface.	\$700
Total Estimated Cost for Barrier Removal					\$43,199

APPENDIX G: PARK AMENITIES



Park/Facility	Public Right of Way	Paved Accessible Paths	Unpaved Accessible paths/Trail	Playground	Sprayground	Tennis	Basketball	Baseball	Soccer	Football	Picnic Tables/Shelter	Parking	Historic Building	Garden	Restroom	Skatepark	Community Center	Pool	Pier/dock	Golf	Building(s)	Zoo	Notes		
Alderwood Park	1,033	0.13	Y	1							1														
Ailing Park	1,233		Y	1		1					1														
Baltimore Park	1,234	0.26	Y	1			1		1		1	1													
Browns Point Lighthouse Park	N/A	0.16									1	1	1												
Browns Point Playfield	390	Y	Y	1		1	1	1	1		1	1													
Center at Norpoint	N/A																1	1							
Charlotte's Blueberry Park	1,200	0.52	Y	1							1	1		1											
China Lake Park			Y									1													Natural Area
Chinese Reconciliation Park			Y									1										1			Ruston Way
Cloverdale Park	842		Y	1		1	1				1														
Cummings Park	N/A	Y																							Ruston Way
Dash Point Park and Pier	310			1							1	1				1									Ruston Way
DeLong Park	400		Y									1													Pier Closed
Dickman Mill Park	N/A	Y	Y													1									Natural Area
Eastside Community Center & Pool	N/A																1	1							Ruston Way
Fern Hill Park	173		Y	1							1														
Ferry Park	760	Y	Y	1																					
Fort Nisqually Living History Museum																									
Franklin Park	2,400	0.51	Y	1	1		1	1		1	1	1	1	1	1										
Garfield Park (including Garfield Gulch)	500		Y	1			1	1	1		1														
Hamilton Park	N/A	Y																							Ruston Way
Heidelberg Davis Park	3,000		Y	1				1				1				1	1								
Irving Park	640	0.06		1			1	1																	
Jack Hyde Park	N/A	Y									1														Ruston Way
Jane Clark Park	1,600			1			1	1			1														
Jefferson Park	2,365	0.53	Y	1	1	1	1	1			1					1	1								Community Center closed due to fire
Jerry Meeker Memorial	353																								
Judge Jack Tanner Park	N/A																								Ruston Way
Julia's Gulch			Y								1														Natural Area
Kandle Park & Pool	2,012	0.5		1	1		1				1	1		1	1	1									
Les Davis Pier	N/A	Y																							Ruston Way
Lincoln Heights Park	1,000	Y	Y	1																					
Lincoln Park	1,825		Y	1							1	1				1									
Lots for Tots	160		Y	1							1														
Manitou Park	1,555	Y	Y	1							1					1									
McKinley Park	570		Y	1												1									
Meadow Park Golf Course	2,700											1				1									Includes Maint. Shop
Metro Parks Headquarters	1,250	0.11	Y													1									
Neighbors Park	294	Y		1			1							1		1									
Norpoint Park	1,800	Y	Y	1	1						1	1				1	1								
North Slope Historic Park	162	Y	Y	1																					
Northeast Tacoma Playground	1,170																								
Northwest Trek Wildlife Park		Y	Y	1								1													
Oak Tree Park			Y																						Includes Maint. Shop
Oakland Madrona Park	1,130	0.3	Y	1			1				1	1										1	1		Natural Area
Old Town Dock		Y										1													Ruston Way
Old Town Park	420	Y		1			1				1	1													
Optimist Park	1,220			1			1	1			1	1													
Peck Field	2,500							1				1				1									Includes parking lot across street
People's Community Center & Pool	935			1			1					1					1								
People's Park	945			1			1				1							Y							
Point Defiance Lodge & Visitors Center																									
Point Defiance Park (PDP)		Y	Y	1		1					1	1	1	1	1										Includes Maint. Shop
Dune Peninsula at Point Defiance Park		Y																							
Point Defiance Marina (Included in PDP Sq. Ft)		Y										1													Under construction until late 2023
Point Defiance Pagoda (Included in PDP Sq. Ft)													1												
Point Defiance Zoo & Aquarium		Y	Y	1								1		1	1								1	1	Includes Maint Shop
Portland Avenue Park	1,730	Y	Y	1			1			1	1	1					1								Construction anticipated
Portland Avenue Community Center																									Construction anticipated
Proctor Gardens														1											
Puget Park			Y	1							1	1													Includes trailhead to Puget Ck.
Puget Gardens (including Puget Gulch)	1,450		Y																						Natural Area-Puget Creek (not Garden)
Roger's Playfield				1			1				1			1											
Roosevelt Park		Y	Y																						Only 0320142137 Parcel
Ruston Way Areas 2-4		Y																							Ruston Way
Ryan's Park			Y	1							1														
Sawyer Tot Lot				1			1																		
SERA Campus and Star Center		Y	Y	1	1	1		1	1			1					1								Includes Maint. Shop-Industrial Arts (IA)
Sheridan Park	511	Y		1							1														
South Park			Y	1	1		1	1			1	1					1								
Stewart Heights Park & Pool	2,035	Y	Y	1		1	1	1	1	1	1	1				1									
Swan Creek Park		Y	Y									1													
Tacoma Nature Center Park/Snake Lake Natural Area	1,000	Y	Y	1							1	1					1								
Thea's Park	660	Y									1	1													
Titlow Lodge (at Titlow Park)																									
Titlow Park (Parcel 1 and Parcel 2)	2,800	Y	Y	1	1	1	1	1			1	1	1			1									
Ursich Park			Y																						Natural Area
Vassault Park	1,890	Y	Y	1		1	1	1	1		1	1					1								
Verlo Playfield	1,450	Y	Y	1	1	1		1	1																Formerly McKinley Playfield
Wapato Hills Park	1,675	Y	Y	1	1		1	1			1	1				1									Large portion is Natural Area

Park/Facility	Public Right of Way	Paved Accessible Paths	Unpaved Accessible paths/Trail	Playground	Sprayground	Tennis	Basketball	Baseball	Soccer	Football	Picnic Tables/ Shelter	Parking	Historic Building	Garden	Restroom	Skatepark	Community Center	Pool	Pier/dock	Golf	Building(s)	Zoo	Notes	
Wapato Park and Pavilion	6,240	Y	Y	1							1	1	1		1				1		1		Includes Maint. Shop	
Wright Park and W.W. Seymour Botanical Conservatory	5,152	Y	Y	1	1	lawn bowling					1	1	1		1						1		Includes Maint. Shop	
Total (in Feet)	66,674																							
Total (in Miles)	12.63																							
Total Number of Amenity Locations				48	10	10	23	16	7	3	39	37	11	9	29	5	8	4	4	1	11	2		

APPENDIX H: HISTORIC AMENITIES




METRO PARKS HISTORIC FACILITIES LISTED ON HISTORIC REGISTERS

NAME	PARK	CATEGORY	ADDRESS/PARK	REGISTRATION
North Slope Historic District	North Slope Historic Park	District	North Slope Historic Park within Historic District - Area bounded by Division Ave., N. Grant Ave, N. Steele St., and N I St.	National Register of Historic Places
Point Defiance Streetcar Station (also known as Pagoda)	Point Defiance Park	Building	5801 Trolley Ln. in Point Defiance Park	National Register of Historic Places
Fort Nisqually Granary and Factor's House	Fort Nisqually Living History Museum	Building	Fort Nisqually Living History Museum in Point Defiance Park	National Register of Historic Places
Camp Six	Point Defiance Park	District	Point Defiance Park	National Register of Historic Places
Wright Park and Seymour Conservatory	Wright Park and Seymour Conservatory	District	501 South I Street	National Register of Historic Places
Fireboat No.1	Ruston Way Areas 2-4	Structure	Marine Park on Ruston Way	National Register of Historic Places
Browns Point Lighthouse and Keeper's Cottage	Browns Point Lighthouse Park	District	201 Tulalip NE	National Register of Historic Places
Point Defiance Lodge	Point Defiance Park	Building	5715 Roberts Garden Rd.	National Register of Historic Places
Dickman Lumber Company Head Saw	Dickman Mill Park	Structure	3017 Ruston Way	Tacoma Landmarks Register
163 Titlow Lodge/Hotel Hesperides	Titlow Park	Building	8425 6th Avenue	Tacoma Landmarks Register

APPENDIX I: PUBLIC SURVEY



Q1. Are there programs or activities sponsored by or facilities owned by the Metro Parks, that you or someone you know cannot participate in or enjoy because of a disability?

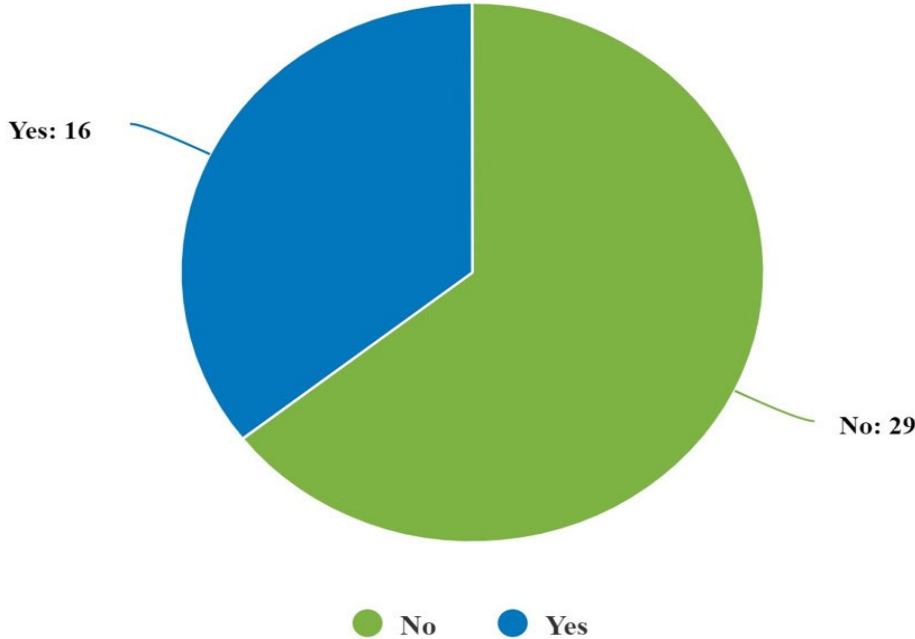

Q2. If yes, please describe:




Q5. Which location owned by Metro Parks is most important to you?



Q6. Please rate the following types of Metro Parks facilities in order of importance to you. Drag the items to rank them from 1 to 10, with 1 being the most important:


42 answers

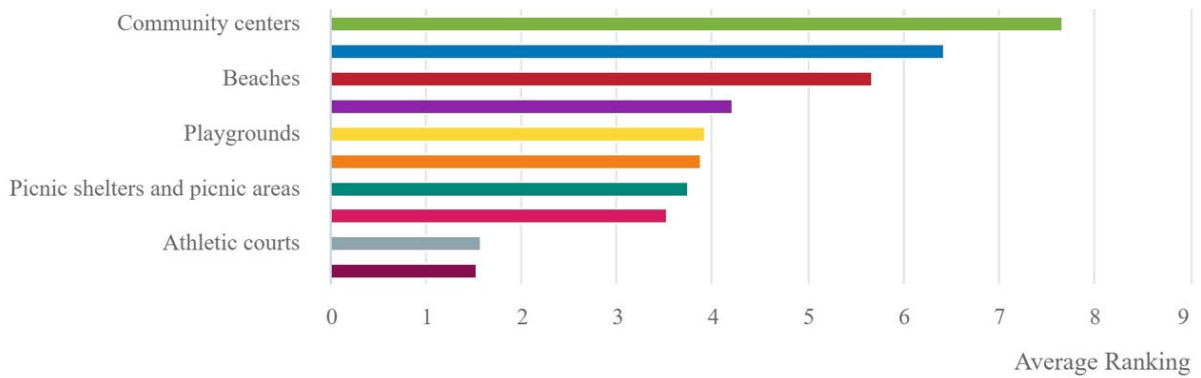


- Community centers
- Trails
- Beaches
- Zoos
- Playgrounds
- Piers
- Picnic shelters and picnic areas
- Historical buildings/elements
- Athletic courts
- Athletic fields

Q7. Please rate the following features of Metro Parks' facilities in order of importance to you. Drag the items to rank them from 1 to 7, with 1 being the most important:


42 answers

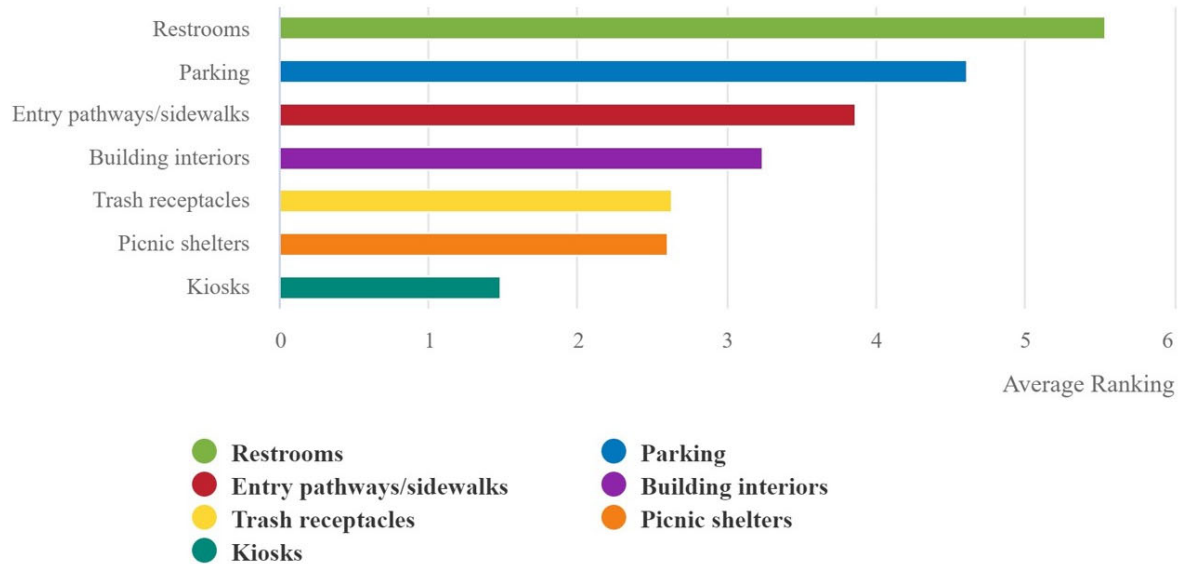


Q8. Do you or someone you know require visual interpretive services or assisted listening systems at Metro Parks' programs or public meetings?

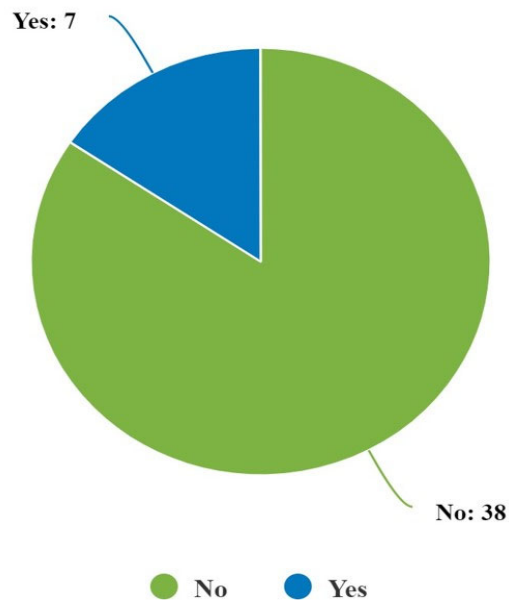

Q9. Is the Metro Parks' website and phone system accessible to you?

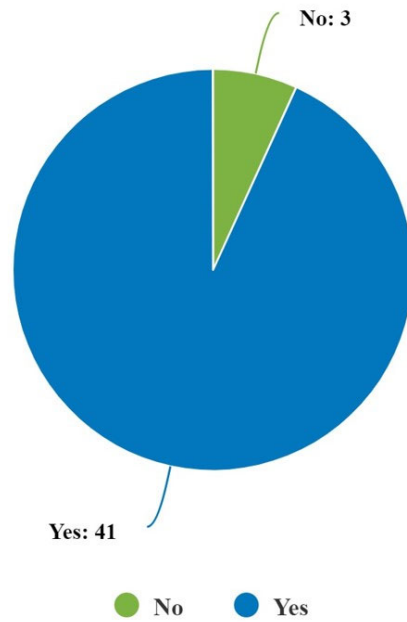

Q11. Do you feel that the Metro Parks system provides adequate emergency response services to assist persons with disabilities?

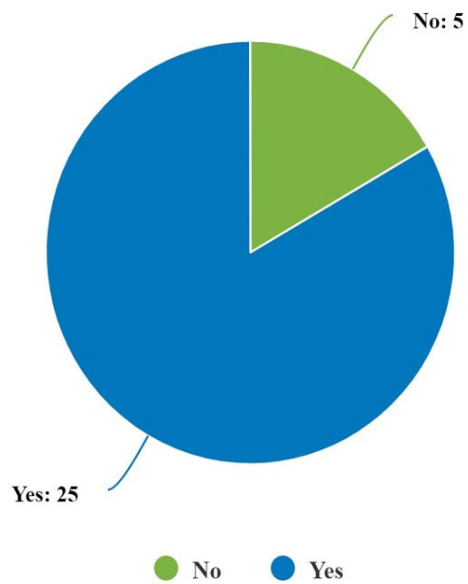

Q12. If no, what services have not been adequate for you?

centers
question
space

Q13. What program, activity, or facility improvements not currently available would promote accessibility to Metro Parks' programs, services, and facilities?



A word cloud visualization of responses to Q13. The words are arranged in various orientations and sizes, with the largest words being 'children', 'activities', 'accessible', 'autism', 'opportunities', 'challenged', 'community', 'physically', 'events', 'crowded getting', 'challenges', 'wheelchair', 'water', 'space', 'folks', 'table', 'needs', 'access', 'socio', 'better adult', 'changing', 'required', 'mobility', 'bathroom', 'people', 'training', 'programming', 'without', 'specifically', 'times', 'adaptive center', and 'soccer'.

children
activities
accessible
autism
opportunities
challenged
community
physically
events
crowded getting
challenges
wheelchair
water
space
folks
table
needs
access
socio
better adult
changing
required
mobility
bathroom
people
training
programming
without
specifically
times
adaptive center
soccer

Transition Plan Public Outreach on www.metroparkstacoma.org

Summary Dashboard

Project Timeframe

Open for comments from 31 Aug 2023 PDT to 31 Mar 2024 PDT [Change](#)

Engagement Summary [Refresh](#)

677

Total Visits [Refresh](#)

351

Unique Users [Refresh](#)

5:02

Avg Time (min) [Refresh](#)

47

Unique Stakeholders [Refresh](#)

-

Comments [Refresh](#)


48

Survey Responses [Refresh](#)

41

Document Downloads [Refresh](#)

Engagement by Day

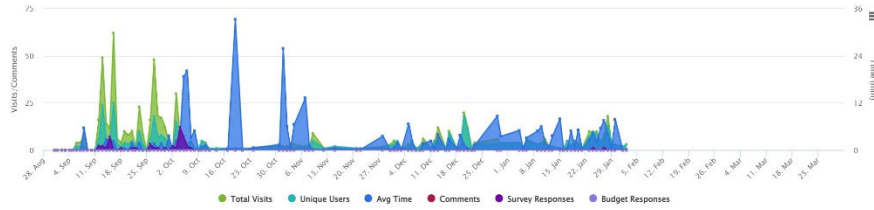

Comment Types

